

# State Of New Mexico

## Energy, Minerals and Natural Resources Department

**Michelle Lujan Grisham**

Governor

**Sarah Cottrell Propst**


Cabinet Secretary

**Todd E. Leahy, JD, PhD**

Deputy Cabinet Secretary

**Adrienne Sandoval**

Division Director

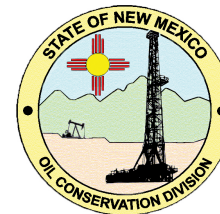

### **"Response Required - Deadline Enclosed"**

*Field Inspection Program  
"Preserving the Integrity of Our Environment"*

28-Dec-20

**WHITE ROCK OIL & GAS, LLC**

5810 Tennyson Parkway

Suite 500

Plano, TX 75024

**LETTER OF VIOLATION - Field Inspection**

Dear Operator:

The following inspection indicates that the well, equipment, location or operational status of the well failed to meet standards of the New Mexico Oil Conservation Division as described in the detail section below. To comply with standards imposed by Rules and Regulations of the Division, corrective action must be taken immediately and the situation brought into compliance. The detail section indicates preliminary findings and/or probable nature of the violation. This determination is based on an inspection of your well or facility by an inspector employed by the Oil Conservation Division on the date indicated.

Please notify the proper district office of the Division, in writing, of the date corrective actions are scheduled to be made so that arrangements can be made to reinspect the well and/or facility.

### ***INSPECTION DETAIL SECTION***

[30-025-29641] EAST LOVINGTON 8 #002

OGRID: 370364

I-08-16S-37E 1874 FSL 554 FEL

<b>Inspection Date</b>	<b>Type Inspection</b>	<b>Inspector</b>	<b>Corrective Action Due By</b>	<b>Inspection No.</b>
12/9/2020	Routine Inspection	[EZB] Eugene Bolton	3/31/2021	iEZB2034437842

**Violations:**

**Rule**

19.15.29 Releases

**Violation**

Surface Leaks/Spills

**Comment:**

PJ release 20 ft radius from wellhead. Nearby connected East Lovington 8 tank battery (1/4 mi south) has releases at both open tanks. An aggregate threshold of 5 bbl release at each site requires form C-141.

19.15.10.8 Safety Procedures for Drilling and Production

General Housekeeping  
Required

**Comment:**

PJ: discarded debris and trash on north side. Chem drum has label with no chem ID. TB: discarded drum, pile of hydrocarbon/soil mix in berm.

19.15.16.18 Well and Lease Equipment

Substandard Equipment  
and/or Needs Repair

**Comment:**

PJ: Containment vat has no net. TB: 1 of 2 open tanks, net in disrepair, containment vat has no net.

In the event that a satisfactory response is not received to this letter of direction by the "Corrective Action Due By:" date shown above, further enforcement will occur. Such enforcement may include this office applying to the Division for an order summoning you to a hearing before a Division Examiner in Santa Fe to show cause why you should not be ordered to permanently plug and abandon this well.

Sincerely,



Eugene Bolton, Compliance Ofc.

Hobbs OCD District Office

**Note:** Information in Detail Section comes directly from field inspector data entries - not all blanks will contain data.

---

Oil Conservation Division \* 1625 N. French Drive \* Hobbs, NM 88240  
Phone: 575-393-6161 \* Fax: 575-393-0720 \* [www.emnrd.state.nm.us](http://www.emnrd.state.nm.us)