Cotton Draw Unit 291H

Casing Assumptions and Load Cases

Surface

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

	Surface Casing Burst Design	1
Load Case	External Pressure	Internal Pressure
Pressure Test	Formation Pore Pressure	Max mud weight of next hole- section plus Test psi
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole section
Displace to Gas	Formation Pore Pressure	Dry gas from next casing point

	Surface Casing Collapse Design			
Load Case	External Pressure	Internal Pressure		
Full Evacuation	Water gradient in cement, mud above TOC	. None		
Cementing	Wet cement weight	Water (8.33ppg)		

Surface Casing Tension Design				
Load Case	Assumptions			
Overpull	100kips			
Runing in hole	3 ft/s			
Service Loads	N/A			

7

4

Cotton Draw Unit 291H

Casing Assumptions and Load Cases

Intermediate

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

	Intermediate Casing Burst Des	sign
Load Case	External Pressure	Internal Pressure
Pressure Test	Formation Pore Pressure	Max mud weight of next hole- section plus Test psi
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole section
Fracture @ Shoe	Formation Pore Pressure	Dry gas

	Intermediate Casing Collapse Desig	zn 🛛	
Load Case	External Pressure	Internal Pressure	
Full Evacuation	Water gradient in cement, mud above TOC	None	
Cementing	Wet cement weight	Water (8.33ppg)	

Intermediate Casing Tension Design				
Load Case	Assumptions			
Overpull	100kips			
Runing in hole	2 ft/s			
Service Loads	N/A			

*

Cotton Draw Unit 291H

Casing Assumptions and Load Cases

Production

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Production Casing Burst Design				
Load Case	External Pressure	Internal Pressure		
Pressure Test	Formation Pore Pressure	Fluid in hole (water or produced water) + test psi		
Tubing Leak	Formation Pore Pressure	Packer @ KOP, leak below surface 8.6 ppg packer fluid		
Stimulation	Formation Pore Pressure	Max frac pressure with heaviest frac fluid		

	Production Casing Collapse Design	n
Load Case	External Pressure	Internal Pressure
Full Evacuation	Water gradient in cement, mud above TOC.	None
Cementing	Wet cement weight	Water (8.33ppg)

Production Casing Tension Design				
Load Case	Assumptions			
Overpull	100kips			
Runing in hole	2 ft/s			
Service Loads	N/A			

.

8.

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi.

• Wellhead will be installed by wellhead representatives.

.

1


- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 3M, as shown on the attached schematic. Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.


After running the 13-3/8" surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 3M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 3,000 psi high pressure test. The 3,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.

After running the 9-5/8' intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 3M will already be installed on the wellhead.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 3,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

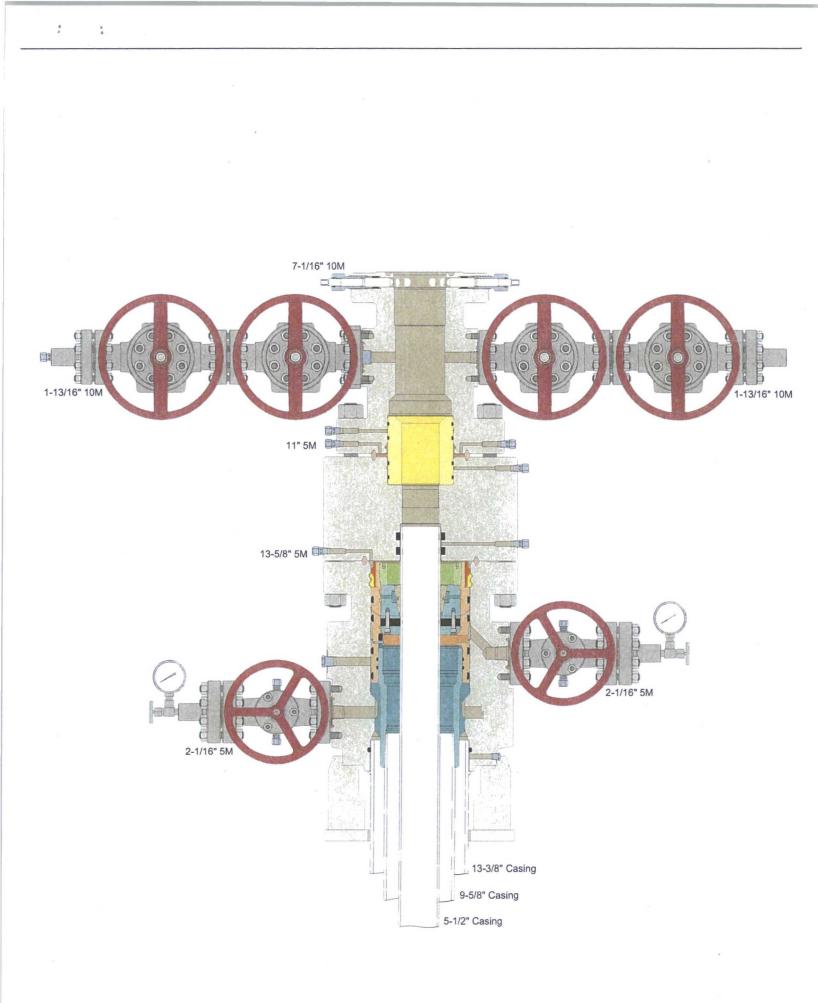

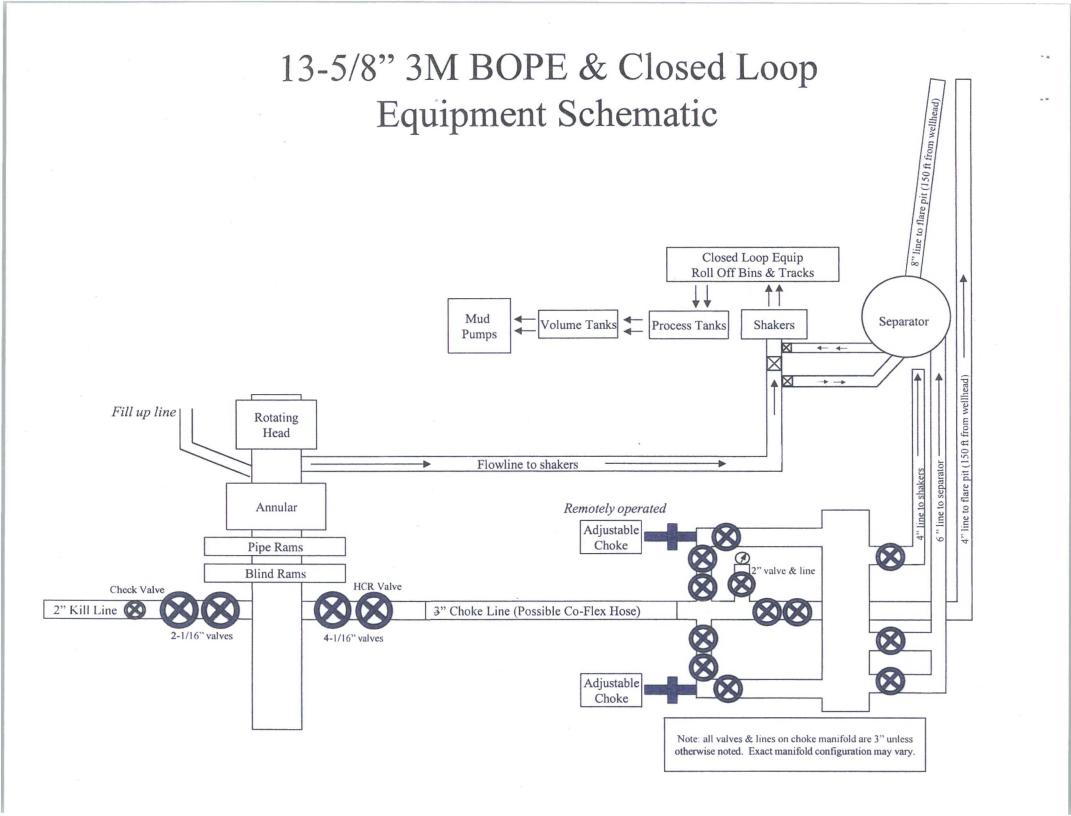

Ontinental & CONTITECH

Fluid Technology

ContiTech Beattie Corp. Website: <u>www.contitechbeattie.com</u>

Monday, June 14, 2010

RE: Drilling & Production Hoses Lifting & Safety Equipment

To Helmerich & Payne,

-

A Continental ContiTech hose assembly can perform as intended and suitable for the application regardless of whether the hose is secured or unsecured in its configuration. As a manufacturer of High Pressure Hose Assemblies for use In Drilling & Production, we do offer the corresponding lifting and safety equipment, this has the added benefit of easing the lifting and handling of each hose assembly whilst affording hose longevity by ensuring correct handling methods and procedures as well as securing the hose in the unlikely event of a failure; but in no way does the lifting and safety equipment affect the performance of the hoses providing the hoses have been handled and installed correctly it is good practice to use lifting & safety equipment but not mandatory

Should you have any questions or require any additional information/clarifications then please do not hesitate to contact us.

ContiTech Beattie is part of the Continental AG Corporation and can offer the full support resources associated with a global organization.

Best regards,

Robin Hodgson Sales Manager ContiTech Beattie Corp

ContiTech Beattie Corp, 11535 Brittmoore Park Drive, Houston, TX 77041 Phone: +1 (832) 327-0141 Fax: +1 (832) 327-0148 www.contitechbeattie.com



R16 212



PHOENIX RUBBER INDUSTRIAL LTD.

6728 Szeged, Budapesti út 10. Hungary • H--6701 Szeged, P. O. Box 152 hone: (3662) 556-737 • Fax: (3662) 556-738

OUALITY DOCUMENT

the share the states of the states of the


1

dis

4

SALES & MARKETING: H-1092 Budapest, Ráday u. 42-44, Hungary • H-1440 Budapest, P. O. Box 26 Phone: (361) 456-4200 • Fax: (361) 217-2972, 456-4273 • www.taurusemerga.hu

PURCHASER: Phoenix Beattie Co. P.O.N ⁻ 1519FA-871 PHOENIX RUBBER order N ^{o.} 170466 HOSE TYPE: 3° ID Choke and Kill Hose HOSE SERIAL N ^{o.} 34128 NOMINAL / ACTUAL LENGTH: 11,43 m W.P. 68,96 MPa 10000 pei T.P. 103,4 MPa 15000 pei Duration: 60 Pressure test with water at ambient temperature See attachment. (1 page) See attachment. (1 page) See attachment. (1 page) COUPLINGS Type Sorial N ^{o.} Quality Heat N ^{o.} 3° coupling with 720 719 AISI 4130 C7628 4 1/16° Flange end AISI 4130 47357 All metal parts are flawless We CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH HETERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH BATEFACTORY RESULT. Date: Inspector		LITY CONTI N AND TEST		ATE		CERT. N	0:	552	
Indextrostication 34128 NOMINAL / ACTUAL LENGTH: 11,43 m HOSE SERIAL N° 34128 NOMINAL / ACTUAL LENGTH: 11,43 m W.P. 68,96 MPa 10000 pet T.P. 103,4 MPa 15000 pet Duration: 60 Pressure test with water at ambient temperature See attachment. (1 page) Image: 10 Min. 60 See attachment. (1 page) 1 10 mm = 10 Min. COUPLINGS COUPLINGS COUPLINGS Type Serial N° Quality Heat N° 3" coupling with 720 719 AISI 4130 C7626 4 1/16" Flange end AISI 4130 47357 AISI 4130 47357 All metal parts are flawless We CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control LIPPECO	PURCHASER:	Phoenix Bea	attie Co.			P.O. Nº.	1519	FA-871	
W.P. 68,96 MPa 10000 pet T.P. 103,4 MPa 15000 psl Duration: 60 Pressure test with water at ambient temperature See attachment. (1 page)	PHOENIX RUBBER order N	• 170466	HOSE TYPE:	3"	ID ·	Cho	oke and Kill	Hose	
Pressure test with water at ambient temperature See attachment. (1 page) To mm = 10 Min. → 10 mm = 25 MPa COUPLINGS Type Serial N° Quality Heat N° COUPLINGS Type Serial N° Quality Heat N° AISI 4130 C7626 4 1/16° Flange end AISI 4130 C7626 4 1/16° Flange end AISI 4130 47357 All metal parts are flawless WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH BATISFACTORY RESULT. Date: Inspector Quality Control ADDITION COUPLINGS Type Serial N° Quality Heat N° COUPLINGS Type Serial N° Quality Control Series NATH COUPLINGS	HOSE SERIAL Nº	34128	NOMINAL / AC	CTUAL LE	ENGTH:	,	11,43 m		
All metal parts are flawless See attachment. (1 page)	W.P. 68,96 MPa	10000 ps	i T.P. 103,4	MPa	1500	0 psi	Duration:	60	min
[↑] 10 mm = 10 Min. → 10 mm = 25 MPa COUPLINGS Type Serial N° Quality 3" coupling with 720 3" coupling with 720 Alsl 4130 Alsl 4130 Alsl 4130 API Spec 16 C Temperature rate: "B" All metal parts are flawless We CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector			•						
10 mm = 10 Min. → 10 mm = 25 MPa COUPLINGS COUPLINGS Type Serial N° Quality Heat N° 3" coupling with 720 719 AISI 4130 C7626 4 1/16" Flange end AISI 4130 47357 AISI 4130 47357 AISI 4130 47357 AISI 4130 A7357 AISI 4130 A131 A7357 AISI 4130 A7357 API Spec 16 C Temperature rate: "B" AII metal parts are flawless We CERTIFY THAT THE ABOVE HOSE HAS EVEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control YHOENIX RUBBEER						· ·			
→ 10 mm = 25 MPa COUPLINGS COUPLINGS Coupling with Crock 3" coupling with 720 719 AISI 4130 C7626 4 1/16" Flange end AISI 4130 47357 Al 1/16" Flange end AISI 4130 47357 All metal parts are flawless API Spec 16 C Temperature rate: "B" All metal parts are flawless Quality Control WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control		See at	tachment. (1	page)	•			•	
→ 10 mm = 25 MPa COUPLINGS COUPLINGS Coupling with Crock 3" coupling with 720 719 AISI 4130 C7626 4 1/16" Flange end AISI 4130 47357 Al 1/16" Flange end AISI 4130 47357 All metal parts are flawless API Spec 16 C Temperature rate: "B" All metal parts are flawless Quality Control WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control						•			
3" coupling with 720 719 AISI 4130 C7626 4 1/16" Flange end AISI 4130 47357 AISI 4130 47357 All and a stress of the series of the series of the order			COUPL	INGS					1. db 1.
4 1/16" Flange end AISI 4130 47357 AlSI 4130 47357 API Spec 16 C Temperature rate:"B" All metal parts are flawless WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control L'HOENIX RUBBER	Туре			1		Quality		Heat N	>
Alsi 4130 47337 Dete: Alsi 4130 47337 Date: Alsi 4130 Date: Alsi 4130 47337 Date: Alsi 4130 Date: Alsi 4	3" coupling with		720 719		A	ISI 4130		C7626	
All metal parts are flawless WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control Laborer LOENIX RUBBER	4 1/16" Flange er	nd			A	ISI 4130		47357	
All metal parts are flawless WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control HOENIX RUBBER						:			
All metal parts are flawless WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control HOENIX RUBBER									
WE CERTIFY THAT THE ABOVE HOSE HAS BEEN MANUFACTURED IN ACCORDANCE WITH THE TERMS OF THE ORDE PRESSURE TESTED AS ABOVE WITH SATISFACTORY RESULT. Date: Inspector Quality Control							3"		
HOENIX RUBBER	WE CERTIFY THAT THE ABO	VE HOSE HAS BEI VE WITH SATISFAC	EN MANUFACTUR	RED IN AC	CORDA		THE TERMS	of the ord	ER AN
29. April. 2002.		Inspector		Qual M	ity Contr	HOL	dustrial Ltd Inspection		in

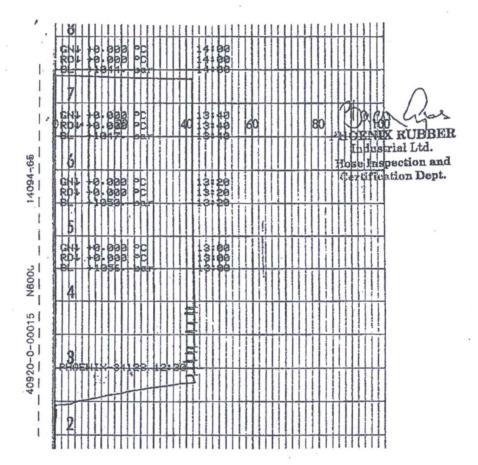

2.03

a state

31 008

 \sim

1.00

17 . 123

ų.

An for 5

5

No.

VERIFIED TRUE CO.

PHOENIX RUBBER Q.C.