



December 2, 2025

New Mexico Oil Conservation Division

New Mexico Energy, Minerals, and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, New Mexico 87505

**Re: Deferral Request
Corral Canyon 8 Sat
Incident Number nAPP2514157393
Eddy County, New Mexico**

To Whom It May Concern:

Ensolum, LLC (Ensolum), on behalf of XTO Energy, Inc. (XTO), has prepared this *Deferral Request*, to document assessment, delineation, excavation, soil sampling activities, and the results of an engineering evaluation and karst survey at the Corral Canyon 8 Sat (Site). The purpose of the report is to describe release response activities following a release of produced water at the Site and support deferral of final remediation for Incident Number nAPP2514157393 until the facility is reconstructed, and/or the well pad is abandoned.

SITE DESCRIPTION AND RELEASE SUMMARY

The Site is located in Unit K, Section 08, Township 25 South, Range 29 East, in Eddy County, New Mexico (32.142883°, -104.006843°) and is associated with oil and gas exploration and production operations on Federal Land managed by the Bureau of Land Management (BLM).

On May 20, 2025, equipment failure resulted in a release into a steel lined containment which overflowed onto the facility pad and under surface piping and equipment. An estimated 11 barrels (bbls) of produced water were released. A vacuum truck was immediately dispatched to the Site and recovered approximately 5 bbls of released fluids. XTO reported the release to the New Mexico Oil Conservation Division (NMOCD) via Notification of Release (NOR) on May 21, 2025, and subsequently an Initial C-141 Application (C-141) May 28, 2025, the release was assigned Incident Number nAPP2514157393.

SITE CHARACTERIZATION AND CLOSURE CRITERIA

The Site was characterized to assess the applicability of Table I, Closure Criteria for Soils Impacted by a Release, of Title 19, Chapter 15, Part 29 (19.15.29) of the New Mexico Administrative Code (NMAC). Results from the characterization desktop review are presented below and potential Site receptors are identified on Figure 1.

Depth to groundwater at the Site is estimated to be greater than 100 feet below ground surface (bgs) based on the nearest groundwater well data. On June 2, 1997, New Mexico Office of State Engineer (OSE) permitted well C-02518 was advanced to a depth of 462 feet below ground surface (bgs) approximately 0.26 miles southeast of the Site. No moisture or groundwater was encountered during drilling activities. On April 19, 2021, an additional soil boring (C-04503 POD 1) was drilled to a depth of

XTO Energy, Inc.
Deferral Request
Corral Canyon 8 Sat

110 feet bgs, approximately 0.80 miles southeast of the Site. The soil boring was dry, which provides additional support that groundwater beneath the Site is greater than 100 feet bgs. The referenced well records are included in Appendix A.

The closest continuously flowing or significant watercourse to the Site is a dry wash, located approximately 780 feet south of the Site. The Site is greater than 200 feet from a lakebed, sinkhole, or playa lake and greater than 300 feet from an occupied residence, school, hospital, institution, church, or wetland. The Site is greater than 1,000 feet to a freshwater well or spring and is not within a 100-year floodplain or overlying a subsurface mine.

Southwest Geophysical Consulting, a BLM-approved third-party cave/karst contractor, conducted a desktop survey, aerial survey, and geophysical survey of the Site. In summary, no surface karst features within the 200-foot survey area surrounding the release extent were identified in the desktop or surface karst surveys. Results of the geophysical study indicated a well-layered geologic system is present beneath the Site with no anomalies in the data that would be consistent with air-filled subsurface voids or a pathway to groundwater. The *Environmental Karst Study Report* is presented in Appendix B.

Based on the results of the Site Characterization, and NMOCD's preference for groundatwer data located within 0.5 miles of the Site and collected withing the last 25 years, the following NMOCD Table I Closure Criteria (Closure Criteria) apply:

- Benzene: 10 milligrams per kilogram (mg/kg)
- Benzene, toluene, ethylbenzene, and total xylenes (BTEX): 50 mg/kg
- Total petroleum hydrocarbons (TPH): 100 mg/kg
- Chloride: 600 mg/kg

LINER INTEGRITY INSPECTION

The steel lined containment overflowed as a result of the May 20, 2025, release of produced water. A 48-hour advance notice of the liner inspection was submitted to the NMOCD on July 7, 2025. The liner was cleared of all debris and fluids. A liner integrity inspection was conducted by Ensolum personnel on July 8, 2025. The lined containment was inspected and was determined to be operating as designed. Upon inspection, no rips, tears, holes, or damage was observed. The liner was determined to be sufficient, and all released fluids from the containment were recovered. NMOCD correspondence for approval of the liner inspection notification is included in Appendix C. Photographic documentation of the inspection is included in Appendix D.

ASSESSMENT AND DELINEATION ACTIVITIES

Between June 4 and June 6, 2025, Ensolum personnel visited the Site to evaluate the release extent based on information provided on the C-141, information provided by XTO, and visual observations. Eight delineation soil samples (SS01 through SS08) were collected around the release extent from a depth of 0.5 feet bgs to assess the lateral extent of the release. Three potholes (PH01 through PH03) were advanced via backhoe to depths ranging from 0.5 feet to 1.5 feet bgs to assess the vertical extent of the release. Discrete soil samples were collected from each delineation pothole at depths ranging from 0.5 feet to 1.5 feet bgs. The soil samples were field screened for volatile organic compounds (VOCs) and chloride utilizing a calibrated photoionization detector (PID) and Hach® chloride QuanTab® test strips, respectively. The release extent and delineation soil sample locations were mapped utilizing

XTO Energy, Inc.
Deferral Request
Corral Canyon 8 Sat

a handheld Global Positioning System (GPS) unit and are depicted on Figure 2. Photographic documentation was collected during all Site activities, and a photographic log is included in Appendix D.

The delineation soil samples were placed directly into pre-cleaned glass jars, labeled with the location, date, time, sampler name, method of analysis, and immediately placed on ice. The soil samples were transported under strict chain-of-custody procedures to Cardinal Laboratories (Cardinal) in Hobbs, New Mexico, for analysis of the following constituents of concern (COCs): BTEX following United States Environmental Protection Agency (EPA) Method 8021B; TPH-gasoline range organics (GRO), TPH-diesel range organics (DRO), and TPH-oil range organics (ORO) following EPA Method 8015M/D; and chloride following EPA Method SM4500.

On June 26, 2025, Ensolum personnel returned to the Site to further delineate the release extent. One delineation borehole (BH01) was advanced via core drill to a depth of 2-feet bgs. Discrete soil samples were collected at depths ranging from 0.25 feet to 2 feet bgs. The soil sample was field screened and handled in the same manner as described above. Field screening results and observations for all boreholes advanced were logged on lithologic/soil sampling logs, which are included in Appendix E.

Laboratory analytical results from delineation soil samples SS01 through SS08 indicated all COC concentrations were in compliance with the Closure Criteria, successfully defining the lateral extent of the release. Additionally, BH01 indicated TPH and chloride concentrations exceeded the Closure Criteria at a depth of 0.25 feet bgs, but were in compliance with Closure Criteria at 1-foot and 2 feet bgs, successfully defining the vertical extent of the release. Laboratory analytical results from delineation potholes PH01 and PH02 indicated TPH and/or chloride concentrations exceeded the Closure Criteria at 0.5-feet bgs, but all COC concentrations were in compliance with Closure Criteria at 1.5-feet and 1-foot bgs respectively. Laboratory analytical results for delineation pothole PH03 indicated concentrations of TPH and chloride exceeded Closure Criteria at 0.5-feet bgs, and chloride concentrations exceeded Closure Criteria at 1-foot bgs and 1.5 bgs. Based on visible staining in the release area, elevated field screening results, and laboratory analytical results, additional remedial activities appeared warranted.

EXCAVATION AND SOIL SAMPLING ACTIVITIES

Between June 6, and August 12, 2025, Ensolum personnel returned to the Site to oversee excavation activities and to address impacted soil identified in vicinity of PH01 through PH03 and BH01. Impacted soil was excavated from the release extent as indicated by delineation and soil sample laboratory analytical results. The excavation occurred on the facility pad near active production equipment and surface piping. Excavation activities were performed by use of heavy equipment and transport vehicles but were limited in areas due to the associated infrastructure present within the release extent. To direct excavation activities, soil was field screened for VOCs and chloride utilizing the same methods as described above. The excavation was completed to a terminal depth of 1.5 feet bgs. A surface scrape of the release extent was performed in areas inaccessible to heavy equipment. Hand tools were utilized to surface scrape the release area to the maximum extent practicable (MEP). Photographic documentation of the excavation and surface scrape activities is included in Appendix C.

Following the removal of impacted soil, 5-point composite soil samples were collected every 200 square feet from the floor and sidewall of the excavation extent. The 5-point composite samples were collected by placing five equivalent aliquots of soil into a resealable plastic bag and homogenizing the samples by thoroughly mixing. Confirmation soil samples FS01 through FS04 were collected from the floor of the excavation at depths ranging between 1-foot and 1.5 feet bgs. Confirmation soil samples SW01 through SW03 were collected from the sidewalls of the excavation at depths ranging from the ground surface to 1.5 feet bgs. The confirmation soil sample locations were mapped utilizing a GPS unit and are depicted on Figure 3.

XTO Energy, Inc.
Deferral Request
Corral Canyon 8 Sat

The final excavation extent measured approximately 627 square feet. A total of approximately 40 cubic yards of impacted soil was removed during excavation activities and was properly disposed of at the Owl Landfill Facility in Lea County, New Mexico. A copy of the waste manifests will be made available upon request.

LABORATORY ANALYTICAL RESULTS

Laboratory analytical results for all confirmation excavation soil samples collected, with the exception of SW01, indicated all COC concentrations were compliant with the Closure Criteria. Laboratory analytical results from SW01 indicated TPH concentrations exceeded the Closure Criteria. Laboratory analytical results are summarized in Table 1, and the complete laboratory analytical reports are included as Appendix F.

ENGINEERING REVIEW

The Site was assessed by a person trained in Occupational Safety and Health Administration (OSHA) excavation and trench safety (Competent Person) under the consultation of a Registered Professional Engineer (RPE) licensed in the State of New Mexico. Soil type B was observed in the inaccessible area—an 86-foot by 88-foot section directly adjacent to and beneath active production piping and footings, and a central circulation pump lined containment. Immediately adjacent to the impacted soil is an electrical panel structure, additional surface piping and footings of varying dimensions, additional engineered pipe racks and platforms, two compressor structures supported by skid structures of varying dimensions, and a lined containment containing three 300-bbl steel crude oil tanks.

Based on the Site conditions and ensuring compliance with OSHA Excavation Standards, the RPE recommendation indicates excavation should not be completed within 2 feet of the edge of the lined containment or within 16 feet of the edge of the pipe rack footings. The RPE recommendation indicates excavation should not be completed within 8 feet of the edge of the compressors. The RPE recommendation indicates excavation should not be completed within 10 feet of active lines with pressure and/or fluids. Based on the dimensions of the requested excavation and presence of adjacent structures, there is inadequate structure support to conduct excavation of the identified impacted soil in a manner that protects both personnel health and equipment stability.

A detailed description of the review and calculations is included in the *Excavation Guidance Document* in Appendix G. The *Excavation Guidance Document* is stamped by an RPE licensed in the state of New Mexico.

DEFERAL REQUEST

Due to active production equipment and process piping present in the area, the remaining impacted soil immediately adjacent and underneath the associated infrastructure, could not be removed, per XTO policy. As such, XTO is requesting deferral of final remediation. The estimated area of remaining impacted soil measures an approximate area of 1,406 square feet, and a total of approximately 78 cubic yards of impacted soil remains in place, assuming a depth of 1.5 feet bgs based on laboratory analytical results from delineation soil samples PH01B, PH02A, PH03A and BH01B. The impacted soil is limited to the area beneath active production equipment and surface piping where safety hazards prohibit excavation without major facility deconstruction. The release extent has been vertically delineated by delineation soil samples PH01B, PH02A, PH03A, and BH01B, along with confirmation soil samples FS01 through FS04. The release extent has been laterally delineated by delineation soil samples SS01 through SS08 and excavation sidewall soil samples SW02 and SW03. The proposed deferral area and all delineation and excavation soil samples used to define the deferral area are depicted on Figure 4.

XTO Energy, Inc.
Deferral Request
Corral Canyon 8 Sat

The results of the karst survey confirm the impacted soil does not pose an imminent risk to deep groundwater at the Site based on the absence of any visible karst features through desktop and pedestrian surveys and absence of any anomalies observed through the geophysical survey to indicate voids. The absence of karst features beneath the Site indicates the subsurface is stable. Impacted soil was removed to the MEP via manual scraping and excavation, and the engineering review indicates additional excavation would require major facility deconstruction. The remaining impacted soil has been fully delineated vertically and laterally to the Closure Criteria.

XTO does not believe deferment will result in imminent risk to human health, the environment, or groundwater. Depth to groundwater was determined to be greater than 100 feet, and the entirety of the release remained on pad. Based on the presence of active production equipment and process piping within the release area and the complete lateral and vertical definition of impacted soil remaining in place, XTO requests deferral of final remediation for Incident Number nAPP2514157393 until final reclamation of the well pad or major construction, whichever comes first.

If you have any questions or comments, please contact Ms. Tacoma Morrissey at (337) 257-8307 or tmorrissey@ensolum.com.

Sincerely,
Ensolum, LLC



Jeremy Reich
Project Geologist



Tacoma Morrissey, PG (licensed in TX)
Associate Principal


cc: Robert Woodall, XTO
Richard Kotzur, XTO
BLM

Appendices:

- Figure 1 Site Receptor Map
- Figure 2 Delineation Soil Sample Locations
- Figure 3 Confirmation Soil Sample Locations
- Figure 4 Deferral Area Map
- Table 1 Soil Sample Analytical Results
- Appendix A Referenced Well Records
- Appendix B Environmental Karst Study Report
- Appendix C NMOCD Correspondence
- Appendix D Photographic Log
- Appendix E Lithologic & Soil Sampling Logs
- Appendix F Laboratory Analytical Reports & Chain-of-Custody Documentation
- Appendix G Excavation Guidance Document
- Appendix H Spill Volume Calculation



FIGURES

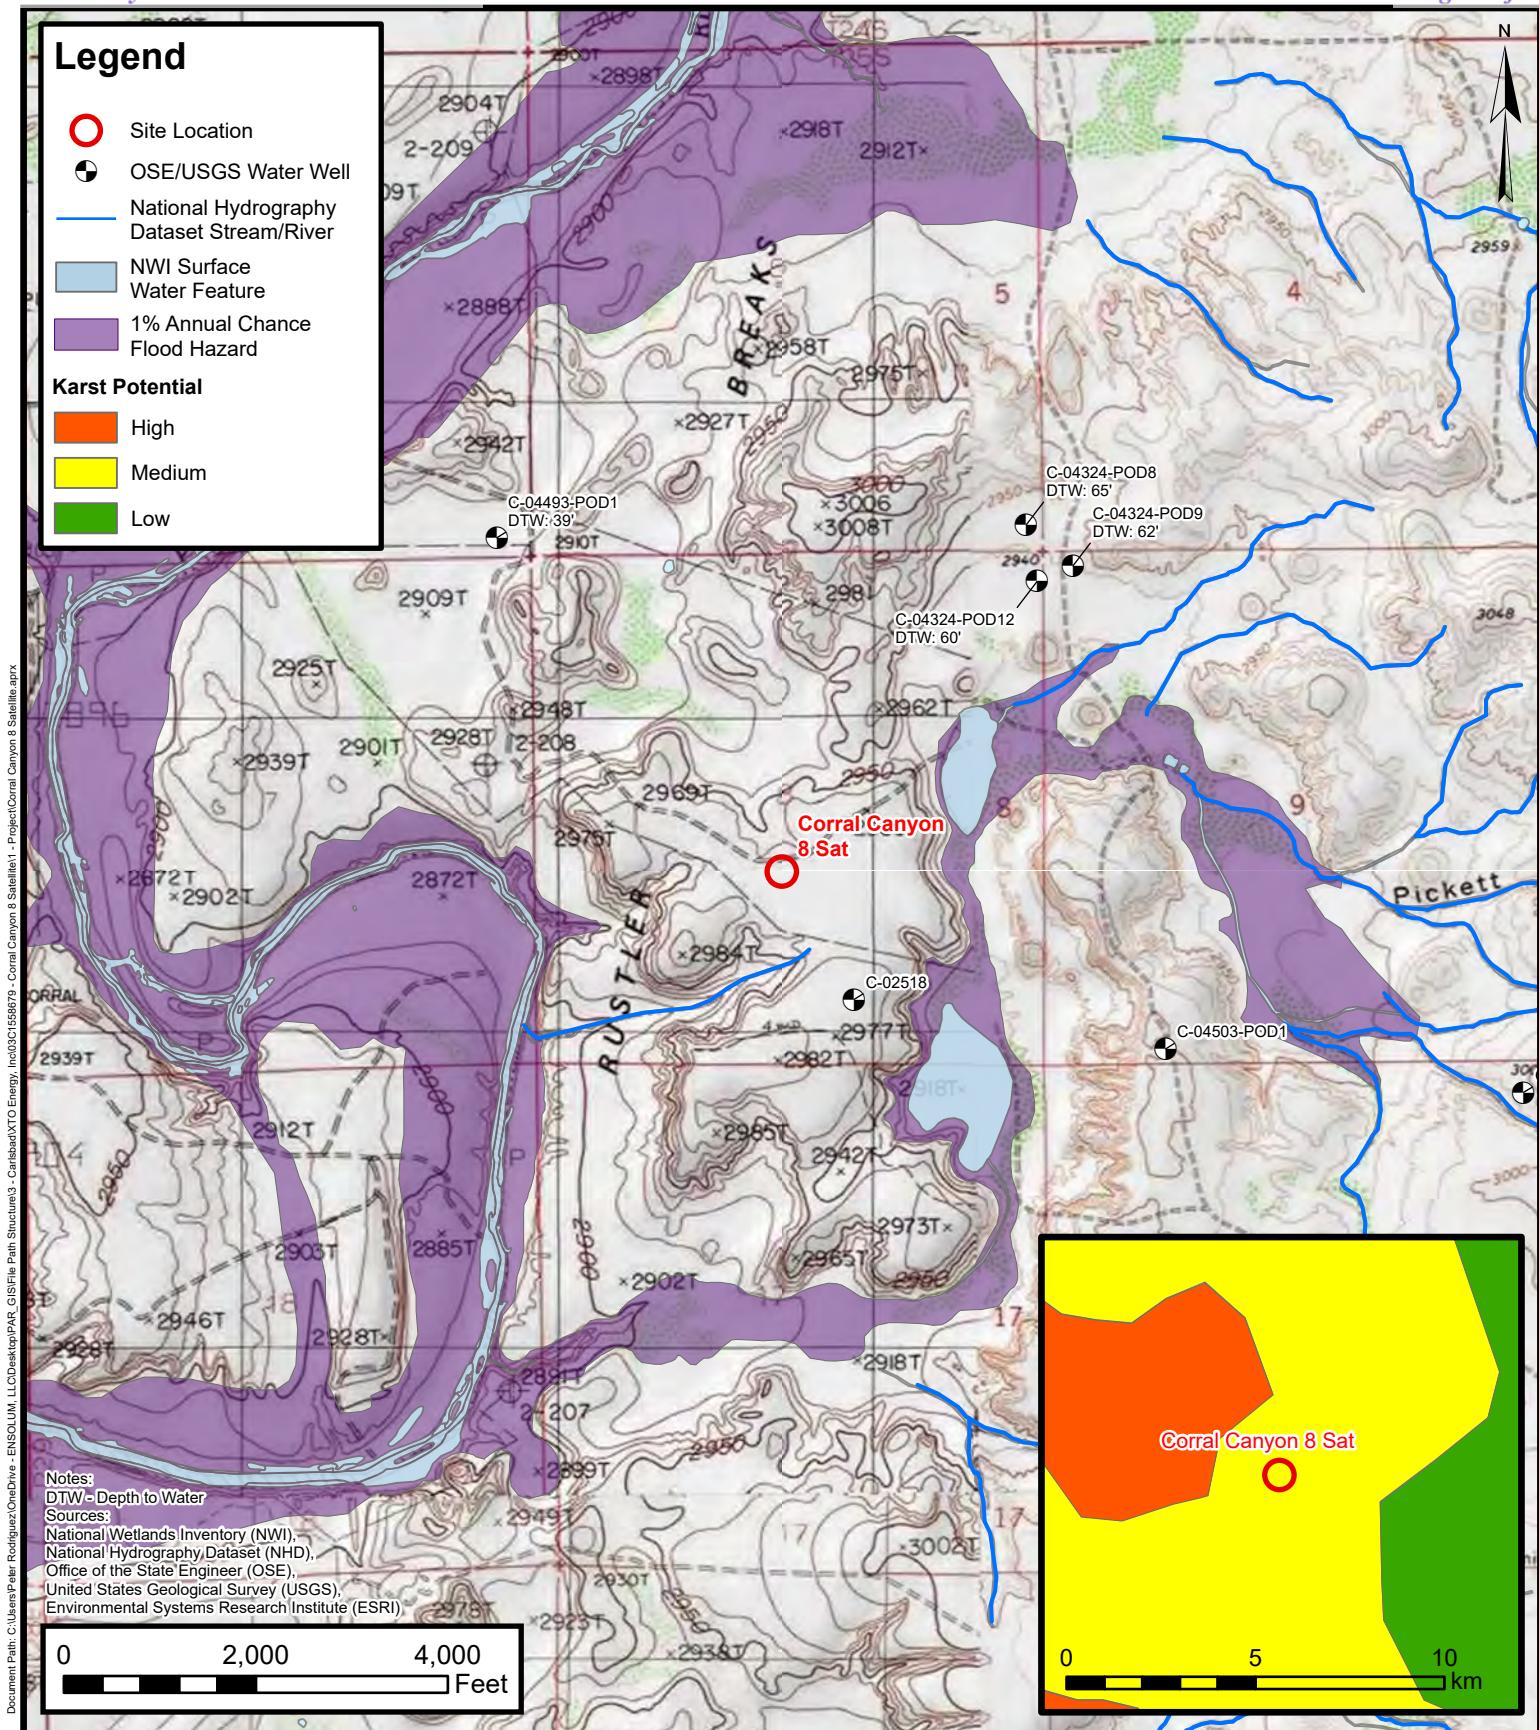

Site Receptor Map

XTO Energy, Inc
Corral Canyon 8 Sat
Incident Number: nAPP2514157393

Unit K, Section 08, T25S, R29E
Eddy County, New Mexico




Environmental, Engineering and
Hydrogeologic Consultants


FIGURE
1

Legend

- ▲ Point of Release
- Delineation Soil Sample Compliant with Closure Criteria
- Delineation Soil Sample Formerly Not Compliant with Site Closure Criteria
- Delineation Soil Sample Not Compliant with Site Closure Criteria
- Electric Utility Line
- Fiber Optic Line
- Gas Line
- Oil and Gas Utility Line
- Surface Production Line
- Lined Containment Area
- Release Extent

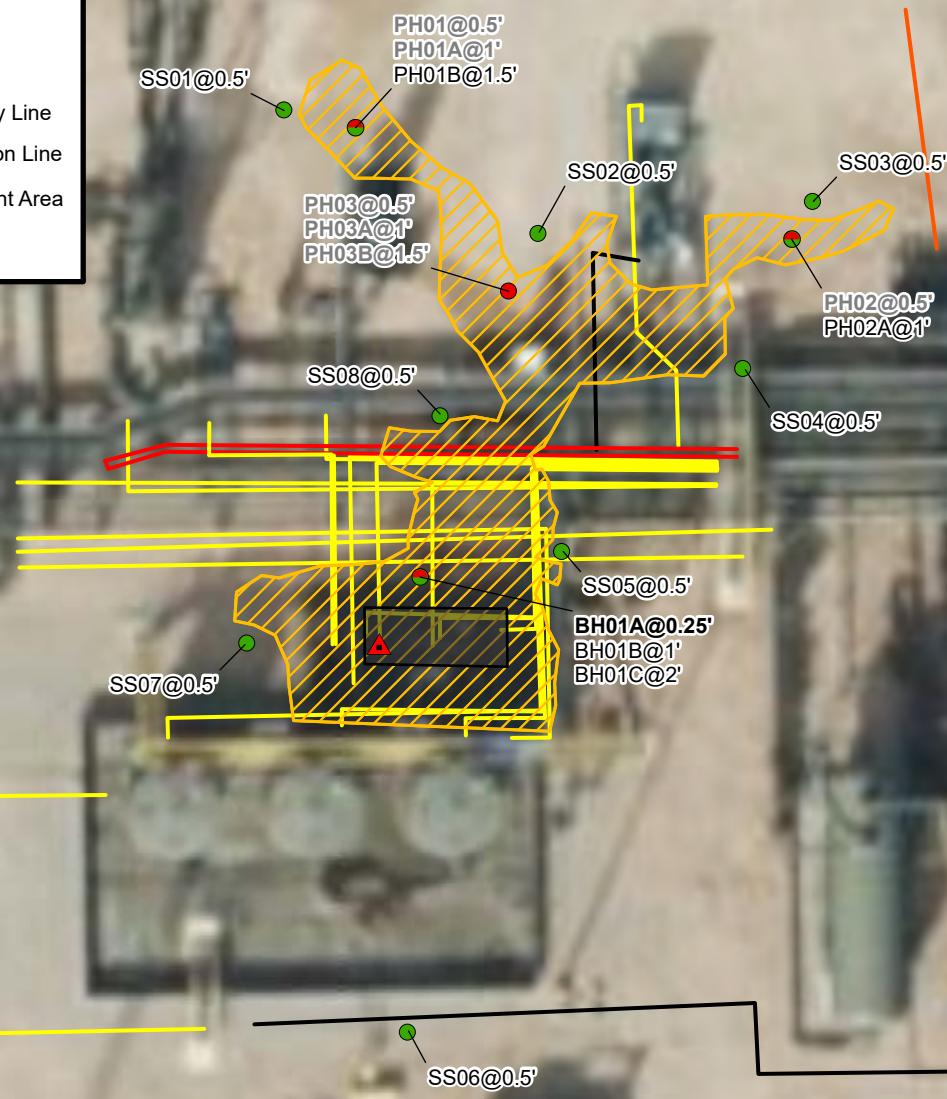

Note:
 Sample ID @ Depth Below Ground Surface
 Concentrations in **bold** exceed the NMOCD Table I Closure Criteria
 or reclamation requirement where applicable.
 Grey text indicates soil sample removed during excavation activities.



Sources
Azure Maps




Environmental, Engineering and
Hydrogeologic Consultants

Delineation Soil Sample Locations

XTO Energy, Inc
 Corral Canyon 8 Sat
 Incident Number: nAPP2514157393

Unit K, Section 08, T25S, R29E
 Eddy County, New Mexico

FIGURE
2

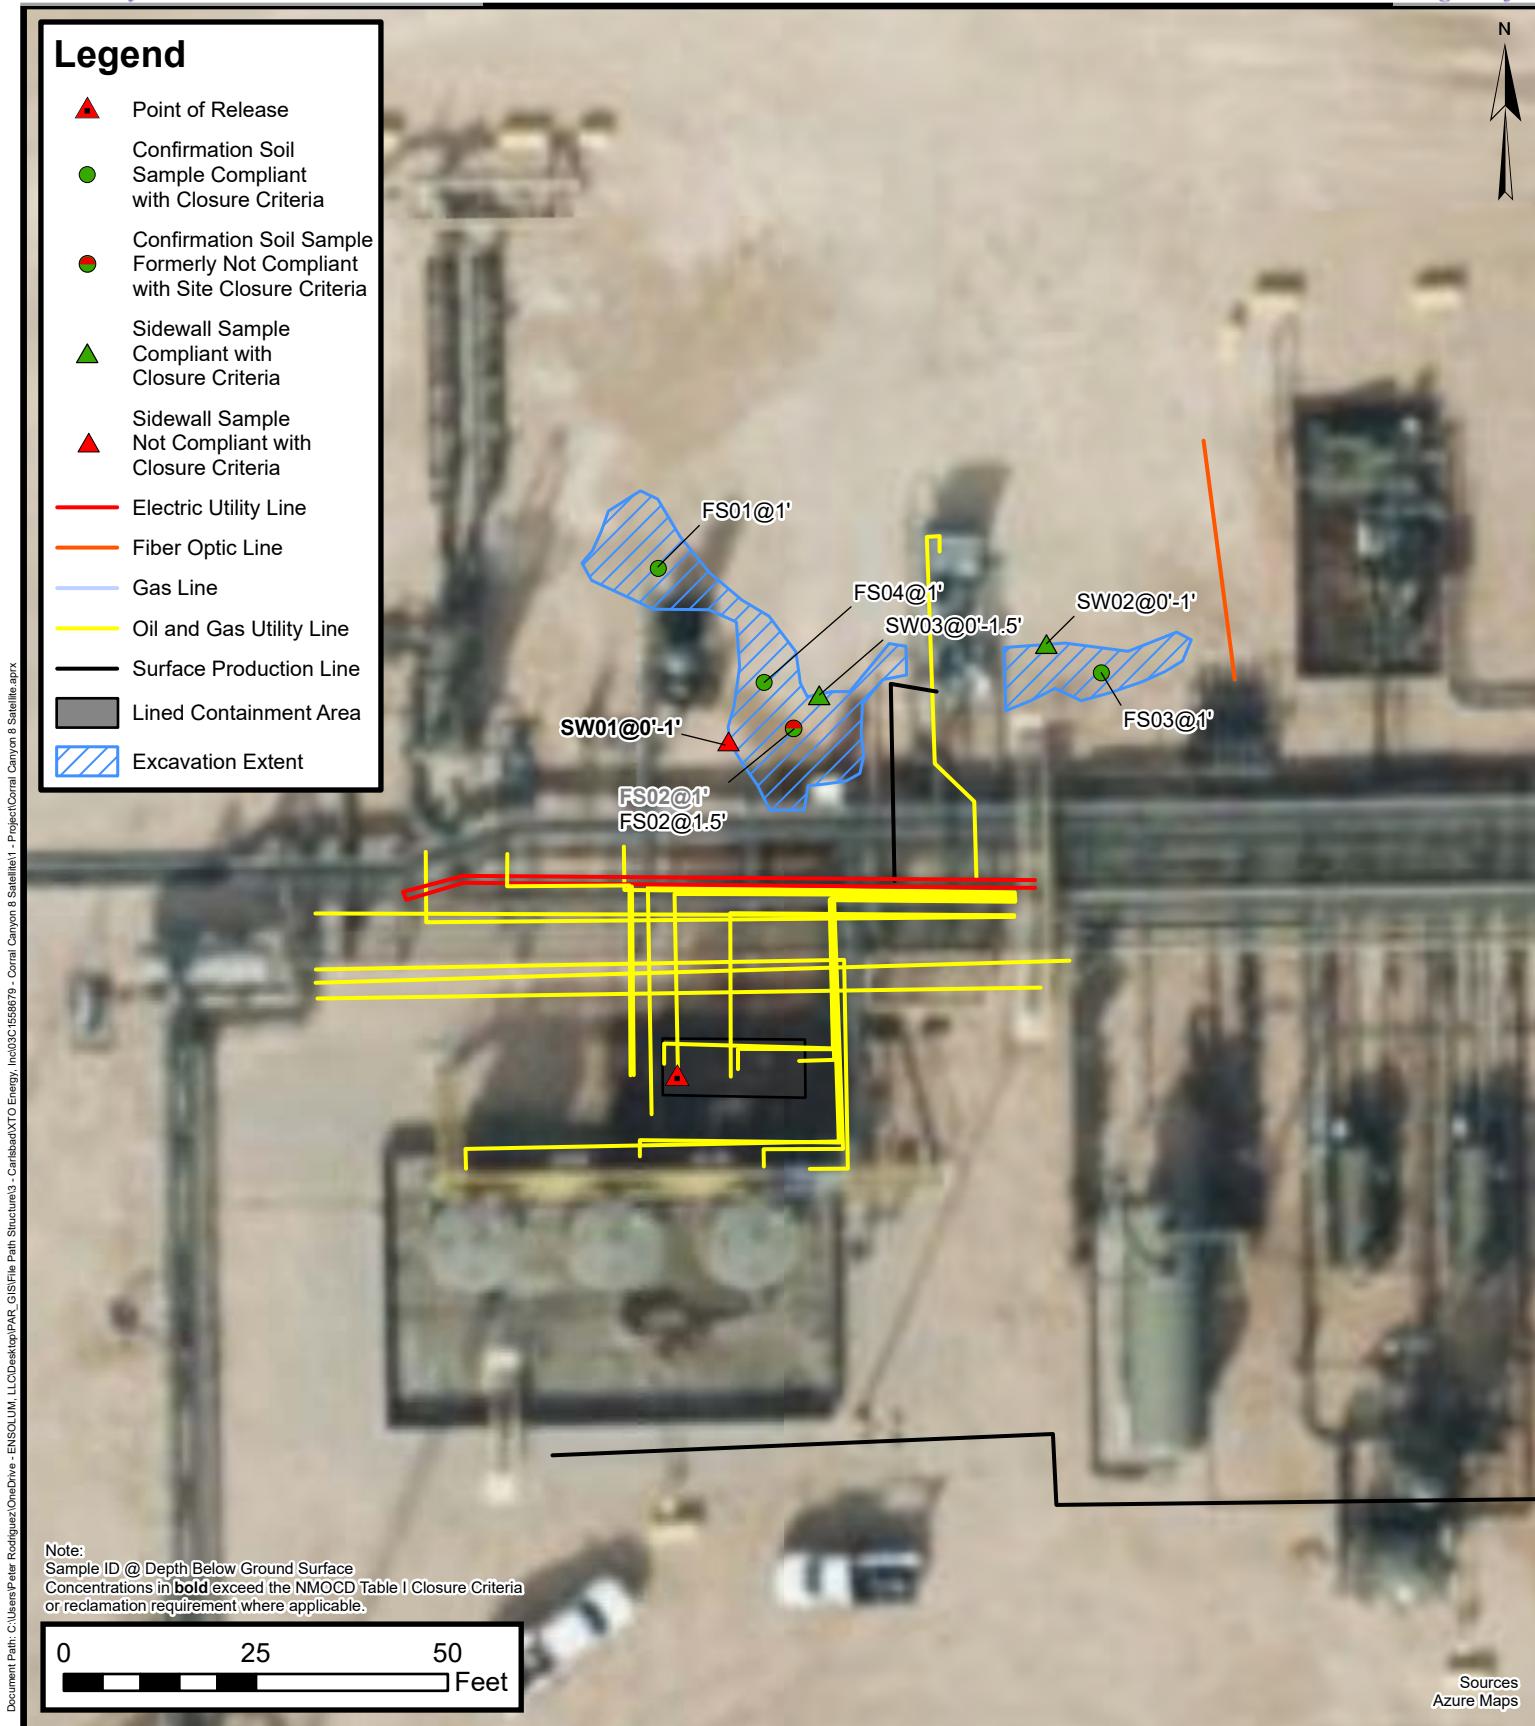

Environmental, Engineering and
Hydrogeologic Consultants

Confirmation Soil Sample Locations

XTO Energy, Inc
Corral Canyon 8 Sat
Incident Number: nAPP2514157393


Unit K, Section 08, T25S, R29E
Eddy County, New Mexico

FIGURE
3

Legend


- ▲ Point of Release
- Delineation Soil Sample Compliant with Closure Criteria
- Delineation Soil Sample Not Compliant with Site Closure Criteria
- ▲ Sidewall Sample Not Compliant With Closure Criteria
- Electric Utility Line Fiber
- Optic Line
- Gas Line
- Oil and Gas Utility Line
- Surface Production Line
- Area of Requested Deferral
- Excavation Extent
- Release Extent
- Lined Containment Area
- Production Equipment

N

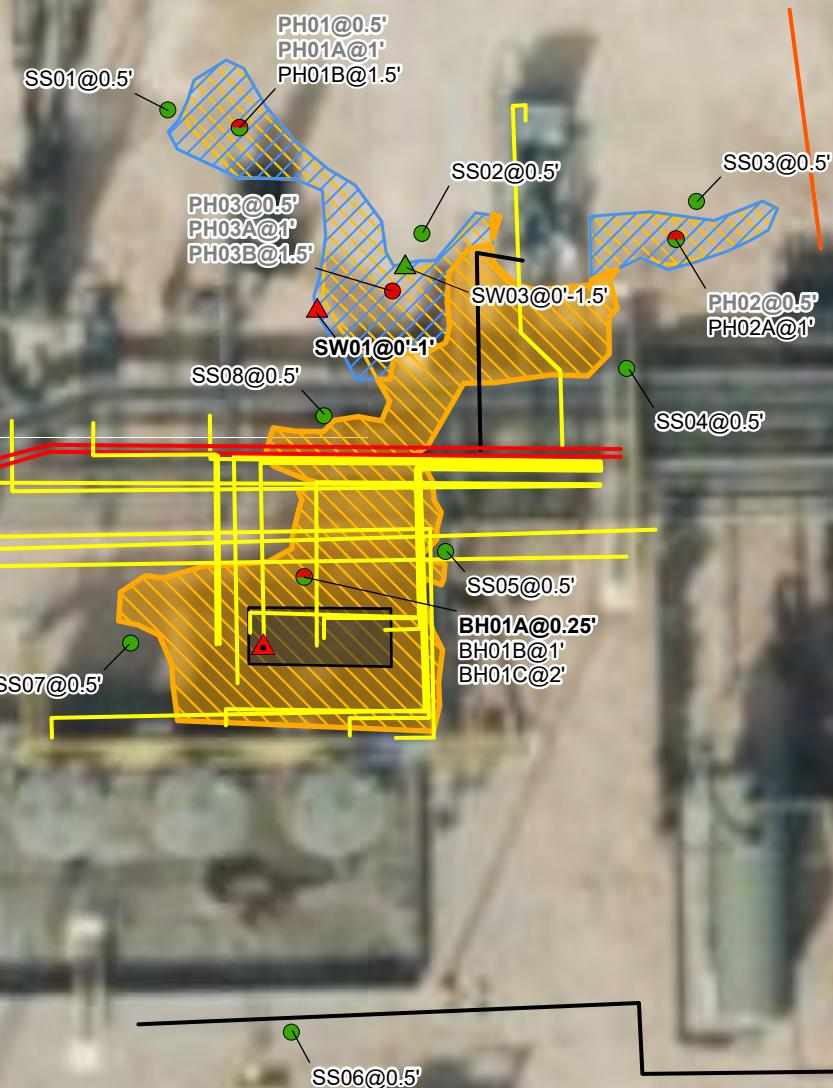

Note:

Sample ID @ Depth Below Ground Surface
 Concentrations in **bold** exceed the MMOCD Table I Closure Criteria
 or reclamation requirement where applicable.

Sources
Azure MapsEnvironmental, Engineering and
Hydrogeologic Consultants

Requested Area of Deferral

XTO Energy, Inc
 Corral Canyon 8 Sat
 Incident Number: nAPP2514157393

Unit K, Section 08, T25S, R29E
 Eddy County, New Mexico

FIGURE
4



TABLES



TABLE 1
SOIL SAMPLE ANALYTICAL RESULTS
Corral Canyon 8 Sat
nAPP2514157393
XTO Energy, Inc
Eddy County, New Mexico

Sample I.D.	Sample Date	Sample Depth (feet bgs)	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH GRO (mg/kg)	TPH DRO (mg/kg)	TPH ORO (mg/kg)	GRO+DRO (mg/kg)	Total TPH (mg/kg)	Chloride (mg/kg)
NMOCD Table I Closure Criteria (NMAC 19.15.29)			10	50	NE	NE	NE	NE	100	600
Delineation Soil Samples										
SS01	06/04/2025	0.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	336
SS02	06/04/2025	0.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	128
SS03	06/04/2025	0.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	256
SS04	06/04/2025	0.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	400
SS05	06/04/2025	0.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	128
SS06	06/04/2025	0.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	16.0
SS07	06/04/2025	0.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	80.0
SS08	06/04/2025	0.5	<0.050	<0.300	<10.0	24.9	<10.0	24.9	24.9	96.0
BH01A	06/26/2025	0.25	<0.050	1.35	19.3	2,490	541	2,509	3,050	3,920
BH01B	06/26/2025	1	<0.050	<0.300	<10.0	26.9	<10.0	26.9	26.9	144
BH01C	06/26/2025	2	<0.050	<0.300	<10.0	11.0	<10.0	11.0	11.0	144
PH04	06/04/2025	0.5	<0.050	<0.300	<10.0	20.9	<10.0	20.9	20.9	656
PH04A	06/04/2025	4	<0.050	<0.300	<10.0	92.9	443	92.9	206	442
PH01B	06/06/2025	1.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	176
PH02	06/04/2025	0.5	<0.050	5.03	367	8,400	1,480	8,767	10,247	416
PH02A	06/04/2025	4	<0.050	<0.300	<10.0	29.0	24.4	29.0	50.4	176
PH03	06/04/2025	0.5	<0.050	<0.300	<10.0	109	33.0	109	142	2,520
PH03A	06/04/2025	4	<0.050	<0.300	<10.0	36.1	10.2	36.1	46.3	976
PH03B	06/06/2025	4.5	<0.050	<0.300	<10.0	52.2	16.9	52.2	68.4	1,040
Confirmation Soil Samples										
FS01	06/06/2025	1	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	256
FS02	06/16/2025	4	<0.050	<0.300	<10.0	462	34.4	462	496	224
FS02	08/12/2025	1.5	<0.050	<0.300	<10.0	30.7	<10.0	30.7	30.7	128
FS03	06/06/2025	1	<0.050	<0.300	<10.0	11.7	<10.0	11.7	11.7	528
FS04	06/16/2025	1	<0.050	<0.300	<10.0	39.8	<10.0	39.8	39.8	224
SW01	06/16/2025	0-1	<0.050	<0.300	<10.0	94.4	19.4	94.4	114	240
SW02	06/16/2025	0-1	<0.050	<0.300	<10.0	48.8	<10.0	48.8	48.8	208
SW03	08/12/2025	0-1.5	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	<10.0	304

Notes:

bgs: below ground surface

mg/kg: milligrams per kilogram

NMOCD: New Mexico Oil Conservation Division

BTEX: Benzene, Toluene, Ethylbenzene, and Xylenes

Concentrations in **bold** exceed the NMOCD Table I Closure Criteria or

GRO: Gasoline Range Organics

DRO: Diesel Range Organics

ORO: Oil Range Organics

TPH: Total Petroleum Hydrocarbon

NMAC: New Mexico Administrative Code



APPENDIX A

Referenced Well Records

STATE ENGINEER OFFICE

WELL RECORD

465788

Revised June 1972

Section 1. GENERAL INFORMATION

OFFICE OF

STATE ENGINEER

SANTA FE, NEW MEXICO

(A) Owner of well Penwell Energy Owner's Well No. 600
 Street or Post Office Address c/o Glenn's Water Well Service Address 1 PM 1 29
 City and State P.O. Box 692 Tatum, NM 88267 Date 1/99

Well was drilled under Permit No. C-2518 and is located in the:

a. 1/4 1/4 SW 1/4 SE 1/4 of Section 8 Township 25 Range 29 N.M.P.M.

b. Tract No. _____ of Map No. _____ of the _____

c. Lot No. _____ of Block No. _____ of the _____
 Subdivision, recorded in _____ County.

d. X= _____ feet, Y= _____ feet, N.M. Coordinate System _____
 the _____ Zone in _____ Grant.

(B) Drilling Contractor Glenn's Water Well Service License No. WD - 421

Address P.O. Box 692 Tatum, NM 88267Drilling Began 6-2-97 Completed 6-2-97 Type tools rotary Size of hole 7 7/8 in.Elevation of land surface or _____ at well is _____ ft. Total depth of well 462 ft.Completed well is shallow artesian. Depth to water upon completion of well _____ ft.

Section 2. PRINCIPAL WATER-BEARING STRATA

Depth in Feet		Thickness in Feet	Description of Water-Bearing Formation	Estimated Yield (gallons per minute)
From	To			
			dry hole	

Section 3. RECORD OF CASING

Depth in Feet		Thickness in Feet	Description of Water-Bearing Formation	Estimated Yield (gallons per minute)			Perforations	
From	To						From	To
			none					

Section 4. RECORD OF MUDDING AND CEMENTING

Depth in Feet		Hole Diameter	Sacks of Mud	Cubic Feet of Cement	Method of Placement						
From	To					Top	Bottom	Length (feet)	Type of Shoe	From	To

Section 5. PLUGGING RECORD

Plugging Contractor well was back filled with cutting
 Address and drilling mud

Plugging Method _____

Date Well Plugged _____

Plugging approved by: _____

State Engineer Representative _____

No.	Depth in Feet		Cubic Feet of Cement
	Top	Bottom	
1	0	460	cutting & mud
2			
3			
4			

FOR USE OF STATE ENGINEER ONLY

Date Received 06-10-97

Quad _____ FWL _____ FSL _____

File No. C-2518 Use OWD "Dry Hole" Location No. 258.29E.8.43412

Section 6. LOG OF HOLE

Section 7. REMARKS AND ADDITIONAL INFORMATION

卷之三

97 JUN 10 PM 1 17

The undersigned hereby certifies that, to the best of his knowledge and belief, the foregoing is a true and correct record of the above described hole.

Corky J. Gray
Driller

Driller

INSTRUCTIONS: This form should be executed in triplicate, preferably typewritten, and submitted to the appropriate district office of the State Engineer. All sections, except Section 5, shall be answered as completely and accurately as possible when any well is drilled, repaired or deepened. When this form is used as a plugging record, only Section 1(a) and Section 5 need be completed.



WELL RECORD & LOG
OFFICE OF THE STATE ENGINEER
www.ose.state.nm.us

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06/30/17)


FOR USE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 06/30/17)		
FILE NO.	C-4503	POD NO.	1	TRN NO.
LOCATION	Exp 1	255.29E. 9.334	WELL TAG ID NO.	PAGE 1 OF 2

FOR OSE INTERNAL USE WR-20 WELL RECORD & LOG (Version 06/30/2017)
FILE NO. C-4503 POD NO. 1 TRN NO. 682792
LOCATION WELL TAG ID NO. PAGE 2 OF 2



APPENDIX B

Environmental Karst Survey

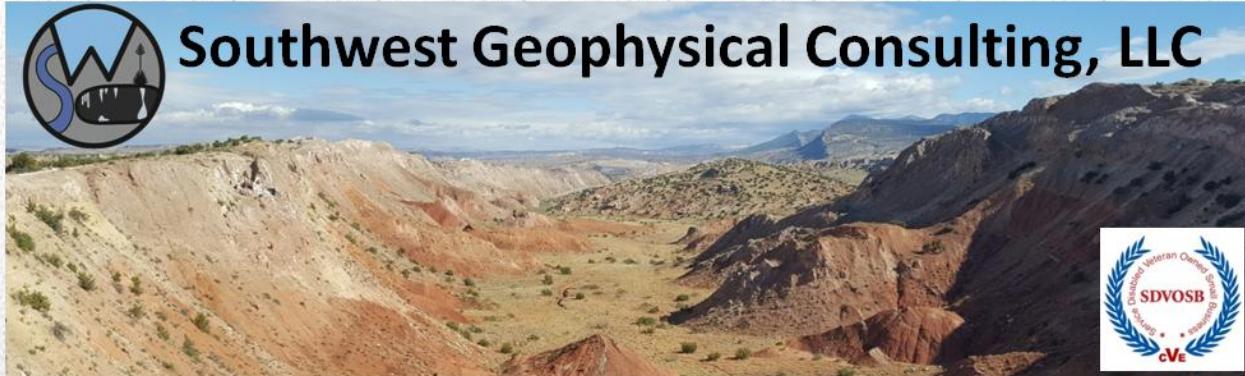

Environmental Karst Study Report

XTO Corral Canyon 8 Satellite

Eddy County, New Mexico

Prepared For:

Ensolum, LLC

3122 National Parks Highway
Carlsbad, NM 88220

- Positive within 200 feet of spill delineation boundary
- Negative within 200 feet of spill delineation boundary
- Stable Unstable Ground
- Karst Monitor Recommended

August 15, 2025

ENS-018-20250609

©2025 – Southwest Geophysical Consulting, LLC. All rights reserved.

Published by:

Southwest Geophysical Consulting, LLC
5117 Fairfax Dr. NW
Albuquerque, NM 87114
(505) 585-2550
www.swgeophys.com

Prepared by:

Steven Kesler
Field Geologist
steven@swgeophys.com

Reviewed by:

David Decker, PhD, PG, CPG
CEO, Principal Geologist
dave@swgeophys.com

Prepared for:

Ensolum, LLC
3122 National Parks Highway
Carlsbad, NM 88220

Tracy Hillard
(575) 937-3906
thillard@ensolum.com

MMXXV

TABLE OF CONTENTS

FRONT MATTER.....	i
TABLE OF CONTENTS.....	ii
LIST OF FIGURES.....	iii
LIST OF TABLES.....	iii
1.0 INTRODUCTION.....	1
1.1 <i>Goals of this Study</i>	1
1.2 <i>Summary of Findings</i>	1
1.3 <i>Affected Environment</i>	1
1.4 <i>Limitations of Report</i>	3
2.0 LOCATION AND DESCRIPTION OF STUDY AREA.....	4
2.1 <i>Description of Site</i>	4
2.2 <i>Local Geology Summary</i>	5
2.3 <i>Description of Survey</i>	6
2.3.1 Surface Karst Survey	6
2.3.2 Geophysical Survey.....	8
3.0 RESULTS.....	10
3.1 <i>Surface Karst Survey</i>	10
3.2 <i>Geophysical Survey</i>	11
4.0 DISCUSSION.....	13
5.0 SUMMARY.....	15
6.0 DISCLOSURE STATEMENT	15
7.0 REFERENCES	17
8.0 GLOSSARY OF TERMS	18
9.0 ATTESTATION	20

LIST OF FIGURES

Figure 1: Karst occurrence zone overview.....	2
Figure 2: Land ownership and PLSS overview.....	4
Figure 3: Geology overview	5
Figure 4: Surface survey overview	7
Figure 5: Geophysical survey overview	8
Figure 6: UAS-conducted surface karst survey results	10
Figure 7: 2D inverted resistivity sections.....	12
Figure 8: Data overlay	14

LIST OF TABLES

Table 1: Survey Line Data Table.....	9
Table 2: Software Information and Settings.....	9

1.0 INTRODUCTION

This report was commissioned by Ensolum, LLC (hereinafter referred to as "the client"), on June 9, 2025, for the purpose of conducting an environmental karst study within an area encompassing the XTO Corral Canyon 8 Satellite project site (hereinafter termed "XCC8") centered at N 32.142567° W 104.006681°.

1.1 Goals of this Study

The goals of this study are to conduct a surface karst inventory and provide the client with the location and description of any surface karst features located within 200 feet (61 meters) of the spill delineation boundary (as defined by 19.15.29.12 NMAC^[1]), and to determine whether stable ground exists (as defined by 19.15.2 NMAC Definitions^[2]) within the spill boundary of the XTO Corral Canyon 8 Satellite project as provided by the client via e-mail (**XCC8_INF_UTM13.kmz**) on June 17, 2025, using electrical resistivity imaging^[3].

1.2 Summary of Findings

- **No surface karst features exist within the 200-foot (61-meter) perimeter of the spill delineation boundary.**
- **No anomalies consistent with subsurface air-filled voids were found within the XCC8 resistivity survey area.**
- **Flat-lying stratigraphy is interpreted to exist beneath the area where the geophysical survey was conducted, indicating stable ground.**

1.3 Affected Environment

The XCC8 project site is located in evaporite karst terrain, a landform that is characterized by underground drainage through solutionally enlarged conduits. Evaporite karst terrain may contain sinkholes, sinking streams, caves, and springs. Sinkholes leading to underground drainages and voids are common. These karst features, as well as occasional fissures and discontinuities in the bedrock, provide the primary sources for rapid recharge of the groundwater aquifers of the region. Additionally, karst may develop by hypogene processes involving dissolution by upwelling fluids from depth independent of recharge from the overlying or immediately adjacent surface. Hypogene karst systems may not be connected to the surface and can remain undiscovered unless encountered during drilling or excavation.

Karst features are delicate resources that are often of geological, hydrological, biological, and archeological importance, and should be protected. The four primary concerns in these types of terrain are environmental issues, worker safety, equipment damage, and infrastructure integrity.

The Bureau of Land Management (BLM) categorizes all areas within the Carlsbad Field Office (CFO) zone of responsibility as having either low, medium, high, or critical cave potential based on geology, occurrence of known caves, density of karst features, and potential impacts to freshwater aquifers^[4]. These designations are also recognized by the New Mexico State Land Office (NMSLO). This project occurs within a **MEDIUM** karst occurrence zone (MKOZ)^[5] (**Figure 1**).



Figure 1: Karst occurrence zone overview. Background image credit: Google Earth. Image date: August 21, 2024. Image datum: WGS-84.

A medium karst occurrence zone is defined as an area in known soluble rock types that may have a shallow insoluble overburden. These areas may contain isolated karst features such as caves and sinkholes. Groundwater recharge may not be wholly dependent on karst features, but the karst features still provide the most rapid aquifer recharge in response to surface runoff^[4].

Due to the rapidity with which evaporite karst develops, each location within a BLM-CFO designated karst occurrence zone must be assessed on an individual basis to determine the existence of surface karst features and the possibility of sub-surface karst development each time a release occurs.

1.4 Limitations of Report

This report should be read in full. No responsibility is accepted for the use of any part of this report in any other context or for any other purpose or by third parties. This report does not purport to give legal advice. Legal advice can only be given by qualified legal practitioners.

This report has been prepared for the use of Ensolum, LLC, in accordance with generally accepted consulting practices. Every effort has been made to ensure the information in this report is accurate as of the time of its writing. This report has not been prepared for use by parties other than the client, their contracting party, and their respective consulting advisors. It may not contain sufficient information for the purposes of other parties or for other uses.

This report was prepared upon completion of the associated fieldwork using a standard template prepared by Southwest Geophysical Consulting and is based on information collected prior to fieldwork, conditions encountered on site, and data collected during the fieldwork and reviewed at the time of preparation. Southwest Geophysical Consulting disclaims responsibility for any changes that might have occurred at the site after this time. The interpreted results, locations, and depths noted in this report (if applicable) should be taken as an interpretation only and no decision should be based solely on this information. Physical verification of aerial imagery analysis results in the field should be conducted prior to using this information for remediation planning. Physical verification of geophysical results using geotechnical methods should be conducted.

To the best of our knowledge, the information contained in this report is accurate at the date of issue. Due to the nature of karst terrain, the information in this report shall not be used beyond two years past the date of the field work provided in section **2.3 Description of Survey**. Large weather events can shorten this time period as areas subject to karst development can rapidly form new features subsequent to these events.

2.0 LOCATION AND DESCRIPTION OF STUDY AREA

2.1 Description of Site

The site is located 11.1 kilometers (6.9 miles) southeast of Malaga, New Mexico, east of US Highway 285 and northwest of Pipeline Road Number 1. The release site is located within section 8, NM T25S R29E^[6] (**Figure 1** and **Figure 2**). The region has flat-lying terrain with karstification occurring in the gypssite soils and underlying gypsum and dolomite bedrock^[7] (see section **2.2 Local Geology Summary** for further information). The climate in this area of southeast New Mexico is semi-arid with an average annual precipitation of approximately 13 inches, of which about two-thirds falls as rain during summer thunderstorms from June to October. Summers are hot and sunny while winters are generally mild, with an average maximum temperature of 96°F in July and an average minimum temperature of 28°F in January^[8]. This area is within the Chihuahuan Desert Thornscrub as defined by the Southwestern Regional ReGAP Vegetation map^[9] and the vegetation consists mostly of areas of blue grama, nine-awned pappus grass, burro grass and low scrub including yucca. The spill delineation boundary is located within an MKOZ^[5] (**Figure 1**) and within BLM-CFO managed land^[10] (**Figure 2**).



Figure 2: Land ownership and PLSS overview. Background image credit: Google Earth. Image date: March 20, 2023. Image datum: WGS-84.

2.2 Local Geology Summary

The site for the XCC8 survey is located at an elevation of 903 meters (2,961 feet), \pm 6 meters (19 feet), and is located within a region underlain by the Permian Rustler Formation (Pru). The area is mantled by thin gypsumiferous soils (gypsiter), Quaternary alluvium (Qal), and eolian deposits (Qe)^[11] up to 5 meters in depth (**Figure 3**).

The Rustler Formation is an evaporite facies composed mainly of thin siltstones and sandstones interbedded with claystones, dolomite, and gypsum, and contains both karst-forming strata (the Forty-niner and Tamarisk members) and two shallow aquifers (the Magenta and Culebra Dolomite members)^[12].

The Pru overlies the Permian Salado Formation (Psl) (not shown on map as it does not outcrop in the survey area), a layer of extremely soluble halite which can readily dissolve to create caves, sinkholes, and other karst features; however, due to its extremely soluble nature, only non-soluble silt and sand remain from the dissolution of this layer at the surface^[12]. The Rustler Formation may be subject to collapse if a void has developed beneath it in the Salado Formation^[13].

The survey area is covered by the easily accessible Geologic Map of New Mexico (2003) at 1:500,000 scale^[14] and the Digital Geologic Map of New Mexico in ARC/INFO Format^[11].



Figure 3: Geology overview. Geology map credit: The Digital Geologic Map of New Mexico in ARC/INFO Format. Background image credit: Google Earth. Image date: March 20, 2023. Image datum: WGS-84.

2.3 Description of Survey

2.3.1 Surface Karst Survey

Southwest Geophysical Consulting, in partnership with SWCA Environmental Consultants, provides surface karst surveys using small, uncrewed aerial systems (sUAS) that are flown by qualified, FAA licensed drone pilots and that meet the stringent Bureau of Land Management – Carlsbad Field Office requirements for both pedestrian and aerial karst surveys.

The surface karst survey includes a desk study prior to the flight which allows us to provide client feedback in the event of any previously known karst features in the area. The desk study is performed out to 305 meters (1,000 feet) from the spill delineation boundary per New Mexico Oil Conservation Division guidance^[1] (**Figure 4**). The study was performed using satellite and aerial imagery from Google Earth Pro dated March 20, 2023 (please note features less than one meter in diameter are generally not visible using this method); the Southwest Geophysical Cave and Karst Database dated December 23, 2024^[15]; the Malaga, NM, 1:24,000 quad, 1985, USGS topographic map; and the latest lidar imagery from CalTopo.com. Please note that we use older topographic maps because newer maps have had caves removed from them. These searches and queries returned no surface karst features within the 305-meter survey boundary.

Surface karst surveys are conducted by sUAS at low elevation within 200 meters of the spill delineation boundary^[3] (**Figure 4**) following a preplanned raster pattern flightpath designed for the purpose of generating at least 75% imagery overlap. The collected high-resolution, georeferenced imagery is stitched together to develop orthomosaic imagery which is further developed into a digital elevation model (DEM); the DEM is then processed into a local relief model (LRM) (**Figure 6**). This LRM is color coded to enhance differences in elevation of as little as five centimeters. The orthoimagery, DEM, and LRM are uploaded to a server where they are analyzed by an experienced karst geologist. Finally, the data is reviewed by a senior karst geologist for quality assurance and downloaded into a table for inclusion in a written report^[16].

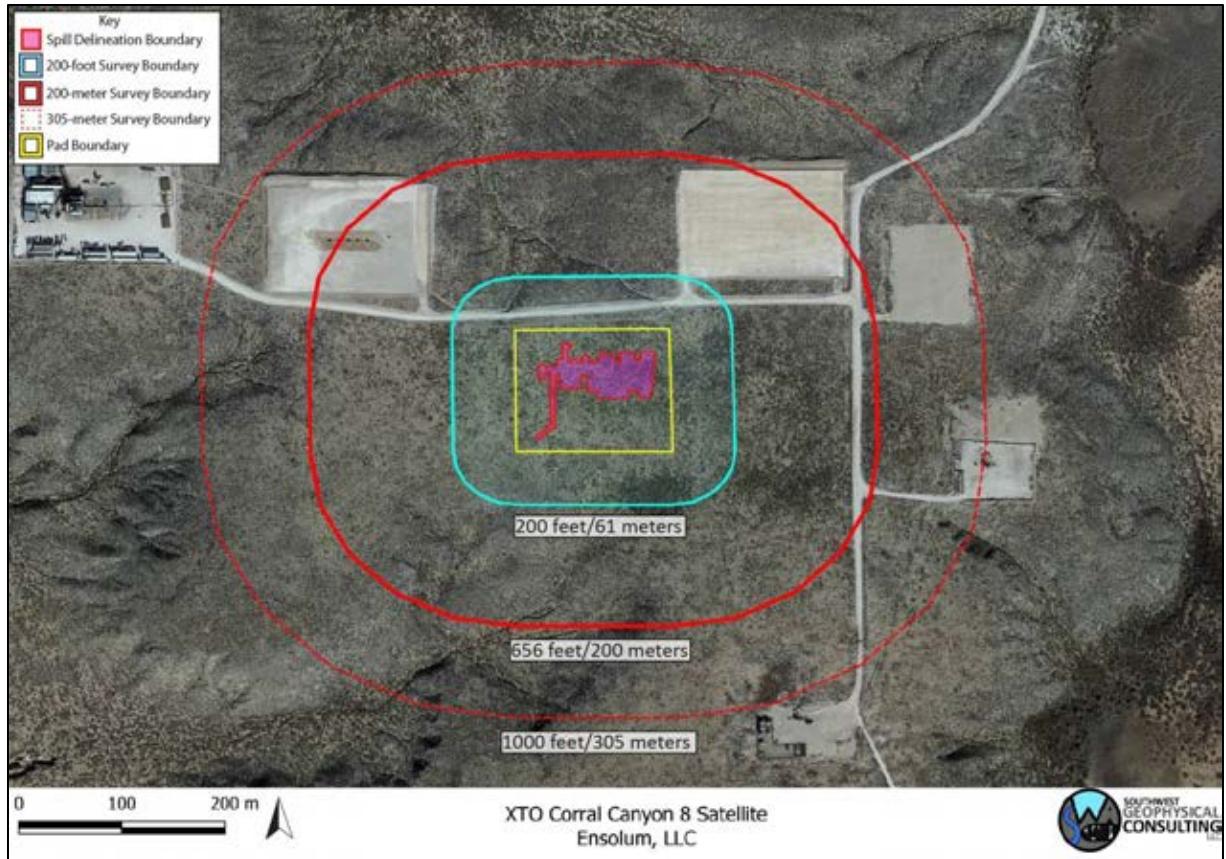


Figure 4: Surface survey overview. Background image credit: Google Earth. Image date: January 27, 2023. Datum: WGS-84.

The resolution of the orthoimagery is clear enough that features as small as 10 centimeters can be positively identified in most circumstances. Occasionally there are ambiguous features identified during an aerial survey that will need to be checked in the field if they are impacted by the proposed remediation efforts. Specifically, it is difficult to tell the difference between solution tubes, abandoned uncased well bores, and some burrows in drone imagery. If an ambiguous feature is located during imagery analysis, it is marked with a yellow dot in **Figure 6**. If a feature of any likelihood is subsequently verified in the field prior to publication of the report, the dot will be changed to a red triangle if confirmed as a karst feature or deleted if not.

The imagery for this study was collected via aerial survey by Pat Lagodney of SWCA on July 8, 2025. Surface karst features may have developed after this date and will not be noted in this report. Imagery analysis was completed by Dave Decker of Southwest Geophysical Consulting on July 24, 2025.

2.3.2 Geophysical Survey

For this survey, an ABEM Terrameter LS 2, two 42-electrode, and one 56-electrode array of 40-centimeter-long electrodes were used to image the subsurface. This survey consisted of three resistivity lines in a dipole-dipole configuration: line XCC801 was laid out south to north, line XCC802 was laid out west to east, and XCC803 was laid out south to north. Line XCC801 consisted of 56 electrodes at 5-meter spacing resulting in a 275-meter-long array and lines XCC802 and XCC803 both consisted of 42 electrodes at 5-meter spacing resulting in 205-meter long arrays (**Figure 5, Table 1**). A preconfigured command file was used to run the data collection (DipoleDipole4x14). The 56-electrode configuration provided a depth of investigation of 55 meters (180 feet) with a resolution of 2.0 to 2.5 meters (6.6 to 8.2 feet). The 42-electrode configuration provided a depth of investigation of 33 meters (108 feet) with a resolution of 2.0 to 2.5 meters (6.6 to 8.2 feet) within the first 5 to 8 meters (16 to 26 feet) from the surface. A Leica GS18 GPS was used to record electrode locations and elevations.

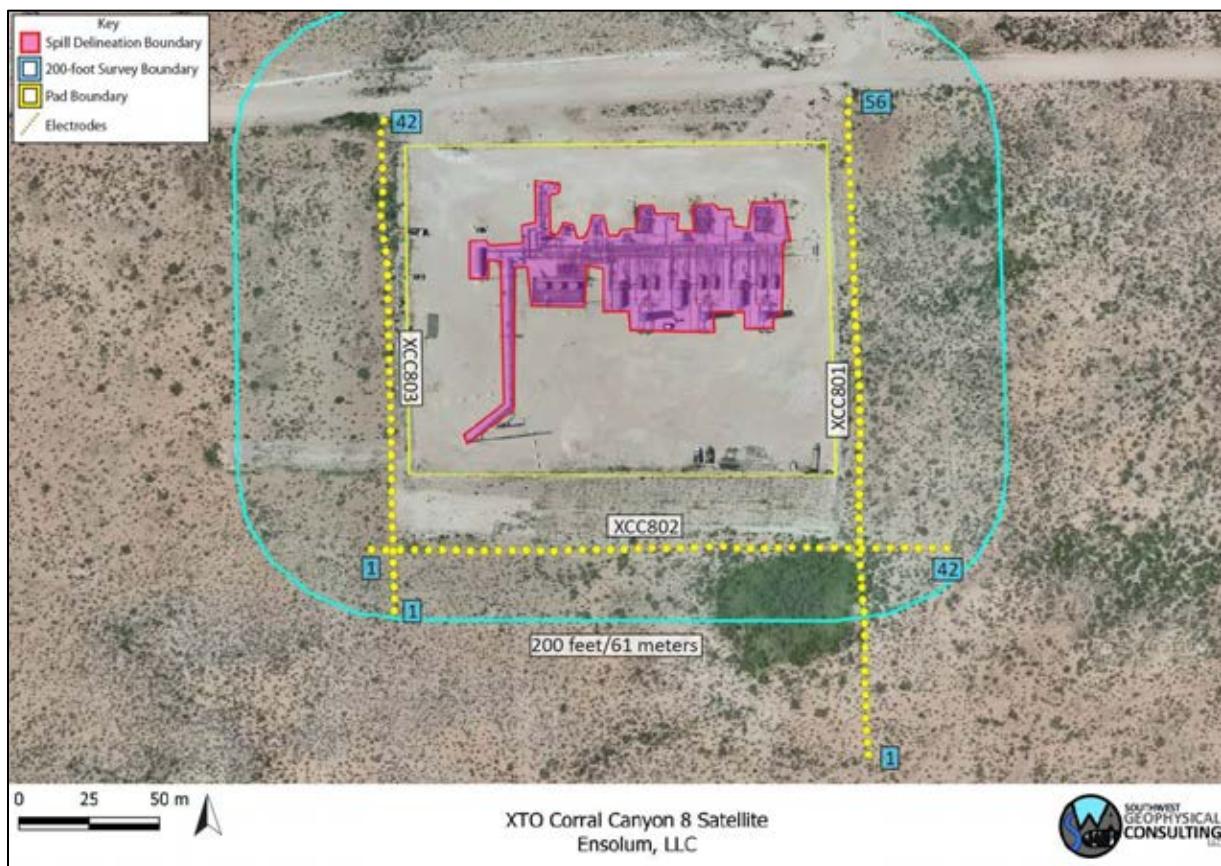


Figure 5: Geophysical survey overview. XCC801 was conducted with 56 electrodes at 5-meter spacing, and both XCC802 and XCC803 were conducted with 42 electrodes at 5-meter spacing (yellow dots denoted with blue numbers). Background image credit: Google Earth. Image date: January 27, 2023. Image datum: WGS-84.

Table 1 provides basic line data. Detailed information for each line including electrode number, location in latitude/longitude (decimal degree format), and elevation in meters can be found in the accompanying data files.

Table 1: Survey Line Data Table. The XCC8_ERI_Points.kmz file contains all the points for the survey line listed in the file name. These data are available in the accompanying files XCC8_ERI_Points.xlsx and ENS-018-20250609_XCC8_Data_Files.kmz.

File Name:	Completed By:	Date:
XCC801.kmz	Steven Kesler – Field Geologist	
XCC802.kmz	Kat Knight – Field Geologist	7/16/2025
XCC803.kmz	Michael Jones – Field Geologist	

EarthImager™ 2D software was used to download and process the data and to provide the model used to make our interpretations. The design of the survey and the orientation of each of the lines provides the information necessary to make the determination of “stable” or “unstable” ground at this site.

A typical starting model was used for the data processing due to the two-layer model of the geology in the area; specifically, generally high-resistivity gypsum and dolomite at the surface and low-resistivity saturated gypsum and dolomite bedrock at depth. The starting model used was “average apparent resistivity” and a default inversion setting of “surface,” with a minimum apparent resistivity set to 0.1 Ohm-meters (Ohm-m or Ω -m) and a max apparent resistivity set to 100,000 Ω -m (**Table 2**).

Table 2: Software Information and Settings

Software Name:	EarthImager™ 2D
Version:	2.4.4.649
Starting Model:	Average Apparent Resistivity
Default Inversion Settings:	Surface
Changes to Default Inversion Settings:	Max Apparent Resistivity = 100 k Ω -m Min Apparent Resistivity = 0.1 Ω -m

Note: Raw data files (.stg files for EarthImager™ 2D) and processed data (.trn files, terrain files for surface correction in EarthImager™ 2D and .out files, the processed .stg files) are available upon request.

All field work, including setup, stow, and travel, was completed by Steven Kesler, Kat Knight, and Michael Jones on July 16, 2025.

3.0 RESULTS

3.1 Surface Karst Survey

The desk study and surface karst survey located no surface karst features within the 200-foot (61-meter)^[1] survey boundary (Figure 6).

No surface karst features exist within the **200-meter** survey boundary, and no springs exist within the 305-meter (1,000 foot) survey boundary^[1].

The lack of surface karst features does not mean the area is not karstified and the survey area may still contain buried karst features. Caution should be exercised while clearing brush and during any excavation, trenching, or construction operations. Employing a Bureau of Land Management approved karst monitor on site during these operations should be considered.

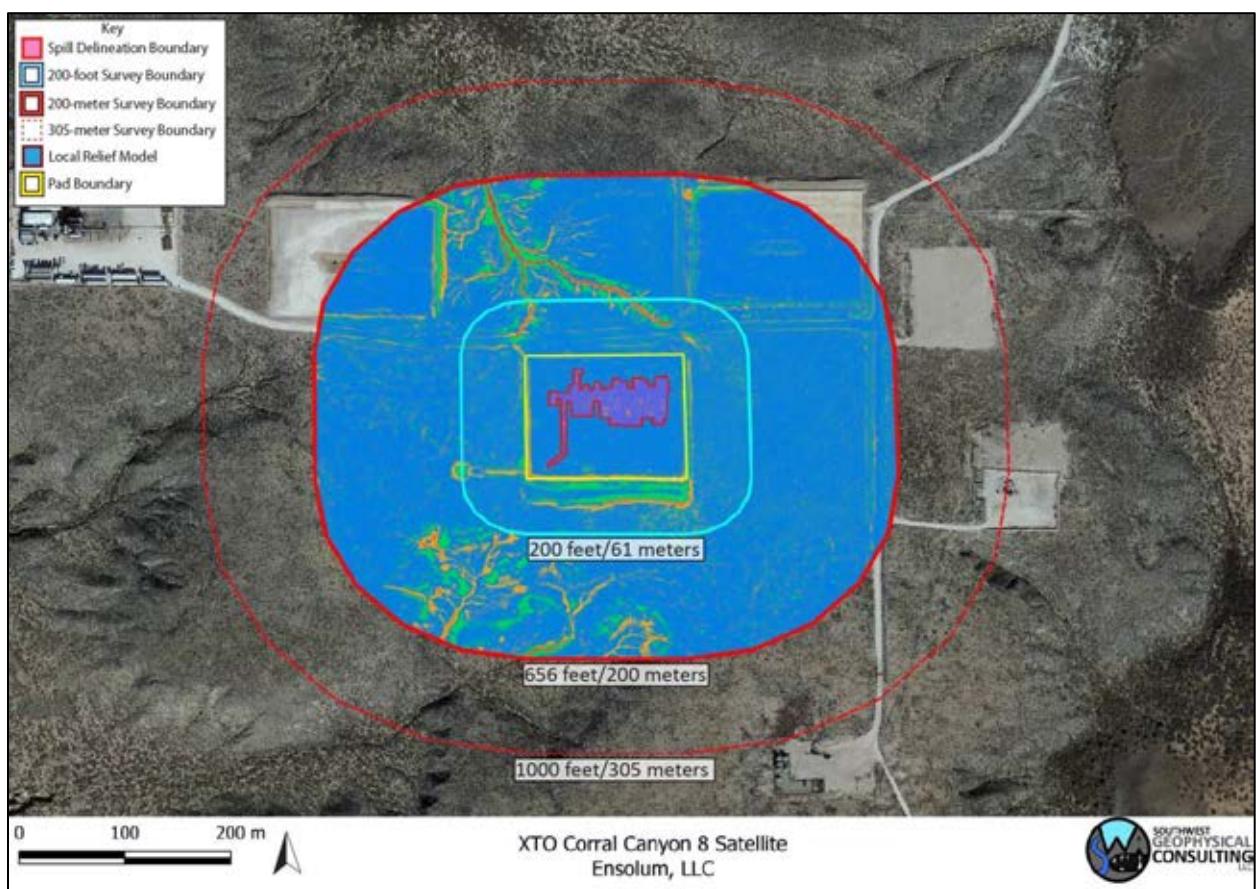


Figure 6: UAS-conducted surface karst survey results. Background image credit: Google Earth. Image date: March 20, 2023. Image datum: WGS-84.

3.2 Geophysical Survey

Electrical resistivity tomography forms images of the subsurface by causing a current to flow through the rock and soil and then measuring the resistance of these materials as the current flows through them. This measurement is taken many times and the resulting data, once processed, is used to produce a model of the subsurface (**Figure 7**). This model is produced using "non-unique" solutions, which means that there are many models and interpretations which will satisfy the data. Using experience and knowledge of the local geology, a high-confidence model can be established and used to develop an accurate understanding of what lies below the surface. This survey was conducted with the express purpose of locating subsurface voids and does not purport to find paleokarst (old, non-active karst features that have been filled in with sand and sediment) or nascent karst features below the resolution limit of the survey.

The results of this study indicate a moderately stable geologic system with resistivities between 0.33 and 5,447 Ohm-m with occasional resistivities to 100,000 Ohm-m (**Figure 7**). These high-resistivity anomalies are interpreted to be noise associated with nearby infrastructure. **No anomalies interpreted as underground voids were found in the XCC8 survey area.** Please keep in mind when viewing the 2D inverted resistivity sections that color maps can be widely different for each view. Always check the color map located on the right side of the image when viewing the 2D images to ensure you understand the range of resistivities presented. Distances along the top and depths along the left side are in meters. The color map along the right side is in Ohm-m. Due to the nature of the survey, shallower zones have higher resolution between electrodes than deeper zones; therefore, small features at depth will not be visible.

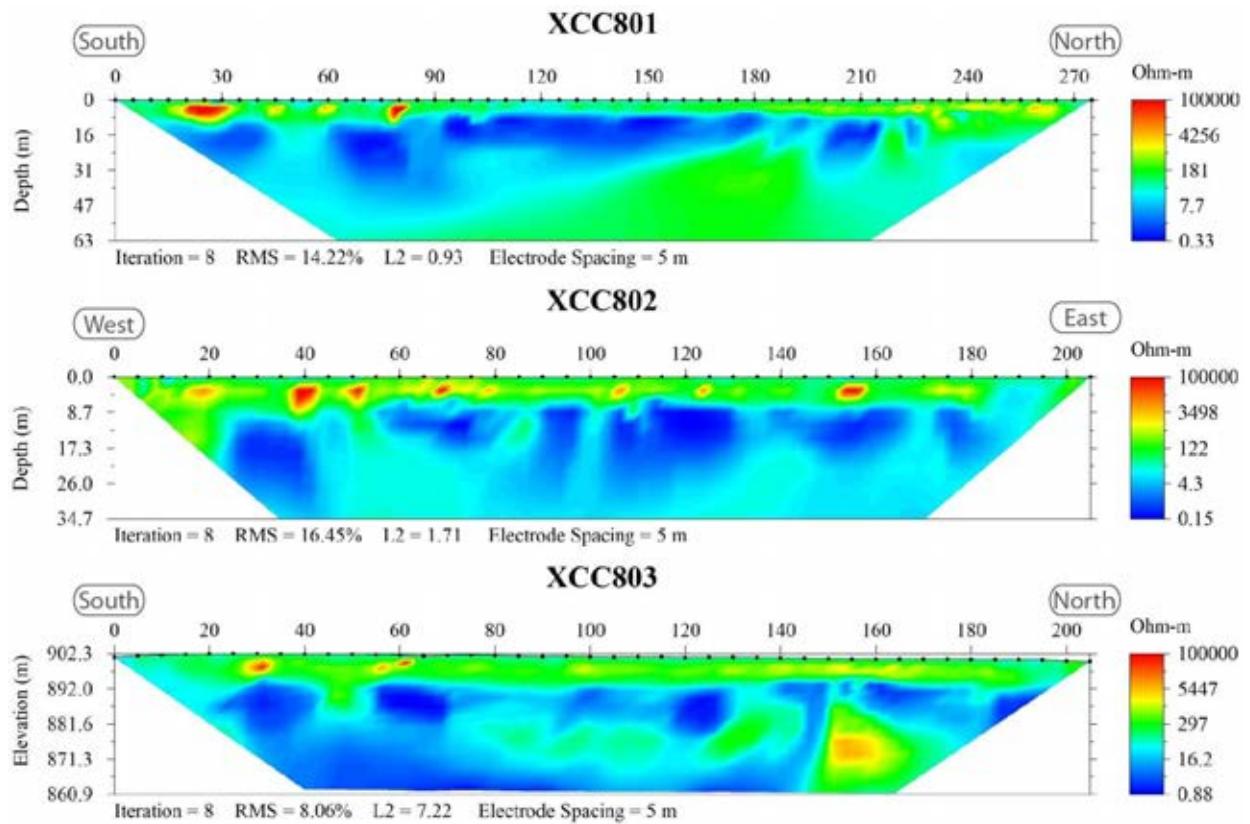


Figure 7: 2D inverted resistivity sections. Reds and oranges indicate higher resistivity values. Yellows and greens are medium-resistivity values. Blues are low-resistivity values. Please note that the color scale is relative.

4.0 DISCUSSION

No anomalies interpreted as large near-surface voids are located within the study area. However, due to the resolution limit of the survey, other small voids at or near the resolution limit (2.5 – 3.0 meters) cannot be ruled out. The extremely high-resistivity areas (100,000 Oh-m) on these lines are interpreted as noise associated with nearby infrastructure. Other moderately high resistivity areas located less than 10 meters beneath the surface are interpreted as dry caliche or gypssite soils; due to their low resistivity values when compared with significant subsurface voids, these features should not be a concern for construction of any well pad infrastructure. Areas of moderate resistivity (yellows and greens) near the surface are interpreted as dry caliche soils and gypsum or dolomite bedrock of the Rustler Formation (**Figure 7** and **Figure 8**).

Resistivity of the survey area drops below 50 $\Omega\text{-m}$ at approximately 12 - 15 meters (39.4 – 49.2 feet) depth and generally increases to greater than 500 $\Omega\text{-m}$ below these depths throughout the survey area, indicating a change from moist to saturated caliche/gypssite soils or gypsums to the bedrock of the Rustler Formation (**Figure 7** and **Figure 8**).

Please remember that these are interpretations made from knowledge of the local subsurface materials and experience. **They remain interpretations until verified by geotechnical methods.**

Within karst terrains like the project site, small air- or sediment-filled voids and/or brecciated zones and solutionally enlarged fractures that are below the resolution limit of the survey may exist; these may be encountered during excavation and if so, should be evaluated by a karst specialist prior to continuation of the excavation. Employing a BLM-CFO approved karst monitor on site during excavation in this area should be considered.

Fracture sets within the subsurface can act as hydrologic pathways to the water table. Rapid dissolution of gypsum can occur along these pathways creating solution-enlarged fractures, and in some cases, voids within months to years. For this reason, this survey is valid only for this remediation event.



Figure 8: Data overlay. Colored trapezoids are 2D inverted resistivity lines. Background image credit: Google Earth. Image date: January 27, 2023.

5.0 SUMMARY

- The XCC8 survey contains no surface karst features within 200 feet (61 meters) of the spill delineation boundary.
- The XCC8 survey contains no subsurface anomalies which are interpreted as karst-related features within 200-feet (61 meters) of the spill delineation boundary.
- Flat-lying stratigraphy is interpreted to exist beneath the area where the geophysical survey was conducted, indicating stable ground.
- Employing a BLM-CFO approved karst monitor during excavation at this site should be considered.

6.0 DISCLOSURE STATEMENT

Karst occurrence zones are prone to rapid karst formation and warrant careful planning and engineering to mitigate karst-forming processes that could be accelerated by removal of surface cover or the vibrations associated with heavy equipment used in the remediation process.

Mitigation measures for any karst features revealed during excavation shall be approved by the Bureau of Land Management – Carlsbad Field Office and follow the Natural Resources Conservation Service Conservation Practice Standard for Karst Sinkhole Treatment, Code 527, or the Bureau of Land Management Cave and Karst Management Handbook, H-8380-1.

Vigilance during remediation activities is paramount. If voids are encountered during excavation, contact the Bureau of Land Management Karst Division at (575) 234-5972, the New Mexico State Land Office Surface Resources Division at (505) 827-5768, or a BLM-CFO approved karst contractor and request an on-site investigation from a karst expert if one is not already on site. A karst consultant can generally be available in Eddy County within five hours.

Approved karst monitors should have karst feature identification training, at least two years of supervised experience identifying karst features, wilderness first aid training, SRT training, confined space training, gas monitor training, and a minimum of SPAR cave rescue training through NCRC. They should have with them the proper gear and be prepared both physically and mentally to enter a collapse feature within minutes to perform a rescue if needed. Monitoring services with qualified karst monitors, as well as cave surveys and geophysical surveys, are available from Southwest Geophysical Consulting.

Under no circumstances should an untrained, inexperienced person enter a cave, pit, sinkhole, or collapse feature. All field employees of Southwest Geophysical Consulting have extensive caving experience and the ability to determine whether entry into a karst feature is safe or presents a hazard. In the event it is necessary to enter a karst feature, Southwest Geophysical Consulting can provide these services on request.

Cave and karst resource inventory reports, karst feature investigations, and geophysical reports commissioned at the request of the land manager should be submitted to the BLM-CFO at blm_nm_karst@blm.gov.

Cave and karst resource inventory reports for the NMSLO should be submitted to the respective project manager.

Environmental karst reports should be submitted to the appropriate project manager at the New Mexico Oil Conservation Division.

7.0 REFERENCES

- 1 Division, O. C. *Title 19, Chapter 15, Part 29* (Oil Conservation Division, 2018).
- 2 NMSLO. (ed Oil Conservation Division) (New Mexico State Land Office, Santa Fe, NM, 2018).
- 3 Decker, D. & Jorgensen, G. L. *Environmental Karst Surveys White Paper* (Southwest Geophysical Consulting, LLC, 2024).
- 4 Goodbar, J. R. Vol. BLM Management Handbook H-8380-1 (ed Carlsbad Field Office) 59 (Bureau of Land Management, Denver, CO, 2015).
- 5 Decker, D., Trautner, E. & Palmer, R. (Bureau of Land Management - Carlsbad Field Office, 2025).
- 6 Earthpoint. *Earthpoint Tools for Google Earth*, <<https://www.earthpoint.us/Townships.aspx>> (2022).
- 7 Decker, D. D., Land, L. & Luke, B. Characterization of Playa Lakes in the Gypsum Karst of Southeastern New Mexico and West Texas, USA. *Oklahoma Geological Survey Circular 113* **113** (2021).
- 8 W.R.C.C. *National Climate Data Center 1981-2010 Normal Climate Summary for Carlsbad, New Mexico* (291469), 2010.
- 9 Whitehead, W. & Flynn, C. *Plant Utilization in Southeastern New Mexico: Botany, Ethnobotany, and Archaeology*. (Bureau of Land Management, Carlsbad Field Office, 2017).
- 10 NMSLO. Digital overlay (KML) of the surface land ownership in New Mexico (New Mexico State Land Office, Santa Fe, NM, 2024).
- 11 Green, G. N. & Jones, G. E. *The Digital Geologic Map of New Mexico in ARC/INFO Format*, <<https://mrdata.usgs.gov/geology/state/state.php?state=NM>> (1997).
- 12 Austin, G. S. *Geology and mineral deposits of Ochoan rocks in Delaware Basin and adjacent areas*. Vol. Circular 159 (New Mexico Bureau of Mines and Mineral Resources, 1978).
- 13 Johnson, K. S. Evaporite Karst in the United States. *Carbonates and Evaporites* **12**, 2-14 (1997).
- 14 Scholle, P. A. Geologic Map of New Mexico. (2003).
- 15 Decker, D. D., Jorgensen, G. L. & Palmer, R. in *Southwest Geophysical Cave and Karst Database* (ed LLC Southwest Geophysical Consulting) (Albuquerque, NM, 2025).
- 16 Whitehead, W., Bandy, M. & Decker, D. Protocol for Using UAV Photography for Rapid Assessment of Karst Features in Southeast New Mexico. *Proceedings of the 2022 Cave and Karst Management Symposium* (2022).

8.0 GLOSSARY OF TERMS

AGI	Advanced Geosciences Inc.
BLM-CFO	Bureau of Land Management - Carlsbad Field Office
brecciated	Fractured rock caused by faulting or collapse.
caprock-collapse sinkhole	Collapse of roof-spanning rock into a cave or void.
cave	Natural opening at the surface large enough for a person to enter.
cover-collapse sinkhole	Collapse of roof-spanning soil or clay ground cover into a subsurface void.
ERI	Electrical Resistivity Imaging
GPS	Global Positioning System
grike	A solutionally enlarged, vertical, or sub-vertical joint or fracture.
(H)	High confidence modifier for a PKF. This is typically reserved for a feature that is definitely karst but has not been confirmed in the field.
HKOZ	High Karst Occurrence Zone
karst	A landscape containing solutional features such as caves, sinkholes, swallets, and springs.
(L)	Low confidence modifier for a PKF. This is typically a feature that cannot be ruled out as karst but is most likely NOT karst related. This modifier may also be used for pseudokarst features.
(M)	Medium confidence modifier for PKF. This is an ambiguous feature that can't be positively identified as karst without a field visit (e.g., burrows, abandoned unlined wells, solution tubes, pseudokarst).
MKOZ	Medium Karst Occurrence Zone
NCRC	National Cave Rescue Commission
NKF	Non-karst feature. Used for features originally identified as PKF that have been subsequently identified in the field as non-karst related. This term may also be used for pseudokarst features.
NMSLO	New Mexico State Land Office
Ohm-m	Ohm-meter, a unit of measurement for resistivity. Sometimes abbreviated $\Omega\text{-m}$.
paleokarst	Previously formed karst features that have been filled in by erosion and/or deposition of minerals.
Pat	Permian Artesia Group
Pc	Permian Capitan Formation
Pcs	Permian Castile Formation

Pdl	Permian Dewey Lake Formation
PKF	Possible karst feature. This term is reserved for features identified in satellite or aerial imagery that have NOT been visited in the field. Further modifiers include (H) for high confidence, (M) for medium confidence, and (L) for low confidence. These confidence levels are based on field experience.
PLSS	Public Land Survey System
Pqg	Permian Queen/Greyburg Formation
Pru	Permian Rustler Formation
pseudokarst	Karst-like features (sinkholes, conduits, voids etc.) that are not formed by dissolution. These types of features include soil piping, lava tubes, and some cover-collapse and suffosion sinkholes.
Psl	Permian Salado Formation
Psr	Permian Seven Rivers Formation
Pt	Permian Tansill Formation
Py	Permian Yates Formation
Qal	Quaternary alluvium
Qe	Quaternary eolian deposits
Qp	Quaternary piedmont deposits
Qpl	Quaternary playa lake deposits
RKF	Recognized karst feature. This term is reserved for karst features that have been physically verified in the field.
SPAR	Small Party Assisted Rescue
SUAS	Small, uncrewed aerial system
suffosion sinkhole	Raveling of soil into a pre-existing void or fracture.
swallet	A natural opening in the surface, too small for a person, that drains water to an aquifer. Some are "open," meaning a void can be seen below; some are "closed," meaning they are full of sediment.
SWG	Southwest Geophysical Consulting, LLC
UTM	Universal Transverse Mercator (projected coordinates)
(V)	Field verified modifier for a RKF. This indicates that the feature has been visited by a qualified karst professional in the field and fully identified
WGS	World Geodetic System (geographic coordinates)

9.0 ATTESTATION

David D. Decker, PhD, PG, CPG

Chief Executive Officer, Principal Geologist
Southwest Geophysical Consulting, LLC
5117 Fairfax Dr. NW
Albuquerque, NM 87114
dave@swgeophys.com
(505) 585-2550

CERTIFICATE OF AUTHOR

I, David D. Decker, a Licensed Professional Geologist and a Certified Professional Geologist, do certify that:

- I am currently employed as a consulting geologist in the specialty of caves and karst with an office address of 5117 Fairfax Dr. NW, Albuquerque, NM, USA, 87114.
- I graduated with a Master of Science in Applied Physics with a specialization in Sensor Systems from the Naval Post Graduate School in Monterey, California, in 2003, and a Doctor of Philosophy in Earth and Planetary Sciences from the University of New Mexico, Albuquerque, New Mexico, in 2018.
- I am a Licensed Professional Geologist in the State of Texas, USA (PG-15242) and have been since 2021. I am a Certified Professional Geologist through the American Institute of Professional Geologists (CPG-12123) and have been since 2021.
- I have been employed as a geologist continuously since 2016. I was previously employed as a Fire Controlman, Naval Flight Officer, and Aerospace Engineering Duty Officer in the U.S. Navy and operated, maintained, and installed various sensor systems including magnetic, electromagnetic, radar, communications, and acoustic systems in various capacities from 1986 through 2010.
- I have been involved in various aspects of cave and karst studies continuously since 1985, including exploration, mapping, and scientific studies.
- I have read the definition of “qualified karst professional” set out in the ASTM Standard Practice for Preliminary Karst Terrain Assessment for Site Development (ASTM E-1527). I meet the definition of “qualified professional” for the purposes of this standard.
- I am responsible for the content, compilation, and editing of all sections of report number ENS-018-20250609 entitled, “Environmental Karst Study Report, XTO Corral Canyon 8 Satellite, Eddy County, New Mexico.” I or a duly authorized and qualified representative of Southwest Geophysical Consulting, LLC, have personally visited this site and/or reviewed the aerial imagery on the date or dates mentioned in section **2.3 Description of Survey**.

- I have no prior involvement nor monetary interest in the described property or project, save for my fee for conducting this investigation and providing the report.

Dated in Albuquerque, New Mexico, August 16, 2025.



David D. Decker
PhD, CPG-12123





APPENDIX C

NMOCD Correspondence

From: [Wells, Shelly, EMNRD](#)
To: [Mcafee, Ashley A](#)
Cc: [Dirkx, Kaylan](#); [Brown, Colton S](#); [Woodall, Robert D](#); [Tracy Hillard](#); [Tacoma Morrissey](#); [Ben Belill](#); [Bratcher, Michael, EMNRD](#); [Rodgers, Scott, EMNRD](#); [Hamlet, Robert, EMNRD](#)
Subject: RE: [EXTERNAL] XTO - Variance Request - Corral Canyon 8 Satellite - Incident Numbers nAPP2514157393 & nAPP2518148302
Date: Monday, July 7, 2025 5:12:36 PM

[**EXTERNAL EMAIL**]

Good afternoon Ashley,

The request is approved to conduct the liner inspection on 7/8/25 and use the photographs for closure, should the liner be deemed to be operating as intended. Please include a copy of this and all notifications in the remedial and/or closure reports to ensure the notifications are documented in the project file.

Kind regards,

Shelly

Shelly Wells * Environmental Specialist-Advanced
Environmental Bureau
EMNRD-Oil Conservation Division
1220 S. St. Francis Drive|Santa Fe, NM 87505
(505)469-7520 Shelly.Wells@emnrd.nm.gov
<http://www.emnrd.state.nm.us/OCD/>

From: Mcafee, Ashley A <ashley.a.mcafee@exxonmobil.com>
Sent: Monday, July 7, 2025 3:21 PM
To: Enviro, OCD, EMNRD <OCD.Enviro@emnrd.nm.gov>
Cc: Dirkx, Kaylan <kaylan.dirkx@exxonmobil.com>; Brown, Colton S <colton.s.brown@exxonmobil.com>; Woodall, Robert D <robert.d.woodall@exxonmobil.com>; Tracy Hillard <thillard@ensolum.com>; Tacoma Morrissey <tmorrissey@ensolum.com>; Ben Belill <bbelill@ensolum.com>
Subject: [EXTERNAL] XTO - Variance Request - Corral Canyon 8 Satellite - Incident Numbers nAPP2514157393 & nAPP2518148302

CAUTION: This email originated outside of our organization. Exercise caution prior to clicking on links or opening attachments.

Hello,

XTO is requesting a variance of the 48-hr liner inspection notification (C-141L) requirement for a spill

at Corral Canyon 8 Satellite (Incident Numbers nAPP2514157393 & nAPP2518148302). Due to frequent weather delays and simultaneous operations (SIMOPS) in the area of the subject lined containment, successful liner inspection activities have not been completed. Access to the liner without SIMOPS is obtainable tomorrow in order to submit a closure request report required in 19.15.29.12.B.(1) NMAC with an adequate lined containment inspection. XTO requests the lined containment inspection photographs collected may be used for closure, providing that they meet applicable standards. XTO requests to complete the lined containment inspection tomorrow, July 8, 2025. Following approval of the variance, a C-141L will be submitted via the portal and the correspondence will be included in the final report.

Thank you,

Ashley McAfee
Wastewater Advisor

ExxonMobil Upstream Company

3104 E. Greene St.
Carlsbad, NM 88220
Cell Phone: 575-988-0812

Ashley.A.McAfee@exxonmobil.com




APPENDIX D

Photographic Log





Photographic Log
 XTO Energy, Inc
 Corral Canyon 8 Sat
 Incident Number: nAPP2514157393

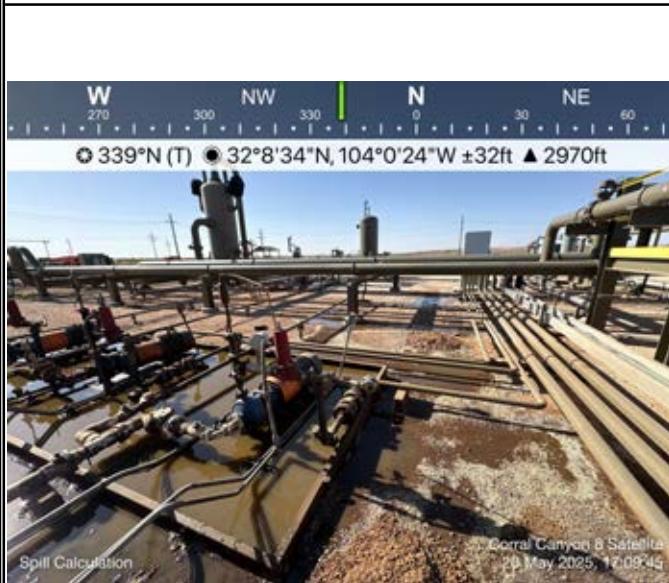

Photograph: 1 Date: 5/20/2025
 Description: Initial release near containment, BH01
 View: Northwest

Photograph: 2 Date: 5/20/2025
 Description: Initial release near SS04
 View: West

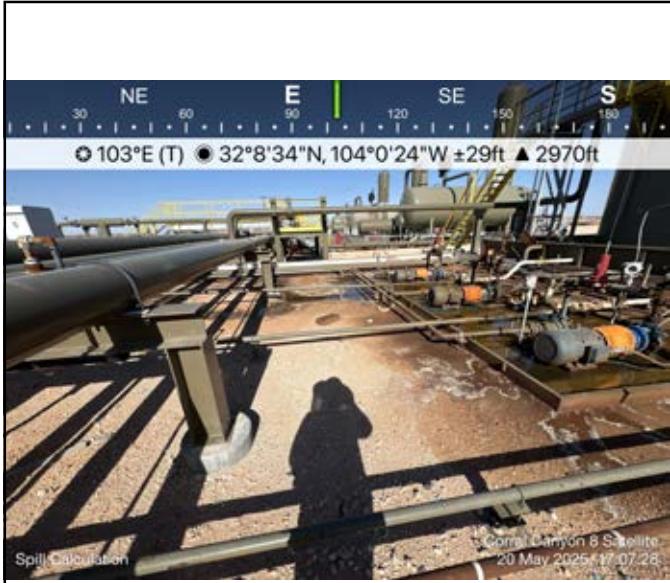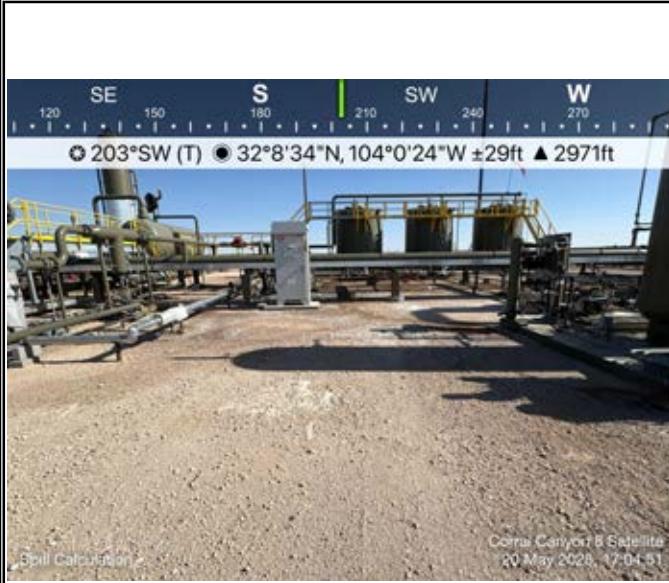

Photograph: 3 Date: 5/20/2025
 Description: Initial release near SS02
 View: South


Photograph: 4 Date: 5/20/2025
 Description: Initial release near lined containment
 View: East




Photographic Log
XTO Energy, Inc
Corral Canyon 8 Sat
Incident Number: nAPP2514157393



Photograph: 5 Date: 6/4/2025
 Description: Delineation near PH02
 View: Northeast

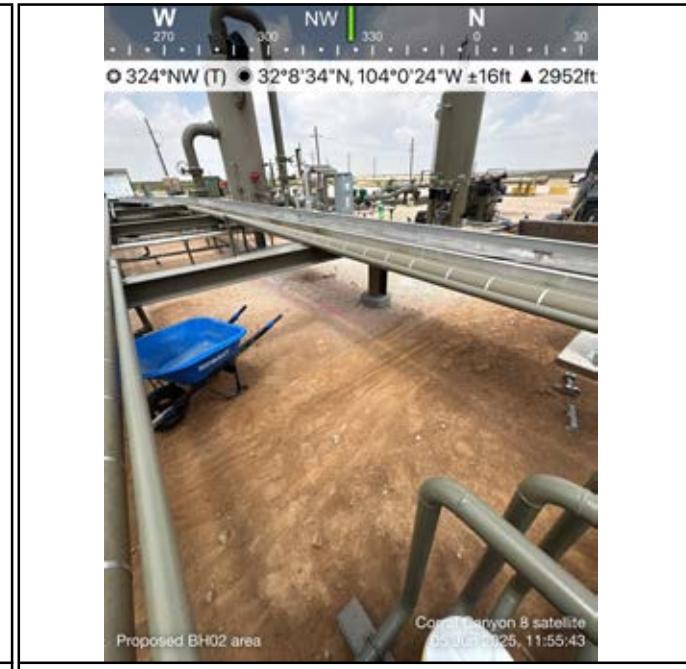

Photograph: 6 Date: 6/5/2025
 Description: Hand scraping activities near BH01
 View: Northwest

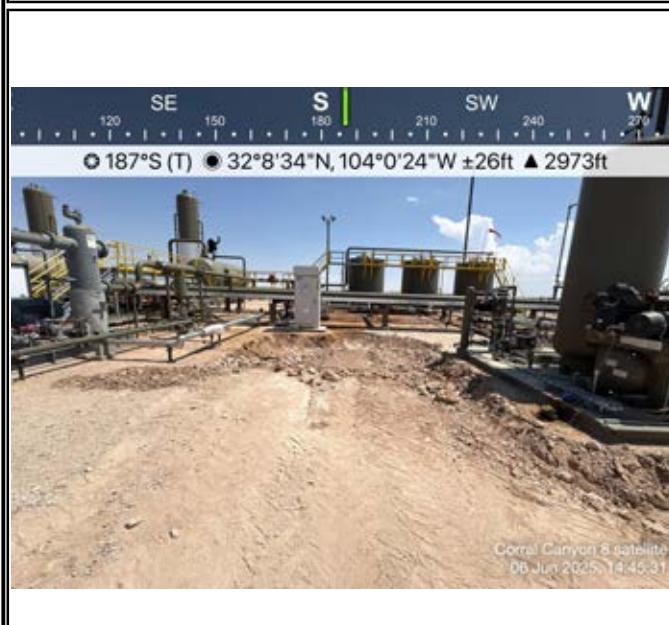

Photograph: 7 Date: 6/6/2025
 Description: Excavation activities; near FS03, SW02
 View: South



**Photographic Log**

XTO Energy, Inc
Corral Canyon 8 Sat
Incident Number: nAPP2514157393

• 187°S (T) • 32.143168, -104.007464 ±3m ▲ 404m



Photograph: 9
Description: Facility sign
View: South

Date: 7/8/2025

• 204°S (T) • 32.142755, -104.006833 ±3m ▲ 404m



Photograph: 10
Description: Liner competency inspection
View: Southeast

Date: 7/8/2025



Photograph: 11
Description: Liner competency inspection
View: South

Date: 7/8/2025



Photograph: 12
Description: Liner competency inspection
View: Northwest



Photographic Log

XTO Energy, Inc
Corral Canyon 8 Sat
Incident Number: nAPP2514157393



Photograph: 13 Date: 8/12/2025
Description: Additional excavation near FS02
View: Northeast



Photograph: 14 Date: 8/12/2025
Description: Additional excavation near FS02, SW03
View: Northwest



Photograph: 15 Date: 8/12/2025
Description: Excavation activities; near FS02
View: Southeast





Photograph: 16 Date: 8/12/2025
Description: Excavation activities near FS02, SW03
View: Southwest




APPENDIX E

Lithologic Soil Sampling Logs

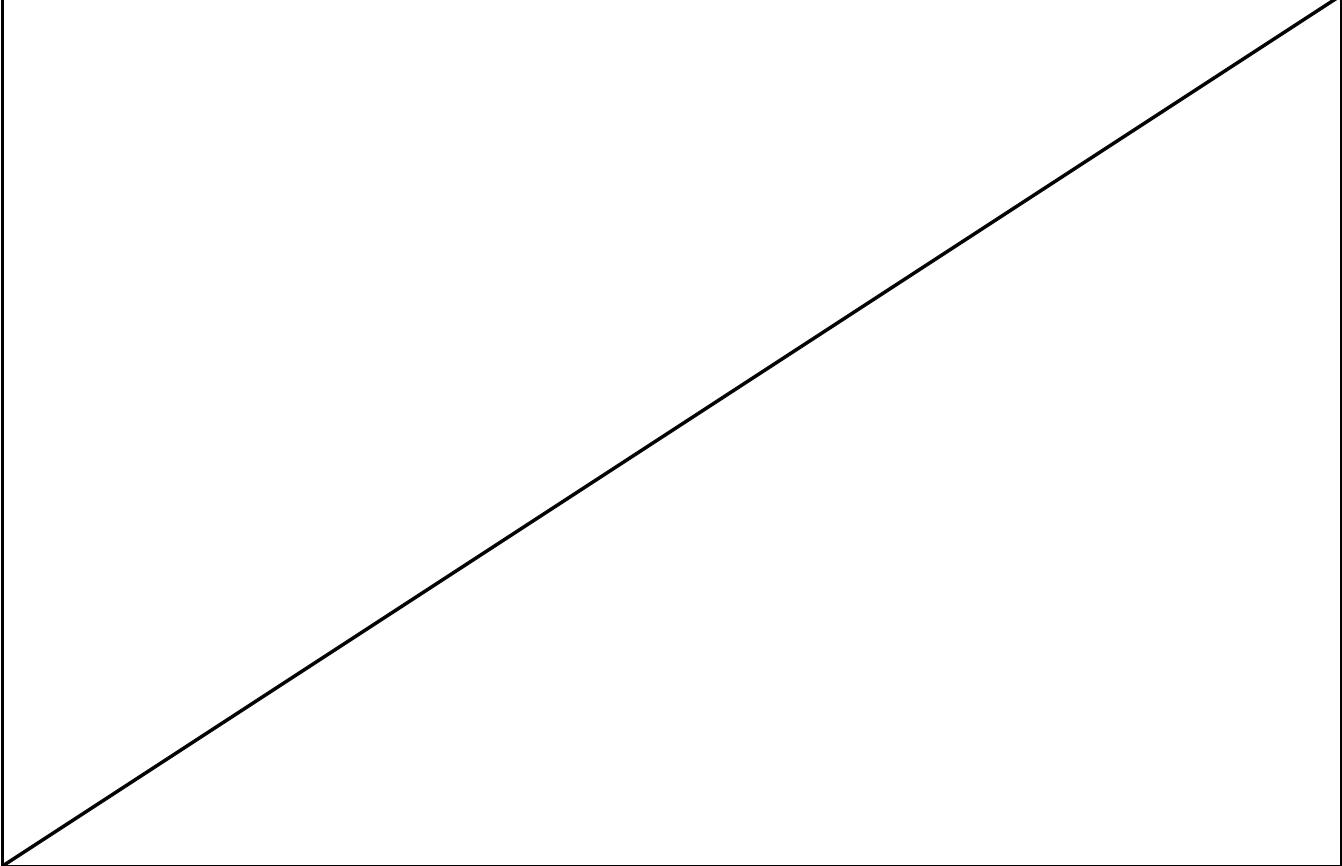 ENSOLUM								BH01	Date: 6/26/2025
								Site Name: Corral Canyon 8 Sat	
								Incident Number: nAPP2514157393	
								Job Number: 03C1558679	
LITHOLOGIC / SOIL SAMPLING LOG								Logged By: U. Santillana	Method: Core Drill
Coordinates: 32.142883, -104.006843								Hole Diameter: 3 inch	Total Depth: 2 ft
Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water. No correction factors included.									
Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (ft bgs)	Depth (ft bgs)	USCS/Rock Symbol	Lithologic Descriptions	
D	4088	92	Y	BH01A	0.25	0	CCHE	Fine-medium grained sand, brown, some silt, non-cohesive. No odor.	
D	258	3.8	N	BH01B	0.5	1	SW	Sand, tan, coarse-fine grain, non-cohesive, few silt. Has odor.	
D	174	11.5	N	BH01C	1	2	SP	Sand, brown, w/ trace silt, med-fine grain, noncohesive. No odor.	
Total Depth @ 2 Feet									
									

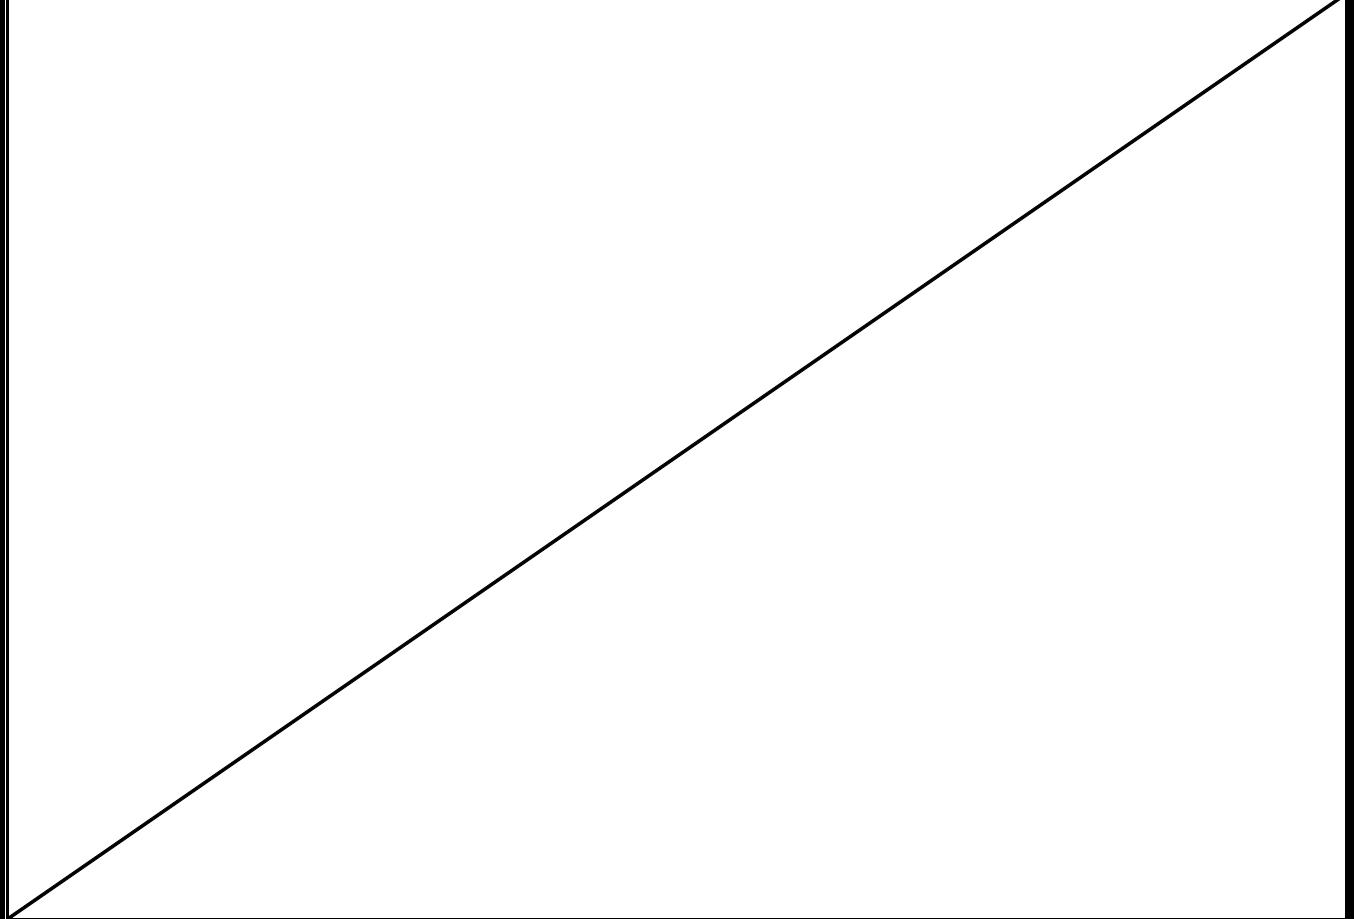 ENSOLUM								Sample Name: PH01	Date: 6/4/2025
								Site Name: Corral Canyon 8 Sat	
								Incident Number: nAPP2514157393	
								Job Number: 03C1558679	
LITHOLOGIC / SOIL SAMPLING LOG								Logged By: U. Santillana	Method: Backhoe
Coordinates: 32.1429371, -104.0068720								Hole Diameter: 3 feet	Total Depth: 1.0 ft
Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water. No correction factors included.									
Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (ft bgs)	Depth (ft bgs)	USCS/Rock Symbol	Lithologic Descriptions	
D	739.2	0.7	Y	PH01	0.5	0	CCHE	Fine-medium grained sand, brown, some silt, non-cohesive. No odor.	
D	<174	0.3	N	01A	1	1	SW	Sand, tan, coarse-fine grain, non-cohesive, few silt. Has odor.	
D	< 174	0.3	N	01B	1.5		SP	Sand, brown, w/ trace silt, med-fine grain, noncohesive. No odor.	
								Total Depth @ 1.5'	
									

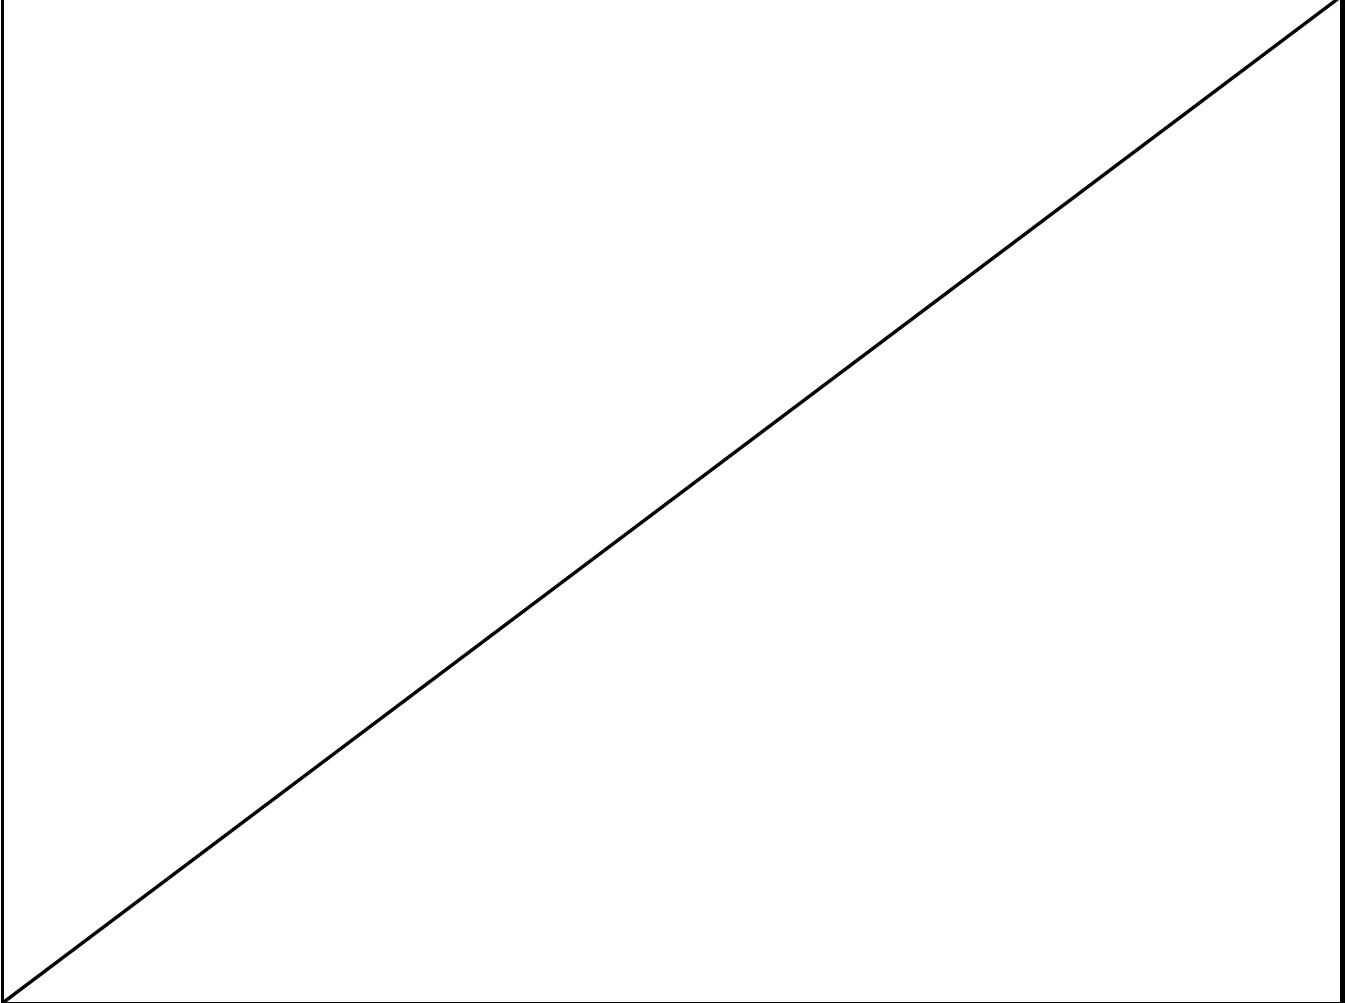 ENSOLUM								Sample Name: PH02	Date: 6/4/2025
								Site Name: Corral Canyon 8 Sat	
								Incident Number: nAPP2514157393	
								Job Number: 03C1558679	
LITHOLOGIC / SOIL SAMPLING LOG								Logged By: U. Santillana	Method: Backhoe
Coordinates: 32.1428974, -104.0066863								Hole Diameter: 3 feet	Total Depth: 1.0 ft
Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water. No correction factors included.									
Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (ft bgs)	Depth (ft bgs)	USCS/Rock Symbol	Lithologic Descriptions	
D	476	230	Y	PH01	0.5	0	CCHE	Fine-medium grained sand, brown, some silt, non-cohesive. No odor.	
D	207.2	27.5	N	01A	1	1	SW	Sand, tan, coarse-fine grain, non-cohesive, few silt. Has odor.	
Total Depth @ 1'									
									

 ENSOLUM								Sample Name: PH03	Date: 6/4/2025
								Site Name: Corral Canyon 8 Sat	
								Incident Number: nAPP2514157393	
								Job Number: 03C1558679	
LITHOLOGIC / SOIL SAMPLING LOG								Logged By: U. Santillana	Method: Backhoe
Coordinates: 32.1428798, -104.0068050								Hole Diameter: 3 feet	Total Depth: 1.0 ft
Comments: Field screening conducted with HACH Chloride Test Strips and PID for chloride and vapor, respectively. Chloride test performed with 1:4 dilution factor of soil to distilled water. No correction factors included.									
Moisture Content	Chloride (ppm)	Vapor (ppm)	Staining	Sample ID	Sample Depth (ft bgs)	Depth (ft bgs)	USCS/Rock Symbol	Lithologic Descriptions	
D	2817	0.5	Y	PH01	0.5	0	CCHE	Fine-medium grained sand, brown, some silt, non-cohesive. No odor.	
D	1238	1.1	N	01A	1	1	SW	Sand, tan, coarse-fine grain, non-cohesive, few silt. Has odor.	
D	1204	0	N	01B	1.5		SP	Sand, brown, w/ trace silt, med-fine grain, noncohesive. No odor.	
Total Depth @ 1.5'									



APPENDIX F

Laboratory Analytical Reports & Chain of Custody Documentation



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 06, 2025

JEREMY REICH
ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND, TX 79705

RE: CORRAL CANYON 8 SATELLITE

Enclosed are the results of analyses for samples received by the laboratory on 06/05/25 13:20.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene
Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 01 0.5' (H253357-01)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 103 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	336	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	<10.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 64.7 % 44.4-145

Surrogate: 1-Chlorooctadecane 60.3 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 02 0.5' (H253357-02)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	128	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	<10.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 70.8 % 44.4-145

Surrogate: 1-Chlorooctadecane 65.4 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 03 0.5' (H253357-03)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 102 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	256	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	<10.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 69.6 % 44.4-145

Surrogate: 1-Chlorooctadecane 63.5 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 04 0.5' (H253357-04)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 105 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	400	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	<10.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 78.5 % 44.4-145

Surrogate: 1-Chlorooctadecane 73.0 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 05 0.5' (H253357-05)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	128	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	<10.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 74.4 % 44.4-145

Surrogate: 1-Chlorooctadecane 68.8 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 06 0.5' (H253357-06)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	<10.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 78.1 % 44.4-145

Surrogate: 1-Chlorooctadecane 71.6 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 07 0.5' (H253357-07)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 103 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	<10.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 81.0 % 44.4-145

Surrogate: 1-Chlorooctadecane 74.0 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: SS 08 0.5' (H253357-08)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	96.0	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	24.9	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 85.2 % 44.4-145

Surrogate: 1-Chlorooctadecane 80.1 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C
	Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240

ANALYSIS REQUEST																
BILL TO																
Company Name: Ensolum, LLC		P.O. #:														
Project Manager: Jeremy Reich																
Address: 601 N Marienfeld Street, Suite 400																
City: Midland		State: TX		Zip: 79701												
Phone #: 432-296-0627		Fax #:														
Project #: 03C1558679		Project Owner: XTO Energy														
Project Name: Corral Canyon 8 Satellite		- SPILLS														
Project Location: 32.142883, -104.006843																
Sampler Name: Uriel Santillana																
FOR LAB USE ONLY																
Lab I.D.	Sample I.D.	Depth (feet)	(G)RAB OR (C)OMP.		# CONTAINERS	MATRIX	PRESERV/	SAMPLING								
			GROUNDWATER	WASTEWATER				SOIL	OIL	SLUDGE	OTHER:	ACID/BASE:	ICE / COOL	OTHER:		
HS53357	5501	0.5'	G	X	1			X	X	X	6/4/25	1404	X	X	X	TPH 8015
	5502			X							1510					BTEX 8021
	5503			X							1407					Chloride 4500
	5504			X							1539					
	5505			X							1412					
	5506			X							1415					
	5507			X							1418					
	5508			X							1420					
PLEASE NOTE: Liability and Damages: Client/Arch's liability and clients' entitlements will only be for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analyses. All claims, including those for negligence, and any other cause whatsoever which the client retains unless made in writing and recorded by Client/Arch within 30 days after the completion of the applicable work. In no event shall Client/Arch be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use or loss of profits incurred by client, its subcontractors, employees or successors or arising out of or related to the performance of services furnished by Client/Arch, regardless of whether such claim is based upon any of the above stated reasons or otherwise.																
Relinquished By: <i>J. Davis</i>		Received By: <i>Spaldingney</i>														
Date: 6/5/25		Date: 6/13/20														
Time: 1320		Time: 1320														
Relinquished By:		Received By:														
Delivered By: (Circle One)		Sample Condition		CHECKED BY:												
Sampler - UPS - Bus - Other:		Observed Temp. °C -0.9		Initials) Rush												
Current Temp. °C -0.18		Cool Yes Yes														
No No		No No														
Turnaround Time: 74 h		Standard														
Thermometer ID: 4444		Bacteria (only) Sample Condition														
Correction Factor: -85°C		Cool Yes Yes														
Temp: 10.32		Yes Yes														
N/A		No No														
API: IAPP2207553359		Yes Yes														
Comments: <i>UR</i>		Yes Yes														
REMARKS: Incident Number: IAPP2514157393		Yes Yes														
Cost Center: 2125321001		Yes Yes														
OFCM: 48605000		Yes Yes														
RECEIVED BY: <i>K. Thomas</i>		Email Address: Jreich@ensolum.com														
RECEIVED BY: <i>K. Thomas</i>		Email Address: KThomas@ensolum.com														
RECEIVED BY: <i>U. Santillana</i>		Email Address: usantillana@ensolum.com														

HOMOGENEITY 215

† Cardinal cannot accept verbal changes. Please email changes to celey_keene@cardinallabsnm.com



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 06, 2025

JEREMY REICH
ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND, TX 79705

RE: CORRAL CANYON 8 SATELLITE

Enclosed are the results of analyses for samples received by the laboratory on 06/05/25 13:20.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene
Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received: 06/05/2025 Sampling Date: 06/04/2025
 Reported: 06/06/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883, -104.006843

Sample ID: PH 01 0.5 (H253358-01)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 103 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	656	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	20.9	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	<10.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 85.5 % 44.4-145

Surrogate: 1-Chlorooctadecane 80.2 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received: 06/05/2025 Sampling Date: 06/04/2025
 Reported: 06/06/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883, -104.006843

Sample ID: PH 01A 1 (H253358-02)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	112	16.0	06/06/2025	ND	432	108	400	0.00		
TPH 8015M										

Analyte		Result		Reporting Limit		Analyzed		Method Blank		BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0		10.0		06/05/2025		ND		182		91.1	200	0.810	
DRO >C10-C28*	92.9		10.0		06/05/2025		ND		195		97.4	200	2.39	
EXT DRO >C28-C36	113		10.0		06/05/2025		ND							

Surrogate: 1-Chlorooctane 86.7 % 44.4-145

Surrogate: 1-Chlorooctadecane 83.7 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: PH 02 0.5 (H253358-03)

BTEX 8021B		mg/kg		Analyzed By: JH					S-04	
Analyte		Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*		<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61	
Toluene*		<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55	
Ethylbenzene*		<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14	GC-NC
Total Xylenes*		5.03	0.150	06/05/2025	ND	6.08	101	6.00	0.786	GC-NC1
Total BTEX		5.03	0.300	06/05/2025	ND					GC-NC1

Surrogate: 4-Bromofluorobenzene (PID) 187 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte		Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride		416	16.0	06/06/2025	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					S-04	
Analyte		Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*		367	10.0	06/05/2025	ND	182	91.1	200	0.810	
DRO >C10-C28*		8400	10.0	06/05/2025	ND	195	97.4	200	2.39	
EXT DRO >C28-C36		1480	10.0	06/05/2025	ND					

Surrogate: 1-Chlorooctane 149 % 44.4-145

Surrogate: 1-Chlorooctadecane 272 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received: 06/05/2025 Sampling Date: 06/04/2025
 Reported: 06/06/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883, -104.006843

Sample ID: PH 02A 1 (H253358-04)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 105 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	176	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	29.0	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	21.4	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 74.8 % 44.4-145

Surrogate: 1-Chlorooctadecane 71.7 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: PH 03 0.5 (H253358-05)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2520	16.0	06/06/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	109	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	33.0	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 82.7 % 44.4-145

Surrogate: 1-Chlorooctadecane 84.9 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/05/2025	Sampling Date:	06/04/2025
Reported:	06/06/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: PH 03A 1 (H253358-06)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/05/2025	ND	1.96	98.2	2.00	1.61		
Toluene*	<0.050	0.050	06/05/2025	ND	2.15	107	2.00	1.55		
Ethylbenzene*	<0.050	0.050	06/05/2025	ND	2.02	101	2.00	1.14		
Total Xylenes*	<0.150	0.150	06/05/2025	ND	6.08	101	6.00	0.786		
Total BTEX	<0.300	0.300	06/05/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	976	16.0	06/06/2025	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/05/2025	ND	182	91.1	200	0.810		
DRO >C10-C28*	36.1	10.0	06/05/2025	ND	195	97.4	200	2.39		
EXT DRO >C28-C36	10.2	10.0	06/05/2025	ND						

Surrogate: 1-Chlorooctane 80.3 % 44.4-145

Surrogate: 1-Chlorooctadecane 77.3 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
GC-NC1	8260 confirmation analysis was performed; initial GC results were not supported by GC/MS analysis and are biased high with interfering compounds.
GC-NC	8260 confirmation analysis was performed; initial GC results were not supported by GC/MS analysis and are reported as ND.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C
	Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Ensolum, LLC (575) 393-2326 FAX (575) 393-2476		BILL TO		ANALYSIS REQUEST		
Project Manager: Jeremy Reich	P.O. #:	State: TX	Zip: 79701			
Address: 501 N Marientfeld Street, Suite 400	Company: XTO Energy, Inc					
City: Midland	Attn: Colton Brown/Dale Woodall					
Phone #: 432-296-0627	Address: 3104 E Greene St					
Fax #:	City: Carlsbad					
Project #: 03C1558679	State: NM	Zip: 88220				
Project Name: Corral Canyon 8 Satellite	- SPILLS					
Project Location: 32.142883, -104.006843	Phone #:					
Sampler Name: Uriel Santillana	Fax #:					
FOR LAB USE ONLY		MATRIX	PRESERV	SAMPLING		
Lab I.D.	Sample I.D.	Depth (feet)	(G)RAB OR (C)OMP.	# CONTAINERS		
HHS3358		1	PH01	0.5	DATE	TIME
		2	PH01A	1	6/4/25	1219
		3	PH02	0.5	17225	X
		4	PH02A	1	1153	X
		5	PH03	0.5	1212	X
		6	PH03A	1'	1303	X
		7	PH04	1'	1313	X
		8	PH05	1'	1314	X
		9	PH06	1'	1315	X
		10	PH07	1'	1316	X
		11	PH08	1'	1317	X
		12	PH09	1'	1318	X
		13	PH10	1'	1319	X
		14	PH11	1'	1320	X
		15	PH12	1'	1321	X
		16	PH13	1'	1322	X
		17	PH14	1'	1323	X
		18	PH15	1'	1324	X
		19	PH16	1'	1325	X
		20	PH17	1'	1326	X
		21	PH18	1'	1327	X
		22	PH19	1'	1328	X
		23	PH20	1'	1329	X
		24	PH21	1'	1330	X
		25	PH22	1'	1331	X
		26	PH23	1'	1332	X
		27	PH24	1'	1333	X
		28	PH25	1'	1334	X
		29	PH26	1'	1335	X
		30	PH27	1'	1336	X
		31	PH28	1'	1337	X
		32	PH29	1'	1338	X
		33	PH30	1'	1339	X
		34	PH31	1'	1340	X
		35	PH32	1'	1341	X
		36	PH33	1'	1342	X
		37	PH34	1'	1343	X
		38	PH35	1'	1344	X
		39	PH36	1'	1345	X
		40	PH37	1'	1346	X
		41	PH38	1'	1347	X
		42	PH39	1'	1348	X
		43	PH40	1'	1349	X
		44	PH41	1'	1350	X
		45	PH42	1'	1351	X
		46	PH43	1'	1352	X
		47	PH44	1'	1353	X
		48	PH45	1'	1354	X
		49	PH46	1'	1355	X
		50	PH47	1'	1356	X
		51	PH48	1'	1357	X
		52	PH49	1'	1358	X
		53	PH50	1'	1359	X
		54	PH51	1'	1360	X
		55	PH52	1'	1361	X
		56	PH53	1'	1362	X
		57	PH54	1'	1363	X
		58	PH55	1'	1364	X
		59	PH56	1'	1365	X
		60	PH57	1'	1366	X
		61	PH58	1'	1367	X
		62	PH59	1'	1368	X
		63	PH60	1'	1369	X
		64	PH61	1'	1370	X
		65	PH62	1'	1371	X
		66	PH63	1'	1372	X
		67	PH64	1'	1373	X
		68	PH65	1'	1374	X
		69	PH66	1'	1375	X
		70	PH67	1'	1376	X
		71	PH68	1'	1377	X
		72	PH69	1'	1378	X
		73	PH70	1'	1379	X
		74	PH71	1'	1380	X
		75	PH72	1'	1381	X
		76	PH73	1'	1382	X
		77	PH74	1'	1383	X
		78	PH75	1'	1384	X
		79	PH76	1'	1385	X
		80	PH77	1'	1386	X
		81	PH78	1'	1387	X
		82	PH79	1'	1388	X
		83	PH80	1'	1389	X
		84	PH81	1'	1390	X
		85	PH82	1'	1391	X
		86	PH83	1'	1392	X
		87	PH84	1'	1393	X
		88	PH85	1'	1394	X
		89	PH86	1'	1395	X
		90	PH87	1'	1396	X
		91	PH88	1'	1397	X
		92	PH89	1'	1398	X
		93	PH90	1'	1399	X
		94	PH91	1'	1400	X
		95	PH92	1'	1401	X
		96	PH93	1'	140	



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

August 18, 2025

JEREMY REICH
ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND, TX 79705

RE: CORRAL CANYON 8 SATELLITE

Enclosed are the results of analyses for samples received by the laboratory on 06/09/25 12:20.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Total Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Cardinal Laboratories is accredited through the State of New Mexico Environment Department for:

Method SM 9223-B	Total Coliform and E. coli (Colilert MMO-MUG)
Method EPA 524.2	Regulated VOCs and Total Trihalomethanes (TTHM)
Method EPA 552.2	Total Haloacetic Acids (HAA-5)

Accreditation applies to public drinking water matrices for State of Colorado and New Mexico.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC 705 W WADLEY AVE. MIDLAND TX, 79705	Project: CORRAL CANYON 8 SATELLITE Project Number: 03C1558679 Project Manager: JEREMY REICH Fax To:	Reported: 18-Aug-25 11:53
--	--	------------------------------

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
FS 01 1'	H253416-07	Soil	06-Jun-25 12:37	09-Jun-25 12:20
FS 03 1'	H253416-08	Soil	06-Jun-25 12:33	09-Jun-25 12:20

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence or any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damage including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink that reads "Cely D. Keene".

Cely D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND TX, 79705

Project: CORRAL CANYON 8 SATELLITE
Project Number: 03C1558679
Project Manager: JEREMY REICH
Fax To:

Reported:
18-Aug-25 11:53

FS 01 1'**H253416-07 (Soil)**

Analyte	Result	MDL	Reporting Limit	Units	Dilution	Batch	Analyst	Analyzed	Method	Notes
---------	--------	-----	-----------------	-------	----------	-------	---------	----------	--------	-------

Cardinal Laboratories**Inorganic Compounds**

Chloride	256	16.0	mg/kg	4	5060932	AC	09-Jun-25	4500-Cl-B
----------	------------	------	-------	---	---------	----	-----------	-----------

Volatile Organic Compounds by EPA Method 8021

Benzene*	<0.050	0.050	mg/kg	50	5060915	JH	09-Jun-25	8021B
Toluene*	<0.050	0.050	mg/kg	50	5060915	JH	09-Jun-25	8021B
Ethylbenzene*	<0.050	0.050	mg/kg	50	5060915	JH	09-Jun-25	8021B
Total Xylenes*	<0.150	0.150	mg/kg	50	5060915	JH	09-Jun-25	8021B
Total BTEX	<0.300	0.300	mg/kg	50	5060915	JH	09-Jun-25	8021B

Surrogate: 4-Bromofluorobenzene (PID)	103 %	71.5-134	5060915	JH	09-Jun-25	8021B
---------------------------------------	-------	----------	---------	----	-----------	-------

Petroleum Hydrocarbons by GC FID

GRO C6-C10*	<10.0	10.0	mg/kg	1	5060922	MS	10-Jun-25	8015B
DRO >C10-C28*	<10.0	10.0	mg/kg	1	5060922	MS	10-Jun-25	8015B
EXT DRO >C28-C36	<10.0	10.0	mg/kg	1	5060922	MS	10-Jun-25	8015B
Surrogate: 1-Chlorooctane		84.1 %	44.4-145		5060922	MS	10-Jun-25	8015B
Surrogate: 1-Chlorooctadecane		83.8 %	40.6-153		5060922	MS	10-Jun-25	8015B

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence or any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damage including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND TX, 79705

Project: CORRAL CANYON 8 SATELLITE
Project Number: 03C1558679
Project Manager: JEREMY REICH
Fax To:

Reported:
18-Aug-25 11:53

FS 03 1'**H253416-08 (Soil)**

Analyte	Result	MDL	Reporting Limit	Units	Dilution	Batch	Analyst	Analyzed	Method	Notes
---------	--------	-----	-----------------	-------	----------	-------	---------	----------	--------	-------

Cardinal Laboratories**Inorganic Compounds**

Chloride	528	16.0	mg/kg	4	5060932	AC	09-Jun-25	4500-Cl-B
----------	------------	------	-------	---	---------	----	-----------	-----------

Volatile Organic Compounds by EPA Method 8021

Benzene*	<0.050	0.050	mg/kg	50	5060915	JH	09-Jun-25	8021B
Toluene*	<0.050	0.050	mg/kg	50	5060915	JH	09-Jun-25	8021B
Ethylbenzene*	<0.050	0.050	mg/kg	50	5060915	JH	09-Jun-25	8021B
Total Xylenes*	<0.150	0.150	mg/kg	50	5060915	JH	09-Jun-25	8021B
Total BTEX	<0.300	0.300	mg/kg	50	5060915	JH	09-Jun-25	8021B

Surrogate: 4-Bromofluorobenzene (PID)	101 %	71.5-134	5060915	JH	09-Jun-25	8021B
---------------------------------------	-------	----------	---------	----	-----------	-------

Petroleum Hydrocarbons by GC FID

GRO C6-C10*	<10.0	10.0	mg/kg	1	5060922	MS	09-Jun-25	8015B
DRO >C10-C28*	11.7	10.0	mg/kg	1	5060922	MS	09-Jun-25	8015B
EXT DRO >C28-C36	<10.0	10.0	mg/kg	1	5060922	MS	09-Jun-25	8015B

Surrogate: 1-Chlorooctane	92.1 %	44.4-145	5060922	MS	09-Jun-25	8015B
---------------------------	--------	----------	---------	----	-----------	-------

Surrogate: 1-Chlorooctadecane	90.8 %	40.6-153	5060922	MS	09-Jun-25	8015B
-------------------------------	--------	----------	---------	----	-----------	-------

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence or any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damage including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Cely D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND TX, 79705

Project: CORRAL CANYON 8 SATELLITE
Project Number: 03C1558679
Project Manager: JEREMY REICH
Fax To:

Reported:
18-Aug-25 11:53

Inorganic Compounds - Quality Control**Cardinal Laboratories**

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	---------	-----------	-------

Batch 5060932 - 1:4 DI Water

Blank (5060932-BLK1)	Prepared & Analyzed: 09-Jun-25								
Chloride	ND	16.0	mg/kg						
LCS (5060932-BS1)	Prepared & Analyzed: 09-Jun-25								
Chloride	432	16.0	mg/kg	400		108	80-120		
LCS Dup (5060932-BSD1)	Prepared & Analyzed: 09-Jun-25								
Chloride	448	16.0	mg/kg	400		112	80-120	3.64	20

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence or any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damage including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink that reads "Cely D. Keene".

Cely D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND TX, 79705

Project: CORRAL CANYON 8 SATELLITE
Project Number: 03C1558679
Project Manager: JEREMY REICH
Fax To:

Reported:
18-Aug-25 11:53

Volatile Organic Compounds by EPA Method 8021 - Quality Control**Cardinal Laboratories**

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	---------	-----------	-------

Batch 5060915 - Volatiles**Blank (5060915-BLK1)**

Prepared & Analyzed: 09-Jun-25						
Benzene	ND	0.050	mg/kg			
Toluene	ND	0.050	mg/kg			
Ethylbenzene	ND	0.050	mg/kg			
Total Xylenes	ND	0.150	mg/kg			
Total BTEX	ND	0.300	mg/kg			
Surrogate: 4-Bromofluorobenzene (PID)	0.0530		mg/kg	0.0500	106	71.5-134

LCS (5060915-BS1)

Prepared & Analyzed: 09-Jun-25						
Benzene	2.08	0.050	mg/kg	2.00	104	76.3-129
Toluene	2.26	0.050	mg/kg	2.00	113	84.1-129
Ethylbenzene	2.11	0.050	mg/kg	2.00	105	80.1-133
m,p-Xylene	4.20	0.100	mg/kg	4.00	105	81.4-134
o-Xylene	2.13	0.050	mg/kg	2.00	106	81.4-133
Total Xylenes	6.33	0.150	mg/kg	6.00	106	81.5-134
Surrogate: 4-Bromofluorobenzene (PID)	0.0508		mg/kg	0.0500	102	71.5-134

LCS Dup (5060915-BSD1)

Prepared & Analyzed: 09-Jun-25							
Benzene	1.88	0.050	mg/kg	2.00	94.2	76.3-129	9.90
Toluene	2.06	0.050	mg/kg	2.00	103	84.1-129	9.23
Ethylbenzene	1.92	0.050	mg/kg	2.00	95.8	80.1-133	9.51
m,p-Xylene	3.82	0.100	mg/kg	4.00	95.5	81.4-134	9.64
o-Xylene	1.94	0.050	mg/kg	2.00	97.1	81.4-133	9.19
Total Xylenes	5.76	0.150	mg/kg	6.00	96.0	81.5-134	9.49
Surrogate: 4-Bromofluorobenzene (PID)	0.0509		mg/kg	0.0500	102	71.5-134	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence or any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damage including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND TX, 79705

Project: CORRAL CANYON 8 SATELLITE
Project Number: 03C1558679
Project Manager: JEREMY REICH
Fax To:

Reported:
18-Aug-25 11:53

Petroleum Hydrocarbons by GC FID - Quality Control**Cardinal Laboratories**

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	---------	-----------	-------

Batch 5060922 - General Prep - Organics**Blank (5060922-BLK1)**

		Prepared & Analyzed: 09-Jun-25				
GRO C6-C10	ND	10.0	mg/kg			
DRO >C10-C28	ND	10.0	mg/kg			
EXT DRO >C28-C36	ND	10.0	mg/kg			
Surrogate: 1-Chlorooctane	42.0		mg/kg	50.0	84.1	44.4-145
Surrogate: 1-Chlorooctadecane	40.5		mg/kg	50.0	81.0	40.6-153

LCS (5060922-BS1)

		Prepared & Analyzed: 09-Jun-25				
GRO C6-C10	216	10.0	mg/kg	200	108	81.5-123
DRO >C10-C28	208	10.0	mg/kg	200	104	77.7-122
Total TPH C6-C28	424	10.0	mg/kg	400	106	80.9-121
Surrogate: 1-Chlorooctane	40.3		mg/kg	50.0	80.6	44.4-145
Surrogate: 1-Chlorooctadecane	39.1		mg/kg	50.0	78.2	40.6-153

LCS Dup (5060922-BSD1)

		Prepared & Analyzed: 09-Jun-25				
GRO C6-C10	216	10.0	mg/kg	200	108	81.5-123
DRO >C10-C28	209	10.0	mg/kg	200	105	77.7-122
Total TPH C6-C28	425	10.0	mg/kg	400	106	80.9-121
Surrogate: 1-Chlorooctane	44.0		mg/kg	50.0	88.1	44.4-145
Surrogate: 1-Chlorooctadecane	43.1		mg/kg	50.0	86.3	40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence or any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damage including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence or any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damage including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink that appears to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Maryland, Hobbs, NM 88240

ANALYSIS REQUEST							
BILL TO							
Project Manager: Jeremy Reich	P.O. #:						
Address: 601 N Marienfeld Street, Suite 400	Company: XTO Energy, Inc						
City: Midland	Attn: Colton Brown/Dale Woodall						
Phone #: 432-296-0627	Fax #:						
Project #: 03C1558679	Project Owner: XTO Energy						
Project Name: Corral Canyon 8 Satellite	- SPILLS						
Project Location: 32.142883, -104.006843	State: NM	Zip: 88220					
Sampler Name: Uriel Santillana	Phone #:						
FOR LAB USE ONLY	Fax #:						
Lab I.D.	Sample I.D.	Depth (feet)		MATRIX	PRESERV.	SAMPLING	
4253414	CSO1	0.5'	C	(G)RAB OR (C)OMP.	# CONTAINERS		
1	CSO2	0.5'	C	GROUNDWATER			
2	CSO3	0.5'	C	WASTEWATER			
3	CSO4	0.5'	C	SOIL			
4	CSO5	0.5'	C	OIL			
5	CSO6	0.5'	C	SLUDGE			
6	CSO7	0.5'	C	OTHER			
7	CSO8	1'	C	ACID/BASE			
8	CSO9	1'	C	ICE / COOL			
	FSO1	1'	C	OTHER			
	FSO3	1'	C				
PLEASE NOTE: Liability and damages, including those for negligence and any other cause whatsoever that may be deemed reason sufficient in writing and recorded by Cardinal within 30 days after completion of the applicable analyses. All claims including those for negligence and any other cause whatsoever that may be deemed reason sufficient in writing and recorded by Cardinal within 30 days after completion of the applicable analyses. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subcontractors, or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.				DATE	TIME		
Relinquished By: <i>J. Reich</i>	Received By: <i>J. Reich</i>	Date: <i>6/25/25</i>	Time: <i>12:37</i>	6/15/25	13:50	TPH 8015	
Delivered By: (Circle One)	Sample Condition: <input checked="" type="checkbox"/> Standard <input type="checkbox"/> Cool <input type="checkbox"/> Intact	Checked By: <i>J. Reich</i>	Time: <i>6/25/25</i>	6/15/25	13:58	BTEX 8021	
Sampler - UPS - Bus - Other:	Current Temp. °C <input checked="" type="checkbox"/> 25 <input type="checkbox"/> Yes <input type="checkbox"/> No	Comments: <i>Thermometer 0 #13 #14, 3:00</i>		6/15/25	14:05	Chloride 4500	
REMARKS: Incident Number: NAPP2514157393				Turnaround Time: 24 hr <input checked="" type="checkbox"/> Rush	Standard <input type="checkbox"/> Bacteria (only) <input type="checkbox"/> Sample Condition		
				Thermometer 0 #13 #14, 3:00	Cool <input type="checkbox"/> Intact <input type="checkbox"/> Observed Temp. °C		
				Correlation Factor: 0.0°C	Yes <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> No		
					Corrected Temp. °C		



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 10, 2025

JEREMY REICH
ENSOLUM, LLC
705 W WADLEY AVE.
MIDLAND, TX 79705

RE: CORRAL CANYON 8 SATELLITE

Enclosed are the results of analyses for samples received by the laboratory on 06/09/25 12:20.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene
Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/09/2025	Sampling Date:	06/06/2025
Reported:	06/10/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Tamara Oldaker
Project Location:	XTO 32.142883, -104.006843		

Sample ID: PH 01 B 1.5' (H253417-01)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/09/2025	ND	2.08	104	2.00	9.90		
Toluene*	<0.050	0.050	06/09/2025	ND	2.26	113	2.00	9.23		
Ethylbenzene*	<0.050	0.050	06/09/2025	ND	2.11	105	2.00	9.51		
Total Xylenes*	<0.150	0.150	06/09/2025	ND	6.33	106	6.00	9.49		
Total BTEX	<0.300	0.300	06/09/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 102 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	176	16.0	06/09/2025	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/09/2025	ND	216	108	200	0.0648		
DRO >C10-C28*	<10.0	10.0	06/09/2025	ND	208	104	200	0.634		
EXT DRO >C28-C36	<10.0	10.0	06/09/2025	ND						

Surrogate: 1-Chlorooctane 83.9 % 44.4-145

Surrogate: 1-Chlorooctadecane 82.1 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM, LLC
 JEREMY REICH
 705 W WADLEY AVE.
 MIDLAND TX, 79705
 Fax To:

Received:	06/09/2025	Sampling Date:	06/06/2025
Reported:	06/10/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Tamara Oldaker
Project Location:	XTO 32.142883, -104.006843		

Sample ID: PH 03 B 1.5' (H253417-02)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/09/2025	ND	2.08	104	2.00	9.90		
Toluene*	<0.050	0.050	06/09/2025	ND	2.26	113	2.00	9.23		
Ethylbenzene*	<0.050	0.050	06/09/2025	ND	2.11	105	2.00	9.51		
Total Xylenes*	<0.150	0.150	06/09/2025	ND	6.33	106	6.00	9.49		
Total BTEX	<0.300	0.300	06/09/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 102 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1040	16.0	06/09/2025	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/09/2025	ND	216	108	200	0.0648		
DRO >C10-C28*	52.2	10.0	06/09/2025	ND	208	104	200	0.634		
EXT DRO >C28-C36	15.9	10.0	06/09/2025	ND						

Surrogate: 1-Chlorooctane 86.1 % 44.4-145

Surrogate: 1-Chlorooctadecane 86.6 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C
	Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240

Please email changes to keene@cardinalabsn.com.



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 23, 2025

JEREMY REICH

ENSOLUM

3122 NATIONAL PARKS HWY

CARLSBAD, NM 88220

RE: CORRAL CANYON 8 SATELLITE - SPILLS

Enclosed are the results of analyses for samples received by the laboratory on 06/17/25 13:35.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 06/17/2025 Sampling Date: 06/16/2025
 Reported: 06/23/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE - SPILLS Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883-104.006843

Sample ID: FS 02 1 (H253604-01)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/18/2025	ND	1.91	95.4	2.00	7.89		
Toluene*	<0.050	0.050	06/18/2025	ND	1.92	96.1	2.00	7.98		
Ethylbenzene*	<0.050	0.050	06/18/2025	ND	1.98	99.0	2.00	9.34		
Total Xylenes*	<0.150	0.150	06/18/2025	ND	5.86	97.7	6.00	9.29		
Total BTEX	<0.300	0.300	06/18/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 110 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	224	16.0	06/18/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/18/2025	ND	194	96.9	200	1.31		
DRO >C10-C28*	162	10.0	06/18/2025	ND	182	91.0	200	0.0429		
EXT DRO >C28-C36	34.1	10.0	06/18/2025	ND						

Surrogate: 1-Chlorooctane 81.5 % 44.4-145

Surrogate: 1-Chlorooctadecane 83.4 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 06/17/2025 Sampling Date: 06/16/2025
 Reported: 06/23/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE - SPILLS Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883-104.006843

Sample ID: FS 04 1 (H253604-02)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/18/2025	ND	1.91	95.4	2.00	7.89		
Toluene*	<0.050	0.050	06/18/2025	ND	1.92	96.1	2.00	7.98		
Ethylbenzene*	<0.050	0.050	06/18/2025	ND	1.98	99.0	2.00	9.34		
Total Xylenes*	<0.150	0.150	06/18/2025	ND	5.86	97.7	6.00	9.29		
Total BTEX	<0.300	0.300	06/18/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 108 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	224	16.0	06/18/2025	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/18/2025	ND	194	96.9	200	1.31		
DRO >C10-C28*	39.8	10.0	06/18/2025	ND	182	91.0	200	0.0429		
EXT DRO >C28-C36	<10.0	10.0	06/18/2025	ND						

Surrogate: 1-Chlorooctane 88.1 % 44.4-145

Surrogate: 1-Chlorooctadecane 87.3 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 06/17/2025 Sampling Date: 06/16/2025
 Reported: 06/23/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE - SPILLS Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883-104.006843

Sample ID: SW 01 0-1 (H253604-03)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/18/2025	ND	1.91	95.4	2.00	7.89		
Toluene*	<0.050	0.050	06/18/2025	ND	1.92	96.1	2.00	7.98		
Ethylbenzene*	<0.050	0.050	06/18/2025	ND	1.98	99.0	2.00	9.34		
Total Xylenes*	<0.150	0.150	06/18/2025	ND	5.86	97.7	6.00	9.29		
Total BTEX	<0.300	0.300	06/18/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 108 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	240	16.0	06/18/2025	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/18/2025	ND	194	96.9	200	1.31		
DRO >C10-C28*	94.4	10.0	06/18/2025	ND	182	91.0	200	0.0429		
EXT DRO >C28-C36	19.4	10.0	06/18/2025	ND						

Surrogate: 1-Chlorooctane 87.5 % 44.4-145

Surrogate: 1-Chlorooctadecane 87.3 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 06/17/2025 Sampling Date: 06/16/2025
 Reported: 06/23/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE - SPILLS Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883-104.006843

Sample ID: SW 02 0-1 (H253604-04)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/18/2025	ND	1.91	95.4	2.00	7.89		
Toluene*	<0.050	0.050	06/18/2025	ND	1.92	96.1	2.00	7.98		
Ethylbenzene*	<0.050	0.050	06/18/2025	ND	1.98	99.0	2.00	9.34		
Total Xylenes*	<0.150	0.150	06/18/2025	ND	5.86	97.7	6.00	9.29		
Total BTEX	<0.300	0.300	06/18/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 111 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	208	16.0	06/18/2025	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/18/2025	ND	194	96.9	200	1.31		
DRO >C10-C28*	48.8	10.0	06/18/2025	ND	182	91.0	200	0.0429		
EXT DRO >C28-C36	<10.0	10.0	06/18/2025	ND						

Surrogate: 1-Chlorooctane 74.8 % 44.4-145

Surrogate: 1-Chlorooctadecane 76.9 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

S-04 The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.

QM-07 The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.

ND Analyte NOT DETECTED at or above the reporting limit

RPD Relative Percent Difference

** Samples not received at proper temperature of 6°C or below.

*** Insufficient time to reach temperature.

- Chloride by SM4500Cl-B does not require samples be received at or below 6°C

Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

July 07, 2025

JEREMY REICH

ENSOLUM

3122 NATIONAL PARKS HWY

CARLSBAD, NM 88220

RE: CORRAL CANYON 8 SATELLITE - SPILLS

Enclosed are the results of analyses for samples received by the laboratory on 06/30/25 12:10.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink, appearing to read "Mike Snyder".

Mike Snyder For Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 06/30/2025 Sampling Date: 06/26/2025
 Reported: 07/07/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE - SPILLS Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883-104.006843

Sample ID: BH 01 - C 2.0' (H253923-01)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/30/2025	ND	1.95	97.3	2.00	5.34		
Toluene*	<0.050	0.050	06/30/2025	ND	1.98	98.8	2.00	4.43		
Ethylbenzene*	<0.050	0.050	06/30/2025	ND	2.01	101	2.00	4.81		
Total Xylenes*	<0.150	0.150	06/30/2025	ND	5.97	99.6	6.00	5.07		
Total BTEX	<0.300	0.300	06/30/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.6 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	144	16.0	07/01/2025	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/30/2025	ND	207	104	200	2.76		
DRO >C10-C28*	11.0	10.0	06/30/2025	ND	192	95.9	200	1.36		
EXT DRO >C28-C36	<10.0	10.0	06/30/2025	ND						

Surrogate: 1-Chlorooctane 89.3 % 44.4-145

Surrogate: 1-Chlorooctadecane 88.5 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C
	Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Mike Snyder".

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Page 4 of 4

1 of 1

		BILL TO		ANALYSIS REQUEST											
Company Name: Ensolium, LLC	Project Manager: Jeremy Reich	P.O. #:													
Address: 3122 National Parks Hwy		Company:	XTO ENERGY, Inc.												
City: Carlsbad	Phone #: 432-296-0627	State: NM	Zip: 88220	Attn: Dale Hobday											
		Fax #:		Address: 303 E Green St											
Project #: 03C 1558 679				City: Carlsbad											
Project Name: Corral Canyon 8 SATELLITE		Project Owner:	XTO ENERGY, Inc.	State: NM		Zip: 88220									
Project Location: (32.142883, -104.006843)		Phone #:													
Sampler Name: CHRIS WRIGHT		Fax #:													
FOR LAB USE ONLY															
Lab I.D. H053923	Sample I.D. BHO1 - C	Sample Depth (feet) 2.0	(G)RAB OR (C)OMP. # CONTAINERS 1	MATRIX	PRESERV.	SAMPLING									
			GROUNDWATER												
			WASTEWATER												
			SOIL												
			OIL												
			SLUDGE												
			OTHER:												
			ACID/BASE:												
			ICE / COOL												
			OTHER:												
				DATE	TIME										
				4/24/05	10:50										
						BTEX									
						TPH									
						CHLORIDE									
REMARKS: All Results are emailed. Please provide Email address: jeremy.reich@ensolium.com Katherine.Brown@ensolium.com Chris.Wright@ensolium.com REMARKS: 4/24/05 10:50 AM REMARKS: 4/24/05 10:50 AM															
Delivered By: (Circle One)	Desired Temp. °C 3.8	Sample Condition Cool Intact Yes No	CHECKED BY: Initials Rush	Bacteria (only) Sample Condition Cool Intact Yes No	Observed Temp. °C										
Sampler - UPS - Bus - Other:	Corrected Temp. °C 4.12														
PLEASE NOTE: Liability and Damage: Contractor's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 20 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruption, loss of use, or loss of profits, incurred by client, its subcontractors, affiliates or successors, arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon one of the above stated reasons or otherwise.															
Relinquished By: Chris Wright	Received By: Spud Engen	Verbal Result: All Results are emailed. Please provide Email address: jeremy.reich@ensolium.com Katherine.Brown@ensolium.com Chris.Wright@ensolium.com	Turnaround Time: Standard	4/24/05 10:50 AM	Spills										
Relinquished By:	Date: 12/10	Received By:	Standard	<input checked="" type="checkbox"/>	Rush										
	Time:														

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

July 07, 2025

JEREMY REICH

ENSOLUM

3122 NATIONAL PARKS HWY

CARLSBAD, NM 88220

RE: CORRAL CANYON 8 SATELLITE - SPILLS

Enclosed are the results of analyses for samples received by the laboratory on 06/30/25 12:10.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink, appearing to read "Mike Snyder".

Mike Snyder For Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 06/30/2025 Sampling Date: 06/26/2025
 Reported: 07/07/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE - SPILLS Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883-104.006843

Sample ID: BH 01 - A 0.25' (H253925-01)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/30/2025	ND	1.95	97.3	2.00	5.34		
Toluene*	0.215	0.050	06/30/2025	ND	1.98	98.8	2.00	4.43		
Ethylbenzene*	0.071	0.050	06/30/2025	ND	2.01	101	2.00	4.81		
Total Xylenes*	1.04	0.150	06/30/2025	ND	5.97	99.6	6.00	5.07		
Total BTEX	1.35	0.300	06/30/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 103 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	3920	16.0	07/01/2025	ND	400	100	400	3.92		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	19.3	10.0	06/30/2025	ND	207	104	200	2.76		
DRO >C10-C28*	2490	10.0	06/30/2025	ND	192	95.9	200	1.36		
EXT DRO >C28-C36	541	10.0	06/30/2025	ND						

Surrogate: 1-Chlorooctane 83.3 % 44.4-145

Surrogate: 1-Chlorooctadecane 131 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 06/30/2025 Sampling Date: 06/26/2025
 Reported: 07/07/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE - SPILLS Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883-104.006843

Sample ID: BH 01 - B 1.0' (H253925-02)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/30/2025	ND	1.95	97.3	2.00	5.34		
Toluene*	<0.050	0.050	06/30/2025	ND	1.98	98.8	2.00	4.43		
Ethylbenzene*	<0.050	0.050	06/30/2025	ND	2.01	101	2.00	4.81		
Total Xylenes*	<0.150	0.150	06/30/2025	ND	5.97	99.6	6.00	5.07		
Total BTEX	<0.300	0.300	06/30/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.0 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	144	16.0	07/01/2025	ND	400	100	400	3.92		

TPH 8015M		mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/30/2025	ND	207	104	200	2.76		
DRO >C10-C28*	26.9	10.0	06/30/2025	ND	192	95.9	200	1.36		
EXT DRO >C28-C36	<10.0	10.0	06/30/2025	ND						

Surrogate: 1-Chlorooctane 80.9 % 44.4-145

Surrogate: 1-Chlorooctadecane 79.4 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C
	Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Mike Snyder".

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



CARDINAL
Laboratories

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

141

Delivered By: (Circle One)		Observed Temperature: °C <u>20</u>	Sample Condition	CHECKED BY:
Relinquished By:		Date: <u>10/30/25</u>	Time: <u>10:30</u>	Received By: <u>Shad Rigney</u>
Relinquished By:		Date: <u></u>	Time: <u></u>	Received By: <u></u>
<p>Verbal Result: All Results are entered <u>jeffrich@bioscience.com</u> REMARKS: <u>U: 2125321 to 1</u> <u>4pm: 4805000 -</u> Turnaround Time: </p>				

Verbal Results:	<input type="checkbox"/> Yes <input type="checkbox"/> No	Add'l Phone #:
All Results are emailed. Please provide Email address: yachich@benton.com kthomson@benton.com mfriis@benton.com		
REMARKS:	Comments: napp154155D13	
NU: 112532101		

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinalabsnm.com



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

August 13, 2025

JEREMY REICH

ENSOLUM

3122 NATIONAL PARKS HWY

CARLSBAD, NM 88220

RE: CORRAL CANYON 8 SATELLITE

Enclosed are the results of analyses for samples received by the laboratory on 08/12/25 13:51.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received:	08/12/2025	Sampling Date:	08/12/2025
Reported:	08/13/2025	Sampling Type:	Soil
Project Name:	CORRAL CANYON 8 SATELLITE	Sampling Condition:	Cool & Intact
Project Number:	03C1558679	Sample Received By:	Shalyn Rodriguez
Project Location:	XTO 32.142883, -104.006843		

Sample ID: FS 02 1.5' (H254970-01)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte		Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*		<0.050	0.050	08/13/2025	ND	1.73	86.7	2.00	4.96	
Toluene*		<0.050	0.050	08/13/2025	ND	1.89	94.4	2.00	4.06	
Ethylbenzene*		<0.050	0.050	08/13/2025	ND	2.01	100	2.00	3.47	
Total Xylenes*		<0.150	0.150	08/13/2025	ND	6.40	107	6.00	3.37	
Total BTEX		<0.300	0.300	08/13/2025	ND					

Surrogate: 4-Bromofluorobenzene (PID) 109 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte		Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride		128	16.0	08/13/2025	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: ms						
Analyte		Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*		<10.0	10.0	08/12/2025	ND	206	103	200	0.244	
DRO >C10-C28*		30.7	10.0	08/12/2025	ND	179	89.7	200	0.253	
EXT DRO >C28-C36		<10.0	10.0	08/12/2025	ND					

Surrogate: 1-Chlorooctane 73.2 % 44.4-145

Surrogate: 1-Chlorooctadecane 73.4 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

ENSOLUM
 JEREMY REICH
 3122 NATIONAL PARKS HWY
 CARLSBAD NM, 88220
 Fax To:

Received: 08/12/2025 Sampling Date: 08/12/2025
 Reported: 08/13/2025 Sampling Type: Soil
 Project Name: CORRAL CANYON 8 SATELLITE Sampling Condition: Cool & Intact
 Project Number: 03C1558679 Sample Received By: Shalyn Rodriguez
 Project Location: XTO 32.142883, -104.006843

Sample ID: SW 03 0-1.5' (H254970-02)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/13/2025	ND	1.73	86.7	2.00	4.96		
Toluene*	<0.050	0.050	08/13/2025	ND	1.89	94.4	2.00	4.06		
Ethylbenzene*	<0.050	0.050	08/13/2025	ND	2.01	100	2.00	3.47		
Total Xylenes*	<0.150	0.150	08/13/2025	ND	6.40	107	6.00	3.37		
Total BTEX	<0.300	0.300	08/13/2025	ND						

Surrogate: 4-Bromofluorobenzene (PID) 107 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	304	16.0	08/13/2025	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: ms						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	08/13/2025	ND	206	103	200	0.244		
DRO >C10-C28*	<10.0	10.0	08/13/2025	ND	179	89.7	200	0.253		
EXT DRO >C28-C36	<10.0	10.0	08/13/2025	ND						

Surrogate: 1-Chlorooctane 74.2 % 44.4-145

Surrogate: 1-Chlorooctadecane 72.8 % 40.6-153

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C
	Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink that reads "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(505) 392-2222 FAX (505) 392-2476

FORM-006 R.3.2 10/07/2011

† Cardinal cannot accept verbal changes. Please email changes to caley_keene@carolinanbaum.com



APPENDIX G

Excavation Guidance Document



November 25, 2025

New Mexico Oil Conservation Division

1220 South St. Francis Drive
Santa Fe, New Mexico 87505

**Re: Excavation Guidance Document
Corral Canyon 8 Satellite
Incident Number nAPP2514157393
Eddy County, New Mexico**

To Whom It May Concern:

Ensolum, LLC (Ensolum) has prepared this document on behalf of XTO Energy, Inc (XTO), to provide guidance on safety precautions related to the proposed excavation near existing production equipment and lined containment. This guidance applies to the proposed excavation and applies only to the Corral Canyon 8 Satellite (Site), for which a Requested Area of Deferral is attached as Figure 1.

This document has been prepared in accordance with the Occupational Safety and Health Administration (OSHA) Excavation Standard 29 Code of Federal Regulations (CFR) Part 1926 Sub-part P Section 1926.652(i) and 1926.652(j) and under the consultation of a Registered Professional Engineer (RPE). The document includes a review of the stability of adjacent structures and protection of employees from loose rocks, soil, and equipment and analysis of the following parameters:

- Soil types and conditions leading to cave-ins;
- Stability of engineered facility equipment with requested excavation;
- Protection of employees from materials and equipment that could fall or roll into an excavation; and
- Other hazardous conditions, including confined spaces.

This guidance document must be reviewed before starting any proposed excavation activities and kept on site if excavation activities are occurring. In addition, a copy of the OSHA Excavation Standard 29 CFR Part 1926 Sub-part P will be kept on site.

Review of OSHA Excavation Standards indicates the following guidance for general excavation activities:

- The walls of any excavated areas must be sloped to a maximum 1 horizontal to 1 vertical for Type B soils. Soil types shall be evaluated by a trained competent person prior to any excavation.
- OSHA Excavation Standard 29 CFR Part 1926 Sub-part P indicates the following:
 - Excavation below the level of the base or footing of any foundation or retaining wall poses a reasonable hazard to employees and should not be conducted without the removal of equipment adjacent to the proposed excavation and/or installation of physical safety measures such as shoring or other protective structures to prevent structural failure of the equipment foundation and to ensure safety to employees working near the proposed excavation.

- Employees shall be protected from excavated or other materials or equipment that could pose a hazard by falling or rolling into any excavation. Protection shall be provided by placing and keeping such materials or equipment at least two feet (0.61 m) from the edge of excavations, or by the use of retaining devices that are sufficient to prevent materials or equipment from falling or rolling into excavations, or by a combination of both if necessary.
- When surcharge loads from stored material or equipment, operating equipment, or traffic are present, a Competent Person shall determine the degree to which the actual slope must be reduced below the maximum allowable slope and shall assure that such a reduction is achieved. Surcharge loads from adjacent structures shall be evaluated in accordance with § 1926.651(i).

EXCAVATION ANALYSIS PARAMETERS

The following findings were observed at the Site:

- Type B soil was observed during the Site visit. Type B soil will be utilized for determining excavation slopes and excavation setbacks. A competent person will inspect the site daily and note any changes in soil type during excavation activities. If type A or type C soil is identified, the excavation slope and excavation setback will be modified to account for this change.
- Maximum excavation depth of 1.5 feet bgs was utilized for the excavation setbacks. Adjustment of the maximum depth of the excavation will require modifications to the setbacks described below.
- The proposed excavation area entails a polygon with maximum dimensions of 85.5 feet by 87.8 feet directly adjacent to multiple structures containing production equipment and active pipelines as shown on Figure 2. A portion of the proposed excavation area has been excavated and is shown in orange for reference.
- To the south of the proposed excavation area is an engineered lined containment containing multiple pipelines, stair and platform supports, and large holding tanks. The lined containment measures 35.5 feet wide by 58.5 feet in length. The lined containment lays directly onto the pad surface. Three large cylindrical tanks measuring 12 feet in diameter and 15 feet in height reside within the lined containment.
- To the north of the proposed excavation area are two compressor structures supported by skid structures measuring 8 feet wide by 21.6 feet long (Compressor A) and 7.9 feet wide by 14 feet long (Compressor B).
- Directly overlaying and adjacent to the proposed excavation area are multiple production pipelines lying on supports of varying dimensions. The production pipelines range in diameter from 2.5 inches to 12 inches. Multiple pipes running across the central portion of the extent are supported by a pipe rack measuring 8 feet wide by over 300 feet long.
- The production pipeline and platform supports throughout the entire proposed excavation area range in dimensions of 4 inches wide by 8 inches long up to 4 inches wide by 54 inches long.
- The southern portion of the proposed excavation area is an engineered lined containment containing three circulation pumps. The lined containment measures 8.58 feet wide by 19.6 feet in length. The lined containment lays directly onto the pad surface.
- The central portion of the proposed excavation area contains an electrical panel and stairs. The electrical panel is supported by a concrete base that measures 35 inches wide by 59 inches long laying directly on pad surface. The stairs are supported by a concrete base that measures 48 inches wide by 48 inches long laying directly on pad surface.

ENGINEER RECOMMENDATIONS

Review of the above-mentioned parameters, OSHA regulations, and Site conditions observed during Site visits were completed and the following RPE recommendations were reached:

- Stress to the soil below the lined containment structure can be estimated by the 2:1 Stress Distribution Model in the proposed excavation area adjacent to the lined containment. The beginning of the slope should be limited to beginning no less than 2 feet from the edge of the lined containment footing per above stated OSHA guidelines.
- Using the northern compressor structures footing bearing capacity in Terzaghi's bearing capacity equation, the bearing capacity would be undermined with slopes of 30 degrees beginning less than 1 times the width from the edge of the footing. The beginning of the slope should be limited to beginning no less than 8 feet from the edge of Compressor A's structure footing without substantial supports added to the structure. The beginning of the slope should be limited to beginning no less than 7.9 feet from the edge of Compressor B's structure footing without substantial supports added to the structure.
- The production pipelines that the proposed excavation area are supported by footings of varying dimensions. The beginning of the slope should be limited to beginning no less than two feet from the edge of any pipeline support per above stated OSHA guidelines. Review of the potential pipe stress and deflection during an excavation directly below pipelines, the pipelines can experience increased tension and compression causing increased hoop stress. Even if additional supports are installed in the process of excavation, the brief time they remain unsupported can cause pipe fatigue and eventually pipe failure. It is reasonable to assume that an increase in hoop stress and increase of pipe fatigue on the pipeline system can exceed the engineered parameters and lead to pipeline failure resulting in an additional release. It is not recommended to excavate directly below any of the pipelines.
- Stress to the soil below the pipe rack running across the northern portion of the proposed excavation area can be estimated utilizing Boussinesq's infinitely long strip footing. The beginning of the slope should be limited to beginning no less than 16 feet from the edge of the pipe rack footings.
- Stress to the soil below the pipeline and platform singular point support structures can be estimated by the 2:1 Stress Distribution Model in the area of requested. The beginning of the slope should be limited to beginning no less than 2 feet from the edge of the singular point support structure per above stated OSHA guidelines or 4 times the width of the support footing, whichever is greater. This recommendation applies to shut in lines with no pressure and/or fluids contained. For active lines with pressure and/or fluid contained, the beginning of the slope should be limited to beginning no less than 10 feet from the edge of the singular point support structure.
- Stress to the soil below the central circulation pump lined containment structure can be estimated by the 2:1 Stress Distribution Model in the proposed excavation area adjacent to the lined containment. The beginning of the slope should be limited to beginning no less than 2 feet from the edge of the lined containment footing per above stated OSHA guidelines.
- Stress to the soil below the electrical panel structure can be estimated by the 2:1 Stress Distribution Model in the proposed excavation area. The beginning of the slope should be limited to beginning no less than 2 feet from the edge of the electrical panel support footing per above stated OSHA guidelines.
- Stress to the soil below the stair support platform on the northern portion of the proposed excavation area can be estimated by the 2:1 Stress Distribution Model in the proposed excavation area. The beginning of the slope should be limited to beginning no less than 2 feet from the edge of the stair support footing per above stated OSHA guidelines.

XTO Energy, Inc
Excavation Guidance Document
Corral Canyon 8 Satellite

- Due to the presence of production equipment and lined containment, excavation directly below any of the current lined containment areas is not recommended and would require substantial deconstruction and/or additional support for equipment. These areas lay directly below and adjacent to engineered lined containments and excavation of the identified areas may result in loss of effectiveness or competency of the lined containment.

CONCLUSIONS

Based on the dimensions of the requested excavation and presence of adjacent structures, there is inadequate structure support to conduct additional excavation of the identified impacted soil in a manner that both protects personnel health and equipment stability.

Sincerely,

Ensolum, LLC



Brian Sulzberger, PE
Associate Principal

cc: Robert Woodall, XTO
 Richard Kotzur, XTO
 New Mexico State Land Office

Appendices:


Figure 1 Requested Area of Deferral
Figure 2 Engineering Schematic
Appendix A Engineering Models



FIGURES

Legend

- ▲ Point of Release
- Delineation Soil Sample Compliant with Closure Criteria
- Delineation Soil Sample Not Compliant with Site Closure Criteria
- ▲ Sidewall Sample Not Compliant With Closure Criteria
- Electric Utility Line Fiber
- Optic Line
- Gas Line
- Oil and Gas Utility Line
- Surface Production Line
- Area of Requested Deferral
- Excavation Extent
- Release Extent
- Lined Containment Area
- Production Equipment

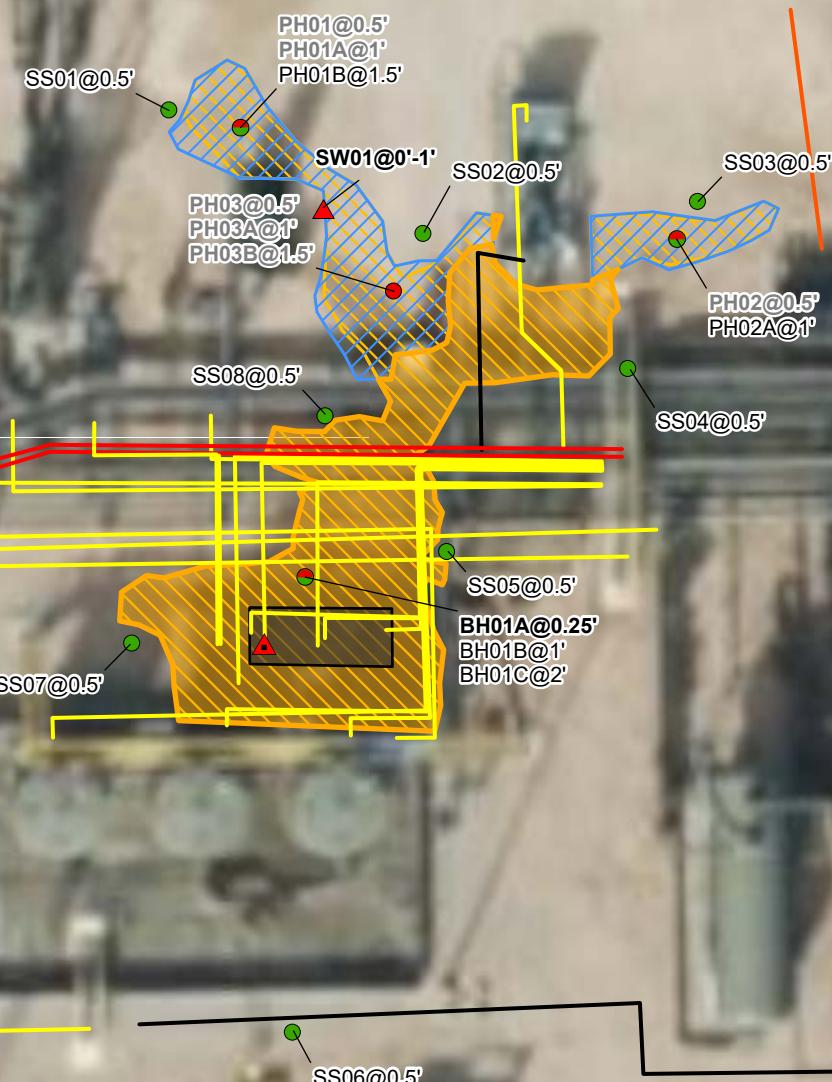

Note:
Sample ID @ Depth Below Ground Surface
Concentrations in **bold** exceed the MMOCD Table I Closure Criteria
or reclamation requirement where applicable.



Sources
Azure Maps




Environmental, Engineering and
Hydrogeologic Consultants

Requested Area of Deferral

XTO Energy, Inc
Corral Canyon 8 Satellite
Incident Number: nAPP2514157393
Unit K, Section 08, T25S, R29E
Eddy County, New Mexico

FIGURE

1

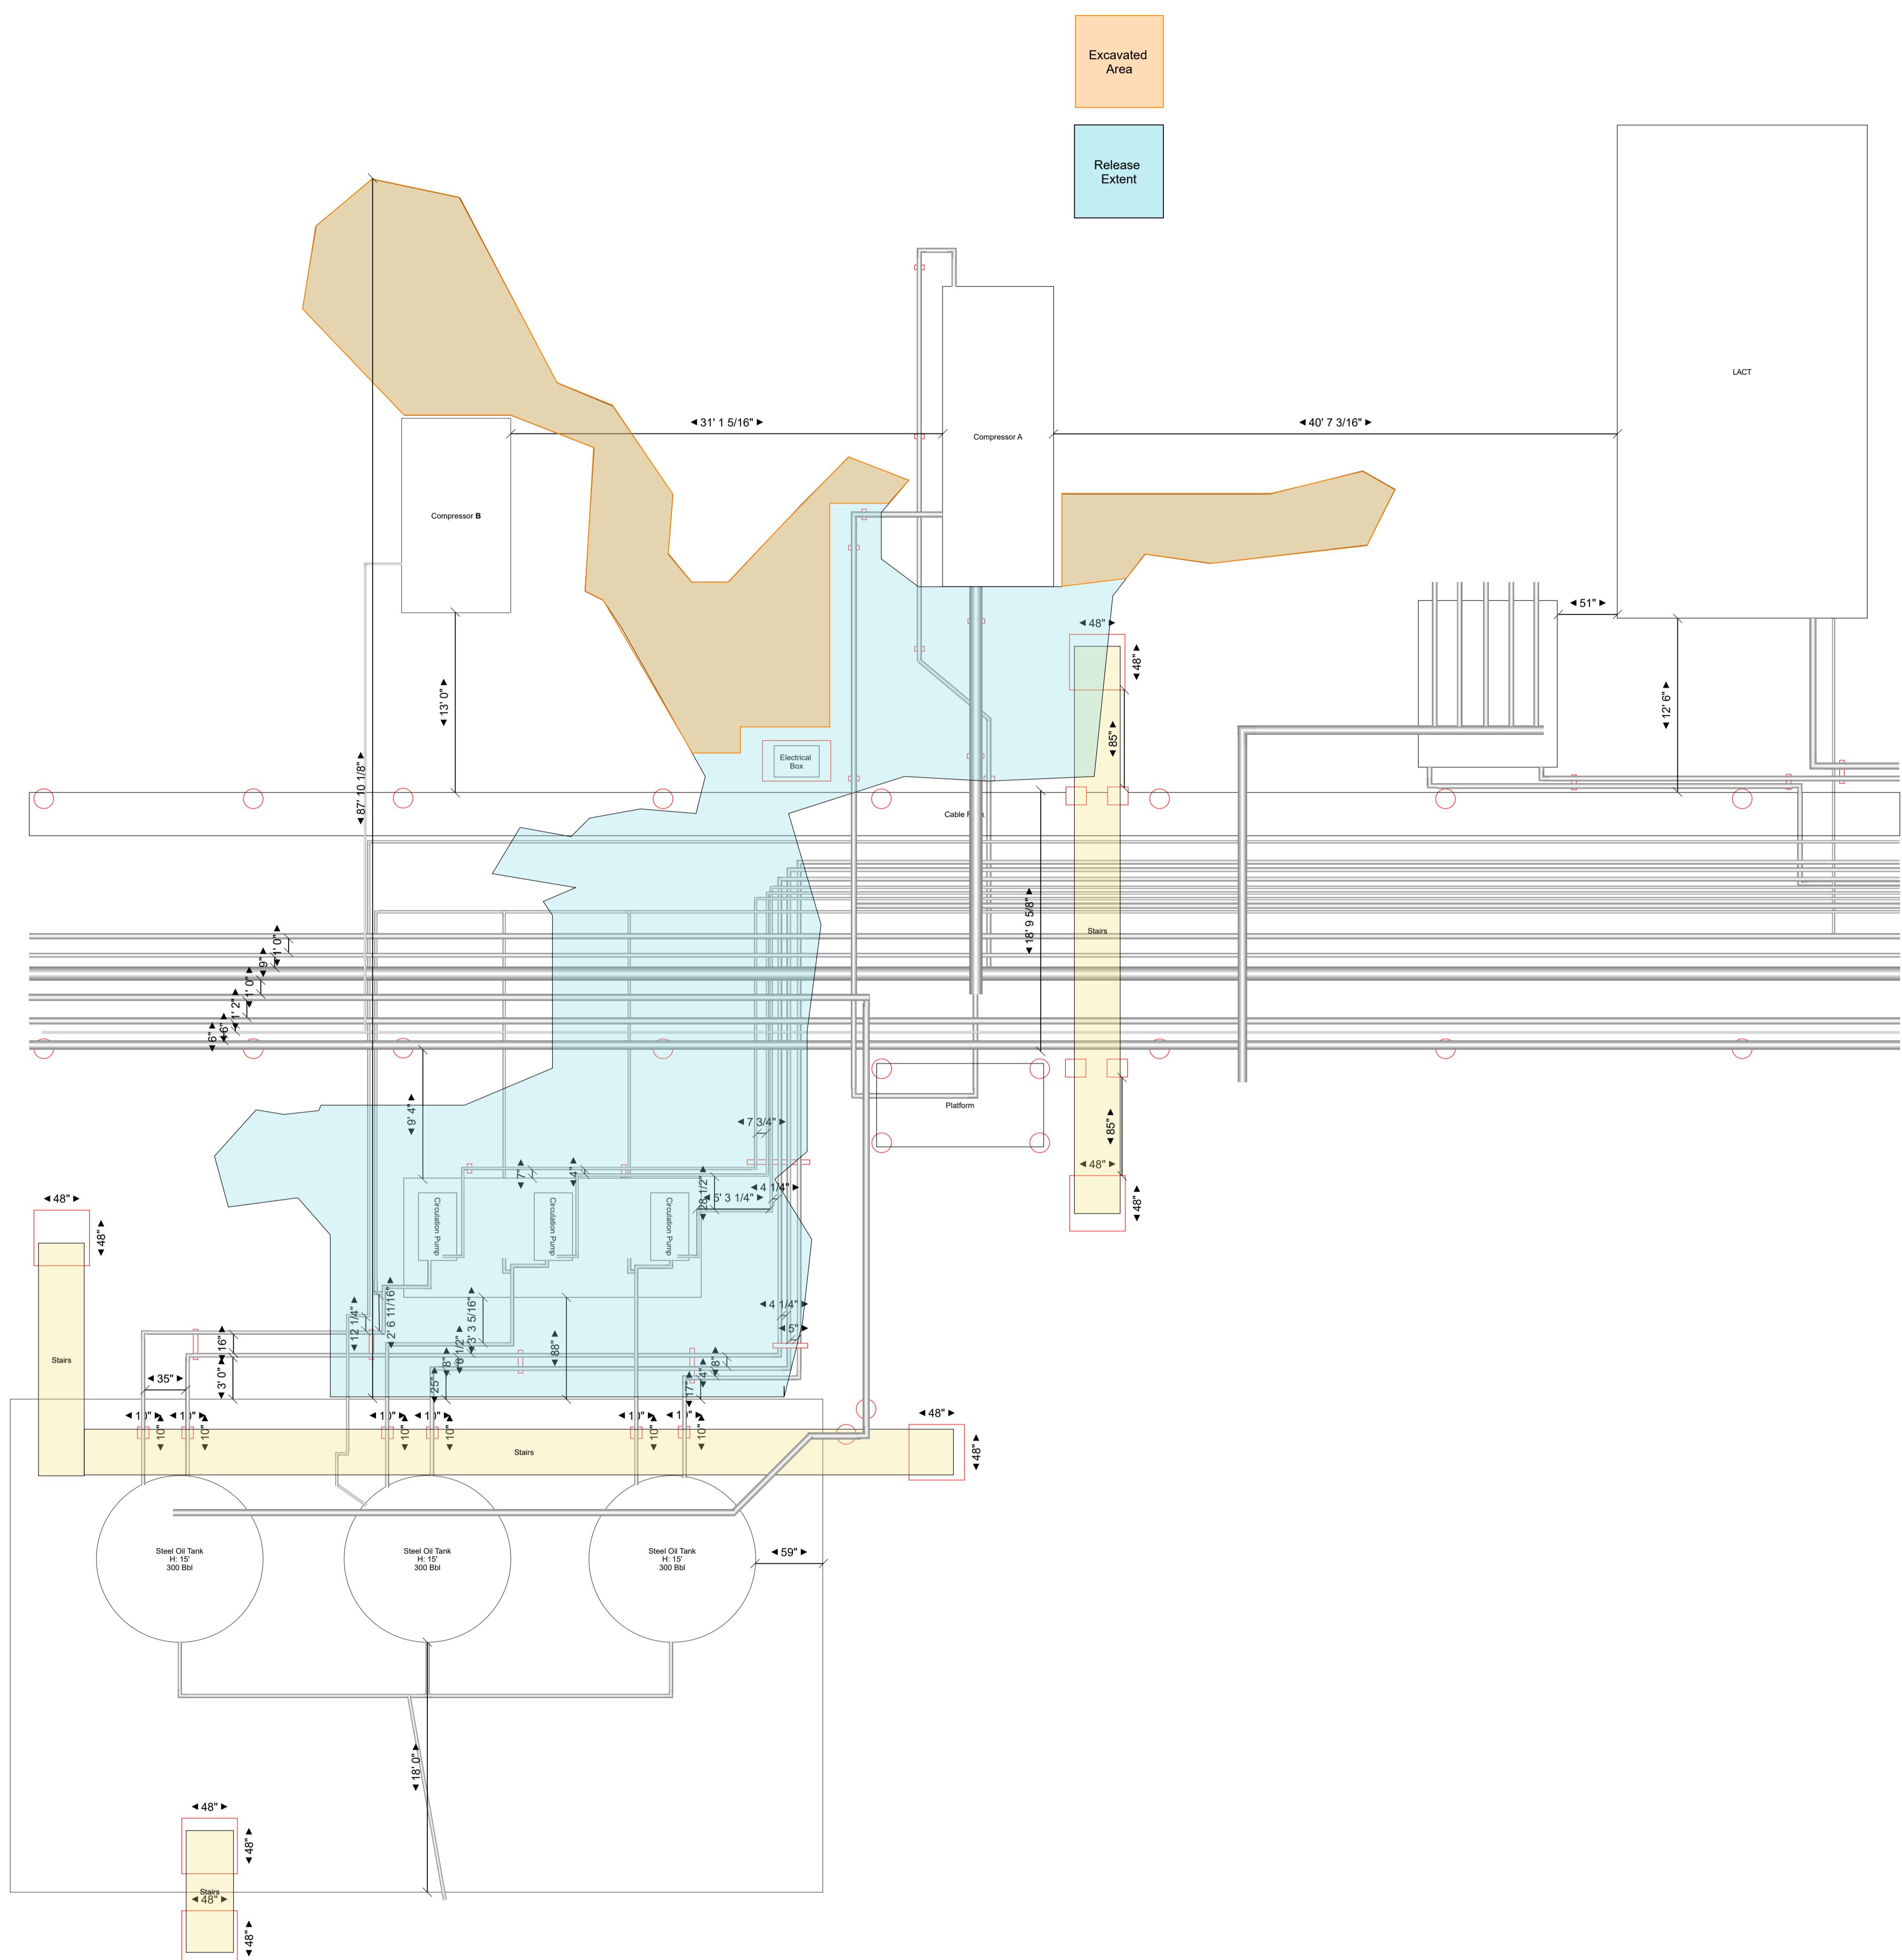

Site:	Corral Canyon 8 Satellite	Drawing:	801506	Project:	03C1558679	Drawn:	Tracy Hillard	Notes:	In relation to NMOCD	Ensolum, LLC
Title:	Figure 2 - Engineering Schematic	Scale:	1/4":1'0"	Date:	09/23/2025	Rev:	A	Incident Number	nAPP2514157393	8330 LBJ Freeway St 830 Dallas, TX



Appendix A Engineering Models

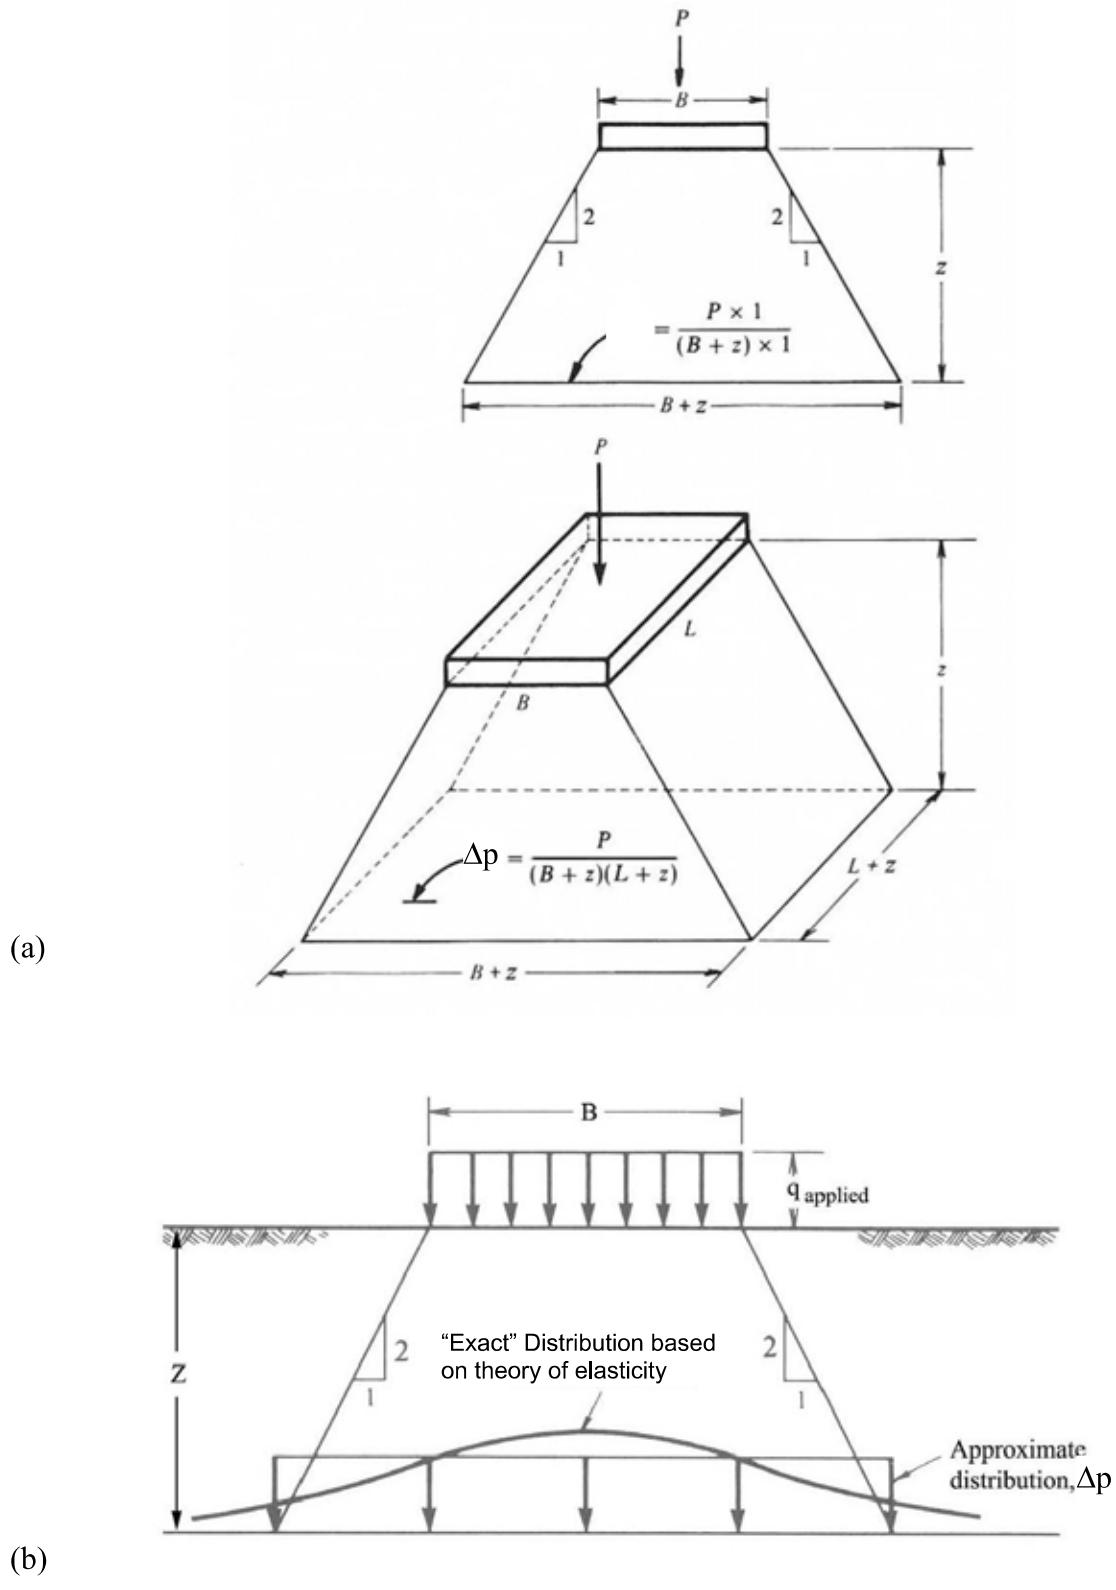


Figure 2-10. Distribution of vertical stress by the 2:1 method (after Perloff and Baron, 1976).




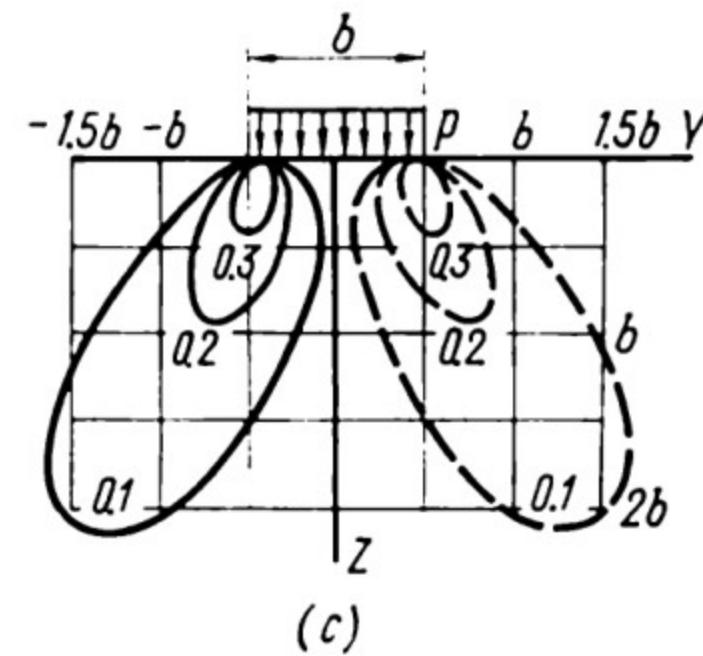


Fig. 49. Lines of equal stresses in a linearly deformable massif for the planar problem

(a) isobars σ_z ; (b) lateral pressure σ_y ; (c) shears τ_{zx}

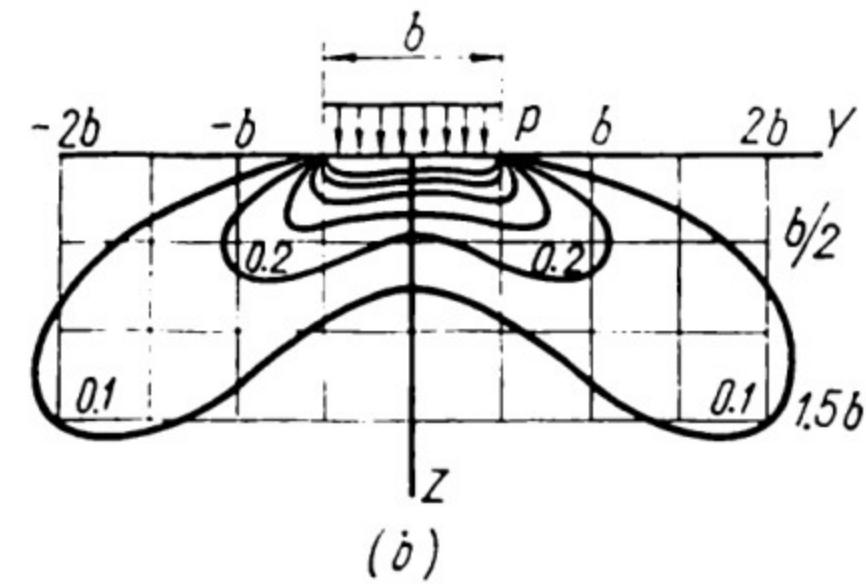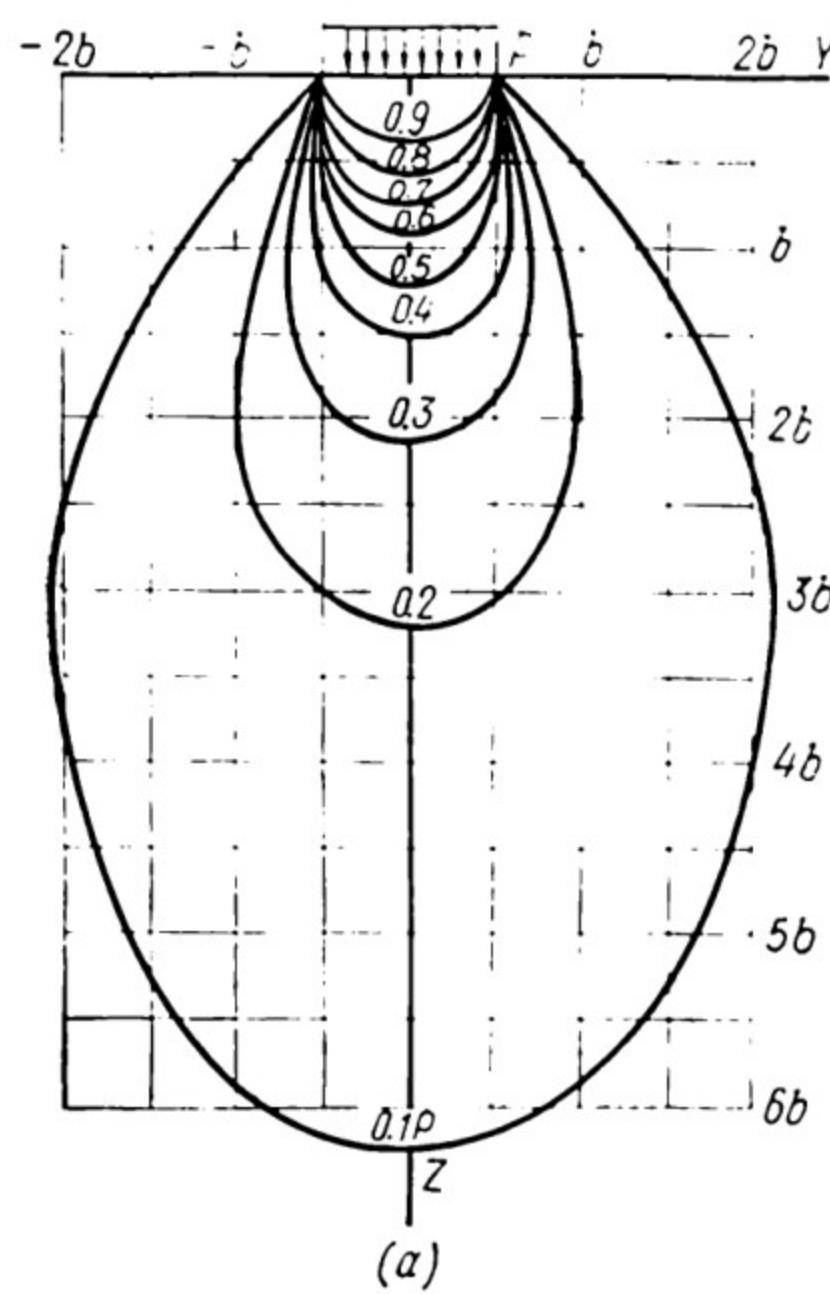

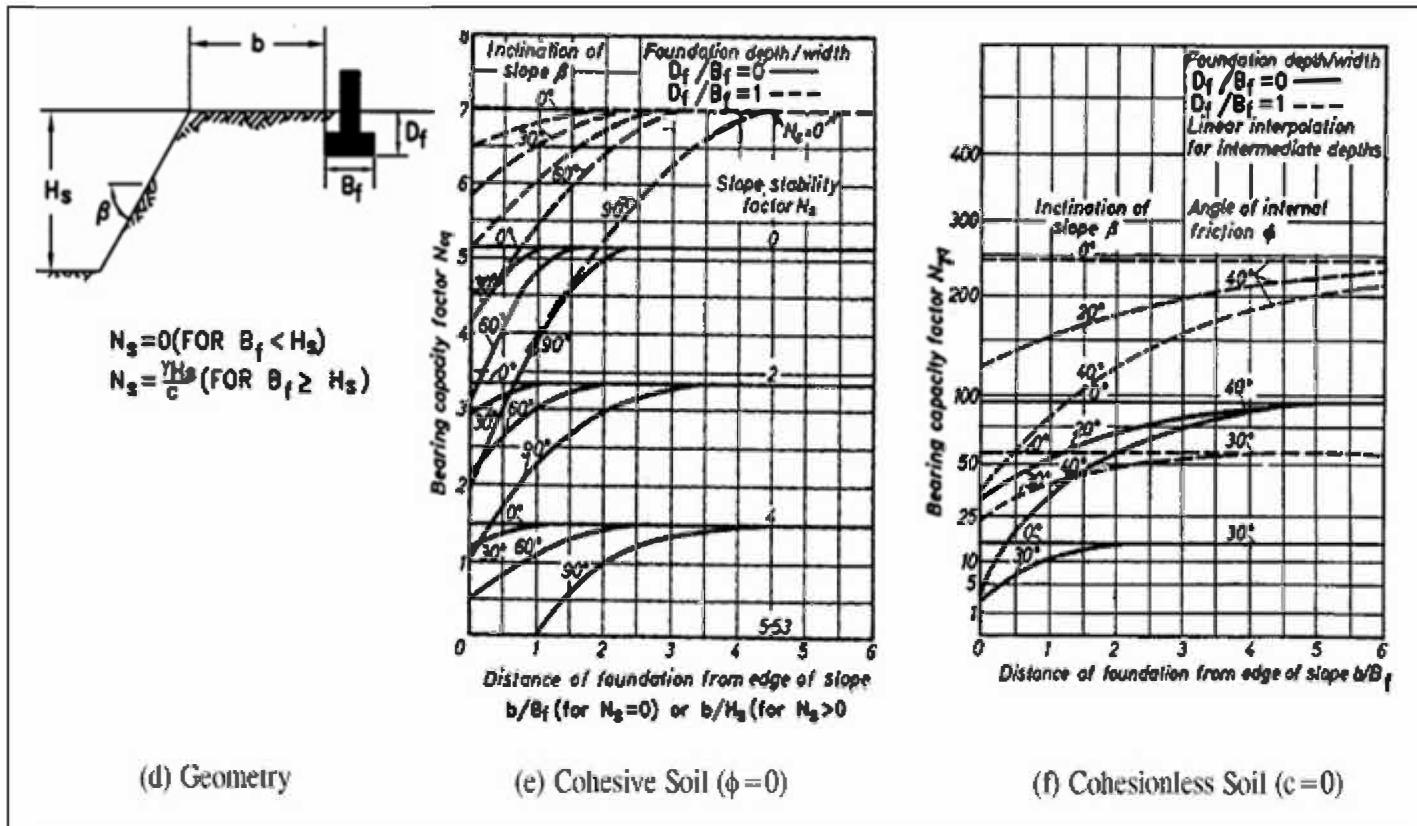

APPENDIX H

Spill Calculation - nAPP2514157393

Location:	CORRAL CANYON 8 SAT	
Spill Date:	5/20/2025	
Incident:	NAPP2514157393	
Area 1		
Approximate Area =	150	sq. ft.
Average Saturation (or depth) of spill =	2.25	inches
VOLUME OF LEAK		
Total Crude Oil =		bbls
Total Produced Water =	5.00	bbls
Area 2		
Approximate Area =	2,032	sq. ft.
Average Saturation (or depth) of spill =	1.00	inches
Average Porosity Factor =	0.25	
VOLUME OF LEAK		
Total Crude Oil =		bbls
Total Produced Water =	6.00	bbls
TOTAL VOLUME OF LEAK		
Total Crude Oil =		bbls
Total Produced Water =	11.00	bbls
TOTAL VOLUME RECOVERED		
Total Crude Oil =		bbls
Total Produced Water =	5.00	bbls

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 467969

QUESTIONS

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 467969
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2514157393
Incident Name	NAPP2514157393 CORRAL CANYON 8 SAT @ 0
Incident Type	Produced Water Release
Incident Status	Initial C-141 Received
Incident Facility	[fAPP2207552359] CORRAL CANYON 8 SAT

Location of Release Source

Please answer all the questions in this group.

Site Name	CORRAL CANYON 8 SAT
Date Release Discovered	05/20/2025
Surface Owner	Federal

Incident Details

Please answer all the questions in this group.

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	<i>Not answered.</i>
Produced Water Released (bbls) Details	<i>Cause: Equipment Failure Pump Produced Water Released: 11 BBL Recovered: 5 BBL Lost: 6 BBL.</i>
Is the concentration of chloride in the produced water >10,000 mg/l	<i>Yes</i>
Condensate Released (bbls) Details	<i>Not answered.</i>
Natural Gas Vented (Mcf) Details	<i>Not answered.</i>
Natural Gas Flared (Mcf) Details	<i>Not answered.</i>
Other Released Details	<i>Not answered.</i>
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	<i>Not answered.</i>

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 467969

QUESTIONS (continued)

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 467969
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	No
Reasons why this would be considered a submission for a notification of a major release	Unavailable.

With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.

Initial Response	
<i>The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.</i>	
The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Robert Woodall Title: Environmental Analyst Email: robert.d.woodall@exxonmobil.com Date: 05/28/2025
--	--

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 467969

QUESTIONS (continued)

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 467969
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

QUESTIONS

Site Characterization

Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	<i>Not answered.</i>
What method was used to determine the depth to ground water	<i>Not answered.</i>
Did this release impact groundwater or surface water	<i>Not answered.</i>
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	<i>Not answered.</i>
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	<i>Not answered.</i>
An occupied permanent residence, school, hospital, institution, or church	<i>Not answered.</i>
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	<i>Not answered.</i>
Any other fresh water well or spring	<i>Not answered.</i>
Incorporated municipal boundaries or a defined municipal fresh water well field	<i>Not answered.</i>
A wetland	<i>Not answered.</i>
A subsurface mine	<i>Not answered.</i>
An (non-karst) unstable area	<i>Not answered.</i>
Categorize the risk of this well / site being in a karst geology	<i>Not answered.</i>
A 100-year floodplain	<i>Not answered.</i>
Did the release impact areas not on an exploration, development, production, or storage site	<i>Not answered.</i>

Remediation Plan

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

Requesting a remediation plan approval with this submission	No
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 467969

CONDITIONS

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 467969
	Action Type: [C-141] Initial C-141 (C-141-v-Initial)

CONDITIONS

Created By	Condition	Condition Date
scott.rodgers	None	5/28/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 531268

QUESTIONS

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 531268
	Action Type: [C-141] Deferral Request C-141 (C-141-v-Deferral)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2514157393
Incident Name	NAPP2514157393 CORRAL CANYON 8 SAT @ FAPP2207552359
Incident Type	Produced Water Release
Incident Status	Deferral Request Received
Incident Facility	[fAPP2207552359] CORRAL CANYON 8 SAT

Location of Release Source

Please answer all the questions in this group.

Site Name	CORRAL CANYON 8 SAT
Date Release Discovered	05/20/2025
Surface Owner	Federal

Incident Details

Please answer all the questions in this group.

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	<i>Not answered.</i>
Produced Water Released (bbls) Details	<i>Cause: Equipment Failure Pump Produced Water Released: 11 BBL Recovered: 5 BBL Lost: 6 BBL.</i>
Is the concentration of chloride in the produced water >10,000 mg/l	<i>Yes</i>
Condensate Released (bbls) Details	<i>Not answered.</i>
Natural Gas Vented (Mcf) Details	<i>Not answered.</i>
Natural Gas Flared (Mcf) Details	<i>Not answered.</i>
Other Released Details	<i>Not answered.</i>
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	<i>Not answered.</i>

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 531268

QUESTIONS (continued)

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 531268
	Action Type: [C-141] Deferral Request C-141 (C-141-v-Deferral)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	No
Reasons why this would be considered a submission for a notification of a major release	<i>Unavailable.</i>

With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.

Initial Response	
<i>The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.</i>	
The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	<i>Not answered.</i>

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Richard Kotzur Title: Senior Project Manager Email: NMEnvNotifications@exxonmobil.com Date: 12/02/2025
--	---

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

QUESTIONS, Page 3

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

Action 531268

QUESTIONS (continued)

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 531268
	Action Type: [C-141] Deferral Request C-141 (C-141-v-Deferral)

QUESTIONS**Site Characterization**

Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Between 500 and 1000 (ft.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Between 1000 (ft.) and ½ (mi.)
An occupied permanent residence, school, hospital, institution, or church	Between 1 and 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between 1000 (ft.) and ½ (mi.)
Any other fresh water well or spring	Between 1000 (ft.) and ½ (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Between 500 and 1000 (ft.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Between ½ and 1 (mi.)
Categorize the risk of this well / site being in a karst geology	Medium
A 100-year floodplain	Between 1000 (ft.) and ½ (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	No

Remediation Plan

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
Soil Contamination Sampling: (Provide the highest observable value for each, in milligrams per kilograms.)	
Chloride (EPA 300.0 or SM4500 Cl B)	3920
TPH (GRO+DRO+MRO) (EPA SW-846 Method 8015M)	3050
GRO+DRO (EPA SW-846 Method 8015M)	2509
BTEX (EPA SW-846 Method 8021B or 8260B)	0
Benzene (EPA SW-846 Method 8021B or 8260B)	0

Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.

On what estimated date will the remediation commence	05/20/2025
On what date will (or did) the final sampling or liner inspection occur	07/08/2025
On what date will (or was) the remediation complete(d)	08/12/2025
What is the estimated surface area (in square feet) that will be reclaimed	0
What is the estimated volume (in cubic yards) that will be reclaimed	0
What is the estimated surface area (in square feet) that will be remediated	627
What is the estimated volume (in cubic yards) that will be remediated	40

These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 531268

QUESTIONS (continued)

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 531268
	Action Type: [C-141] Deferral Request C-141 (C-141-v-Deferral)

QUESTIONS**Remediation Plan (continued)**

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:

(Select all answers below that apply.)

(Ex Situ) Excavation and off-site disposal (i.e. dig and haul, hydrovac, etc.)	Yes
Which OCD approved facility will be used for off-site disposal	fJEG1635837366 OWL LANDFILL JAL
OR which OCD approved well (API) will be used for off-site disposal	<i>Not answered.</i>
OR is the off-site disposal site, to be used, out-of-state	<i>Not answered.</i>
OR is the off-site disposal site, to be used, an NMED facility	<i>Not answered.</i>
(Ex Situ) Excavation and on-site remediation (i.e. On-Site Land Farms)	<i>Not answered.</i>
(In Situ) Soil Vapor Extraction	<i>Not answered.</i>
(In Situ) Chemical processing (i.e. Soil Shredding, Potassium Permanganate, etc.)	<i>Not answered.</i>
(In Situ) Biological processing (i.e. Microbes / Fertilizer, etc.)	<i>Not answered.</i>
(In Situ) Physical processing (i.e. Soil Washing, Gypsum, Disking, etc.)	<i>Not answered.</i>
Ground Water Abatement pursuant to 19.15.30 NMAC	<i>Not answered.</i>
OTHER (Non-listed remedial process)	<i>Not answered.</i>

Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Richard Kotzur Title: Senior Project Manager Email: NMEnvNotifications@exxonmobil.com Date: 12/02/2025
--	---

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 5

Action 531268

QUESTIONS (continued)

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 531268
	Action Type: [C-141] Deferral Request C-141 (C-141-v-Deferral)

QUESTIONS

Deferral Requests Only <i>Only answer the questions in this group if seeking a deferral upon approval this submission. Each of the following items must be confirmed as part of any request for deferral of remediation.</i>	
Requesting a deferral of the remediation closure due date with the approval of this submission	Yes
Have the lateral and vertical extents of contamination been fully delineated	Yes
Is the remaining contamination in areas immediately under or around production equipment where remediation could cause a major facility deconstruction	Yes
Please list or describe the production equipment and how (re)moving the equipment would cause major facility deconstruction	Active production piping and footings, and a central circulation pump lined containment. Immediately adjacent to the impacted soil is an electrical panel structure, additional surface piping and footings of varying dimensions, additional engineered pipe racks and platforms, two compressor structures supported by skid structures of varying dimensions, and a lined containment containing three 300-bbl steel crude oil tanks.
What is the remaining surface area (in square feet) that will still need to be remediated if a deferral is granted	1406
What is the remaining volume (in cubic yards) that will still need to be remediated if a deferral is granted	78
<i>Per Paragraph (2) of Subsection C of 19.15.29.12 NMAC if contamination is located in areas immediately under or around production equipment such as production tanks, wellheads and pipelines where remediation could cause a major facility deconstruction, the remediation, restoration and reclamation may be deferred with division written approval until the equipment is removed during other operations, or when the well or facility is plugged or abandoned, whichever comes first.</i>	
Enter the facility ID (f#) on which this deferral should be granted	fAPP2207552359 CORRAL CANYON 8 SAT
Enter the well API (30-) on which this deferral should be granted	Not answered.
Contamination does not cause an imminent risk to human health, the environment, or groundwater	True
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.	
I hereby agree and sign off to the above statement	Name: Richard Kotzur Title: Senior Project Manager Email: NMEnvNotifications@exxonmobil.com Date: 12/02/2025

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 531268

QUESTIONS (continued)

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 531268
	Action Type: [C-141] Deferral Request C-141 (C-141-v-Deferral)

QUESTIONS

Sampling Event Information	
Last sampling notification (C-141N) recorded	492778
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	08/12/2025
What was the (estimated) number of samples that were to be gathered	5
What was the sampling surface area in square feet	100

Remediation Closure Request

Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.

Requesting a remediation closure approval with this submission	No
--	-----------

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 531268

CONDITIONS

Operator: XTO ENERGY, INC 6401 Holiday Hill Road Midland, TX 79707	OGRID: 5380
	Action Number: 531268
	Action Type: [C-141] Deferral Request C-141 (C-141-v-Deferral)

CONDITIONS

Created By	Condition	Condition Date
scwells	Deferral approved. Deferral of BH01A and SW01 is approved until plugging and abandonment or a major facility deconstruction, whichever comes first. A complete and accurate remediation report and/or reclamation report will need to be submitted at that time.	12/22/2025