



## SITE INFORMATION

---

### Closure Report

**Maxus B 8026 JV-P #003 (04.24.2007)**

**Incident ID: nAPM2325637248**

**Lea County, New Mexico**

**Unit B, S34, T22S, R34E**

**32.3536034°, -103.4546661°**

### Crude Oil Release

**Point of Release: Equipment Failure at Separator**

**Release Date: 04.24.2007**

**Volume Released: 5 Barrels of Crude Oil**

**Volume Recovered: 0 Barrels of Crude Oil**

**CARMONA RESOURCES**



### Prepared for:

**BTA Oil Producers, LLC**

**104 S Pecos St.**

**Midland, Texas 79701**

### Prepared by:

**Carmona Resources, LLC**

**310 West Wall Street**

**Suite 500**

**Midland, Texas 79701**

## TABLE OF CONTENTS

---

### 1.0 SITE INFORMATION AND BACKGROUND

### 2.0 SITE CHARACTERIZATION AND GROUNDWATER

### 3.0 NMAC REGULATORY CRITERIA

### 4.0 SITE ASSESSMENT ACTIVITIES

### 5.0 CONCLUSIONS

### FIGURES

FIGURE 1      OVERVIEW                      FIGURE 2      TOPOGRAPHIC

FIGURE 3      SAMPLE LOCATION

### APPENDICES

APPENDIX A      TABLE

APPENDIX B      PHOTOS

APPENDIX C      INITIAL C-141 & NMOCD CORRESPONDENCE

APPENDIX D      SITE CHARACTERIZATION AND GROUNDWATER

APPENDIX E      LABORATORY REPORTS



January 29, 2026

New Mexico Oil Conservation Division  
1220 South St, Francis Drive  
Santa Fe, New Mexico 87505

Re: **Closure Report**  
**Maxus B 8026 JV-P #003 (04.24.2007)**  
**Incident ID: nAPM2325637248**  
**BTA Oil Producers, LLC**  
**Site Location: Unit B, S34, T22S, R34E**  
**32.3536034° -103.4546661°**  
**Lea County, New Mexico**

To whom it may concern:

On behalf of BTA Oil Producers, LLC (BTA), Carmona Resources LLC has prepared this letter to document the remediation activities for the Maxus B 8026 JV-P #003 release. The site is located at 32.3536034°, - 103.4546661° within Unit B, S34, T22S, R34E, in Lea County, New Mexico (Figures 1 and 2).

### **1.0 Site Information and Background**

Based on the information obtained from the New Mexico Oil Conservation Division (NMOCD), the release was discovered on April 24, 2007, due to equipment failure at the separator. It resulted in approximately five (5) barrels of crude oil being released, with zero (0) barrels of crude oil recovered. The spill boundaries are shown in Figure 3. The Notification of Release and Initial C-141 form is attached in Appendix C.

### **2.0 Site Characterization and Groundwater**

The site is located within a low karst area. Based on a review of the New Mexico Office of State Engineers and USGS databases, there are no known water sources within a 0.50-mile radius of the location. The nearest well is approximately 0.63 miles West of the site in S34, T22S, R34E, and was drilled in 2019. The well has a reported depth to groundwater of 305 feet below the ground surface (ft bgs). A copy of the summary report is attached in Appendix D.

### **3.0 NMAC Regulatory Criteria**

Per the NMOCD regulatory criteria established in 19.15.29.12 NMAC, the following criteria were utilized in assessing and remediating the site.

- Benzene: 10 milligrams per kilogram (mg/kg).
- Benzene, toluene, ethylbenzene, and total xylenes (BTEX): 50 mg/kg.
- TPH: 100 mg/kg (GRO + DRO + MRO).
- Chloride: 600 mg/kg.



#### **4.0 Site Assessment Activities**

On December 16, 2025, communication with the NMOCD resulted in a request to sample inside and surrounding the release area. Five (5) samples were requested to be collected within the release area, and four (4) horizontal delineation samples surrounding the release area. See Figure 3. See Appendix C for NMOCD email correspondence.

#### **Initial Assessment**

On January 14, 2025, Carmona Resources personnel performed site assessment activities via a hand auger to evaluate soil impacts stemming from the release. A total of five (5) sample points (S-1 through S-5) and four (4) horizontal samples (H-1 through H-4) were installed to total depths ranging from surface to 4.0 ft bgs inside and surrounding the release area. See Figure 3 for the sample locations. For chemical analysis, the soil samples were collected and placed directly into laboratory-provided sample containers, stored on ice, and transported under the proper chain-of-custody protocol to Eurofins Laboratories in Midland, Texas. The samples were analyzed for total petroleum hydrocarbons (TPH) by EPA method 8015, modified benzene, toluene, ethylbenzene, and xylenes (BTEX) by EPA Method 8021B, and Chloride by EPA method 300.0. The laboratory reports, including analytical methods, results, and chain-of-custody documents, are attached in Appendix E.

#### **Vertical Delineation**

Vertical delineation was achieved in all areas for Benzene, total BTEX, TPH, and Chloride concentrations. Refer to Table 1.

#### **Horizontal Delineation**

Horizontal delineation was achieved in all areas for Benzene, total BTEX, TPH, and Chloride concentrations. Refer to Table 1.

#### **6.0 Conclusions**

Based on the assessment and analytical data, no further actions are required at the site. BTA formally requests the closure of the spill. If you have any questions regarding this report or need additional information, please contact us at 432-813-8988.

Sincerely,  
**Carmona Resources, LLC**

Ashton Thielke  
Director of Operations

Gilbert Priego  
Project Manager

# FIGURES

CARMONA RESOURCES







OVERVIEW MAP  
BTA OIL PRODUCERS, LLC  
MAXUS B 8026 JV-P #003 (04.24.2007)  
LEA COUNTY, NEW MEXICO  
32.3536034°, -103.4546661°



FIGURE 1

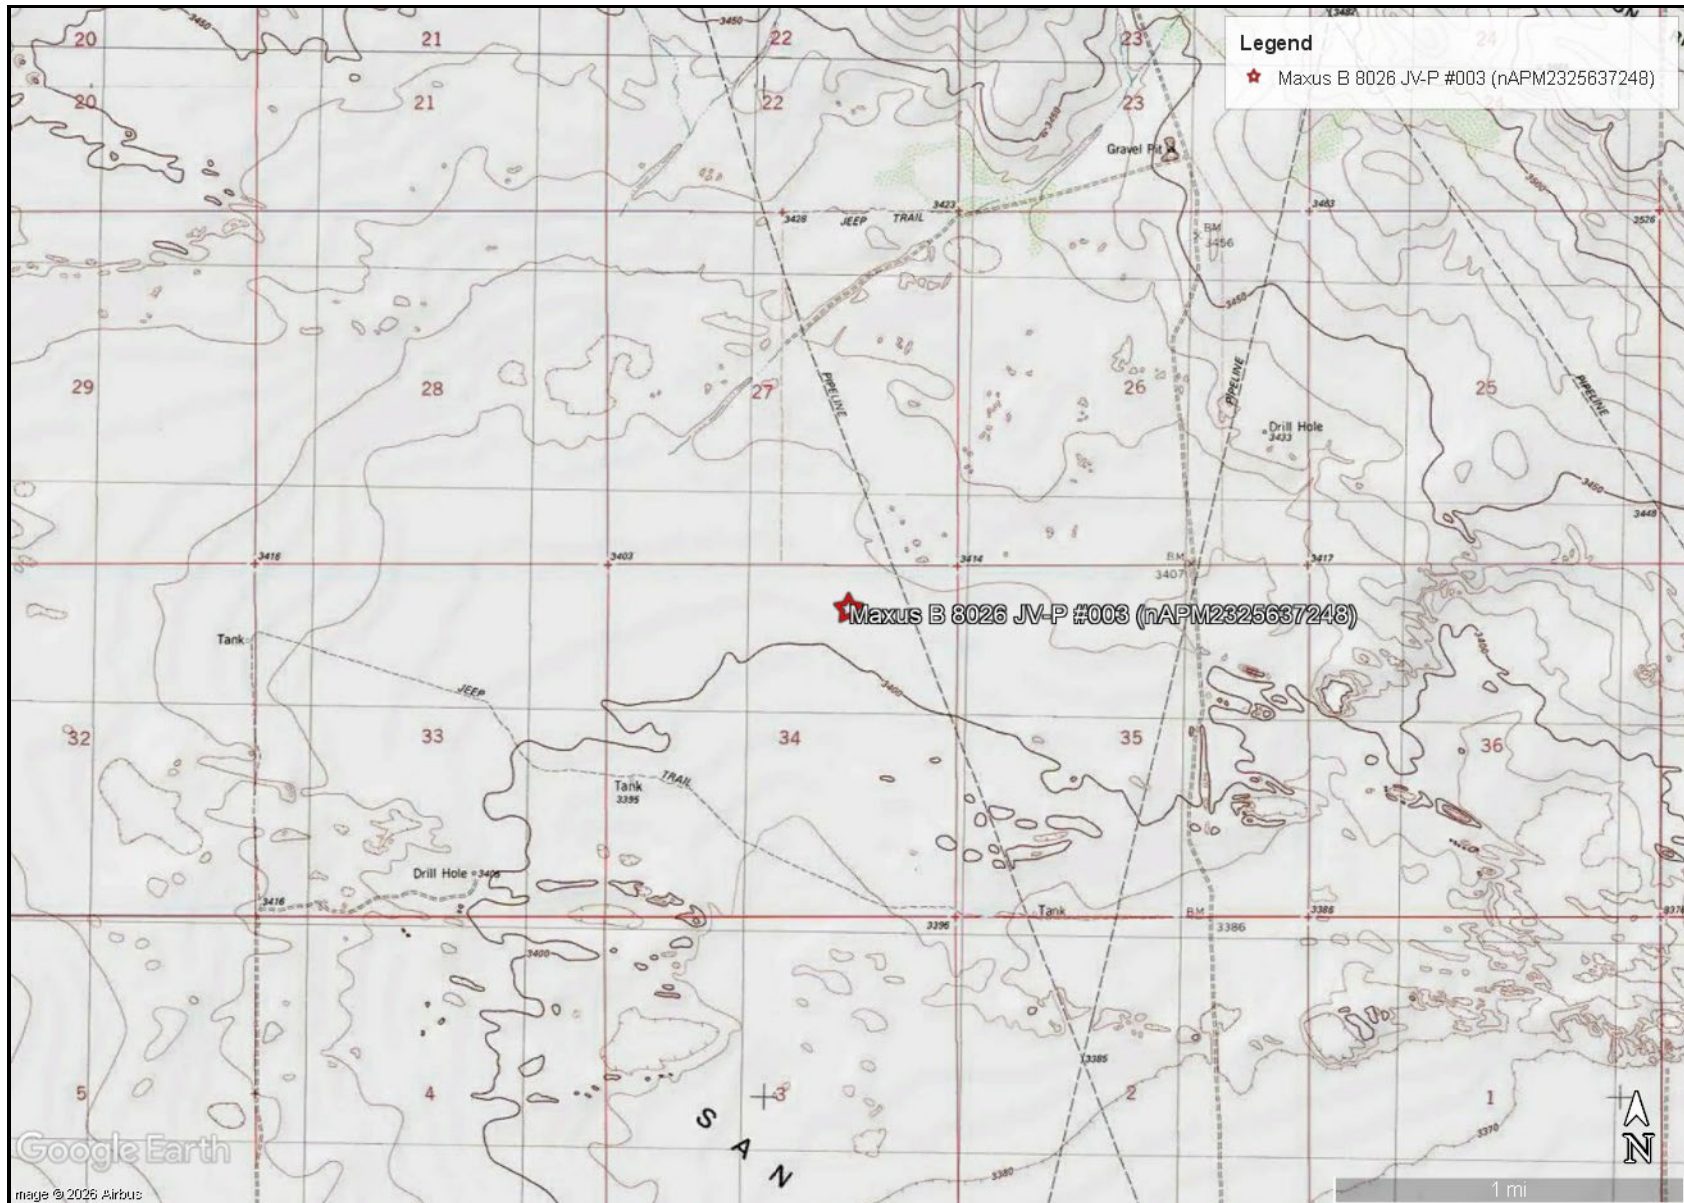

<p>TOPOGRAPHIC MAP BTA OIL PRODUCERS, LLC MAXUS B 8026 JV-P #003 (04.24.2007) LEA COUNTY, NEW MEXICO 32.3536034°, -103.4546661°</p>	<p>CARMONA RESOURCES </p>	<p>FIGURE 2</p>
---	--	-----------------



SAMPLE LOCATION MAP  
BTA OIL PRODUCERS, LLC  
MAXUS B 8026 JV-P #003 (04.24.2007)  
LEA COUNTY, NEW MEXICO  
32.3536034°, -103.4546661°



FIGURE 3

## APPENDIX A

CARMONA RESOURCES



**Table 1  
BTA Oil Producers  
Maxus B 8026 JV-P #003 (04.24.2007)  
Lea County, New Mexico**

Sample ID	Date	Depth (ft)	TPH (mg/kg)				Benzene (mg/kg)	Toluene (mg/kg)	Ethlybenzene (mg/kg)	Xylene (mg/kg)	Total BTEX (mg/kg)	Chloride (mg/kg)
			GRO	DRO	MRO	Total						
S-1	1/14/2026	0-1'	<49.6	<49.6	<49.6	<49.6	<0.00200	<0.00200	<0.00200	<0.00400	<0.00400	<9.96
	"	2.0'	<49.8	<49.8	<49.8	<49.8	<0.00200	<0.00200	<0.00200	<0.00399	<0.00399	<9.96
	"	3.0'	<50.1	<50.1	<50.1	<50.1	<0.00201	<0.00201	<0.00201	<0.00402	<0.00402	<9.98
	"	4.0'	<50.0	<50.0	<50.0	<50.0	<0.00202	<0.00202	0.00276	<0.00404	<0.00404	<9.92
S-2	1/14/2026	0-1'	<50.0	<50.0	<50.0	<50.0	<0.00199	<0.00199	<0.00199	<0.00398	<0.00398	<10.0
	"	2.0'	<50.1	<50.1	<50.1	<50.1	<0.00200	<0.00200	<0.00200	<0.00399	<0.00399	<10.0
	"	3.0'	<49.8	<49.8	<49.8	<49.8	<0.00201	<0.00201	<0.00201	<0.00402	<0.00402	<10.1
	"	4.0'	<49.7	<49.7	<49.7	<49.7	<0.00202	<0.00202	<0.00202	<0.00404	<0.00404	<9.94
S-3	1/14/2026	0-1'	<50.3	<50.3	<50.3	<50.3	<0.00199	<0.00199	0.00250	<0.00398	<0.00398	<9.92
	"	2.0'	<50.0	<50.0	<50.0	<50.0	<0.00200	<0.00200	<0.00200	<0.00399	<0.00399	<9.98
	"	3.0'	<49.8	<49.8	<49.8	<49.8	<0.00201	<0.00201	<0.00201	<0.00402	<0.00402	<10.0
	"	4.0'	<50.1	<50.1	<50.1	<50.1	<0.00202	<0.00202	<0.00202	<0.00404	<0.00404	<9.92
S-4	1/14/2026	0-1'	<50.0	<50.0	<50.0	<50.0	<0.00199	<0.00199	<0.00199	0.00647	0.00647	<9.90
	"	2.0'	<50.1	<50.1	<50.1	<50.1	<0.00200	<0.00200	0.00426	<0.00399	0.00627	<10.1
	"	3.0'	<50.0	<50.0	<50.0	<50.0	<0.00201	<0.00201	0.00257	0.00452	0.00709	<9.94
	"	4.0'	<50.2	<50.2	<50.2	<50.2	<0.00200	<0.00200	<0.00200	<0.00401	<0.00401	<9.92
S-5	1/14/2026	0-1'	<49.8	<49.8	<49.8	<49.8	<0.00199	<0.00199	<0.00199	<0.00398	<0.00398	<9.98
	"	2.0'	<49.7	<49.7	<49.7	<49.7	<0.00200	<0.00200	<0.00200	<0.00399	<0.00399	<9.92
	"	3.0'	<50.3	<50.3	<50.3	<50.3	<0.00201	<0.00201	<0.00201	<0.00402	<0.00402	<10.0
	"	4.0'	<49.8	<49.8	<49.8	<49.8	<0.00202	<0.00202	<0.00202	<0.00404	<0.00404	<10.1
H-1	1/14/2026	0-0.5'	<49.8	<49.8	<49.8	<49.8	<0.00201	<0.00201	<0.00201	<0.00402	<0.00402	<9.96
H-2	1/14/2026	0-0.5'	<50.1	<50.1	<50.1	<50.1	<0.00200	<0.00200	<0.00200	<0.00401	<0.00401	<10.1
H-3	1/14/2026	0-0.5'	<49.7	<49.7	<49.7	<49.7	<0.00202	<0.00202	<0.00202	<0.00403	<0.00403	<10.0
H-4	1/14/2026	0-0.5'	<50.1	<50.1	<50.1	<50.1	<0.00199	<0.00199	<0.00199	<0.00398	<0.00398	<10.0
<b>Regulatory Criteria<sup>A</sup></b>						<b>100 mg/kg</b>	<b>10 mg/kg</b>				<b>50 mg/kg</b>	<b>600 mg/kg</b>

(-) Not Analyzed

<sup>A</sup> - Table 1 - 19.15.29 NMAC

mg/kg - milligram per kilogram

TPH - Total Petroleum Hydrocarbons

ft - feet

(S) - Soil Sample

(H) - Horizontal Sample

## APPENDIX B

CARMONA RESOURCES



# PHOTOGRAPHIC LOG

## BTA Oil Producers, LLC

### Photograph No. 1

**Facility:** Maxus B 8026 JV-P #003  
(04.24.2007)

**County:** Lea County, New Mexico

**Description:**  
View North of sampling area.




### Photograph No. 2

**Facility:** Maxus B 8026 JV-P #003  
(04.24.2007)

**County:** Lea County, New Mexico

**Description:**  
View Southwest of sampling area.

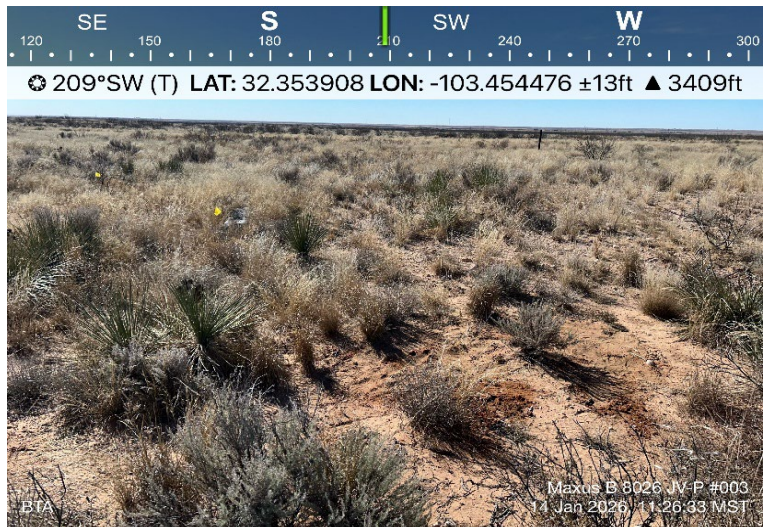


### Photograph No. 3

**Facility:** Maxus B 8026 JV-P #003  
(04.24.2007)

**County:** Lea County, New Mexico

**Description:**  
View Northwest of sampling area.

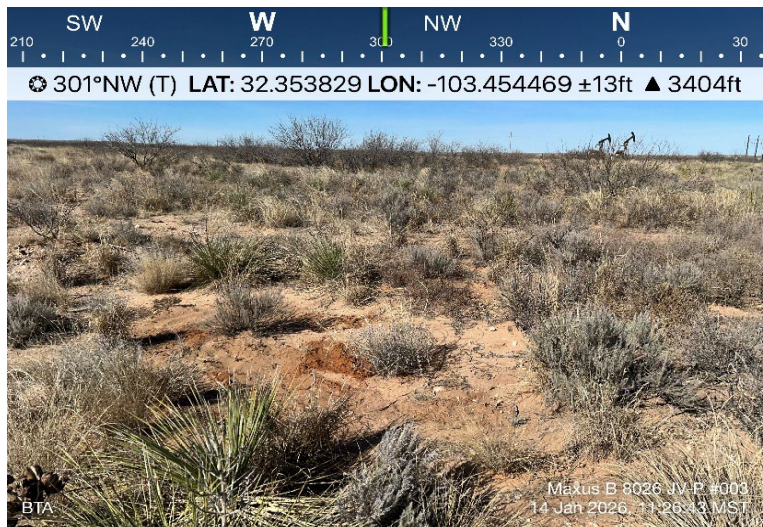

## APPENDIX C

CARMONA RESOURCES



District I  
1625 N. French Dr., Hobbs, NM 88240

District II  
1301 W. Grand Avenue, Artesia, NM 88210

District III  
1000 Rio Brazos Road, Aztec, NM 87410

District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources

Form C-141  
Revised June 10, 2003

Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form.

Release Notification and Corrective Action

OPERATOR

Initial Report  Final Report

Name of Company	BTA Oil Producers	Contact	Royce Boyce	Operations Manager
Address	104 South Pecos	Midland, TX 79701-9988	Telephone No.	432-682-3753
Facility Name	Maxus B Federal 003		Facility Type	Oil Well (P&A)

Surface Owner	State of NM	Mineral Owner	BLM	API No.:	30-025- 30661
---------------	-------------	---------------	-----	----------	---------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from North Line	Feet from East Line	Longitude-W	Latitude-N	County
B	34	22S	34E	660	1650	103deg 27.283'	32deg 21.216'	Lea

NATURE OF RELEASE

Type of Release	Crude Oil	Volume of Release	> 5 bbl	Volume Recovered	0 bbl
Source of Release	Separator Blow Down Line	Date and Hour of Occurrence	Over Time	Date and Hour of Discovery	NA
Was Immediate Notice Given?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Not Required	If YES, To Whom?			
By Whom?		Date and Hour			
Was a Watercourse Reached?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	If YES, Volume Impacting the Watercourse			

WTR 150'

If a Watercourse was Impacted, Describe Fully\*

RP-1298  
1285

Describe Cause of Problem and Remedial Action Taken. \*

Oil from separator blow down has been sprayed directly onto ground north of separator. Well no longer in operation.

Describe Area Affected and Cleanup Action Taken. \*

The area affected is approximately 1,200-ft<sup>2</sup> immediately north of the separator unit. Contaminant depth unknown at this time. Hungry Horse, LLC, Hobbs, NM contracted to perform site delineation and remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:		<b>OIL CONSERVATION DIVISION</b>	
Printed Name:	John Good	Approved by District Supervisor:	
Title:	Env. Manager, Hungry Horse LLC	Approval Date:	6.15.07
E-Mail Address:	jcgood4614@aol.com	Expiration Date:	8.15.07
Date:	4/24/2007	Phone:	505-631-3277
		Conditions of Approval:	<input type="checkbox"/> Attached

APPROVAL FOR DELINEATION ONLY. THIS IS A 'KNOWING

**HUNGRY HORSE, LLC**

15

BTA Maxus B Fed 003

& WILLFUL VIOLATION OF NMAC.

**Ashton Thielke**

---

**From:** Rodgers, Scott, EMNRD <Scott.Rodgers@emnrd.nm.gov>  
**Sent:** Tuesday, December 16, 2025 4:33 PM  
**To:** Noah Tinker  
**Cc:** Bratcher, Michael, EMNRD; Ashton Thielke  
**Subject:** RE: [EXTERNAL] nPAC0716945342 Cancellation & nAPM2325637248 Site Assessment Plan

Good afternoon,

For incident #nAPM2325637248, the OCD conditionally approves of the plan presented below. Please collect from five sample points each going down to 4' and pulling samples from each 1' depth interval to vertically delineate the spill area. Also, collect four (4) grab samples to horizontally define the area of concern.

For incident #nPAC0716945342, there is a separator on this site that is visible from the 2012 google earth image. It appears that it might be plumbed into a blowdown in the pasture area like incident nAPM2325637248. OCD is requesting sampling in this area (32.342225, -103.451594 ). Please complete sampling in a 6-foot by 6-foot area to the coordinates given. We are requesting sampling from five sample points pulling samples from each 1' depth interval down to four feet. The five sample points should be completed with one sample point in each corner and one directly in the middle, like the number 5 on a dice.

Thank you and please let me know if you have any questions,  
Scott

**Scott Rodgers** • Environmental Specialist – Adv.  
Environmental Bureau  
EMNRD - Oil Conservation Division  
5200 Oakland NE, Suite B | Albuquerque, NM 87113  
505.469.1830 | [scott.rodgers@emnrd.nm.gov](mailto:scott.rodgers@emnrd.nm.gov)  
<http://www.emnrd.nm.gov/oed>



---

**From:** Noah Tinker <ntinker@btaoil.com>  
**Sent:** Monday, December 15, 2025 12:27 PM  
**To:** Rodgers, Scott, EMNRD <Scott.Rodgers@emnrd.nm.gov>  
**Cc:** Velez, Nelson, EMNRD <Nelson.Velez@emnrd.nm.gov>; Bratcher, Michael, EMNRD <mike.bratcher@emnrd.nm.gov>; Ashton Thielke <thielkea@carmonaresources.com>  
**Subject:** [EXTERNAL] nPAC0716945342 Cancellation & nAPM2325637248 Site Assessment Plan

CAUTION: This email originated outside of our organization. Exercise caution prior to clicking on links or opening attachments.

Good afternoon Mr. Rogers,

I have done some additional digging into this release and have found some additional information to help cancel the (nPAC0716945342) incident as we believe it is a duplicate.

Both nAPM2325637248 & nPAC0716945342 have the same spill date, spill description, and spill volume.

I have found the "Site Abandonment Plan" from April 24, 2007 under the "orders" section of "nAPM2325637248B".

In that plan, you will see the spill description on page 3, "Blow-down line of separator installed to discharge off-site into pasture."

You will see on page 10, a spill location and description of the release area which correlates with the "MAXUS B 8026 JV-P #003" (32.353600°, -103.454717°)

You will see that all of this information is the same information duplicated on nPAC0716945342 MAXUS B 8026 JV-P #001 incident page.

Additionally, I have come across a closure report in my internal files from 2019 drafted by NTG that shows some assessment data from the release area.

The data collected in 2019 looks to be in compliance with previous 1993 standards but going off of current (2018) standards, there is some minor hydrocarbon impact in place.

To close out this release (and the other duplicated incident), I am proposing to send Carmona Resources to the site to conduct an additional site assessment.

They will install two (2) sample points (S-1 & S-2) to vertically delineate the area of concern. Samples will be collected from surface to 4.0' below ground surface.

Additionally, during that site assessment they will collect 200sqft composite surface samples to verify that no impact is left on the surface.

They will also collect four (4) horizontal grab samples to horizontally define the area of concern.

Prior to arriving onsite, a C-141N will be submitted via webportal, describing what's listed above.

Please let me know if you have any questions!

Thanks!

Noah Tinker

BTA Oil Producers

---

From: [OCDOnline@state.nm.us](mailto:OCDOnline@state.nm.us) <[OCDOnline@state.nm.us](mailto:OCDOnline@state.nm.us)>

Sent: Friday, August 29, 2025 4:44 PM

To: Noah Tinker <[ntinker@btaoil.com](mailto:ntinker@btaoil.com)>

Subject: The Oil Conservation Division (OCD) has rejected the application, Application ID: 482527

**Caution:** This email originated from outside of BTA. Do not click links or open attachments unless you recognize the sender and know the content is safe.

To whom it may concern (c/o Noah Tinker for BTA OIL PRODUCERS, LLC),

The OCD has rejected the submitted *Request to Cancel the Notification of a Release* (C-141C), for incident ID (n#) nPAC0716945342,

for the following reasons:

- **The cancellation request is denied. The two incidents appear to be from different wells with different GPS coordinates. Please provide more information such as initial C-141's ect. to show that the incidents are duplicates.**

The rejected C-141C can be found in the OCD Online: Permitting - Action Status, under the Application ID: 482527.

Please review and make the required correction(s) prior to resubmitting.

If you have any questions why this application was rejected or believe it was rejected in error, please contact me prior to submitting an additional C-141C.

Thank you,

Scott Rodgers

Environmental Specialist - A

505-469-1830

[scott.rodgers@emnrd.nm.gov](mailto:scott.rodgers@emnrd.nm.gov)

**New Mexico Energy, Minerals and Natural Resources Department**

1220 South St. Francis Drive

Santa Fe, NM 87505

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico  
Energy, Minerals and Natural Resources  
Oil Conservation Division  
1220 S. St Francis Dr.  
Santa Fe, NM 87505**

QUESTIONS

Action 541720

**QUESTIONS**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 541720
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

**QUESTIONS**

<b>Prerequisites</b>	
Incident ID (n#)	nAPM2325637248
Incident Name	NAPM2325637248 MAXUS B 8026 JV-P #003 @ 30-025-30661
Incident Type	Oil Release
Incident Status	Remediation Plan Approved
Incident Well	[30-025-30661] MAXUS B 8026 JV-P #003

<b>Location of Release Source</b>	
Site Name	MAXUS B 8026 JV-P #003
Date Release Discovered	04/24/2007
Surface Owner	State

<b>Sampling Event General Information</b>	
<i>Please answer all the questions in this group.</i>	
What is the sampling surface area in square feet	500
What is the estimated number of samples that will be gathered	11
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	01/14/2026
Time sampling will commence	09:00 AM
Please provide any information necessary for observers to contact samplers	Carmona Resources – 432-813-8988
Please provide any information necessary for navigation to sampling site	(32.353871°, -103.454495°) Carmona Resources will be onsite to assess the site per NMOCD request "Please collect from five sample points each going down to 4' and pulling samples from each 1' depth interval to vertically delineate the spill area. Also, collect four (4) grab samples to horizontally define the area of concern."

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 541720

**CONDITIONS**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 541720
	Action Type: [NOTIFY] Notification Of Sampling (C-141N)

**CONDITIONS**

Created By	Condition	Condition Date
ntinker	Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.	1/9/2026
ntinker	If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.	1/9/2026

## APPENDIX D

CARMONA RESOURCES



### Nearest water well

BTA OIL PRODUCERS

**Legend**

- 0.50 Mile Radius
- 0.63 Miles
- 1.26 Miles
- MAXUS B 8026 JV-P #003 (04.24.2007)
- NMSEO Water Well



305' - Drilled 2019

MAXUS B 8026 JV-P #003 (04.24.2007)



200' - Drilled 2019




**Low Karst**

BTA OIL PRODUCERS

**Legend**

-  Low
-  MAXUS B 8026 JV-P #003 (04.24.2007)

MAXUS B 8026 JV-P #003 (04.24.2007)





# New Mexico Office of the State Engineer

## Water Column/Average Depth to Water

(A CLW##### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced, O=orphaned, C=the file is closed)

(quarters are smallest to largest)

(meters)

(In feet)

POD Number	Code	Sub basin	County	Q64	Q16	Q4	Sec	Tws	Range	X	Y	Map	Distance	Well Depth	Depth Water	Water Column
<a href="#">CP 01740 POD1</a>		CP	LE	NW	NW	NW	34	22S	34E	644401.8	3580765.5	●	1015	600	560	40
<a href="#">CP 01826 POD1</a>		CP	LE	NW	NW	NW	34	22S	34E	644379.1	3580778.4	●	1038	698	180	518
<a href="#">CP 01803 POD1</a>		CP	LE	NW	NW	NW	34	22S	34E	644356.8	3580786.1	●	1061	240	180	60
<a href="#">CP 01802 POD1</a>		CP	LE	NE	NE	NE	35	22S	34E	647437.4	3580847.4	●	2025	200	0	200
<a href="#">CP 00704</a>		CP	LE		NE	SE	22	22S	34E	645681.0	3583097.0 *	●	2398	600		
<a href="#">CP 01845 POD1</a>		CP	LE	SE	SE	SW	33	22S	34E	643396.2	3579337.3	●	2443	880	293	587
<a href="#">CP 01684 POD1</a>		CP	LE	NE	NW	SE	23	22S	34E	646932.2	3583129.0	●	2852	300		
<a href="#">CP 01706 POD1</a>		CP	LE	SE	SE	NE	32	22S	34E	642603.4	3580185.5	●	2861	340	282	58
<a href="#">CP 01705 POD1</a>		CP	LE	SE	SE	NE	32	22S	34E	642587.8	3580179.1	●	2878	700	305	395
<a href="#">CP 01829 POD1</a>		CP	LE	SE	SE	NE	32	22S	34E	642559.1	3580172.5	●	2907	1410	1150	260
<a href="#">CP 02004 POD1</a>		CP	LE	SW	SE	SW	36	22S	34E	648081.4	3579439.3	●	2954	105		
<a href="#">CP 00598 POD1</a>		CP	LE		SE	NW	23	22S	34E	646480.0	3583511.0 *	●	2993	70		
<a href="#">CP 01844 POD1</a>		CP	LE	SW	SW	SW	33	22S	34E	642763.8	3579308.3	●	3001	960	295	665
<a href="#">CP 01718 POD1</a>		CP	LE	NE	SW	SW	24	22S	34E	647700.1	3582811.2	●	3101	1172	855	317
<a href="#">CP 01840 POD1</a>		CP	LE	NW	NW	NW	11	23S	34E	646007.0	3577597.5	●	3171	969	285	684
<a href="#">CP 01841 POD1</a>		CP	LE	SW	SW	SW	03	23S	34E	644389.5	3577684.8	●	3197	650	295	355
<a href="#">CP 01683 POD1</a>		CP	LE	NE	SW	NE	23	22S	34E	646949.4	3583562.0	●	3235	300		
<a href="#">CP 01719 POD1</a>		CP	LE	SE	SE	SW	24	22S	34E	648215.0	3582680.2	●	3421	1173	838	335
<a href="#">CP 01842 POD1</a>		CP	LE	NW	NW	NE	32	22S	34E	641960.2	3580777.3	●	3456	1083	305	778
<a href="#">CP 01682 POD1</a>		CP	LE	NW	NE	NE	23	22S	34E	647163.5	3583992.4	●	3715	294	42	252
<a href="#">CP 01622 POD1</a>		CP	LE	NW	SW	SW	04	23S	34E	642829.6	3577872.3	●	3841	575	285	290
<a href="#">E 07616 POD1</a>		E	TO							646466.1	3576970.3	●	3887	500	300	200

Average Depth to Water: **379 feet**

Minimum Depth: **0 feet**

Maximum Depth: **1150 feet**

**Record Count:** 22

**UTM Filters (in meters):**

**Easting:** 645416.00

**Northing:** 3580713.00

**Radius:** 4000

\* UTM location was derived from PLSS - see Help

The data is furnished by the NMOSE/ISC and is accepted by the recipient with the expressed understanding that the OSE/ISC make no warranties, expressed or implied, concerning the accuracy, completeness, reliability, usability, or suitability for any particular purpose of



# WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

[www.ose.state.nm.us](http://www.ose.state.nm.us)

STATE ENGINEER OFFICE  
ROSWELL, NEW MEXICO

2019 OCT 17 PM 1:22

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) CP-1740-POD1		WELL TAG ID NO.		OSE FILE NO(S).			
	WELL OWNER NAME(S) Limestone Basin Properties Ranch, LLC				PHONE (OPTIONAL) 210-835-8057			
	WELL OWNER MAILING ADDRESS 3300 N. A Street, Bldg. 1, Ste. 220				CITY Midland	STATE ZIP TX 79705		
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE 32	MINUTES 21	SECONDS 16.2	N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND * DATUM REQUIRED: WGS 84		
LONGITUDE 103 27 55.3 W								
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE								
2. DRILLING & CASING INFORMATION	LICENSE NO. WD1706		NAME OF LICENSED DRILLER Bryce Wallace		NAME OF WELL DRILLING COMPANY Elite Drillers Corporation			
	DRILLING STARTED 03/15/19	DRILLING ENDED 09/26/19	DEPTH OF COMPLETED WELL (FT) 600	BORE HOLE DEPTH (FT) 700	DEPTH WATER FIRST ENCOUNTERED (FT) 560			
	COMPLETED WELL IS: <input checked="" type="checkbox"/> ARTESIAN <input type="checkbox"/> DRY HOLE <input type="checkbox"/> SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) 305			
	DRILLING FLUID: <input type="checkbox"/> AIR <input checked="" type="checkbox"/> MUD ADDITIVES - SPECIFY:							
	DRILLING METHOD: <input checked="" type="checkbox"/> ROTARY <input type="checkbox"/> HAMMER <input type="checkbox"/> CABLE TOOL <input type="checkbox"/> OTHER - SPECIFY:							
	DEPTH (feet bgl)		BORE HOLE DIAM (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	+1	20	20	ASTM53 Grade B	Welded	15.5	.25	
	+3	300	14.75	ASTM53 Grade B	Welded	8.125	.25	
	300	600	14.75	SDR17 PVC Screen	Spline	7.6	.51	.032
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						
	0	20	20	Portland I/II Cement	16	Tremie		
	+1	295	14.75	Portland I/II Cement	245	Tremie		
	295	600	14.75	Silica Sand 8/16	273	Pour		

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06/30/17)


FILE NO. <u>CP-1740</u>	POD NO. <u>1</u>	TRN NO. <u>637130</u>
LOCATION <u>111 T22S R34E Sec 34</u>	WELL TAG ID NO. <u>NA</u>	PAGE 1 OF 2

4. HYDROGEOLOGIC LOG OF WELL	DEPTH (feet bgl)		THICKNESS (feet)	COLOR AND TYPE OF MATERIAL ENCOUNTERED - INCLUDE WATER-BEARING CAVITIES OR FRACTURE ZONES (attach supplemental sheets to fully describe all units)	WATER BEARING? (YES / NO)	ESTIMATED YIELD FOR WATER-BEARING ZONES (gpm)
	FROM	TO				
	0	10	10	Sandy Topsoil	Y ✓ N	
	10	50	40	Caliche	Y ✓ N	
	50	85	35	Red/Brown Clay	Y ✓ N	
	85	210	125	Tan/Brown/White Sandstone	Y ✓ N	
	210	420	210	Red/Brown Clay	Y ✓ N	
	420	520	100	Red Clay/Red Siltstone	Y ✓ N	
	520	580	60	Red/Gray Sandstone with Gray Clay	✓ Y N	60.00
	580	640	60	Reddish-Brown Clay	Y ✓ N	
	640	700	60	Red Clay/Red Siltstone	Y ✓ N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
METHOD USED TO ESTIMATE YIELD OF WATER-BEARING STRATA:					TOTAL ESTIMATED WELL YIELD (gpm):	
<input type="checkbox"/> PUMP <input checked="" type="checkbox"/> AIR LIFT <input type="checkbox"/> BAILER <input type="checkbox"/> OTHER - SPECIFY:					60.00	

5. TEST; RIG SUPERVISION	WELL TEST	TEST RESULTS - ATTACH A COPY OF DATA COLLECTED DURING WELL TESTING, INCLUDING DISCHARGE METHOD, START TIME, END TIME, AND A TABLE SHOWING DISCHARGE AND DRAWDOWN OVER THE TESTING PERIOD.
	MISCELLANEOUS INFORMATION:	
	PRINT NAME(S) OF DRILL RIG SUPERVISOR(S) THAT PROVIDED ONSITE SUPERVISION OF WELL CONSTRUCTION OTHER THAN LICENSEE:	

6. SIGNATURE	THE UNDERSIGNED HEREBY CERTIFIES THAT, TO THE BEST OF HIS OR HER KNOWLEDGE AND BELIEF, THE FOREGOING IS A TRUE AND CORRECT RECORD OF THE ABOVE DESCRIBED HOLE AND THAT HE OR SHE WILL FILE THIS WELL RECORD WITH THE STATE ENGINEER AND THE PERMIT HOLDER WITHIN 20 DAYS AFTER COMPLETION OF WELL DRILLING:	
	 Bryce Wallace	10/14/2019
SIGNATURE OF DRILLER / PRINT SIGNEE NAME		DATE

STATE ENGINEER OFFICE  
ROSWELL, NEW MEXICO

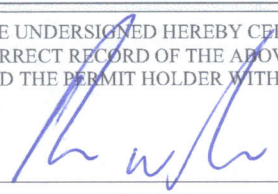FOR OSE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 06/30/2017)	
FILE NO. CP-1740	POD NO. 1	TRN NO. 637130	
LOCATION 111 T22S R34E Sec 34	WELL TAG ID NO. NA	PAGE 2 OF 2	



# WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

www.ose.state.nm.us

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) CP-1802		WELL TAG ID NO. 22472		OSE FILE NO(S)			
	WELL OWNER NAME(S) LIMESTONE BASIN PROPERTIES RANCH LLC				PHONE (OPTIONAL)			
	WELL OWNER MAILING ADDRESS 3300 N A STREET, BLDG 1, STE 220				CITY MIDLAND	STATE TX	ZIP 79705	
	WELL LOCATION (FROM GPS)	LATITUDE	DEGREES 32	MINUTES 21	SECONDS 17.43	* ACCURACY REQUIRED: ONE TENTH OF A SECOND		
	LONGITUDE	103	25	59.15	* DATUM REQUIRED: WGS 84			
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE NE 1/4 NE 1/4 NE 1/4 S35 T22S R34E								
2. DRILLING & CASING INFORMATION	LICENSE NO. WD1706		NAME OF LICENSED DRILLER BRYCE WALLACE			NAME OF WELL DRILLING COMPANY ELITE DRILLERS CORPORATION		
	DRILLING STARTED 11/07/19	DRILLING ENDED 11/09/19	DEPTH OF COMPLETED WELL (FT) 200	BORE HOLE DEPTH (FT) 200	DEPTH WATER FIRST ENCOUNTERED (FT) N/A			
	COMPLETED WELL IS: <input type="checkbox"/> ARTESIAN <input checked="" type="checkbox"/> DRY HOLE <input type="checkbox"/> SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) N/A			
	DRILLING FLUID: <input type="checkbox"/> AIR <input checked="" type="checkbox"/> MUD ADDITIVES SPECIFY:							
	DRILLING METHOD: <input checked="" type="checkbox"/> ROTARY <input type="checkbox"/> HAMMER <input type="checkbox"/> CABLE TOOL <input type="checkbox"/> OTHER SPECIFY:							
	DEPTH (feet bgl)		BORE HOLE DIAM (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	0	160	7 7/8	SDR17 PVC	SPLINE	4.28	SDR17	
	160	200	7 7/8	SDR17 PVC	SPLINE	4.28	SDR17	.32
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						
	25	200	7 7/8	8/16 SILICA SAND	40	POUR		
	0	25	7 7/8	PORTLAND CEMENT	6	POUR		

2020 FEB 13 PM 4:28  
 STATE ENGINEER OFFICE  
 1000 W. UNIVERSITY AVENUE  
 ALBUQUERQUE, NM 87102

FOR OSE INTERNAL USE

FILE NO. <b>CP-1802</b>	POD NO. <b>1</b>	WR-20 WELL RECORD & LOG (Version 04/30/19)
LOCATION <b>Line 22. 34. 35. 222</b>	WELL TAG ID NO. <b>22472</b>	TRN NO. <b>659873</b>
		PAGE 1 OF 2




# MAXUS B 8026 JV-P #003 (04.24.2007)



1/21/2026

World\_Hillshade




Esri, NASA, NGA, USGS, FEMA, Sources: Esri, TomTom, Garmin, FAO, NOAA, USGS, (c) OpenStreetMap contributors, and the GIS User

# MAXUS B 8026 JV-P #003 (04.24.2007)



1/22/2026, 8:57:02 AM

1:144,448



Esri, NASA, NGA, USGS, Sources: Esri, TomTom, Garmin, FAO, NOAA, USGS, © OpenStreetMap contributors, and the GIS User Community





**U.S. Fish and Wildlife Service**  
**National Wetlands Inventory**




MAXUS B 8026 JV-P #003 (04.24.2007)






January 22, 2026

**Wetlands**

-  Estuarine and Marine Deepwater
-  Estuarine and Marine Wetland

-  Freshwater Emergent Wetland
-  Freshwater Forested/Shrub Wetland
-  Freshwater Pond

-  Lake
-  Other
-  Riverine

This map is for general reference only. The US Fish and Wildlife Service is not responsible for the accuracy or currentness of the base data shown on this map. All wetlands related data should be used in accordance with the layer metadata found on the Wetlands Mapper web site.

# APPENDIX E

CARMONA RESOURCES





Environment Testing

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

# ANALYTICAL REPORT

## PREPARED FOR

Attn: Ashton Thielke  
 Carmona Resources  
 310 W Wall St  
 Ste 500  
 Midland, Texas 79701

Generated 1/29/2026 2:18:50 PM Revision 1

## JOB DESCRIPTION

Maxus B 8026 JV-P #003 (04.24.2007)  
 Lea County, New Mexico

## JOB NUMBER

880-67025-1

Eurofins Midland  
 1211 W. Florida Ave  
 Midland TX 79701



# Eurofins Midland

## Job Notes

This report may not be reproduced except in full, and with written approval from the laboratory. The results relate only to the samples tested. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

Analytical test results meet all requirements of the associated regulatory program (i.e., NELAC (TNI), DoD, and ISO 17025) unless otherwise noted under the individual analysis.

## Authorization



Generated  
1/29/2026 2:18:50 PM  
Revision 1

Authorized for release by  
Jessica Kramer, Project Manager  
[Jessica.Kramer@et.eurofinsus.com](mailto:Jessica.Kramer@et.eurofinsus.com)  
(432)704-5440

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Laboratory Job ID: 880-67025-1  
SDG: Lea County, New Mexico

# Table of Contents

Cover Page . . . . .	1
Table of Contents . . . . .	3
Definitions/Glossary . . . . .	4
Case Narrative . . . . .	5
Client Sample Results . . . . .	6
Surrogate Summary . . . . .	21
QC Sample Results . . . . .	23
QC Association Summary . . . . .	29
Lab Chronicle . . . . .	34
Certification Summary . . . . .	41
Method Summary . . . . .	42
Sample Summary . . . . .	43
Chain of Custody . . . . .	44
Receipt Checklists . . . . .	46

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

## Definitions/Glossary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

## Qualifiers

## GC VOA

Qualifier	Qualifier Description
S1+	Surrogate recovery exceeds control limits, high biased.
U	Indicates the analyte was analyzed for but not detected.

## GC Semi VOA

Qualifier	Qualifier Description
F1	MS and/or MSD recovery exceeds control limits.
S1+	Surrogate recovery exceeds control limits, high biased.
U	Indicates the analyte was analyzed for but not detected.

## HPLC/IC

Qualifier	Qualifier Description
U	Indicates the analyte was analyzed for but not detected.

## Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
☼	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

## Case Narrative

Client: Carmona Resources  
Project: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1

**Job ID: 880-67025-1**

**Eurofins Midland**

### Job Narrative 880-67025-1

#### REVISION

The report being provided is a revision of the original report sent on 1/20/2026. The report (revision 1) is being revised due to Per client email, requesting all pages of COC to be in report.

The analytical test results presented in this report meet all requirements of the associated regulatory program listed on the Accreditation/Certification Summary Page, unless otherwise noted. Data qualifiers and/or narrative comments are included to explain any exceptions, if applicable. Regulated compliance samples (e.g. SDWA, NPDES) must comply with associated agency requirements/permits.

- Matrix-specific batch QC (e.g., MS, MSD, SD) may not be reported when insufficient sample volume is available or when site-specific QC samples are not submitted. In such cases, a Laboratory Control Sample Duplicate (LCSD) may be analyzed to provide precision data for the batch.
- For samples analyzed using surrogate and/or isotope dilution analytes, any recoveries falling outside of established acceptance criteria are re-prepared and/or re-analyzed to confirm results, unless the deviation is due to sample dilution or otherwise explained in the case narrative.

#### **Receipt**

The samples were received on 1/14/2026 5:00 PM. Unless otherwise noted below, the samples arrived in good condition, and, where required, properly preserved and on ice. The temperature of the cooler at receipt time was 7.0°C.

#### **GC VOA**

Method 8021B: Surrogate recovery for the following samples were outside control limits: S-4 (0-1') (880-67025-13) and S-5 (4.0') (880-67025-20). Evidence of matrix interference is present; therefore, re-extraction and/or re-analysis was not performed.

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

#### **Diesel Range Organics**

Method 8015B NM: Surrogate recovery for the following sample was outside control limits: (880-67022-A-16-D MS). Evidence of matrix interference is present; therefore, re-extraction and/or re-analysis was not performed.

Method 8015B NM: Surrogate recovery for the following sample was outside control limits: (LCSD 880-129027/3-A). Evidence of matrix interference is present; therefore, re-extraction and/or re-analysis was not performed.

Method 8015B NM: Surrogate recovery for the following sample was outside control limits: (MB 880-129027/1-A). Evidence of matrix interferences is not obvious.

Method 8015B NM: The continuing calibration verification (CCV) associated with batch 880-129255 recovered above the upper control limit for Gasoline Range Organics (GRO)-C6-C10 and Diesel Range Organics (Over C10-C28). The samples associated with this CCV were non-detects for the affected analytes; therefore, the data have been reported. The associated sample is:(CCV 880-129255/59).

Method 8015B NM: The matrix spike / matrix spike duplicate (MS/MSD) recoveries for preparation batch 880-129032 and analytical batch 880-129255 were outside control limits for one or more analytes. See QC Sample Results for detail. Sample matrix interference and/or non-homogeneity are suspected because the associated laboratory control sample (LCS) recovery is within acceptance limits.

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

#### **HPLC/IC**

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Eurofins Midland

## Client Sample Results

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

Client Sample ID: S-1 (0-1')

Lab Sample ID: 880-67025-1

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:28	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:28	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:28	1
m,p-Xylenes	<0.00400	U	0.00400		mg/Kg		01/15/26 11:17	01/16/26 00:28	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:28	1
Xylenes, Total	<0.00400	U	0.00400		mg/Kg		01/15/26 11:17	01/16/26 00:28	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	92		70 - 130	01/15/26 11:17	01/16/26 00:28	1
1,4-Difluorobenzene (Surr)	95		70 - 130	01/15/26 11:17	01/16/26 00:28	1

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00400	U	0.00400		mg/Kg			01/16/26 00:28	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.6	U	49.6		mg/Kg			01/18/26 16:48	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.6	U	49.6		mg/Kg		01/15/26 10:58	01/18/26 16:48	1
Diesel Range Organics (Over C10-C28)	<49.6	U	49.6		mg/Kg		01/15/26 10:58	01/18/26 16:48	1
Oil Range Organics (Over C28-C36)	<49.6	U	49.6		mg/Kg		01/15/26 10:58	01/18/26 16:48	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	106		70 - 130	01/15/26 10:58	01/18/26 16:48	1
o-Terphenyl (Surr)	89		70 - 130	01/15/26 10:58	01/18/26 16:48	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.96	U	9.96		mg/Kg			01/15/26 18:14	1

Client Sample ID: S-1 (2.0')

Lab Sample ID: 880-67025-2

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:48	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:48	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:48	1
m,p-Xylenes	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 00:48	1
<b>o-Xylene</b>	<b>0.00236</b>		0.00200		mg/Kg		01/15/26 11:17	01/16/26 00:48	1
Xylenes, Total	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 00:48	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	108		70 - 130	01/15/26 11:17	01/16/26 00:48	1
1,4-Difluorobenzene (Surr)	92		70 - 130	01/15/26 11:17	01/16/26 00:48	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-1 (2.0')**

**Lab Sample ID: 880-67025-2**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00399	U	0.00399		mg/Kg			01/16/26 00:48	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.8	U	49.8		mg/Kg			01/18/26 17:03	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 17:03	1
Diesel Range Organics (Over C10-C28)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 17:03	1
Oil Range Organics (Over C28-C36)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 17:03	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	121		70 - 130	01/15/26 10:58	01/18/26 17:03	1
o-Terphenyl (Surr)	99		70 - 130	01/15/26 10:58	01/18/26 17:03	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.96	U	9.96		mg/Kg			01/15/26 18:35	1

**Client Sample ID: S-1 (3.0')**

**Lab Sample ID: 880-67025-3**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 01:09	1
Toluene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 01:09	1
Ethylbenzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 01:09	1
m,p-Xylenes	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 01:09	1
<b>o-Xylene</b>	<b>0.00265</b>		0.00201		mg/Kg		01/15/26 11:17	01/16/26 01:09	1
Xylenes, Total	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 01:09	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	109		70 - 130	01/15/26 11:17	01/16/26 01:09	1
1,4-Difluorobenzene (Surr)	95		70 - 130	01/15/26 11:17	01/16/26 01:09	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00402	U	0.00402		mg/Kg			01/16/26 01:09	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.1	U	50.1		mg/Kg			01/18/26 17:32	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 17:32	1
Diesel Range Organics (Over C10-C28)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 17:32	1

Eurofins Midland

## Client Sample Results

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

## Client Sample ID: S-1 (3.0')

Date Collected: 01/14/26 00:00

Date Received: 01/14/26 17:00

## Lab Sample ID: 880-67025-3

Matrix: Solid

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Oil Range Organics (Over C28-C36)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 17:32	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	115		70 - 130	01/15/26 10:58	01/18/26 17:32	1
o-Terphenyl (Surr)	95		70 - 130	01/15/26 10:58	01/18/26 17:32	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.98	U	9.98		mg/Kg			01/15/26 18:41	1

## Client Sample ID: S-1 (4.0')

Date Collected: 01/14/26 00:00

Date Received: 01/14/26 17:00

## Lab Sample ID: 880-67025-4

Matrix: Solid

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 01:29	1
Toluene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 01:29	1
Ethylbenzene	0.00276		0.00202		mg/Kg		01/15/26 11:17	01/16/26 01:29	1
m,p-Xylenes	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 01:29	1
o-Xylene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 01:29	1
Xylenes, Total	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 01:29	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	105		70 - 130	01/15/26 11:17	01/16/26 01:29	1
1,4-Difluorobenzene (Surr)	100		70 - 130	01/15/26 11:17	01/16/26 01:29	1

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00404	U	0.00404		mg/Kg			01/16/26 01:29	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.0	U	50.0		mg/Kg			01/18/26 17:47	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 17:47	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 17:47	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 17:47	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	113		70 - 130	01/15/26 10:58	01/18/26 17:47	1
o-Terphenyl (Surr)	95		70 - 130	01/15/26 10:58	01/18/26 17:47	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.92	U	9.92		mg/Kg			01/15/26 18:48	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-2 (0-1')**

**Lab Sample ID: 880-67025-5**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 01:50	1
Toluene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 01:50	1
Ethylbenzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 01:50	1
m,p-Xylenes	<0.00398	U	0.00398		mg/Kg		01/15/26 11:17	01/16/26 01:50	1
o-Xylene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 01:50	1
Xylenes, Total	<0.00398	U	0.00398		mg/Kg		01/15/26 11:17	01/16/26 01:50	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	94		70 - 130	01/15/26 11:17	01/16/26 01:50	1
1,4-Difluorobenzene (Surr)	87		70 - 130	01/15/26 11:17	01/16/26 01:50	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00398	U	0.00398		mg/Kg			01/16/26 01:50	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.0	U	50.0		mg/Kg			01/18/26 18:02	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 18:02	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 18:02	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 18:02	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	118		70 - 130	01/15/26 10:58	01/18/26 18:02	1
o-Terphenyl (Surr)	99		70 - 130	01/15/26 10:58	01/18/26 18:02	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/15/26 18:55	1

**Client Sample ID: S-2 (2.0')**

**Lab Sample ID: 880-67025-6**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 02:10	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 02:10	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 02:10	1
m,p-Xylenes	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 02:10	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 02:10	1
Xylenes, Total	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 02:10	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	101		70 - 130	01/15/26 11:17	01/16/26 02:10	1
1,4-Difluorobenzene (Surr)	95		70 - 130	01/15/26 11:17	01/16/26 02:10	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-2 (2.0')**

**Lab Sample ID: 880-67025-6**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00399	U	0.00399		mg/Kg			01/16/26 02:10	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.1	U	50.1		mg/Kg			01/18/26 18:17	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 18:17	1
Diesel Range Organics (Over C10-C28)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 18:17	1
Oil Range Organics (Over C28-C36)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 18:17	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	111		70 - 130	01/15/26 10:58	01/18/26 18:17	1
o-Terphenyl (Surr)	93		70 - 130	01/15/26 10:58	01/18/26 18:17	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/15/26 19:16	1

**Client Sample ID: S-2 (3.0')**

**Lab Sample ID: 880-67025-7**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 02:31	1
Toluene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 02:31	1
Ethylbenzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 02:31	1
m,p-Xylenes	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 02:31	1
o-Xylene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 02:31	1
Xylenes, Total	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 02:31	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	119		70 - 130	01/15/26 11:17	01/16/26 02:31	1
1,4-Difluorobenzene (Surr)	100		70 - 130	01/15/26 11:17	01/16/26 02:31	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00402	U	0.00402		mg/Kg			01/16/26 02:31	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.8	U	49.8		mg/Kg			01/18/26 18:31	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 18:31	1
Diesel Range Organics (Over C10-C28)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 18:31	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-2 (3.0')**

**Lab Sample ID: 880-67025-7**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Oil Range Organics (Over C28-C36)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 18:31	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
1-Chlorooctane (Surr)	113		70 - 130				01/15/26 10:58	01/18/26 18:31	1
o-Terphenyl (Surr)	96		70 - 130				01/15/26 10:58	01/18/26 18:31	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.1	U	10.1		mg/Kg			01/15/26 19:23	1

**Client Sample ID: S-2 (4.0')**

**Lab Sample ID: 880-67025-8**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 02:51	1
Toluene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 02:51	1
Ethylbenzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 02:51	1
m,p-Xylenes	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 02:51	1
<b>o-Xylene</b>	<b>0.00255</b>		0.00202		mg/Kg		01/15/26 11:17	01/16/26 02:51	1
Xylenes, Total	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 02:51	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
4-Bromofluorobenzene (Surr)	126		70 - 130				01/15/26 11:17	01/16/26 02:51	1
1,4-Difluorobenzene (Surr)	100		70 - 130				01/15/26 11:17	01/16/26 02:51	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00404	U	0.00404		mg/Kg			01/16/26 02:51	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.7	U	49.7		mg/Kg			01/18/26 18:47	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.7	U	49.7		mg/Kg		01/15/26 10:58	01/18/26 18:47	1
Diesel Range Organics (Over C10-C28)	<49.7	U	49.7		mg/Kg		01/15/26 10:58	01/18/26 18:47	1
Oil Range Organics (Over C28-C36)	<49.7	U	49.7		mg/Kg		01/15/26 10:58	01/18/26 18:47	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
1-Chlorooctane (Surr)	117		70 - 130				01/15/26 10:58	01/18/26 18:47	1
o-Terphenyl (Surr)	99		70 - 130				01/15/26 10:58	01/18/26 18:47	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.94	U	9.94		mg/Kg			01/15/26 19:30	1

Eurofins Midland

## Client Sample Results

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

Client Sample ID: S-3 (0-1')

Lab Sample ID: 880-67025-9

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 03:12	1
Toluene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 03:12	1
<b>Ethylbenzene</b>	<b>0.00250</b>		0.00199		mg/Kg		01/15/26 11:17	01/16/26 03:12	1
m,p-Xylenes	<0.00398	U	0.00398		mg/Kg		01/15/26 11:17	01/16/26 03:12	1
o-Xylene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 03:12	1
Xylenes, Total	<0.00398	U	0.00398		mg/Kg		01/15/26 11:17	01/16/26 03:12	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	124		70 - 130	01/15/26 11:17	01/16/26 03:12	1
1,4-Difluorobenzene (Surr)	104		70 - 130	01/15/26 11:17	01/16/26 03:12	1

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00398	U	0.00398		mg/Kg			01/16/26 03:12	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.3	U	50.3		mg/Kg			01/18/26 19:01	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.3	U	50.3		mg/Kg		01/15/26 10:58	01/18/26 19:01	1
Diesel Range Organics (Over C10-C28)	<50.3	U	50.3		mg/Kg		01/15/26 10:58	01/18/26 19:01	1
Oil Range Organics (Over C28-C36)	<50.3	U	50.3		mg/Kg		01/15/26 10:58	01/18/26 19:01	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	110		70 - 130	01/15/26 10:58	01/18/26 19:01	1
o-Terphenyl (Surr)	92		70 - 130	01/15/26 10:58	01/18/26 19:01	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.92	U	9.92		mg/Kg			01/15/26 19:37	1

Client Sample ID: S-3 (2.0')

Lab Sample ID: 880-67025-10

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 03:32	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 03:32	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 03:32	1
m,p-Xylenes	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 03:32	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 03:32	1
Xylenes, Total	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 03:32	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	112		70 - 130	01/15/26 11:17	01/16/26 03:32	1
1,4-Difluorobenzene (Surr)	98		70 - 130	01/15/26 11:17	01/16/26 03:32	1

Eurofins Midland

## Client Sample Results

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

Client Sample ID: S-3 (2.0')

Lab Sample ID: 880-67025-10

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00399	U	0.00399		mg/Kg			01/16/26 03:32	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.0	U	50.0		mg/Kg			01/18/26 19:15	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 19:15	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 19:15	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 19:15	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	112		70 - 130	01/15/26 10:58	01/18/26 19:15	1
o-Terphenyl (Surr)	95		70 - 130	01/15/26 10:58	01/18/26 19:15	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.98	U	9.98		mg/Kg			01/15/26 19:43	1

Client Sample ID: S-3 (3.0')

Lab Sample ID: 880-67025-11

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 05:23	1
Toluene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 05:23	1
Ethylbenzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 05:23	1
m,p-Xylenes	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 05:23	1
o-Xylene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 05:23	1
Xylenes, Total	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 05:23	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	90		70 - 130	01/15/26 11:17	01/16/26 05:23	1
1,4-Difluorobenzene (Surr)	95		70 - 130	01/15/26 11:17	01/16/26 05:23	1

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00402	U	0.00402		mg/Kg			01/16/26 05:23	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.8	U	49.8		mg/Kg			01/18/26 19:30	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 19:30	1
Diesel Range Organics (Over C10-C28)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 19:30	1

Eurofins Midland

## Client Sample Results

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

## Client Sample ID: S-3 (3.0')

Date Collected: 01/14/26 00:00

Date Received: 01/14/26 17:00

## Lab Sample ID: 880-67025-11

Matrix: Solid

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Oil Range Organics (Over C28-C36)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 19:30	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	111		70 - 130	01/15/26 10:58	01/18/26 19:30	1
o-Terphenyl (Surr)	92		70 - 130	01/15/26 10:58	01/18/26 19:30	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/15/26 19:50	1

## Client Sample ID: S-3 (4.0')

Date Collected: 01/14/26 00:00

Date Received: 01/14/26 17:00

## Lab Sample ID: 880-67025-12

Matrix: Solid

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 05:43	1
Toluene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 05:43	1
Ethylbenzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 05:43	1
m,p-Xylenes	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 05:43	1
o-Xylene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 05:43	1
Xylenes, Total	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 05:43	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	105		70 - 130	01/15/26 11:17	01/16/26 05:43	1
1,4-Difluorobenzene (Surr)	99		70 - 130	01/15/26 11:17	01/16/26 05:43	1

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00404	U	0.00404		mg/Kg			01/16/26 05:43	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.1	U	50.1		mg/Kg			01/18/26 19:44	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 19:44	1
Diesel Range Organics (Over C10-C28)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 19:44	1
Oil Range Organics (Over C28-C36)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 19:44	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	111		70 - 130	01/15/26 10:58	01/18/26 19:44	1
o-Terphenyl (Surr)	96		70 - 130	01/15/26 10:58	01/18/26 19:44	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.92	U	9.92		mg/Kg			01/15/26 20:11	1

Eurofins Midland

## Client Sample Results

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

Client Sample ID: S-4 (0-1')

Lab Sample ID: 880-67025-13

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 06:04	1
Toluene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 06:04	1
Ethylbenzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 06:04	1
m,p-Xylenes	<0.00398	U	0.00398		mg/Kg		01/15/26 11:17	01/16/26 06:04	1
<b>o-Xylene</b>	<b>0.00647</b>		0.00199		mg/Kg		01/15/26 11:17	01/16/26 06:04	1
<b>Xylenes, Total</b>	<b>0.00647</b>		0.00398		mg/Kg		01/15/26 11:17	01/16/26 06:04	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	132	S1+	70 - 130	01/15/26 11:17	01/16/26 06:04	1
1,4-Difluorobenzene (Surr)	92		70 - 130	01/15/26 11:17	01/16/26 06:04	1

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
<b>Total BTEX</b>	<b>0.00647</b>		0.00398		mg/Kg			01/16/26 06:04	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.0	U	50.0		mg/Kg			01/19/26 20:06	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 20:06	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 20:06	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 20:06	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	101		70 - 130	01/15/26 11:21	01/19/26 20:06	1
o-Terphenyl (Surr)	101		70 - 130	01/15/26 11:21	01/19/26 20:06	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.90	U	9.90		mg/Kg			01/15/26 20:18	1

Client Sample ID: S-4 (2.0')

Lab Sample ID: 880-67025-14

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 06:24	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 06:24	1
<b>Ethylbenzene</b>	<b>0.00426</b>		0.00200		mg/Kg		01/15/26 11:17	01/16/26 06:24	1
m,p-Xylenes	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 06:24	1
<b>o-Xylene</b>	<b>0.00201</b>		0.00200		mg/Kg		01/15/26 11:17	01/16/26 06:24	1
Xylenes, Total	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 06:24	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	118		70 - 130	01/15/26 11:17	01/16/26 06:24	1
1,4-Difluorobenzene (Surr)	104		70 - 130	01/15/26 11:17	01/16/26 06:24	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-4 (2.0')**

**Lab Sample ID: 880-67025-14**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	0.00627		0.00399		mg/Kg			01/16/26 06:24	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.1	U	50.1		mg/Kg			01/19/26 20:21	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	50.1		mg/Kg		01/15/26 11:21	01/19/26 20:21	1
Diesel Range Organics (Over C10-C28)	<50.1	U	50.1		mg/Kg		01/15/26 11:21	01/19/26 20:21	1
Oil Range Organics (Over C28-C36)	<50.1	U	50.1		mg/Kg		01/15/26 11:21	01/19/26 20:21	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	89		70 - 130	01/15/26 11:21	01/19/26 20:21	1
o-Terphenyl (Surr)	94		70 - 130	01/15/26 11:21	01/19/26 20:21	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.1	U	10.1		mg/Kg			01/15/26 20:39	1

**Client Sample ID: S-4 (3.0')**

**Lab Sample ID: 880-67025-15**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 06:45	1
Toluene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 06:45	1
Ethylbenzene	0.00257		0.00201		mg/Kg		01/15/26 11:17	01/16/26 06:45	1
m,p-Xylenes	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 06:45	1
o-Xylene	0.00452		0.00201		mg/Kg		01/15/26 11:17	01/16/26 06:45	1
Xylenes, Total	0.00452		0.00402		mg/Kg		01/15/26 11:17	01/16/26 06:45	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	113		70 - 130	01/15/26 11:17	01/16/26 06:45	1
1,4-Difluorobenzene (Surr)	96		70 - 130	01/15/26 11:17	01/16/26 06:45	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	0.00709		0.00402		mg/Kg			01/16/26 06:45	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.0	U	50.0		mg/Kg			01/19/26 20:36	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 20:36	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 20:36	1

Eurofins Midland

## Client Sample Results

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

## Client Sample ID: S-4 (3.0')

Date Collected: 01/14/26 00:00

Date Received: 01/14/26 17:00

## Lab Sample ID: 880-67025-15

Matrix: Solid

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 20:36	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	90		70 - 130	01/15/26 11:21	01/19/26 20:36	1
o-Terphenyl (Surr)	94		70 - 130	01/15/26 11:21	01/19/26 20:36	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.94	U	9.94		mg/Kg			01/15/26 20:46	1

## Client Sample ID: S-4 (4.0')

Date Collected: 01/14/26 00:00

Date Received: 01/14/26 17:00

## Lab Sample ID: 880-67025-16

Matrix: Solid

## Method: SW846 8021B - Volatile Organic Compounds (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:05	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:05	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:05	1
m,p-Xylenes	<0.00401	U	0.00401		mg/Kg		01/15/26 11:17	01/16/26 07:05	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:05	1
Xylenes, Total	<0.00401	U	0.00401		mg/Kg		01/15/26 11:17	01/16/26 07:05	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	119		70 - 130	01/15/26 11:17	01/16/26 07:05	1
1,4-Difluorobenzene (Surr)	94		70 - 130	01/15/26 11:17	01/16/26 07:05	1

## Method: TAL SOP Total BTEX - Total BTEX Calculation

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00401	U	0.00401		mg/Kg			01/16/26 07:05	1

## Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.2	U	50.2		mg/Kg			01/19/26 20:52	1

## Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.2	U	50.2		mg/Kg		01/15/26 11:21	01/19/26 20:52	1
Diesel Range Organics (Over C10-C28)	<50.2	U	50.2		mg/Kg		01/15/26 11:21	01/19/26 20:52	1
Oil Range Organics (Over C28-C36)	<50.2	U	50.2		mg/Kg		01/15/26 11:21	01/19/26 20:52	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	86		70 - 130	01/15/26 11:21	01/19/26 20:52	1
o-Terphenyl (Surr)	92		70 - 130	01/15/26 11:21	01/19/26 20:52	1

## Method: EPA 300.0 - Anions, Ion Chromatography - Soluble

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.92	U	9.92		mg/Kg			01/15/26 20:52	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-5 (0-1')**

**Lab Sample ID: 880-67025-17**

**Date Collected: 01/14/26 00:00**

**Matrix: Solid**

**Date Received: 01/14/26 17:00**

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 07:26	1
Toluene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 07:26	1
Ethylbenzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 07:26	1
m,p-Xylenes	<0.00398	U	0.00398		mg/Kg		01/15/26 11:17	01/16/26 07:26	1
o-Xylene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:17	01/16/26 07:26	1
Xylenes, Total	<0.00398	U	0.00398		mg/Kg		01/15/26 11:17	01/16/26 07:26	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	116		70 - 130	01/15/26 11:17	01/16/26 07:26	1
1,4-Difluorobenzene (Surr)	100		70 - 130	01/15/26 11:17	01/16/26 07:26	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00398	U	0.00398		mg/Kg			01/16/26 07:26	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.8	U	49.8		mg/Kg			01/19/26 21:06	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.8	U	49.8		mg/Kg		01/15/26 11:21	01/19/26 21:06	1
Diesel Range Organics (Over C10-C28)	<49.8	U	49.8		mg/Kg		01/15/26 11:21	01/19/26 21:06	1
Oil Range Organics (Over C28-C36)	<49.8	U	49.8		mg/Kg		01/15/26 11:21	01/19/26 21:06	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	91		70 - 130	01/15/26 11:21	01/19/26 21:06	1
o-Terphenyl (Surr)	95		70 - 130	01/15/26 11:21	01/19/26 21:06	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.98	U	9.98		mg/Kg			01/15/26 20:59	1

**Client Sample ID: S-5 (2.0')**

**Lab Sample ID: 880-67025-18**

**Date Collected: 01/14/26 00:00**

**Matrix: Solid**

**Date Received: 01/14/26 17:00**

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:46	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:46	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:46	1
m,p-Xylenes	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 07:46	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/16/26 07:46	1
Xylenes, Total	<0.00399	U	0.00399		mg/Kg		01/15/26 11:17	01/16/26 07:46	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	117		70 - 130	01/15/26 11:17	01/16/26 07:46	1
1,4-Difluorobenzene (Surr)	96		70 - 130	01/15/26 11:17	01/16/26 07:46	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-5 (2.0')**

**Lab Sample ID: 880-67025-18**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00399	U	0.00399		mg/Kg			01/16/26 07:46	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.7	U	49.7		mg/Kg			01/19/26 21:21	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.7	U	49.7		mg/Kg		01/15/26 11:21	01/19/26 21:21	1
Diesel Range Organics (Over C10-C28)	<49.7	U	49.7		mg/Kg		01/15/26 11:21	01/19/26 21:21	1
Oil Range Organics (Over C28-C36)	<49.7	U	49.7		mg/Kg		01/15/26 11:21	01/19/26 21:21	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	88		70 - 130	01/15/26 11:21	01/19/26 21:21	1
o-Terphenyl (Surr)	91		70 - 130	01/15/26 11:21	01/19/26 21:21	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.92	U	9.92		mg/Kg			01/15/26 21:06	1

**Client Sample ID: S-5 (3.0')**

**Lab Sample ID: 880-67025-19**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 08:07	1
Toluene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 08:07	1
Ethylbenzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 08:07	1
m,p-Xylenes	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 08:07	1
o-Xylene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:17	01/16/26 08:07	1
Xylenes, Total	<0.00402	U	0.00402		mg/Kg		01/15/26 11:17	01/16/26 08:07	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	119		70 - 130	01/15/26 11:17	01/16/26 08:07	1
1,4-Difluorobenzene (Surr)	96		70 - 130	01/15/26 11:17	01/16/26 08:07	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00402	U	0.00402		mg/Kg			01/16/26 08:07	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.3	U	50.3		mg/Kg			01/19/26 21:36	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.3	U	50.3		mg/Kg		01/15/26 11:21	01/19/26 21:36	1
Diesel Range Organics (Over C10-C28)	<50.3	U	50.3		mg/Kg		01/15/26 11:21	01/19/26 21:36	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-5 (3.0')**

**Lab Sample ID: 880-67025-19**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Oil Range Organics (Over C28-C36)	<50.3	U	50.3		mg/Kg		01/15/26 11:21	01/19/26 21:36	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
1-Chlorooctane (Surr)	89		70 - 130				01/15/26 11:21	01/19/26 21:36	1
o-Terphenyl (Surr)	96		70 - 130				01/15/26 11:21	01/19/26 21:36	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/15/26 21:13	1

**Client Sample ID: S-5 (4.0')**

**Lab Sample ID: 880-67025-20**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 08:27	1
Toluene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 08:27	1
Ethylbenzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 08:27	1
m,p-Xylenes	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 08:27	1
o-Xylene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:17	01/16/26 08:27	1
Xylenes, Total	<0.00404	U	0.00404		mg/Kg		01/15/26 11:17	01/16/26 08:27	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
4-Bromofluorobenzene (Surr)	142	S1+	70 - 130				01/15/26 11:17	01/16/26 08:27	1
1,4-Difluorobenzene (Surr)	119		70 - 130				01/15/26 11:17	01/16/26 08:27	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00404	U	0.00404		mg/Kg			01/16/26 08:27	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.8	U	49.8		mg/Kg			01/19/26 21:51	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.8	U	49.8		mg/Kg		01/15/26 11:21	01/19/26 21:51	1
Diesel Range Organics (Over C10-C28)	<49.8	U	49.8		mg/Kg		01/15/26 11:21	01/19/26 21:51	1
Oil Range Organics (Over C28-C36)	<49.8	U	49.8		mg/Kg		01/15/26 11:21	01/19/26 21:51	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
1-Chlorooctane (Surr)	108		70 - 130				01/15/26 11:21	01/19/26 21:51	1
o-Terphenyl (Surr)	112		70 - 130				01/15/26 11:21	01/19/26 21:51	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.1	U	10.1		mg/Kg			01/15/26 21:20	1

Eurofins Midland

## Surrogate Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

## Method: 8021B - Volatile Organic Compounds (GC)

Matrix: Solid

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)	
		BFB1 (70-130)	DFBZ1 (70-130)
880-67025-1	S-1 (0-1')	92	95
880-67025-1 MS	S-1 (0-1')	91	86
880-67025-1 MSD	S-1 (0-1')	103	84
880-67025-2	S-1 (2.0')	108	92
880-67025-3	S-1 (3.0')	109	95
880-67025-4	S-1 (4.0')	105	100
880-67025-5	S-2 (0-1')	94	87
880-67025-6	S-2 (2.0')	101	95
880-67025-7	S-2 (3.0')	119	100
880-67025-8	S-2 (4.0')	126	100
880-67025-9	S-3 (0-1')	124	104
880-67025-10	S-3 (2.0')	112	98
880-67025-11	S-3 (3.0')	90	95
880-67025-12	S-3 (4.0')	105	99
880-67025-13	S-4 (0-1')	132 S1+	92
880-67025-14	S-4 (2.0')	118	104
880-67025-15	S-4 (3.0')	113	96
880-67025-16	S-4 (4.0')	119	94
880-67025-17	S-5 (0-1')	116	100
880-67025-18	S-5 (2.0')	117	96
880-67025-19	S-5 (3.0')	119	96
880-67025-20	S-5 (4.0')	142 S1+	119
LCS 880-129031/1-A	Lab Control Sample	87	90
LCS 880-129031/2-A	Lab Control Sample Dup	105	87
MB 880-128942/5-A	Method Blank	127	77
MB 880-129031/5-A	Method Blank	103	72

## Surrogate Legend

BFB = 4-Bromofluorobenzene (Surr)

DFBZ = 1,4-Difluorobenzene (Surr)

## Method: 8015B NM - Diesel Range Organics (DRO) (GC)

Matrix: Solid

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)	
		1CO1 (70-130)	OTPH1 (70-130)
880-67022-A-16-D MS	Matrix Spike	145 S1+	111
880-67022-A-16-E MSD	Matrix Spike Duplicate	118	112
880-67023-A-4-B MS	Matrix Spike	86	89
880-67023-A-4-C MSD	Matrix Spike Duplicate	83	87
880-67025-1	S-1 (0-1')	106	89
880-67025-2	S-1 (2.0')	121	99
880-67025-3	S-1 (3.0')	115	95
880-67025-4	S-1 (4.0')	113	95
880-67025-5	S-2 (0-1')	118	99
880-67025-6	S-2 (2.0')	111	93
880-67025-7	S-2 (3.0')	113	96
880-67025-8	S-2 (4.0')	117	99
880-67025-9	S-3 (0-1')	110	92

Eurofins Midland

### Surrogate Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Method: 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)**

**Matrix: Solid**

**Prep Type: Total/NA**

Percent Surrogate Recovery (Acceptance Limits)

Lab Sample ID	Client Sample ID	1CO1 (70-130)	OTPH1 (70-130)
880-67025-10	S-3 (2.0')	112	95
880-67025-11	S-3 (3.0')	111	92
880-67025-12	S-3 (4.0')	111	96
880-67025-13	S-4 (0-1')	101	101
880-67025-14	S-4 (2.0')	89	94
880-67025-15	S-4 (3.0')	90	94
880-67025-16	S-4 (4.0')	86	92
880-67025-17	S-5 (0-1')	91	95
880-67025-18	S-5 (2.0')	88	91
880-67025-19	S-5 (3.0')	89	96
880-67025-20	S-5 (4.0')	108	112
LCS 880-129027/2-A	Lab Control Sample	129	117
LCS 880-129032/2-A	Lab Control Sample	94	96
LCSD 880-129027/3-A	Lab Control Sample Dup	134 S1+	106
LCSD 880-129032/3-A	Lab Control Sample Dup	91	95
MB 880-129027/1-A	Method Blank	131 S1+	118
MB 880-129032/1-A	Method Blank	118	120

**Surrogate Legend**

1CO = 1-Chlorooctane (Surr)  
 OTPH = o-Terphenyl (Surr)

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

#### Method: 8021B - Volatile Organic Compounds (GC)

Lab Sample ID: MB 880-128942/5-A  
 Matrix: Solid  
 Analysis Batch: 129010

Client Sample ID: Method Blank  
 Prep Type: Total/NA  
 Prep Batch: 128942

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/14/26 10:46	01/15/26 12:20	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/14/26 10:46	01/15/26 12:20	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/14/26 10:46	01/15/26 12:20	1
m,p-Xylenes	<0.00400	U	0.00400		mg/Kg		01/14/26 10:46	01/15/26 12:20	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/14/26 10:46	01/15/26 12:20	1
Xylenes, Total	<0.00400	U	0.00400		mg/Kg		01/14/26 10:46	01/15/26 12:20	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	127		70 - 130	01/14/26 10:46	01/15/26 12:20	1
1,4-Difluorobenzene (Surr)	77		70 - 130	01/14/26 10:46	01/15/26 12:20	1

Lab Sample ID: MB 880-129031/5-A  
 Matrix: Solid  
 Analysis Batch: 129010

Client Sample ID: Method Blank  
 Prep Type: Total/NA  
 Prep Batch: 129031

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/15/26 23:59	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/15/26 23:59	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/15/26 23:59	1
m,p-Xylenes	<0.00400	U	0.00400		mg/Kg		01/15/26 11:17	01/15/26 23:59	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:17	01/15/26 23:59	1
Xylenes, Total	<0.00400	U	0.00400		mg/Kg		01/15/26 11:17	01/15/26 23:59	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	103		70 - 130	01/15/26 11:17	01/15/26 23:59	1
1,4-Difluorobenzene (Surr)	72		70 - 130	01/15/26 11:17	01/15/26 23:59	1

Lab Sample ID: LCS 880-129031/1-A  
 Matrix: Solid  
 Analysis Batch: 129010

Client Sample ID: Lab Control Sample  
 Prep Type: Total/NA  
 Prep Batch: 129031

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Benzene	0.100	0.09976		mg/Kg		100	70 - 130
Toluene	0.100	0.09639		mg/Kg		96	70 - 130
Ethylbenzene	0.100	0.1030		mg/Kg		103	70 - 130
m,p-Xylenes	0.200	0.1968		mg/Kg		98	70 - 130
o-Xylene	0.100	0.08717		mg/Kg		87	70 - 130

Surrogate	LCS %Recovery	LCS Qualifier	Limits
4-Bromofluorobenzene (Surr)	87		70 - 130
1,4-Difluorobenzene (Surr)	90		70 - 130

Lab Sample ID: LCSD 880-129031/2-A  
 Matrix: Solid  
 Analysis Batch: 129010

Client Sample ID: Lab Control Sample Dup  
 Prep Type: Total/NA  
 Prep Batch: 129031

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Benzene	0.100	0.09745		mg/Kg		97	70 - 130	2	35

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

#### Method: 8021B - Volatile Organic Compounds (GC) (Continued)

Lab Sample ID: LCSD 880-129031/2-A  
 Matrix: Solid  
 Analysis Batch: 129010

Client Sample ID: Lab Control Sample Dup  
 Prep Type: Total/NA  
 Prep Batch: 129031

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Toluene	0.100	0.1064		mg/Kg		106	70 - 130	10	35
Ethylbenzene	0.100	0.09704		mg/Kg		97	70 - 130	6	35
m,p-Xylenes	0.200	0.1998		mg/Kg		100	70 - 130	2	35
o-Xylene	0.100	0.1073		mg/Kg		107	70 - 130	21	35

Surrogate	LCSD %Recovery	LCSD Qualifier	LCSD Limits
4-Bromofluorobenzene (Surr)	105		70 - 130
1,4-Difluorobenzene (Surr)	87		70 - 130

Lab Sample ID: 880-67025-1 MS  
 Matrix: Solid  
 Analysis Batch: 129010

Client Sample ID: S-1 (0-1')  
 Prep Type: Total/NA  
 Prep Batch: 129031

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Benzene	<0.00200	U	0.100	0.07526		mg/Kg		75	70 - 130
Toluene	<0.00200	U	0.100	0.08150		mg/Kg		82	70 - 130
Ethylbenzene	<0.00200	U	0.100	0.08583		mg/Kg		85	70 - 130
m,p-Xylenes	<0.00400	U	0.200	0.1607		mg/Kg		80	70 - 130
o-Xylene	<0.00200	U	0.100	0.08295		mg/Kg		83	70 - 130

Surrogate	MS %Recovery	MS Qualifier	MS Limits
4-Bromofluorobenzene (Surr)	91		70 - 130
1,4-Difluorobenzene (Surr)	86		70 - 130

Lab Sample ID: 880-67025-1 MSD  
 Matrix: Solid  
 Analysis Batch: 129010

Client Sample ID: S-1 (0-1')  
 Prep Type: Total/NA  
 Prep Batch: 129031

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Benzene	<0.00200	U	0.100	0.07378		mg/Kg		74	70 - 130	2	35
Toluene	<0.00200	U	0.100	0.07970		mg/Kg		80	70 - 130	2	35
Ethylbenzene	<0.00200	U	0.100	0.08091		mg/Kg		80	70 - 130	6	35
m,p-Xylenes	<0.00400	U	0.200	0.1629		mg/Kg		81	70 - 130	1	35
o-Xylene	<0.00200	U	0.100	0.08396		mg/Kg		84	70 - 130	1	35

Surrogate	MSD %Recovery	MSD Qualifier	MSD Limits
4-Bromofluorobenzene (Surr)	103		70 - 130
1,4-Difluorobenzene (Surr)	84		70 - 130

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC)

Lab Sample ID: MB 880-129027/1-A  
 Matrix: Solid  
 Analysis Batch: 129212

Client Sample ID: Method Blank  
 Prep Type: Total/NA  
 Prep Batch: 129027

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 12:05	1

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

**Lab Sample ID: MB 880-129027/1-A**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Method Blank**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Analyte	MB MB		RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
	Result	Qualifier							
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 12:05	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 12:05	1

Surrogate	MB MB		Limits	Prepared	Analyzed	Dil Fac
	%Recovery	Qualifier				
1-Chlorooctane (Surr)	131	S1+	70 - 130	01/15/26 10:58	01/18/26 12:05	1
o-Terphenyl (Surr)	118		70 - 130	01/15/26 10:58	01/18/26 12:05	1

**Lab Sample ID: LCS 880-129027/2-A**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Lab Control Sample**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Analyte	Spike Added	LCS LCS		Unit	D	%Rec	Limits
		Result	Qualifier				
Gasoline Range Organics (GRO)-C6-C10	1000	892.9		mg/Kg		89	70 - 130
Diesel Range Organics (Over C10-C28)	1000	944.2		mg/Kg		94	70 - 130

Surrogate	LCS LCS		Limits
	%Recovery	Qualifier	
1-Chlorooctane (Surr)	129		70 - 130
o-Terphenyl (Surr)	117		70 - 130

**Lab Sample ID: LCSD 880-129027/3-A**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Lab Control Sample Dup**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Analyte	Spike Added	LCSD LCSD		Unit	D	%Rec	Limits	RPD	
		Result	Qualifier					RPD	Limit
Gasoline Range Organics (GRO)-C6-C10	1000	892.8		mg/Kg		89	70 - 130	0	20
Diesel Range Organics (Over C10-C28)	1000	899.4		mg/Kg		90	70 - 130	5	20

Surrogate	LCSD LCSD		Limits
	%Recovery	Qualifier	
1-Chlorooctane (Surr)	134	S1+	70 - 130
o-Terphenyl (Surr)	106		70 - 130

**Lab Sample ID: 880-67022-A-16-D MS**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Matrix Spike**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Analyte	Sample Result	Sample Qualifier	Spike Added	MS MS		Unit	D	%Rec	Limits
				Result	Qualifier				
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	996	964.2		mg/Kg		97	70 - 130
Diesel Range Organics (Over C10-C28)	<50.1	U	996	903.8		mg/Kg		91	70 - 130

Surrogate	MS MS		Limits
	%Recovery	Qualifier	
1-Chlorooctane (Surr)	145	S1+	70 - 130
o-Terphenyl (Surr)	111		70 - 130

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

**Lab Sample ID: 880-67022-A-16-E MSD**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Matrix Spike Duplicate**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Analyte	Sample	Sample	Spike	MSD	MSD	Unit	D	%Rec	%Rec	RPD	RPD
	Result	Qualifier	Added	Result	Qualifier				Limits	Limits	Limit
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	1000	963.8		mg/Kg		96	70 - 130	0	20
Diesel Range Organics (Over C10-C28)	<50.1	U	1000	980.2		mg/Kg		98	70 - 130	8	20
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>								
1-Chlorooctane (Surr)	118		70 - 130								
o-Terphenyl (Surr)	112		70 - 130								

**Lab Sample ID: MB 880-129032/1-A**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: Method Blank**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	MB	MB	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
	Result	Qualifier							
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 18:36	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 18:36	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 18:36	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
1-Chlorooctane (Surr)	118		70 - 130				01/15/26 11:21	01/19/26 18:36	1
o-Terphenyl (Surr)	120		70 - 130				01/15/26 11:21	01/19/26 18:36	1

**Lab Sample ID: LCS 880-129032/2-A**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: Lab Control Sample**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	Spike Added	LCS	LCS	Unit	D	%Rec	%Rec	Limits
							Result	
Gasoline Range Organics (GRO)-C6-C10	1000	1107		mg/Kg		111	70 - 130	
Diesel Range Organics (Over C10-C28)	1000	983.9		mg/Kg		98	70 - 130	
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>					
1-Chlorooctane (Surr)	94		70 - 130					
o-Terphenyl (Surr)	96		70 - 130					

**Lab Sample ID: LCSD 880-129032/3-A**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: Lab Control Sample Dup**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	Spike Added	LCSD	LCSD	Unit	D	%Rec	%Rec	RPD	RPD
							Result	Qualifier	Limits
Gasoline Range Organics (GRO)-C6-C10	1000	1088		mg/Kg		109	70 - 130	2	20
Diesel Range Organics (Over C10-C28)	1000	997.9		mg/Kg		100	70 - 130	1	20

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

Lab Sample ID: LCSD 880-129032/3-A  
 Matrix: Solid  
 Analysis Batch: 129255

Client Sample ID: Lab Control Sample Dup  
 Prep Type: Total/NA  
 Prep Batch: 129032

Surrogate	LCSD %Recovery	LCSD Qualifier	Limits
1-Chlorooctane (Surr)	91	U	70 - 130
o-Terphenyl (Surr)	95	U	70 - 130

Lab Sample ID: 880-67023-A-4-B MS  
 Matrix: Solid  
 Analysis Batch: 129255

Client Sample ID: Matrix Spike  
 Prep Type: Total/NA  
 Prep Batch: 129032

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	996	787.0		mg/Kg		79	70 - 130
Diesel Range Organics (Over C10-C28)	<50.1	U F1	996	664.2	F1	mg/Kg		67	70 - 130

Surrogate	MS %Recovery	MS Qualifier	Limits
1-Chlorooctane (Surr)	86	U	70 - 130
o-Terphenyl (Surr)	89	U	70 - 130

Lab Sample ID: 880-67023-A-4-C MSD  
 Matrix: Solid  
 Analysis Batch: 129255

Client Sample ID: Matrix Spike Duplicate  
 Prep Type: Total/NA  
 Prep Batch: 129032

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	995	776.2		mg/Kg		78	70 - 130	1	20
Diesel Range Organics (Over C10-C28)	<50.1	U F1	995	666.1	F1	mg/Kg		67	70 - 130	0	20

Surrogate	MSD %Recovery	MSD Qualifier	Limits
1-Chlorooctane (Surr)	83	U	70 - 130
o-Terphenyl (Surr)	87	U	70 - 130

#### Method: 300.0 - Anions, Ion Chromatography

Lab Sample ID: MB 880-129022/1-A  
 Matrix: Solid  
 Analysis Batch: 129054

Client Sample ID: Method Blank  
 Prep Type: Soluble

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/15/26 17:53	1

Lab Sample ID: LCS 880-129022/2-A  
 Matrix: Solid  
 Analysis Batch: 129054

Client Sample ID: Lab Control Sample  
 Prep Type: Soluble

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Chloride	250	248.6		mg/Kg		99	90 - 110

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Method: 300.0 - Anions, Ion Chromatography (Continued)**

**Lab Sample ID: LCSD 880-129022/3-A**  
**Matrix: Solid**  
**Analysis Batch: 129054**

**Client Sample ID: Lab Control Sample Dup**  
**Prep Type: Soluble**

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	250	250.2		mg/Kg		100	90 - 110	1	20

**Lab Sample ID: 880-67025-1 MS**  
**Matrix: Solid**  
**Analysis Batch: 129054**

**Client Sample ID: S-1 (0-1')**  
**Prep Type: Soluble**

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Chloride	<9.96	U	249	261.2		mg/Kg		105	90 - 110

**Lab Sample ID: 880-67025-1 MSD**  
**Matrix: Solid**  
**Analysis Batch: 129054**

**Client Sample ID: S-1 (0-1')**  
**Prep Type: Soluble**

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	<9.96	U	249	262.7		mg/Kg		106	90 - 110	1	20

**Lab Sample ID: 880-67025-11 MS**  
**Matrix: Solid**  
**Analysis Batch: 129054**

**Client Sample ID: S-3 (3.0')**  
**Prep Type: Soluble**

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Chloride	<10.0	U	250	269.7		mg/Kg		106	90 - 110

**Lab Sample ID: 880-67025-11 MSD**  
**Matrix: Solid**  
**Analysis Batch: 129054**

**Client Sample ID: S-3 (3.0')**  
**Prep Type: Soluble**

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	<10.0	U	250	270.7		mg/Kg		106	90 - 110	0	20

### QC Association Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

#### GC VOA

##### Prep Batch: 128942

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
MB 880-128942/5-A	Method Blank	Total/NA	Solid	5035	

##### Analysis Batch: 129010

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Total/NA	Solid	8021B	129031
880-67025-2	S-1 (2.0')	Total/NA	Solid	8021B	129031
880-67025-3	S-1 (3.0')	Total/NA	Solid	8021B	129031
880-67025-4	S-1 (4.0')	Total/NA	Solid	8021B	129031
880-67025-5	S-2 (0-1')	Total/NA	Solid	8021B	129031
880-67025-6	S-2 (2.0')	Total/NA	Solid	8021B	129031
880-67025-7	S-2 (3.0')	Total/NA	Solid	8021B	129031
880-67025-8	S-2 (4.0')	Total/NA	Solid	8021B	129031
880-67025-9	S-3 (0-1')	Total/NA	Solid	8021B	129031
880-67025-10	S-3 (2.0')	Total/NA	Solid	8021B	129031
880-67025-11	S-3 (3.0')	Total/NA	Solid	8021B	129031
880-67025-12	S-3 (4.0')	Total/NA	Solid	8021B	129031
880-67025-13	S-4 (0-1')	Total/NA	Solid	8021B	129031
880-67025-14	S-4 (2.0')	Total/NA	Solid	8021B	129031
880-67025-15	S-4 (3.0')	Total/NA	Solid	8021B	129031
880-67025-16	S-4 (4.0')	Total/NA	Solid	8021B	129031
880-67025-17	S-5 (0-1')	Total/NA	Solid	8021B	129031
880-67025-18	S-5 (2.0')	Total/NA	Solid	8021B	129031
880-67025-19	S-5 (3.0')	Total/NA	Solid	8021B	129031
880-67025-20	S-5 (4.0')	Total/NA	Solid	8021B	129031
MB 880-128942/5-A	Method Blank	Total/NA	Solid	8021B	128942
MB 880-129031/5-A	Method Blank	Total/NA	Solid	8021B	129031
LCS 880-129031/1-A	Lab Control Sample	Total/NA	Solid	8021B	129031
LCSD 880-129031/2-A	Lab Control Sample Dup	Total/NA	Solid	8021B	129031
880-67025-1 MS	S-1 (0-1')	Total/NA	Solid	8021B	129031
880-67025-1 MSD	S-1 (0-1')	Total/NA	Solid	8021B	129031

##### Prep Batch: 129031

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Total/NA	Solid	5035	
880-67025-2	S-1 (2.0')	Total/NA	Solid	5035	
880-67025-3	S-1 (3.0')	Total/NA	Solid	5035	
880-67025-4	S-1 (4.0')	Total/NA	Solid	5035	
880-67025-5	S-2 (0-1')	Total/NA	Solid	5035	
880-67025-6	S-2 (2.0')	Total/NA	Solid	5035	
880-67025-7	S-2 (3.0')	Total/NA	Solid	5035	
880-67025-8	S-2 (4.0')	Total/NA	Solid	5035	
880-67025-9	S-3 (0-1')	Total/NA	Solid	5035	
880-67025-10	S-3 (2.0')	Total/NA	Solid	5035	
880-67025-11	S-3 (3.0')	Total/NA	Solid	5035	
880-67025-12	S-3 (4.0')	Total/NA	Solid	5035	
880-67025-13	S-4 (0-1')	Total/NA	Solid	5035	
880-67025-14	S-4 (2.0')	Total/NA	Solid	5035	
880-67025-15	S-4 (3.0')	Total/NA	Solid	5035	
880-67025-16	S-4 (4.0')	Total/NA	Solid	5035	
880-67025-17	S-5 (0-1')	Total/NA	Solid	5035	
880-67025-18	S-5 (2.0')	Total/NA	Solid	5035	

Eurofins Midland

## QC Association Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

## GC VOA (Continued)

## Prep Batch: 129031 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-19	S-5 (3.0')	Total/NA	Solid	5035	
880-67025-20	S-5 (4.0')	Total/NA	Solid	5035	
MB 880-129031/5-A	Method Blank	Total/NA	Solid	5035	
LCS 880-129031/1-A	Lab Control Sample	Total/NA	Solid	5035	
LCSD 880-129031/2-A	Lab Control Sample Dup	Total/NA	Solid	5035	
880-67025-1 MS	S-1 (0-1')	Total/NA	Solid	5035	
880-67025-1 MSD	S-1 (0-1')	Total/NA	Solid	5035	

## Analysis Batch: 129171

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Total/NA	Solid	Total BTEX	
880-67025-2	S-1 (2.0')	Total/NA	Solid	Total BTEX	
880-67025-3	S-1 (3.0')	Total/NA	Solid	Total BTEX	
880-67025-4	S-1 (4.0')	Total/NA	Solid	Total BTEX	
880-67025-5	S-2 (0-1')	Total/NA	Solid	Total BTEX	
880-67025-6	S-2 (2.0')	Total/NA	Solid	Total BTEX	
880-67025-7	S-2 (3.0')	Total/NA	Solid	Total BTEX	
880-67025-8	S-2 (4.0')	Total/NA	Solid	Total BTEX	
880-67025-9	S-3 (0-1')	Total/NA	Solid	Total BTEX	
880-67025-10	S-3 (2.0')	Total/NA	Solid	Total BTEX	
880-67025-11	S-3 (3.0')	Total/NA	Solid	Total BTEX	
880-67025-12	S-3 (4.0')	Total/NA	Solid	Total BTEX	
880-67025-13	S-4 (0-1')	Total/NA	Solid	Total BTEX	
880-67025-14	S-4 (2.0')	Total/NA	Solid	Total BTEX	
880-67025-15	S-4 (3.0')	Total/NA	Solid	Total BTEX	
880-67025-16	S-4 (4.0')	Total/NA	Solid	Total BTEX	
880-67025-17	S-5 (0-1')	Total/NA	Solid	Total BTEX	
880-67025-18	S-5 (2.0')	Total/NA	Solid	Total BTEX	
880-67025-19	S-5 (3.0')	Total/NA	Solid	Total BTEX	
880-67025-20	S-5 (4.0')	Total/NA	Solid	Total BTEX	

## GC Semi VOA

## Prep Batch: 129027

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Total/NA	Solid	8015NM Prep	
880-67025-2	S-1 (2.0')	Total/NA	Solid	8015NM Prep	
880-67025-3	S-1 (3.0')	Total/NA	Solid	8015NM Prep	
880-67025-4	S-1 (4.0')	Total/NA	Solid	8015NM Prep	
880-67025-5	S-2 (0-1')	Total/NA	Solid	8015NM Prep	
880-67025-6	S-2 (2.0')	Total/NA	Solid	8015NM Prep	
880-67025-7	S-2 (3.0')	Total/NA	Solid	8015NM Prep	
880-67025-8	S-2 (4.0')	Total/NA	Solid	8015NM Prep	
880-67025-9	S-3 (0-1')	Total/NA	Solid	8015NM Prep	
880-67025-10	S-3 (2.0')	Total/NA	Solid	8015NM Prep	
880-67025-11	S-3 (3.0')	Total/NA	Solid	8015NM Prep	
880-67025-12	S-3 (4.0')	Total/NA	Solid	8015NM Prep	
MB 880-129027/1-A	Method Blank	Total/NA	Solid	8015NM Prep	
LCS 880-129027/2-A	Lab Control Sample	Total/NA	Solid	8015NM Prep	
LCSD 880-129027/3-A	Lab Control Sample Dup	Total/NA	Solid	8015NM Prep	
880-67022-A-16-D MS	Matrix Spike	Total/NA	Solid	8015NM Prep	

Eurofins Midland

## QC Association Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

## GC Semi VOA (Continued)

## Prep Batch: 129027 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67022-A-16-E MSD	Matrix Spike Duplicate	Total/NA	Solid	8015NM Prep	

## Prep Batch: 129032

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-13	S-4 (0-1')	Total/NA	Solid	8015NM Prep	
880-67025-14	S-4 (2.0')	Total/NA	Solid	8015NM Prep	
880-67025-15	S-4 (3.0')	Total/NA	Solid	8015NM Prep	
880-67025-16	S-4 (4.0')	Total/NA	Solid	8015NM Prep	
880-67025-17	S-5 (0-1')	Total/NA	Solid	8015NM Prep	
880-67025-18	S-5 (2.0')	Total/NA	Solid	8015NM Prep	
880-67025-19	S-5 (3.0')	Total/NA	Solid	8015NM Prep	
880-67025-20	S-5 (4.0')	Total/NA	Solid	8015NM Prep	
MB 880-129032/1-A	Method Blank	Total/NA	Solid	8015NM Prep	
LCS 880-129032/2-A	Lab Control Sample	Total/NA	Solid	8015NM Prep	
LCSD 880-129032/3-A	Lab Control Sample Dup	Total/NA	Solid	8015NM Prep	
880-67023-A-4-B MS	Matrix Spike	Total/NA	Solid	8015NM Prep	
880-67023-A-4-C MSD	Matrix Spike Duplicate	Total/NA	Solid	8015NM Prep	

## Analysis Batch: 129212

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Total/NA	Solid	8015B NM	129027
880-67025-2	S-1 (2.0')	Total/NA	Solid	8015B NM	129027
880-67025-3	S-1 (3.0')	Total/NA	Solid	8015B NM	129027
880-67025-4	S-1 (4.0')	Total/NA	Solid	8015B NM	129027
880-67025-5	S-2 (0-1')	Total/NA	Solid	8015B NM	129027
880-67025-6	S-2 (2.0')	Total/NA	Solid	8015B NM	129027
880-67025-7	S-2 (3.0')	Total/NA	Solid	8015B NM	129027
880-67025-8	S-2 (4.0')	Total/NA	Solid	8015B NM	129027
880-67025-9	S-3 (0-1')	Total/NA	Solid	8015B NM	129027
880-67025-10	S-3 (2.0')	Total/NA	Solid	8015B NM	129027
880-67025-11	S-3 (3.0')	Total/NA	Solid	8015B NM	129027
880-67025-12	S-3 (4.0')	Total/NA	Solid	8015B NM	129027
MB 880-129027/1-A	Method Blank	Total/NA	Solid	8015B NM	129027
LCS 880-129027/2-A	Lab Control Sample	Total/NA	Solid	8015B NM	129027
LCSD 880-129027/3-A	Lab Control Sample Dup	Total/NA	Solid	8015B NM	129027
880-67022-A-16-D MS	Matrix Spike	Total/NA	Solid	8015B NM	129027
880-67022-A-16-E MSD	Matrix Spike Duplicate	Total/NA	Solid	8015B NM	129027

## Analysis Batch: 129255

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-13	S-4 (0-1')	Total/NA	Solid	8015B NM	129032
880-67025-14	S-4 (2.0')	Total/NA	Solid	8015B NM	129032
880-67025-15	S-4 (3.0')	Total/NA	Solid	8015B NM	129032
880-67025-16	S-4 (4.0')	Total/NA	Solid	8015B NM	129032
880-67025-17	S-5 (0-1')	Total/NA	Solid	8015B NM	129032
880-67025-18	S-5 (2.0')	Total/NA	Solid	8015B NM	129032
880-67025-19	S-5 (3.0')	Total/NA	Solid	8015B NM	129032
880-67025-20	S-5 (4.0')	Total/NA	Solid	8015B NM	129032
MB 880-129032/1-A	Method Blank	Total/NA	Solid	8015B NM	129032
LCS 880-129032/2-A	Lab Control Sample	Total/NA	Solid	8015B NM	129032
LCSD 880-129032/3-A	Lab Control Sample Dup	Total/NA	Solid	8015B NM	129032

Eurofins Midland

## QC Association Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

## GC Semi VOA (Continued)

## Analysis Batch: 129255 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-A-4-B MS	Matrix Spike	Total/NA	Solid	8015B NM	129032
880-67023-A-4-C MSD	Matrix Spike Duplicate	Total/NA	Solid	8015B NM	129032

## Analysis Batch: 129343

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Total/NA	Solid	8015 NM	
880-67025-2	S-1 (2.0')	Total/NA	Solid	8015 NM	
880-67025-3	S-1 (3.0')	Total/NA	Solid	8015 NM	
880-67025-4	S-1 (4.0')	Total/NA	Solid	8015 NM	
880-67025-5	S-2 (0-1')	Total/NA	Solid	8015 NM	
880-67025-6	S-2 (2.0')	Total/NA	Solid	8015 NM	
880-67025-7	S-2 (3.0')	Total/NA	Solid	8015 NM	
880-67025-8	S-2 (4.0')	Total/NA	Solid	8015 NM	
880-67025-9	S-3 (0-1')	Total/NA	Solid	8015 NM	
880-67025-10	S-3 (2.0')	Total/NA	Solid	8015 NM	
880-67025-11	S-3 (3.0')	Total/NA	Solid	8015 NM	
880-67025-12	S-3 (4.0')	Total/NA	Solid	8015 NM	
880-67025-13	S-4 (0-1')	Total/NA	Solid	8015 NM	
880-67025-14	S-4 (2.0')	Total/NA	Solid	8015 NM	
880-67025-15	S-4 (3.0')	Total/NA	Solid	8015 NM	
880-67025-16	S-4 (4.0')	Total/NA	Solid	8015 NM	
880-67025-17	S-5 (0-1')	Total/NA	Solid	8015 NM	
880-67025-18	S-5 (2.0')	Total/NA	Solid	8015 NM	
880-67025-19	S-5 (3.0')	Total/NA	Solid	8015 NM	
880-67025-20	S-5 (4.0')	Total/NA	Solid	8015 NM	

## HPLC/IC

## Leach Batch: 129022

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Soluble	Solid	DI Leach	
880-67025-2	S-1 (2.0')	Soluble	Solid	DI Leach	
880-67025-3	S-1 (3.0')	Soluble	Solid	DI Leach	
880-67025-4	S-1 (4.0')	Soluble	Solid	DI Leach	
880-67025-5	S-2 (0-1')	Soluble	Solid	DI Leach	
880-67025-6	S-2 (2.0')	Soluble	Solid	DI Leach	
880-67025-7	S-2 (3.0')	Soluble	Solid	DI Leach	
880-67025-8	S-2 (4.0')	Soluble	Solid	DI Leach	
880-67025-9	S-3 (0-1')	Soluble	Solid	DI Leach	
880-67025-10	S-3 (2.0')	Soluble	Solid	DI Leach	
880-67025-11	S-3 (3.0')	Soluble	Solid	DI Leach	
880-67025-12	S-3 (4.0')	Soluble	Solid	DI Leach	
880-67025-13	S-4 (0-1')	Soluble	Solid	DI Leach	
880-67025-14	S-4 (2.0')	Soluble	Solid	DI Leach	
880-67025-15	S-4 (3.0')	Soluble	Solid	DI Leach	
880-67025-16	S-4 (4.0')	Soluble	Solid	DI Leach	
880-67025-17	S-5 (0-1')	Soluble	Solid	DI Leach	
880-67025-18	S-5 (2.0')	Soluble	Solid	DI Leach	
880-67025-19	S-5 (3.0')	Soluble	Solid	DI Leach	
880-67025-20	S-5 (4.0')	Soluble	Solid	DI Leach	
MB 880-129022/1-A	Method Blank	Soluble	Solid	DI Leach	

Eurofins Midland

## QC Association Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

## HPLC/IC (Continued)

## Leach Batch: 129022 (Continued)

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
LCS 880-129022/2-A	Lab Control Sample	Soluble	Solid	DI Leach	
LCSD 880-129022/3-A	Lab Control Sample Dup	Soluble	Solid	DI Leach	
880-67025-1 MS	S-1 (0-1')	Soluble	Solid	DI Leach	
880-67025-1 MSD	S-1 (0-1')	Soluble	Solid	DI Leach	
880-67025-11 MS	S-3 (3.0')	Soluble	Solid	DI Leach	
880-67025-11 MSD	S-3 (3.0')	Soluble	Solid	DI Leach	

## Analysis Batch: 129054

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67025-1	S-1 (0-1')	Soluble	Solid	300.0	129022
880-67025-2	S-1 (2.0')	Soluble	Solid	300.0	129022
880-67025-3	S-1 (3.0')	Soluble	Solid	300.0	129022
880-67025-4	S-1 (4.0')	Soluble	Solid	300.0	129022
880-67025-5	S-2 (0-1')	Soluble	Solid	300.0	129022
880-67025-6	S-2 (2.0')	Soluble	Solid	300.0	129022
880-67025-7	S-2 (3.0')	Soluble	Solid	300.0	129022
880-67025-8	S-2 (4.0')	Soluble	Solid	300.0	129022
880-67025-9	S-3 (0-1')	Soluble	Solid	300.0	129022
880-67025-10	S-3 (2.0')	Soluble	Solid	300.0	129022
880-67025-11	S-3 (3.0')	Soluble	Solid	300.0	129022
880-67025-12	S-3 (4.0')	Soluble	Solid	300.0	129022
880-67025-13	S-4 (0-1')	Soluble	Solid	300.0	129022
880-67025-14	S-4 (2.0')	Soluble	Solid	300.0	129022
880-67025-15	S-4 (3.0')	Soluble	Solid	300.0	129022
880-67025-16	S-4 (4.0')	Soluble	Solid	300.0	129022
880-67025-17	S-5 (0-1')	Soluble	Solid	300.0	129022
880-67025-18	S-5 (2.0')	Soluble	Solid	300.0	129022
880-67025-19	S-5 (3.0')	Soluble	Solid	300.0	129022
880-67025-20	S-5 (4.0')	Soluble	Solid	300.0	129022
MB 880-129022/1-A	Method Blank	Soluble	Solid	300.0	129022
LCS 880-129022/2-A	Lab Control Sample	Soluble	Solid	300.0	129022
LCSD 880-129022/3-A	Lab Control Sample Dup	Soluble	Solid	300.0	129022
880-67025-1 MS	S-1 (0-1')	Soluble	Solid	300.0	129022
880-67025-1 MSD	S-1 (0-1')	Soluble	Solid	300.0	129022
880-67025-11 MS	S-3 (3.0')	Soluble	Solid	300.0	129022
880-67025-11 MSD	S-3 (3.0')	Soluble	Solid	300.0	129022

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-1 (0-1')**

**Lab Sample ID: 880-67025-1**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.00 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 00:28	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 00:28	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 16:48	SA	EET MID
Total/NA	Prep	8015NM Prep			10.08 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 16:48	FC	EET MID
Soluble	Leach	DI Leach			5.02 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 18:14	CS	EET MID

**Client Sample ID: S-1 (2.0')**

**Lab Sample ID: 880-67025-2**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.01 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 00:48	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 00:48	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 17:03	SA	EET MID
Total/NA	Prep	8015NM Prep			10.05 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 17:03	FC	EET MID
Soluble	Leach	DI Leach			5.02 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 18:35	CS	EET MID

**Client Sample ID: S-1 (3.0')**

**Lab Sample ID: 880-67025-3**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.98 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 01:09	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 01:09	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 17:32	SA	EET MID
Total/NA	Prep	8015NM Prep			9.99 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 17:32	FC	EET MID
Soluble	Leach	DI Leach			5.01 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 18:41	CS	EET MID

**Client Sample ID: S-1 (4.0')**

**Lab Sample ID: 880-67025-4**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.95 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 01:29	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 01:29	AJ	EET MID

Eurofins Midland

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-1 (4.0')**

**Lab Sample ID: 880-67025-4**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8015 NM		1			129343	01/18/26 17:47	SA	EET MID
Total/NA	Prep	8015NM Prep			10.00 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 17:47	FC	EET MID
Soluble	Leach	DI Leach			5.04 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 18:48	CS	EET MID

**Client Sample ID: S-2 (0-1')**

**Lab Sample ID: 880-67025-5**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.03 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 01:50	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 01:50	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 18:02	SA	EET MID
Total/NA	Prep	8015NM Prep			10.01 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 18:02	FC	EET MID
Soluble	Leach	DI Leach			5.00 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 18:55	CS	EET MID

**Client Sample ID: S-2 (2.0')**

**Lab Sample ID: 880-67025-6**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.01 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 02:10	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 02:10	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 18:17	SA	EET MID
Total/NA	Prep	8015NM Prep			9.98 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 18:17	FC	EET MID
Soluble	Leach	DI Leach			4.99 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 19:16	CS	EET MID

**Client Sample ID: S-2 (3.0')**

**Lab Sample ID: 880-67025-7**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.98 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 02:31	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 02:31	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 18:31	SA	EET MID
Total/NA	Prep	8015NM Prep			10.05 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 18:31	FC	EET MID

Eurofins Midland

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-2 (3.0')**

**Lab Sample ID: 880-67025-7**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Soluble	Leach	DI Leach			4.96 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 19:23	CS	EET MID

**Client Sample ID: S-2 (4.0')**

**Lab Sample ID: 880-67025-8**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.95 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 02:51	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 02:51	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 18:47	SA	EET MID
Total/NA	Prep	8015NM Prep			10.06 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 18:47	FC	EET MID
Soluble	Leach	DI Leach			5.03 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 19:30	CS	EET MID

**Client Sample ID: S-3 (0-1')**

**Lab Sample ID: 880-67025-9**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.03 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 03:12	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 03:12	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 19:01	SA	EET MID
Total/NA	Prep	8015NM Prep			9.94 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 19:01	FC	EET MID
Soluble	Leach	DI Leach			5.04 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 19:37	CS	EET MID

**Client Sample ID: S-3 (2.0')**

**Lab Sample ID: 880-67025-10**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.01 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 03:32	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 03:32	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 19:15	SA	EET MID
Total/NA	Prep	8015NM Prep			10.00 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 19:15	FC	EET MID
Soluble	Leach	DI Leach			5.01 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 19:43	CS	EET MID

Eurofins Midland

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-3 (3.0')**

**Lab Sample ID: 880-67025-11**

**Date Collected: 01/14/26 00:00**

**Matrix: Solid**

**Date Received: 01/14/26 17:00**

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.98 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 05:23	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 05:23	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 19:30	SA	EET MID
Total/NA	Prep	8015NM Prep			10.05 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 19:30	FC	EET MID
Soluble	Leach	DI Leach			5.00 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 19:50	CS	EET MID

**Client Sample ID: S-3 (4.0')**

**Lab Sample ID: 880-67025-12**

**Date Collected: 01/14/26 00:00**

**Matrix: Solid**

**Date Received: 01/14/26 17:00**

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.95 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 05:43	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 05:43	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/18/26 19:44	SA	EET MID
Total/NA	Prep	8015NM Prep			9.99 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 19:44	FC	EET MID
Soluble	Leach	DI Leach			5.04 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 20:11	CS	EET MID

**Client Sample ID: S-4 (0-1')**

**Lab Sample ID: 880-67025-13**

**Date Collected: 01/14/26 00:00**

**Matrix: Solid**

**Date Received: 01/14/26 17:00**

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.02 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 06:04	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 06:04	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/19/26 20:06	SA	EET MID
Total/NA	Prep	8015NM Prep			10.00 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 20:06	FC	EET MID
Soluble	Leach	DI Leach			5.05 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 20:18	CS	EET MID

**Client Sample ID: S-4 (2.0')**

**Lab Sample ID: 880-67025-14**

**Date Collected: 01/14/26 00:00**

**Matrix: Solid**

**Date Received: 01/14/26 17:00**

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.01 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 06:24	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 06:24	AJ	EET MID

Eurofins Midland

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-4 (2.0')**

**Lab Sample ID: 880-67025-14**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8015 NM		1			129343	01/19/26 20:21	SA	EET MID
Total/NA	Prep	8015NM Prep			9.99 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 20:21	FC	EET MID
Soluble	Leach	DI Leach			4.96 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 20:39	CS	EET MID

**Client Sample ID: S-4 (3.0')**

**Lab Sample ID: 880-67025-15**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.98 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 06:45	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 06:45	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/19/26 20:36	SA	EET MID
Total/NA	Prep	8015NM Prep			10.01 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 20:36	FC	EET MID
Soluble	Leach	DI Leach			5.03 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 20:46	CS	EET MID

**Client Sample ID: S-4 (4.0')**

**Lab Sample ID: 880-67025-16**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.99 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 07:05	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 07:05	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/19/26 20:52	SA	EET MID
Total/NA	Prep	8015NM Prep			9.97 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 20:52	FC	EET MID
Soluble	Leach	DI Leach			5.04 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 20:52	CS	EET MID

**Client Sample ID: S-5 (0-1')**

**Lab Sample ID: 880-67025-17**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.03 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 07:26	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 07:26	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/19/26 21:06	SA	EET MID
Total/NA	Prep	8015NM Prep			10.05 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 21:06	FC	EET MID

Eurofins Midland

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

**Client Sample ID: S-5 (0-1')**

**Lab Sample ID: 880-67025-17**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Soluble	Leach	DI Leach			5.01 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 20:59	CS	EET MID

**Client Sample ID: S-5 (2.0')**

**Lab Sample ID: 880-67025-18**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.01 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 07:46	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 07:46	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/19/26 21:21	SA	EET MID
Total/NA	Prep	8015NM Prep			10.06 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 21:21	FC	EET MID
Soluble	Leach	DI Leach			5.04 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 21:06	CS	EET MID

**Client Sample ID: S-5 (3.0')**

**Lab Sample ID: 880-67025-19**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.97 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 08:07	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 08:07	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/19/26 21:36	SA	EET MID
Total/NA	Prep	8015NM Prep			9.94 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 21:36	FC	EET MID
Soluble	Leach	DI Leach			4.98 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 21:13	CS	EET MID

**Client Sample ID: S-5 (4.0')**

**Lab Sample ID: 880-67025-20**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.95 g	5 mL	129031	01/15/26 11:17	AA	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129010	01/16/26 08:27	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129171	01/16/26 08:27	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129343	01/19/26 21:51	SA	EET MID
Total/NA	Prep	8015NM Prep			10.05 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 21:51	FC	EET MID
Soluble	Leach	DI Leach			4.96 g	50 mL	129022	01/15/26 10:32	SA	EET MID
Soluble	Analysis	300.0		1			129054	01/15/26 21:20	CS	EET MID

Eurofins Midland

# Lab Chronicle

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

**Laboratory References:**

EET MID = Eurofins Midland, 1211 W. Florida Ave, Midland, TX 79701, TEL (432)704-5440

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

# Accreditation/Certification Summary

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

## Laboratory: Eurofins Midland

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
Texas	NELAP	T104704400	06-30-26

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8015 NM		Solid	Total TPH
Total BTEX		Solid	Total BTEX

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

# Method Summary

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
SDG: Lea County, New Mexico

Method	Method Description	Protocol	Laboratory
8021B	Volatile Organic Compounds (GC)	SW846	EET MID
Total BTEX	Total BTEX Calculation	TAL SOP	EET MID
8015 NM	Diesel Range Organics (DRO) (GC)	SW846	EET MID
8015B NM	Diesel Range Organics (DRO) (GC)	SW846	EET MID
300.0	Anions, Ion Chromatography	EPA	EET MID
5035	Closed System Purge and Trap	SW846	EET MID
8015NM Prep	Microextraction	SW846	EET MID
DI Leach	Deionized Water Leaching Procedure	ASTM	EET MID

**Protocol References:**

- ASTM = ASTM International
- EPA = US Environmental Protection Agency
- SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.
- TAL SOP = TestAmerica Laboratories, Standard Operating Procedure

**Laboratory References:**

- EET MID = Eurofins Midland, 1211 W. Florida Ave, Midland, TX 79701, TEL (432)704-5440



### Sample Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67025-1  
 SDG: Lea County, New Mexico

Lab Sample ID	Client Sample ID	Matrix	Collected	Received	Sample Origin
880-67025-1	S-1 (0-1')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-2	S-1 (2.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-3	S-1 (3.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-4	S-1 (4.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-5	S-2 (0-1')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-6	S-2 (2.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-7	S-2 (3.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-8	S-2 (4.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-9	S-3 (0-1')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-10	S-3 (2.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-11	S-3 (3.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-12	S-3 (4.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-13	S-4 (0-1')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-14	S-4 (2.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-15	S-4 (3.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-16	S-4 (4.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-17	S-5 (0-1')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-18	S-5 (2.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-19	S-5 (3.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67025-20	S-5 (4.0')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

# Chain of Custody



880-87025 Chain of Custody

Page 1 of 2

<b>Project Manager:</b> Ashton Thielke <b>Company Name:</b> Carmona Resources <b>Address:</b> 310 W Wall St Ste 500 Midland, TX 79701 <b>City, State ZIP:</b> <b>Phone:</b> 432-813-8988 Email: ThielkeA@carmonaresources.com	<b>Bill to: (if different):</b> <b>Company Name:</b> Carmona Resources <b>Address:</b> <b>City, State ZIP:</b>	<b>Work Order Comments:</b> Program: <input type="checkbox"/> UST/ST <input type="checkbox"/> PRP <input type="checkbox"/> Flowfields <input type="checkbox"/> IRC <input type="checkbox"/> perfund <input type="checkbox"/> State of Project: Reporting Level II <input type="checkbox"/> Level III <input type="checkbox"/> ST/UST <input type="checkbox"/> RRP <input type="checkbox"/> Level IV <input type="checkbox"/> Deliverables: EDD <input type="checkbox"/> ADaPT <input type="checkbox"/> Other:				
<b>ANALYSIS REQUEST</b>						
<b>Project Name:</b> Maxus B 8026 JV-P #003 (04.24.2007) <b>Project Number:</b> 3103 <b>Project Location:</b> Lea County, New Mexico <b>Sampler's Name:</b> JR	<b>Turn Around:</b> <input checked="" type="checkbox"/> Routine <input type="checkbox"/> Rush <b>Due Date:</b> Normal	<b>Preservative Codes:</b> None: NO DI Water: H <sub>2</sub> O Cool: Cool MeOH: Me HCL: HC HNO <sub>3</sub> : HN H <sub>2</sub> SO <sub>4</sub> : H <sub>2</sub> NaOH: Na H <sub>3</sub> PO <sub>4</sub> : HP NaHSO <sub>4</sub> : NABIS Na <sub>2</sub> S <sub>2</sub> O <sub>8</sub> : NaSO <sub>3</sub> Zn Acetate+NaOH: Zn NaOH+Ascorbic Acid: SACP				
<b>SAMPLE RECEIPT</b>						
Received Intact: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Cooler Custody Seals: Yes No (N/A) Sample Custody Seals: Yes No (N/A) Total Containers: 7.0						
<b>Temp Blank:</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Wet Ice: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/>				
Thermometer ID: 128 Correction Factor: -0.1 Temperature Reading: 7.1 Corrected Temperature: 7.0						
<b>Sample Identification</b>	<b>Date</b>	<b>Time</b>	<b>Soil</b>	<b>Water</b>	<b>Grab/Comp</b>	<b># of Cont</b>
S-1 (0-1)	1/14/2026		X		Grab/1	X
S-1 (2-0)	1/14/2026		X		Grab/1	X
S-1 (3-0)	1/14/2026		X		Grab/1	X
S-1 (4-0)	1/14/2026		X		Grab/1	X
S-2 (0-1)	1/14/2026		X		Grab/1	X
S-2 (2-0)	1/14/2026		X		Grab/1	X
S-2 (3-0)	1/14/2026		X		Grab/1	X
S-2 (4-0)	1/14/2026		X		Grab/1	X
S-3 (0-1)	1/14/2026		X		Grab/1	X
S-3 (2-0)	1/14/2026		X		Grab/1	X
Parameters: BTEX 8021B TPH 8015M (GRO + DRO + MRO) Chloride 300 Hold						
<b>Sample Comments</b>						
Comments:						
<b>Relinquished by: (Signature)</b>					<b>Date/Time</b>	
[Signature]					1-14-26 1700	
<b>Received by: (Signature)</b>					<b>Date/Time</b>	
[Signature]					1-14-26 1700	

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

Chain of Custody

Work Order No: \_\_\_\_\_

Page 2 of 2

<b>Project Manager:</b> Ashton Thielke <b>Company Name:</b> Carmona Resources <b>Address:</b> 310 W Wall St Ste 500 <b>City, State ZIP:</b> Midland, TX 79701 <b>Phone:</b> 432-813-8988 <b>Email:</b> ThielkeA@carmonaresources.com		<b>Bill to: (if different)</b> <b>Company Name:</b> Carmona Resources <b>Address:</b> <b>City, State ZIP:</b>	
<b>Project Name:</b> Maxus B 8026 JV-P #003 (04.24.2007) <b>Project Number:</b> 3103 <b>Project Location:</b> Lea County, New Mexico <b>Sampler's Name:</b> JR		<b>Turn Around:</b> <input checked="" type="checkbox"/> Routine <input type="checkbox"/> Rush <b>Due Date:</b> <b>Temp Blank:</b> Yes No <b>Thermometer ID:</b> <b>Cooler Custody Seals:</b> Yes No N/A <b>Sample Custody Seals:</b> Yes No N/A <b>Total Containers:</b>	
<b>SAMPLE RECEIPT</b> Received Intact: Yes No Cooler Custody Seals: Yes No N/A Sample Custody Seals: Yes No N/A Total Containers:		<b>Parameters</b> Wet Ice: Yes No Temperature Reading: Corrected Temperature:	
<b>Sample Identification</b> S-3 (3.0') S-3 (4.0') S-4 (0-1') S-4 (2.0') S-4 (3.0') S-4 (4.0') S-5 (0-1') S-5 (2.0') S-5 (3.0') S-5 (4.0')		<b>Date</b> 1/14/2026 1/14/2026 1/14/2026 1/14/2026 1/14/2026 1/14/2026 1/14/2026 1/14/2026 1/14/2026 1/14/2026	
<b>Time</b> X X X X X X X X X X		<b>Soil</b> X X X X X X X X X X	
<b>Water</b> X X X X X X X X X X		<b># of Cont</b> 1 1 1 1 1 1 1 1 1 1 1	
<b>Grab/Comp</b> Grab/ Grab/ Grab/ Grab/ Grab/ Grab/ Grab/ Grab/ Grab/ Grab/		<b>TPH 8015M (GRO + DRO + MRO)</b> X X X X X X X X X X	
<b>BTEX 8021B</b> X X X X X X X X X X		<b>Chloride 300</b> X X X X X X X X X X	
<b>Hold</b>		<b>Preservative Codes</b> None: NO DI Water: H <sub>2</sub> O Cool: Cool MeOH: Me HCL: HC HNO <sub>3</sub> : HN H <sub>2</sub> SO <sub>4</sub> : H <sub>2</sub> H <sub>3</sub> PO <sub>4</sub> : HP NaHSO <sub>4</sub> : NABIS Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> : NaSO <sub>3</sub> Zn Acetate+NaOH: Zn NaOH+Ascorbic Acid: SACP	
<b>Sample Comments</b>		<b>ANALYSIS REQUEST</b>	
Comments:			
Relinquished by: (Signature)		Date/Time	
Received by: (Signature)		Date/Time	

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

### Login Sample Receipt Checklist

Client: Carmona Resources

Job Number: 880-67025-1  
 SDG Number: Lea County, New Mexico

**Login Number: 67025**  
**List Number: 1**  
**Creator: Dyal, Erica**

**List Source: Eurofins Midland**

Question	Answer	Comment
The cooler's custody seal, if present, is intact.	N/A	
Sample custody seals, if present, are intact.	N/A	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	N/A	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is <6mm (1/4").	N/A	

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14



Environment Testing

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

# ANALYTICAL REPORT

## PREPARED FOR

Attn: Ashton Thielke  
 Carmona Resources  
 310 W Wall St  
 Ste 500  
 Midland, Texas 79701

Generated 1/20/2026 1:44:53 PM

## JOB DESCRIPTION

Maxus B 8026 JV-P #003 (04.24.2007)  
 Lea County, New Mexico

## JOB NUMBER

880-67023-1

Eurofins Midland  
 1211 W. Florida Ave  
 Midland TX 79701



# Eurofins Midland

## Job Notes

This report may not be reproduced except in full, and with written approval from the laboratory. The results relate only to the samples tested. For questions please contact the Project Manager at the e-mail address or telephone number listed on this page.

Analytical test results meet all requirements of the associated regulatory program (i.e., NELAC (TNI), DoD, and ISO 17025) unless otherwise noted under the individual analysis.

## Authorization



Generated  
1/20/2026 1:44:53 PM

Authorized for release by  
Jessica Kramer, Project Manager  
[Jessica.Kramer@et.eurofinsus.com](mailto:Jessica.Kramer@et.eurofinsus.com)  
(432)704-5440

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Laboratory Job ID: 880-67023-1  
SDG: Lea County, New Mexico

# Table of Contents

Cover Page . . . . .	1
Table of Contents . . . . .	3
Definitions/Glossary . . . . .	4
Case Narrative . . . . .	5
Client Sample Results . . . . .	6
Surrogate Summary . . . . .	9
QC Sample Results . . . . .	10
QC Association Summary . . . . .	15
Lab Chronicle . . . . .	17
Certification Summary . . . . .	19
Method Summary . . . . .	20
Sample Summary . . . . .	21
Chain of Custody . . . . .	22
Receipt Checklists . . . . .	23

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

## Definitions/Glossary

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
SDG: Lea County, New Mexico

## Qualifiers

## GC VOA

Qualifier	Qualifier Description
U	Indicates the analyte was analyzed for but not detected.

## GC Semi VOA

Qualifier	Qualifier Description
F1	MS and/or MSD recovery exceeds control limits.
S1+	Surrogate recovery exceeds control limits, high biased.
U	Indicates the analyte was analyzed for but not detected.

## HPLC/IC

Qualifier	Qualifier Description
U	Indicates the analyte was analyzed for but not detected.

## Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
☼	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

## Case Narrative

Client: Carmona Resources  
Project: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1

**Job ID: 880-67023-1**

**Eurofins Midland**

### Job Narrative 880-67023-1

The analytical test results presented in this report meet all requirements of the associated regulatory program listed on the Accreditation/Certification Summary Page, unless otherwise noted. Data qualifiers and/or narrative comments are included to explain any exceptions, if applicable. Regulated compliance samples (e.g. SDWA, NPDES) must comply with associated agency requirements/permits.

- Matrix-specific batch QC (e.g., MS, MSD, SD) may not be reported when insufficient sample volume is available or when site-specific QC samples are not submitted. In such cases, a Laboratory Control Sample Duplicate (LCSD) may be analyzed to provide precision data for the batch.
- For samples analyzed using surrogate and/or isotope dilution analytes, any recoveries falling outside of established acceptance criteria are re-prepared and/or re-analyzed to confirm results, unless the deviation is due to sample dilution or otherwise explained in the case narrative.

#### Receipt

The samples were received on 1/14/2026 5:00 PM. Unless otherwise noted below, the samples arrived in good condition, and, where required, properly preserved and on ice. The temperature of the cooler at receipt time was 7.0°C.

#### GC VOA

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

#### Diesel Range Organics

Method 8015B NM: Surrogate recovery for the following sample was outside control limits: (880-67022-A-16-D MS). Evidence of matrix interference is present; therefore, re-extraction and/or re-analysis was not performed.

Method 8015B NM: Surrogate recovery for the following sample was outside control limits: (LCSD 880-129027/3-A). Evidence of matrix interference is present; therefore, re-extraction and/or re-analysis was not performed.

Method 8015B NM: Surrogate recovery for the following sample was outside control limits: (MB 880-129027/1-A). Evidence of matrix interferences is not obvious.

Method 8015B NM: The continuing calibration verification (CCV) associated with batch 880-129255 recovered above the upper control limit for Gasoline Range Organics (GRO)-C6-C10 and Diesel Range Organics (Over C10-C28). The samples associated with this CCV were non-detects for the affected analytes; therefore, the data have been reported. The associated sample is:(CCV 880-129255/59).

Method 8015B NM: The matrix spike / matrix spike duplicate (MS/MSD) recoveries for preparation batch 880-129032 and analytical batch 880-129255 were outside control limits for one or more analytes. See QC Sample Results for detail. Sample matrix interference and/or non-homogeneity are suspected because the associated laboratory control sample (LCS) recovery is within acceptance limits.

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

#### HPLC/IC

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

**Client Sample ID: H-1 (0-0.5')**

**Lab Sample ID: 880-67023-1**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:24	01/15/26 18:24	1
Toluene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:24	01/15/26 18:24	1
Ethylbenzene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:24	01/15/26 18:24	1
m,p-Xylenes	<0.00402	U	0.00402		mg/Kg		01/15/26 11:24	01/15/26 18:24	1
o-Xylene	<0.00201	U	0.00201		mg/Kg		01/15/26 11:24	01/15/26 18:24	1
Xylenes, Total	<0.00402	U	0.00402		mg/Kg		01/15/26 11:24	01/15/26 18:24	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	107		70 - 130	01/15/26 11:24	01/15/26 18:24	1
1,4-Difluorobenzene (Surr)	96		70 - 130	01/15/26 11:24	01/15/26 18:24	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00402	U	0.00402		mg/Kg			01/15/26 18:24	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.8	U	49.8		mg/Kg			01/18/26 16:03	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 16:03	1
Diesel Range Organics (Over C10-C28)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 16:03	1
Oil Range Organics (Over C28-C36)	<49.8	U	49.8		mg/Kg		01/15/26 10:58	01/18/26 16:03	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	110		70 - 130	01/15/26 10:58	01/18/26 16:03	1
o-Terphenyl (Surr)	92		70 - 130	01/15/26 10:58	01/18/26 16:03	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<9.96	U	9.96		mg/Kg			01/16/26 11:16	1

**Client Sample ID: H-2 (0-0.5')**

**Lab Sample ID: 880-67023-2**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:24	01/15/26 18:44	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:24	01/15/26 18:44	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:24	01/15/26 18:44	1
m,p-Xylenes	<0.00401	U	0.00401		mg/Kg		01/15/26 11:24	01/15/26 18:44	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 11:24	01/15/26 18:44	1
Xylenes, Total	<0.00401	U	0.00401		mg/Kg		01/15/26 11:24	01/15/26 18:44	1

Surrogate	%Recovery	Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	103		70 - 130	01/15/26 11:24	01/15/26 18:44	1
1,4-Difluorobenzene (Surr)	95		70 - 130	01/15/26 11:24	01/15/26 18:44	1

Euofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

**Client Sample ID: H-2 (0-0.5')**

**Lab Sample ID: 880-67023-2**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00401	U	0.00401		mg/Kg			01/15/26 18:44	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.1	U	50.1		mg/Kg			01/18/26 16:19	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 16:19	1
Diesel Range Organics (Over C10-C28)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 16:19	1
Oil Range Organics (Over C28-C36)	<50.1	U	50.1		mg/Kg		01/15/26 10:58	01/18/26 16:19	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
1-Chlorooctane (Surr)	118		70 - 130				01/15/26 10:58	01/18/26 16:19	1
o-Terphenyl (Surr)	96		70 - 130				01/15/26 10:58	01/18/26 16:19	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.1	U	10.1		mg/Kg			01/16/26 11:44	1

**Client Sample ID: H-3 (0-0.5')**

**Lab Sample ID: 880-67023-3**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:24	01/15/26 19:05	1
Toluene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:24	01/15/26 19:05	1
Ethylbenzene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:24	01/15/26 19:05	1
m,p-Xylenes	<0.00403	U	0.00403		mg/Kg		01/15/26 11:24	01/15/26 19:05	1
o-Xylene	<0.00202	U	0.00202		mg/Kg		01/15/26 11:24	01/15/26 19:05	1
Xylenes, Total	<0.00403	U	0.00403		mg/Kg		01/15/26 11:24	01/15/26 19:05	1
<b>Surrogate</b>	<b>%Recovery</b>	<b>Qualifier</b>	<b>Limits</b>				<b>Prepared</b>	<b>Analyzed</b>	<b>Dil Fac</b>
4-Bromofluorobenzene (Surr)	96		70 - 130				01/15/26 11:24	01/15/26 19:05	1
1,4-Difluorobenzene (Surr)	95		70 - 130				01/15/26 11:24	01/15/26 19:05	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00403	U	0.00403		mg/Kg			01/15/26 19:05	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<49.7	U	49.7		mg/Kg			01/18/26 16:33	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<49.7	U	49.7		mg/Kg		01/15/26 10:58	01/18/26 16:33	1
Diesel Range Organics (Over C10-C28)	<49.7	U	49.7		mg/Kg		01/15/26 10:58	01/18/26 16:33	1

Eurofins Midland

### Client Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

**Client Sample ID: H-3 (0-0.5')**

**Lab Sample ID: 880-67023-3**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Oil Range Organics (Over C28-C36)	<49.7	U	49.7		mg/Kg		01/15/26 10:58	01/18/26 16:33	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	111		70 - 130				01/15/26 10:58	01/18/26 16:33	1
o-Terphenyl (Surr)	93		70 - 130				01/15/26 10:58	01/18/26 16:33	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/16/26 11:51	1

**Client Sample ID: H-4 (0-0.5')**

**Lab Sample ID: 880-67023-4**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

**Method: SW846 8021B - Volatile Organic Compounds (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:24	01/15/26 19:25	1
Toluene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:24	01/15/26 19:25	1
Ethylbenzene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:24	01/15/26 19:25	1
m,p-Xylenes	<0.00398	U	0.00398		mg/Kg		01/15/26 11:24	01/15/26 19:25	1
o-Xylene	<0.00199	U	0.00199		mg/Kg		01/15/26 11:24	01/15/26 19:25	1
Xylenes, Total	<0.00398	U	0.00398		mg/Kg		01/15/26 11:24	01/15/26 19:25	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	104		70 - 130				01/15/26 11:24	01/15/26 19:25	1
1,4-Difluorobenzene (Surr)	94		70 - 130				01/15/26 11:24	01/15/26 19:25	1

**Method: TAL SOP Total BTEX - Total BTEX Calculation**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total BTEX	<0.00398	U	0.00398		mg/Kg			01/15/26 19:25	1

**Method: SW846 8015 NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Total TPH	<50.1	U	50.1		mg/Kg			01/19/26 19:21	1

**Method: SW846 8015B NM - Diesel Range Organics (DRO) (GC)**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	50.1		mg/Kg		01/15/26 11:21	01/19/26 19:21	1
Diesel Range Organics (Over C10-C28)	<50.1	U F1	50.1		mg/Kg		01/15/26 11:21	01/19/26 19:21	1
Oil Range Organics (Over C28-C36)	<50.1	U	50.1		mg/Kg		01/15/26 11:21	01/19/26 19:21	1
Surrogate	%Recovery	Qualifier	Limits				Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	86		70 - 130				01/15/26 11:21	01/19/26 19:21	1
o-Terphenyl (Surr)	92		70 - 130				01/15/26 11:21	01/19/26 19:21	1

**Method: EPA 300.0 - Anions, Ion Chromatography - Soluble**

Analyte	Result	Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/16/26 11:57	1

Eurofins Midland

## Surrogate Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

## Method: 8021B - Volatile Organic Compounds (GC)

Matrix: Solid

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)	
		BFB1 (70-130)	DFBZ1 (70-130)
880-67023-1	H-1 (0-0.5')	107	96
880-67023-2	H-2 (0-0.5')	103	95
880-67023-3	H-3 (0-0.5')	96	95
880-67023-4	H-4 (0-0.5')	104	94
LCS 880-129033/1-A	Lab Control Sample	96	94
LCSD 880-129033/2-A	Lab Control Sample Dup	99	95
MB 880-129033/5-A	Method Blank	106	86

**Surrogate Legend**  
 BFB = 4-Bromofluorobenzene (Surr)  
 DFBZ = 1,4-Difluorobenzene (Surr)

## Method: 8021B - Volatile Organic Compounds (GC)

Matrix: Solid

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)	
		BFB1	DFBZ1
890-9336-A-2-E MS	Matrix Spike		

**Surrogate Legend**  
 BFB = 4-Bromofluorobenzene (Surr)  
 DFBZ = 1,4-Difluorobenzene (Surr)

## Method: 8015B NM - Diesel Range Organics (DRO) (GC)

Matrix: Solid

Prep Type: Total/NA

Lab Sample ID	Client Sample ID	Percent Surrogate Recovery (Acceptance Limits)	
		1CO1 (70-130)	OTPH1 (70-130)
880-67022-A-16-D MS	Matrix Spike	145 S1+	111
880-67022-A-16-E MSD	Matrix Spike Duplicate	118	112
880-67023-1	H-1 (0-0.5')	110	92
880-67023-2	H-2 (0-0.5')	118	96
880-67023-3	H-3 (0-0.5')	111	93
880-67023-4	H-4 (0-0.5')	86	92
880-67023-4 MS	H-4 (0-0.5')	86	89
880-67023-4 MSD	H-4 (0-0.5')	83	87
LCS 880-129027/2-A	Lab Control Sample	129	117
LCS 880-129032/2-A	Lab Control Sample	94	96
LCSD 880-129027/3-A	Lab Control Sample Dup	134 S1+	106
LCSD 880-129032/3-A	Lab Control Sample Dup	91	95
MB 880-129027/1-A	Method Blank	131 S1+	118
MB 880-129032/1-A	Method Blank	118	120

**Surrogate Legend**  
 1CO = 1-Chlorooctane (Surr)  
 OTPH = o-Terphenyl (Surr)

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

#### Method: 8021B - Volatile Organic Compounds (GC)

Lab Sample ID: MB 880-129033/5-A  
 Matrix: Solid  
 Analysis Batch: 129007

Client Sample ID: Method Blank  
 Prep Type: Total/NA  
 Prep Batch: 129033

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	<0.00200	U	0.00200		mg/Kg		01/15/26 08:00	01/15/26 11:54	1
Toluene	<0.00200	U	0.00200		mg/Kg		01/15/26 08:00	01/15/26 11:54	1
Ethylbenzene	<0.00200	U	0.00200		mg/Kg		01/15/26 08:00	01/15/26 11:54	1
m,p-Xylenes	<0.00400	U	0.00400		mg/Kg		01/15/26 08:00	01/15/26 11:54	1
o-Xylene	<0.00200	U	0.00200		mg/Kg		01/15/26 08:00	01/15/26 11:54	1
Xylenes, Total	<0.00400	U	0.00400		mg/Kg		01/15/26 08:00	01/15/26 11:54	1

Surrogate	MB %Recovery	MB Qualifier	Limits	Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	106		70 - 130	01/15/26 08:00	01/15/26 11:54	1
1,4-Difluorobenzene (Surr)	86		70 - 130	01/15/26 08:00	01/15/26 11:54	1

Lab Sample ID: LCS 880-129033/1-A  
 Matrix: Solid  
 Analysis Batch: 129007

Client Sample ID: Lab Control Sample  
 Prep Type: Total/NA  
 Prep Batch: 129033

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Benzene	0.100	0.09055		mg/Kg		91	70 - 130
Toluene	0.100	0.09042		mg/Kg		90	70 - 130
Ethylbenzene	0.100	0.09006		mg/Kg		90	70 - 130
m,p-Xylenes	0.200	0.1990		mg/Kg		100	70 - 130
o-Xylene	0.100	0.09555		mg/Kg		96	70 - 130

Surrogate	LCS %Recovery	LCS Qualifier	Limits
4-Bromofluorobenzene (Surr)	96		70 - 130
1,4-Difluorobenzene (Surr)	94		70 - 130

Lab Sample ID: LCSD 880-129033/2-A  
 Matrix: Solid  
 Analysis Batch: 129007

Client Sample ID: Lab Control Sample Dup  
 Prep Type: Total/NA  
 Prep Batch: 129033

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	Limit
Benzene	0.100	0.09307		mg/Kg		93	70 - 130	3	35
Toluene	0.100	0.09739		mg/Kg		97	70 - 130	7	35
Ethylbenzene	0.100	0.09374		mg/Kg		94	70 - 130	4	35
m,p-Xylenes	0.200	0.2131		mg/Kg		107	70 - 130	7	35
o-Xylene	0.100	0.1017		mg/Kg		102	70 - 130	6	35

Surrogate	LCSD %Recovery	LCSD Qualifier	Limits
4-Bromofluorobenzene (Surr)	99		70 - 130
1,4-Difluorobenzene (Surr)	95		70 - 130

Lab Sample ID: 890-9336-A-2-E MS  
 Matrix: Solid  
 Analysis Batch: 129007

Client Sample ID: Matrix Spike  
 Prep Type: Total/NA  
 Prep Batch: 129033

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Benzene			0.100	0.08663		mg/Kg		-	-
Toluene			0.100	0.09000		mg/Kg		-	-

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

#### Method: 8021B - Volatile Organic Compounds (GC) (Continued)

Lab Sample ID: 890-9336-A-2-E MS  
 Matrix: Solid  
 Analysis Batch: 129007

Client Sample ID: Matrix Spike  
 Prep Type: Total/NA  
 Prep Batch: 129033

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Ethylbenzene			0.100	0.08776		mg/Kg			-
m,p-Xylenes			0.200	0.1952		mg/Kg			-
o-Xylene			0.100	0.09513		mg/Kg			-

Surrogate	MS %Recovery	MS Qualifier	MS Limits
4-Bromofluorobenzene (Surr)			
1,4-Difluorobenzene (Surr)			

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC)

Lab Sample ID: MB 880-129027/1-A  
 Matrix: Solid  
 Analysis Batch: 129212

Client Sample ID: Method Blank  
 Prep Type: Total/NA  
 Prep Batch: 129027

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 12:05	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 12:05	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 10:58	01/18/26 12:05	1

Surrogate	MB %Recovery	MB Qualifier	MB Limits	Prepared	Analyzed	Dil Fac
1-Chlorooctane (Surr)	131	S1+	70 - 130	01/15/26 10:58	01/18/26 12:05	1
o-Terphenyl (Surr)	118		70 - 130	01/15/26 10:58	01/18/26 12:05	1

Lab Sample ID: LCS 880-129027/2-A  
 Matrix: Solid  
 Analysis Batch: 129212

Client Sample ID: Lab Control Sample  
 Prep Type: Total/NA  
 Prep Batch: 129027

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Gasoline Range Organics (GRO)-C6-C10	1000	892.9		mg/Kg		89	70 - 130
Diesel Range Organics (Over C10-C28)	1000	944.2		mg/Kg		94	70 - 130

Surrogate	LCS %Recovery	LCS Qualifier	LCS Limits
1-Chlorooctane (Surr)	129		70 - 130
o-Terphenyl (Surr)	117		70 - 130

Lab Sample ID: LCSD 880-129027/3-A  
 Matrix: Solid  
 Analysis Batch: 129212

Client Sample ID: Lab Control Sample Dup  
 Prep Type: Total/NA  
 Prep Batch: 129027

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Gasoline Range Organics (GRO)-C6-C10	1000	892.8		mg/Kg		89	70 - 130	0	20
Diesel Range Organics (Over C10-C28)	1000	899.4		mg/Kg		90	70 - 130	5	20

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

**Lab Sample ID: LCSD 880-129027/3-A**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Lab Control Sample Dup**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Surrogate	LCSD		Limits
	%Recovery	Qualifier	
1-Chlorooctane (Surr)	134	S1+	70 - 130
o-Terphenyl (Surr)	106		70 - 130

**Lab Sample ID: 880-67022-A-16-D MS**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Matrix Spike**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Analyte	Sample	Sample	Spike	MS	MS	Unit	D	%Rec	%Rec	Limits
	Result	Qualifier	Added	Result	Qualifier					
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	996	964.2		mg/Kg		97		70 - 130
Diesel Range Organics (Over C10-C28)	<50.1	U	996	903.8		mg/Kg		91		70 - 130

Surrogate	MS		Limits
	%Recovery	Qualifier	
1-Chlorooctane (Surr)	145	S1+	70 - 130
o-Terphenyl (Surr)	111		70 - 130

**Lab Sample ID: 880-67022-A-16-E MSD**  
**Matrix: Solid**  
**Analysis Batch: 129212**

**Client Sample ID: Matrix Spike Duplicate**  
**Prep Type: Total/NA**  
**Prep Batch: 129027**

Analyte	Sample	Sample	Spike	MSD	MSD	Unit	D	%Rec	%Rec	Limits	RPD	RPD	Limit
	Result	Qualifier	Added	Result	Qualifier								
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	1000	963.8		mg/Kg		96		70 - 130	0	20	
Diesel Range Organics (Over C10-C28)	<50.1	U	1000	980.2		mg/Kg		98		70 - 130	8	20	

Surrogate	MSD		Limits
	%Recovery	Qualifier	
1-Chlorooctane (Surr)	118		70 - 130
o-Terphenyl (Surr)	112		70 - 130

**Lab Sample ID: MB 880-129032/1-A**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: Method Blank**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	MB	MB	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
	Result	Qualifier							
Gasoline Range Organics (GRO)-C6-C10	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 18:36	1
Diesel Range Organics (Over C10-C28)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 18:36	1
Oil Range Organics (Over C28-C36)	<50.0	U	50.0		mg/Kg		01/15/26 11:21	01/19/26 18:36	1

Surrogate	MB	MB	Limits	Prepared	Analyzed	Dil Fac
	%Recovery	Qualifier				
1-Chlorooctane (Surr)	118		70 - 130	01/15/26 11:21	01/19/26 18:36	1
o-Terphenyl (Surr)	120		70 - 130	01/15/26 11:21	01/19/26 18:36	1

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

**Lab Sample ID: LCS 880-129032/2-A**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: Lab Control Sample**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits	
Gasoline Range Organics (GRO)-C6-C10	1000	1107		mg/Kg		111	70 - 130	
Diesel Range Organics (Over C10-C28)	1000	983.9		mg/Kg		98	70 - 130	
		<b>LCS</b>	<b>LCS</b>					
<b>Surrogate</b>		<b>%Recovery</b>	<b>Qualifier</b>			<b>Limits</b>		
1-Chlorooctane (Surr)		94				70 - 130		
o-Terphenyl (Surr)		96				70 - 130		

**Lab Sample ID: LCSD 880-129032/3-A**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: Lab Control Sample Dup**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits		RPD Limit	
									RPD	Limit
Gasoline Range Organics (GRO)-C6-C10	1000	1088		mg/Kg		109	70 - 130	2	20	
Diesel Range Organics (Over C10-C28)	1000	997.9		mg/Kg		100	70 - 130	1	20	
		<b>LCSD</b>	<b>LCSD</b>							
<b>Surrogate</b>		<b>%Recovery</b>	<b>Qualifier</b>			<b>Limits</b>				
1-Chlorooctane (Surr)		91				70 - 130				
o-Terphenyl (Surr)		95				70 - 130				

**Lab Sample ID: 880-67023-4 MS**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: H-4 (0-0.5')**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits	
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	996	787.0		mg/Kg		79	70 - 130	
Diesel Range Organics (Over C10-C28)	<50.1	U F1	996	664.2	F1	mg/Kg		67	70 - 130	
		<b>MS</b>	<b>MS</b>							
<b>Surrogate</b>		<b>%Recovery</b>	<b>Qualifier</b>			<b>Limits</b>				
1-Chlorooctane (Surr)		86				70 - 130				
o-Terphenyl (Surr)		89				70 - 130				

**Lab Sample ID: 880-67023-4 MSD**  
**Matrix: Solid**  
**Analysis Batch: 129255**

**Client Sample ID: H-4 (0-0.5')**  
**Prep Type: Total/NA**  
**Prep Batch: 129032**

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits		RPD Limit	
											RPD	Limit
Gasoline Range Organics (GRO)-C6-C10	<50.1	U	995	776.2		mg/Kg		78	70 - 130	1	20	
Diesel Range Organics (Over C10-C28)	<50.1	U F1	995	666.1	F1	mg/Kg		67	70 - 130	0	20	
		<b>MSD</b>	<b>MSD</b>									
<b>Surrogate</b>		<b>%Recovery</b>	<b>Qualifier</b>			<b>Limits</b>						
1-Chlorooctane (Surr)		83				70 - 130						

Eurofins Midland

### QC Sample Results

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

#### Method: 8015B NM - Diesel Range Organics (DRO) (GC) (Continued)

Lab Sample ID: 880-67023-4 MSD  
 Matrix: Solid  
 Analysis Batch: 129255

Client Sample ID: H-4 (0-0.5')  
 Prep Type: Total/NA  
 Prep Batch: 129032

Surrogate	%Recovery	MSD MSD Qualifier	Limits
<i>o</i> -Terphenyl (Surr)	87		70 - 130

#### Method: 300.0 - Anions, Ion Chromatography

Lab Sample ID: MB 880-129101/1-A  
 Matrix: Solid  
 Analysis Batch: 129131

Client Sample ID: Method Blank  
 Prep Type: Soluble

Analyte	MB Result	MB Qualifier	RL	MDL	Unit	D	Prepared	Analyzed	Dil Fac
Chloride	<10.0	U	10.0		mg/Kg			01/16/26 10:55	1

Lab Sample ID: LCS 880-129101/2-A  
 Matrix: Solid  
 Analysis Batch: 129131

Client Sample ID: Lab Control Sample  
 Prep Type: Soluble

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits
Chloride	250	249.7		mg/Kg		100	90 - 110

Lab Sample ID: LCSD 880-129101/3-A  
 Matrix: Solid  
 Analysis Batch: 129131

Client Sample ID: Lab Control Sample Dup  
 Prep Type: Soluble

Analyte	Spike Added	LCSD Result	LCSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	250	256.0		mg/Kg		102	90 - 110	2	20

Lab Sample ID: 880-67023-1 MS  
 Matrix: Solid  
 Analysis Batch: 129131

Client Sample ID: H-1 (0-0.5')  
 Prep Type: Soluble

Analyte	Sample Result	Sample Qualifier	Spike Added	MS Result	MS Qualifier	Unit	D	%Rec	%Rec Limits
Chloride	<9.96	U	249	259.1		mg/Kg		104	90 - 110

Lab Sample ID: 880-67023-1 MSD  
 Matrix: Solid  
 Analysis Batch: 129131

Client Sample ID: H-1 (0-0.5')  
 Prep Type: Soluble

Analyte	Sample Result	Sample Qualifier	Spike Added	MSD Result	MSD Qualifier	Unit	D	%Rec	%Rec Limits	RPD	RPD Limit
Chloride	<9.96	U	249	264.7		mg/Kg		106	90 - 110	2	20

## QC Association Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

## GC VOA

## Analysis Batch: 129007

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Total/NA	Solid	8021B	129033
880-67023-2	H-2 (0-0.5')	Total/NA	Solid	8021B	129033
880-67023-3	H-3 (0-0.5')	Total/NA	Solid	8021B	129033
880-67023-4	H-4 (0-0.5')	Total/NA	Solid	8021B	129033
MB 880-129033/5-A	Method Blank	Total/NA	Solid	8021B	129033
LCS 880-129033/1-A	Lab Control Sample	Total/NA	Solid	8021B	129033
LCSD 880-129033/2-A	Lab Control Sample Dup	Total/NA	Solid	8021B	129033
890-9336-A-2-E MS	Matrix Spike	Total/NA	Solid	8021B	129033

## Prep Batch: 129033

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Total/NA	Solid	5035	
880-67023-2	H-2 (0-0.5')	Total/NA	Solid	5035	
880-67023-3	H-3 (0-0.5')	Total/NA	Solid	5035	
880-67023-4	H-4 (0-0.5')	Total/NA	Solid	5035	
MB 880-129033/5-A	Method Blank	Total/NA	Solid	5035	
LCS 880-129033/1-A	Lab Control Sample	Total/NA	Solid	5035	
LCSD 880-129033/2-A	Lab Control Sample Dup	Total/NA	Solid	5035	
890-9336-A-2-E MS	Matrix Spike	Total/NA	Solid	5035	

## Analysis Batch: 129162

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Total/NA	Solid	Total BTEX	
880-67023-2	H-2 (0-0.5')	Total/NA	Solid	Total BTEX	
880-67023-3	H-3 (0-0.5')	Total/NA	Solid	Total BTEX	
880-67023-4	H-4 (0-0.5')	Total/NA	Solid	Total BTEX	

## GC Semi VOA

## Prep Batch: 129027

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Total/NA	Solid	8015NM Prep	
880-67023-2	H-2 (0-0.5')	Total/NA	Solid	8015NM Prep	
880-67023-3	H-3 (0-0.5')	Total/NA	Solid	8015NM Prep	
MB 880-129027/1-A	Method Blank	Total/NA	Solid	8015NM Prep	
LCS 880-129027/2-A	Lab Control Sample	Total/NA	Solid	8015NM Prep	
LCSD 880-129027/3-A	Lab Control Sample Dup	Total/NA	Solid	8015NM Prep	
880-67022-A-16-D MS	Matrix Spike	Total/NA	Solid	8015NM Prep	
880-67022-A-16-E MSD	Matrix Spike Duplicate	Total/NA	Solid	8015NM Prep	

## Prep Batch: 129032

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-4	H-4 (0-0.5')	Total/NA	Solid	8015NM Prep	
MB 880-129032/1-A	Method Blank	Total/NA	Solid	8015NM Prep	
LCS 880-129032/2-A	Lab Control Sample	Total/NA	Solid	8015NM Prep	
LCSD 880-129032/3-A	Lab Control Sample Dup	Total/NA	Solid	8015NM Prep	
880-67023-4 MS	H-4 (0-0.5')	Total/NA	Solid	8015NM Prep	
880-67023-4 MSD	H-4 (0-0.5')	Total/NA	Solid	8015NM Prep	

Eurofins Midland

## QC Association Summary

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

## GC Semi VOA

## Analysis Batch: 129212

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Total/NA	Solid	8015B NM	129027
880-67023-2	H-2 (0-0.5')	Total/NA	Solid	8015B NM	129027
880-67023-3	H-3 (0-0.5')	Total/NA	Solid	8015B NM	129027
MB 880-129027/1-A	Method Blank	Total/NA	Solid	8015B NM	129027
LCS 880-129027/2-A	Lab Control Sample	Total/NA	Solid	8015B NM	129027
LCSD 880-129027/3-A	Lab Control Sample Dup	Total/NA	Solid	8015B NM	129027
880-67022-A-16-D MS	Matrix Spike	Total/NA	Solid	8015B NM	129027
880-67022-A-16-E MSD	Matrix Spike Duplicate	Total/NA	Solid	8015B NM	129027

## Analysis Batch: 129255

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-4	H-4 (0-0.5')	Total/NA	Solid	8015B NM	129032
MB 880-129032/1-A	Method Blank	Total/NA	Solid	8015B NM	129032
LCS 880-129032/2-A	Lab Control Sample	Total/NA	Solid	8015B NM	129032
LCSD 880-129032/3-A	Lab Control Sample Dup	Total/NA	Solid	8015B NM	129032
880-67023-4 MS	H-4 (0-0.5')	Total/NA	Solid	8015B NM	129032
880-67023-4 MSD	H-4 (0-0.5')	Total/NA	Solid	8015B NM	129032

## Analysis Batch: 129342

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Total/NA	Solid	8015 NM	
880-67023-2	H-2 (0-0.5')	Total/NA	Solid	8015 NM	
880-67023-3	H-3 (0-0.5')	Total/NA	Solid	8015 NM	
880-67023-4	H-4 (0-0.5')	Total/NA	Solid	8015 NM	

## HPLC/IC

## Leach Batch: 129101

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Soluble	Solid	DI Leach	
880-67023-2	H-2 (0-0.5')	Soluble	Solid	DI Leach	
880-67023-3	H-3 (0-0.5')	Soluble	Solid	DI Leach	
880-67023-4	H-4 (0-0.5')	Soluble	Solid	DI Leach	
MB 880-129101/1-A	Method Blank	Soluble	Solid	DI Leach	
LCS 880-129101/2-A	Lab Control Sample	Soluble	Solid	DI Leach	
LCSD 880-129101/3-A	Lab Control Sample Dup	Soluble	Solid	DI Leach	
880-67023-1 MS	H-1 (0-0.5')	Soluble	Solid	DI Leach	
880-67023-1 MSD	H-1 (0-0.5')	Soluble	Solid	DI Leach	

## Analysis Batch: 129131

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
880-67023-1	H-1 (0-0.5')	Soluble	Solid	300.0	129101
880-67023-2	H-2 (0-0.5')	Soluble	Solid	300.0	129101
880-67023-3	H-3 (0-0.5')	Soluble	Solid	300.0	129101
880-67023-4	H-4 (0-0.5')	Soluble	Solid	300.0	129101
MB 880-129101/1-A	Method Blank	Soluble	Solid	300.0	129101
LCS 880-129101/2-A	Lab Control Sample	Soluble	Solid	300.0	129101
LCSD 880-129101/3-A	Lab Control Sample Dup	Soluble	Solid	300.0	129101
880-67023-1 MS	H-1 (0-0.5')	Soluble	Solid	300.0	129101
880-67023-1 MSD	H-1 (0-0.5')	Soluble	Solid	300.0	129101

Eurofins Midland

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

**Client Sample ID: H-1 (0-0.5')**

**Lab Sample ID: 880-67023-1**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.97 g	5 mL	129033	01/15/26 11:24	MNR	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129007	01/15/26 18:24	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129162	01/15/26 18:24	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129342	01/18/26 16:03	SA	EET MID
Total/NA	Prep	8015NM Prep			10.05 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 16:03	FC	EET MID
Soluble	Leach	DI Leach			5.02 g	50 mL	129101	01/16/26 08:05	SI	EET MID
Soluble	Analysis	300.0		1			129131	01/16/26 11:16	CS	EET MID

**Client Sample ID: H-2 (0-0.5')**

**Lab Sample ID: 880-67023-2**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.99 g	5 mL	129033	01/15/26 11:24	MNR	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129007	01/15/26 18:44	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129162	01/15/26 18:44	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129342	01/18/26 16:19	SA	EET MID
Total/NA	Prep	8015NM Prep			9.99 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 16:19	FC	EET MID
Soluble	Leach	DI Leach			4.96 g	50 mL	129101	01/16/26 08:05	SI	EET MID
Soluble	Analysis	300.0		1			129131	01/16/26 11:44	CS	EET MID

**Client Sample ID: H-3 (0-0.5')**

**Lab Sample ID: 880-67023-3**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			4.96 g	5 mL	129033	01/15/26 11:24	MNR	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129007	01/15/26 19:05	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129162	01/15/26 19:05	AJ	EET MID
Total/NA	Analysis	8015 NM		1			129342	01/18/26 16:33	SA	EET MID
Total/NA	Prep	8015NM Prep			10.06 g	10.00 mL	129027	01/15/26 10:58	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129212	01/18/26 16:33	FC	EET MID
Soluble	Leach	DI Leach			4.98 g	50 mL	129101	01/16/26 08:05	SI	EET MID
Soluble	Analysis	300.0		1			129131	01/16/26 11:51	CS	EET MID

**Client Sample ID: H-4 (0-0.5')**

**Lab Sample ID: 880-67023-4**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Prep	5035			5.03 g	5 mL	129033	01/15/26 11:24	MNR	EET MID
Total/NA	Analysis	8021B		1	5 mL	5 mL	129007	01/15/26 19:25	MNR	EET MID
Total/NA	Analysis	Total BTEX		1			129162	01/15/26 19:25	AJ	EET MID

Eurofins Midland

### Lab Chronicle

Client: Carmona Resources  
 Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
 SDG: Lea County, New Mexico

**Client Sample ID: H-4 (0-0.5')**

**Lab Sample ID: 880-67023-4**

Date Collected: 01/14/26 00:00

Matrix: Solid

Date Received: 01/14/26 17:00

Prep Type	Batch Type	Batch Method	Run	Dil Factor	Initial Amount	Final Amount	Batch Number	Prepared or Analyzed	Analyst	Lab
Total/NA	Analysis	8015 NM		1			129342	01/19/26 19:21	SA	EET MID
Total/NA	Prep	8015NM Prep			9.99 g	10.00 mL	129032	01/15/26 11:21	JN	EET MID
Total/NA	Analysis	8015B NM		1	1 uL	1 uL	129255	01/19/26 19:21	FC	EET MID
Soluble	Leach	DI Leach			5.00 g	50 mL	129101	01/16/26 08:05	SI	EET MID
Soluble	Analysis	300.0		1			129131	01/16/26 11:57	CS	EET MID

**Laboratory References:**

EET MID = Eurofins Midland, 1211 W. Florida Ave, Midland, TX 79701, TEL (432)704-5440

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

### Accreditation/Certification Summary

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
SDG: Lea County, New Mexico

#### Laboratory: Eurofins Midland

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
Texas	NELAP	T104704400	06-30-26

The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.

Analysis Method	Prep Method	Matrix	Analyte
8015 NM		Solid	Total TPH
Total BTEX		Solid	Total BTEX

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

### Method Summary

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
SDG: Lea County, New Mexico

Method	Method Description	Protocol	Laboratory
8021B	Volatile Organic Compounds (GC)	SW846	EET MID
Total BTEX	Total BTEX Calculation	TAL SOP	EET MID
8015 NM	Diesel Range Organics (DRO) (GC)	SW846	EET MID
8015B NM	Diesel Range Organics (DRO) (GC)	SW846	EET MID
300.0	Anions, Ion Chromatography	EPA	EET MID
5035	Closed System Purge and Trap	SW846	EET MID
8015NM Prep	Microextraction	SW846	EET MID
DI Leach	Deionized Water Leaching Procedure	ASTM	EET MID

**Protocol References:**

- ASTM = ASTM International
- EPA = US Environmental Protection Agency
- SW846 = "Test Methods For Evaluating Solid Waste, Physical/Chemical Methods", Third Edition, November 1986 And Its Updates.
- TAL SOP = TestAmerica Laboratories, Standard Operating Procedure

**Laboratory References:**

- EET MID = Eurofins Midland, 1211 W. Florida Ave, Midland, TX 79701, TEL (432)704-5440



### Sample Summary

Client: Carmona Resources  
Project/Site: Maxus B 8026 JV-P #003 (04.24.2007)

Job ID: 880-67023-1  
SDG: Lea County, New Mexico

Lab Sample ID	Client Sample ID	Matrix	Collected	Received	Sample Origin
880-67023-1	H-1 (0-0.5')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67023-2	H-2 (0-0.5')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67023-3	H-3 (0-0.5')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico
880-67023-4	H-4 (0-0.5')	Solid	01/14/26 00:00	01/14/26 17:00	New Mexico

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

# Chain of Custody



880-67023 Chain of Custody

Page 1 of 1

Project Manager: Ashton Thielke	Bill to (if different): Carmona Resources	Carmona Resources	
Company Name: Carmona Resources	Company Name: Carmona Resources		
Address: 310 W Wall St Ste 500	Address: 310 W Wall St Ste 500		
City, State, ZIP: Midland, TX 79701	City, State, ZIP: Midland, TX 79701		
Phone: 432-813-8988	Email: ThielkeA@carmonaresources.com		

**Work Order Comments**

Program: UST/PST PRP Brownfields RC perfund

State of Project: Level II Level III ST/UST RRP Level IV

Reporting Level II Level III ST/UST RRP Level IV

Deliverables: EDD  ADaPT  Other

Project Name: Maxus B 8026 JV-P #003 (04 24 2007)	Turn Around: <input checked="" type="checkbox"/> Routine <input type="checkbox"/> Rush	Pres. Code: Parameters	ANALYSIS REQUEST
Project Number: 3103	Due Date: Normal		
Project Location: Lea County, New Mexico			
Sampler's Name: JR			
PO #			

**SAMPLE RECEIPT**

Received Intact: Yes  No  Temp Blank: Yes  No

Cooler Custody Seals: Yes  No  Thermometer ID: TRS

Sample Custody Seals: Yes  No  Correction Factor: -0.1

Total Containers: Yes  No  Temperature Reading: 7.1

Corrected Temperature: 7.0

Sample Identification	Date	Time	Soil	Water	Grab/Comp	# of Cont
H-1 (0-0.5')	1/14/2026		X		Grab/	1
H-2 (0-0.5')	1/14/2026		X		Grab/	1
H-3 (0-0.5')	1/14/2026		X		Grab/	1
H-4 (0-0.5')	1/14/2026		X		Grab/	1

Preservative Codes	Sample Comments
None NO	
Cool Cool	
HCL. HC	
H <sub>2</sub> SO <sub>4</sub> H <sub>2</sub>	
H <sub>3</sub> PO <sub>4</sub> HP	
NaHSO <sub>4</sub> NABIS	
Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> NaSO <sub>3</sub>	
Zn Acetate+NaOH Zn	
NaOH+Ascorbic Acid SAPC	

Relinquished by (Signature)	Date/Time	Received by (Signature)	Date/Time



### Login Sample Receipt Checklist

Client: Carmona Resources

Job Number: 880-67023-1  
SDG Number: Lea County, New Mexico

**Login Number: 67023**

**List Number: 1**

**Creator: Dyal, Erica**

**List Source: Eurofins Midland**

Question	Answer	Comment
The cooler's custody seal, if present, is intact.	N/A	
Sample custody seals, if present, are intact.	N/A	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	True	
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	N/A	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is <6mm (1/4").	N/A	

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11
- 12
- 13
- 14

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

QUESTIONS

Action 554378

**QUESTIONS**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**QUESTIONS**

<b>Prerequisites</b>	
Incident ID (n#)	nAPM2325637248
Incident Name	NAPM2325637248 MAXUS B 8026 JV-P #003 @ 30-025-30661
Incident Type	Oil Release
Incident Status	Remediation Closure Report Received
Incident Well	[30-025-30661] MAXUS B 8026 JV-P #003

<b>Location of Release Source</b>	
<i>Please answer all the questions in this group.</i>	
Site Name	MAXUS B 8026 JV-P #003
Date Release Discovered	04/24/2007
Surface Owner	State

<b>Incident Details</b>	
<i>Please answer all the questions in this group.</i>	
Incident Type	Oil Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

<b>Nature and Volume of Release</b>	
<i>Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.</i>	
Crude Oil Released (bbls) Details	Cause: Other   Unknown   Crude Oil   Released: 0 BBL (Unknown Released Amount)   Recovered: 0 BBL   Lost: 0 BBL.
Produced Water Released (bbls) Details	Not answered.
Is the concentration of chloride in the produced water >10,000 mg/l	Not answered.
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Not answered.

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

QUESTIONS, Page 2

Action 554378

**QUESTIONS (continued)**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**QUESTIONS**

<b>Nature and Volume of Release (continued)</b>	
Is this a gas only submission (i.e. only significant Mcf values reported)	<b>No, according to supplied volumes this does not appear to be a "gas only" report.</b>
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	<b>Yes</b>
Reasons why this would be considered a submission for a notification of a major release	<b>From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.</b>

*With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.*

**Initial Response**

*The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.*

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

*Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.*

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Noah Tinker Title: Engineer Email: ntinker@btaoil.com Date: 02/16/2026
--	---

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

QUESTIONS, Page 3

Action 554378

**QUESTIONS (continued)**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**QUESTIONS**

**Site Characterization**  
*Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.*

What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
<b>What is the minimum distance, between the closest lateral extents of the release and the following surface areas:</b>	
A continuously flowing watercourse or any other significant watercourse	Greater than 5 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Between 1 and 5 (mi.)
An occupied permanent residence, school, hospital, institution, or church	Between 1 and 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between 1 and 5 (mi.)
Any other fresh water well or spring	Between 1 and 5 (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Between 1 and 5 (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Between 1 and 5 (mi.)
Categorize the risk of this well / site being in a karst geology	Low
A 100-year floodplain	Greater than 5 (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	No

**Remediation Plan**  
*Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.*

Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No

**Soil Contamination Sampling:** (Provide the highest observable value for each, in milligrams per kilograms.)

Chloride (EPA 300.0 or SM4500 Cl B)	0
TPH (GRO+DRO+MRO) (EPA SW-846 Method 8015M)	0
GRO+DRO (EPA SW-846 Method 8015M)	0
BTEX (EPA SW-846 Method 8021B or 8260B)	0
Benzene (EPA SW-846 Method 8021B or 8260B)	0

*Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.*

On what estimated date will the remediation commence	01/14/2026
On what date will (or did) the final sampling or liner inspection occur	01/14/2026
On what date will (or was) the remediation complete(d)	01/14/2026
What is the estimated surface area (in square feet) that will be reclaimed	0
What is the estimated volume (in cubic yards) that will be reclaimed	0
What is the estimated surface area (in square feet) that will be remediated	0
What is the estimated volume (in cubic yards) that will be remediated	0

*These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed. The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.*

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

QUESTIONS, Page 4

Action 554378

**QUESTIONS (continued)**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**QUESTIONS**

**Remediation Plan (continued)**

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

**This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:**

(Select all answers below that apply.)

(Ex Situ) Excavation and <b>off-site</b> disposal (i.e. dig and haul, hydrovac, etc.)	Not answered.
(Ex Situ) Excavation and <b>on-site</b> remediation (i.e. On-Site Land Farms)	Not answered.
(In Situ) Soil Vapor Extraction	Not answered.
(In Situ) Chemical processing (i.e. Soil Shredding, Potassium Permanganate, etc.)	Not answered.
(In Situ) Biological processing (i.e. Microbes / Fertilizer, etc.)	Not answered.
(In Situ) Physical processing (i.e. Soil Washing, Gypsum, Disking, etc.)	Not answered.
Ground Water Abatement pursuant to 19.15.30 NMAC	Not answered.
OTHER (Non-listed remedial process)	Yes
Other Non-listed Remedial Process. Please specify	Area was sampled per NMOCD correspondence. Vertical and horizontal delineation samples all within acceptable limits per NMAC 19.15.29.12

Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Noah Tinker Title: Engineer Email: ntinker@btaoil.com Date: 02/16/2026
--	---

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

QUESTIONS, Page 5

Action 554378

**QUESTIONS (continued)**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**QUESTIONS**

<b>Deferral Requests Only</b>	
<i>Only answer the questions in this group if seeking a deferral upon approval this submission. Each of the following items must be confirmed as part of any request for deferral of remediation.</i>	
Requesting a deferral of the remediation closure due date with the approval of this submission	No

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

QUESTIONS, Page 6

Action 554378

**QUESTIONS (continued)**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**QUESTIONS**

<b>Sampling Event Information</b>	
Last sampling notification (C-141N) recorded	<b>541721</b>
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	<b>01/15/2026</b>
What was the (estimated) number of samples that were to be gathered	<b>11</b>
What was the sampling surface area in square feet	<b>500</b>

**Remediation Closure Request**

*Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.*

Requesting a remediation closure approval with this submission	Yes
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
All areas reasonably needed for production or subsequent drilling operations have been stabilized, returned to the sites existing grade, and have a soil cover that prevents ponding of water, minimizing dust and erosion	Yes
What was the total surface area (in square feet) remediated	0
What was the total volume (cubic yards) remediated	0
All areas not reasonably needed for production or subsequent drilling operations have been reclaimed to contain a minimum of four feet of non-waste contain earthen material with concentrations less than 600 mg/kg chlorides, 100 mg/kg TPH, 50 mg/kg BTEX, and 10 mg/kg Benzene	Yes
What was the total surface area (in square feet) reclaimed	0
What was the total volume (in cubic yards) reclaimed	0
Summarize any additional remediation activities not included by answers (above)	Area was sampled per NMOCD correspondence. Vertical and horizontal delineation samples all within acceptable limits per NMAC 19.15.29.12

*The responsible party must attach information demonstrating they have complied with all applicable closure requirements and any conditions or directives of the OCD. This demonstration should be in the form of a comprehensive report (in .pdf format) including a scaled site map, sampling diagrams, relevant field notes, photographs of any excavation prior to backfilling, laboratory data including chain of custody documents of final sampling, and a narrative of the remedial activities. Refer to 19.15.29.12 NMAC.*

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. The responsible party acknowledges they must substantially restore, reclaim, and re-vegetate the impacted surface area to the conditions that existed prior to the release or their final land use in accordance with 19.15.29.13 NMAC including notification to the OCD when reclamation and re-vegetation are complete.

I hereby agree and sign off to the above statement	Name: Noah Tinker Title: Engineer Email: ntinker@btaoil.com Date: 02/16/2026
--	---

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

QUESTIONS, Page 7

Action 554378

**QUESTIONS (continued)**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**QUESTIONS**

<b>Reclamation Report</b>	
<i>Only answer the questions in this group if all reclamation steps have been completed.</i>	
Requesting a reclamation approval with this submission	No

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 554378

**CONDITIONS**

Operator: BTA OIL PRODUCERS, LLC 104 S Pecos Midland, TX 79701	OGRID: 260297
	Action Number: 554378
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

**CONDITIONS**

Created By	Condition	Condition Date
scott.rodgers	This Remediation Closure Report is approved. Areas reasonably needed for production or subsequent drilling operations will need to be reclaimed and revegetated as soon as they are no longer reasonably needed. A report for reclamation and revegetation will need to be submitted and approved prior to this incident receiving the final status of "Restoration Complete".	2/25/2026