



ENTERPRISE PRODUCTS PARTNERS L.P.
ENTERPRISE PRODUCTS HOLDINGS LLC
(General Partner)

ENTERPRISE PRODUCTS OPERATING LLC

July 2, 2026

Submitted online via OCD E-Permitting:
<https://wwwapps.emnrd.state.nm.us/OCD/OCDPermitting/default.aspx>

Ms. Ashley Maxwell
New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

RE: Second Quarter 2026 Monitoring and Sampling Report (Ensolum, June 30, 2026)
Chaco Plant 3 Phase Separator (7/22/20)
Enterprise Field Services L.L.C
P.O Box 4324, Houston TX 77210-4324
Chaco Plant, San Juan County, NM
Site Coordinates: N 36.481637, W 108.120470
Incident Number: NRM2021235744

Dear Ms. Maxwell:

Enterprise Products Operating LLC (Enterprise), on behalf of Enterprise Field Services LLC, submits herein to the New Mexico Energy, Minerals and Natural Resources Department (EMNRD) Oil Conservation Division's (OCD) an electronic copy of the above referenced report prepared by Ensolum, LLC (Ensolum) dated June 30, 2026. The report is associated with the Enterprise Chaco Plant 3 Phase Separator release of produced water, identified on July 22, 2020, from a faulty valve on a three-phase separator located on the Chaco Plant in San Juan County, New Mexico.

In correspondence dated February 25, 2026, the NMOCD provided the following condition or comment, among others:

- **Transition from submitting annual monitoring and sampling reports to submitting quarterly monitoring and sampling reports. Operator may request to reduce sampling events based upon future results.**

The attached report summarizes groundwater monitoring and sampling (GWM&S) activities that occurred between April 1, 2026 and June 30, 2026 (Second Quarter 2026), including laboratory analytical results.

Should you have any questions, comments, or concerns, or need additional information regarding this Site, please contact Joseph Doyle via email at [jedoyale@eprod.com](mailto:jedoyle@eprod.com), or via phone at 713-381-4668.

Sincerely,

A handwritten signature in blue ink, appearing to read 'Joseph Doyle'.

Joseph E. Doyle
Scientist, Environmental

A handwritten signature in blue ink, appearing to read 'W. Tucker Jacobson'.

W. Tucker Jacobson
Senior Manager, Environmental

ec: NM OCD – Aztec District – Nelson Velez <nelson.velez@emnrd.nm.gov>
Ensolum – Mr. Dan Moir <dmoir@ensolum.com>



June 30, 2026

Joseph Doyle

Scientist, Environmental - Remediation
Enterprise Field Services, LLC
P.O. Box 4324
Houston, Texas 77210-4324

Re: Second Quarter 2026 Monitoring and Sampling Report

Chaco Plant 3 Phase Separator (7/22/20)
San Juan County, New Mexico
NMOCD Incident ID No. NRM2021235744

Mr. Doyle:

Ensolum, LLC (Ensolum) is pleased to present this *Second Quarter 2026 Monitoring and Sampling Report* (Report) to Enterprise Field Services, LLC (Enterprise) to document groundwater monitoring and sampling activities conducted at the Chaco Plant 3 Phase Separator (7/22/20) site (Site) during the second quarter of 2026. The Site is located in Unit Letter N, Section 16, Township 26 North, Range 12 West, in San Juan County, New Mexico (**Figure 1**).

The Site is subject to regulatory oversight by the New Mexico Oil Conservation Division (NMOCD) under 19.15.29 and 19.15.30 of the New Mexico Administrative Code (NMAC), which establishes investigation and abatement requirements for oil and gas releases. Groundwater is evaluated using the New Mexico Water Quality Control Commission (NMWQCC) Groundwater Quality Standards (GQSs) defined in 20.6.2 NMAC.

SITE GROUNDWATER CLEANUP STANDARDS

The following applicable NMWQCC GQSs are presented in micrograms per liter ($\mu\text{g/L}$) and milligrams per liter (mg/L) for the applicable constituents of concern (COCs) at the Site:

- Benzene: 5.0 $\mu\text{g/L}$
- Toluene: 1,000 $\mu\text{g/L}$
- Ethylbenzene: 700 $\mu\text{g/L}$
- Total Xylenes: 620 $\mu\text{g/L}$
- Chloride: 250 mg/L
- Total Dissolved Solids (TDS): 1,000 mg/L

SECOND QUARTER 2026 GROUNDWATER SAMPLING ACTIVITIES AND RESULTS

Ensolum personnel conducted groundwater sampling activities at the Site on May 20, 2026, related to monitoring wells TW-1/EW-1, EW-2, EW-3, and EW-4.

Static groundwater levels were measured using a decontaminated oil/water interface probe. The interface probe was decontaminated with Alconox® soap and rinsed with distilled water prior to each measurement to prevent cross-contamination. Non-aqueous phase liquid (NAPL) was not encountered in any monitoring well at the Site.

Groundwater samples were collected using low-flow sampling techniques. Purging was accomplished by removing stagnant groundwater from the monitoring wells prior to collecting a sample. Field measurements of groundwater quality parameters, including temperature, pH, electrical conductivity, oxidation-reduction potential, and TDS were collected during the purging process. Following low flow purging, groundwater samples were placed directly into a laboratory provided containers and labeled with the date and time of collection, well designation, project name, sample collector's name, and parameters to be analyzed. Containers were immediately sealed and packed on ice to preserve samples. Samples were submitted to Envirotech Analytical Laboratory (Envirotech) in Farmington, New Mexico, for analysis of benzene, toluene, ethylbenzene and total xylenes (BTEX) following United State Environmental Protection Agency (EPA) Method 8260B, TDS following Standard Method (SM) 2540C MOD, and chloride following EPA Method 300.0. Proper chain-of-custody procedures were followed documenting the date and time sampled, sample number, type of sample, sample collector's name, preservative used, analyses required, and sample collector's signature.

Measured depths to groundwater and calculated groundwater elevations are summarized in **Table 1**. A groundwater elevation map constructed from these data (**Figure 2**) indicated a groundwater flow direction generally to the west, as interpreted from groundwater elevation contours, which is consistent with historical events. The calculated hydraulic gradient was approximately 0.002 feet per foot (ft/ft) during the second quarter 2026 monitoring event.

During the May 2026 groundwater sampling event,

- Benzene was detected within TW-1/EW-1 at a concentration of 41.4 µg/L, which was greater than the NMWQCC GQS. Ethylbenzene was also detected within TW-1/EW-1 at a concentration of 15.1 µg/L; however, this concentration was less than the NMWQCC GQS.
- BTEX constituents in monitoring wells EW-2 through EW-4 were not detected above laboratory reporting limits, which were less than their respective NMWQCC GQSs.
- Chloride was detected at concentrations less than the NMWQCC GQS in monitoring wells TW-1/EW-1 through EW-4.
- TDS was detected in all monitoring wells, ranging from 2,540 mg/L to 3,370 mg/L, which were greater than the NMWQCC GQS. Results were consistent with historical data.


Analytical results are summarized in **Table 2 and Table 3** and are depicted on **Figure 2**, with complete laboratory analytical reports provided in **Appendix A**.

The third quarter 2026 monitoring event is tentatively scheduled for August 2026.


Ensolum appreciates the opportunity to provide these environmental services to Enterprise. Please contact either of the undersigned with any questions.

Sincerely,

Ensolum, LLC



Harper Peck
Staff Geologist




Daniel R. Moir, PG (licensed in WY & TX)
Associate Principal, Geologist

Attachments:

Figure 1	Site Location Map
Figure 2	Groundwater Elevation and Analytical Results (May 2026)
Table 1	Groundwater Elevations
Table 2	Groundwater Analytical Summary – Volatile Organic Compounds
Table 3	Groundwater Analytical Summary - Inorganics
Appendix A	Laboratory Analytical Reports




FIGURES

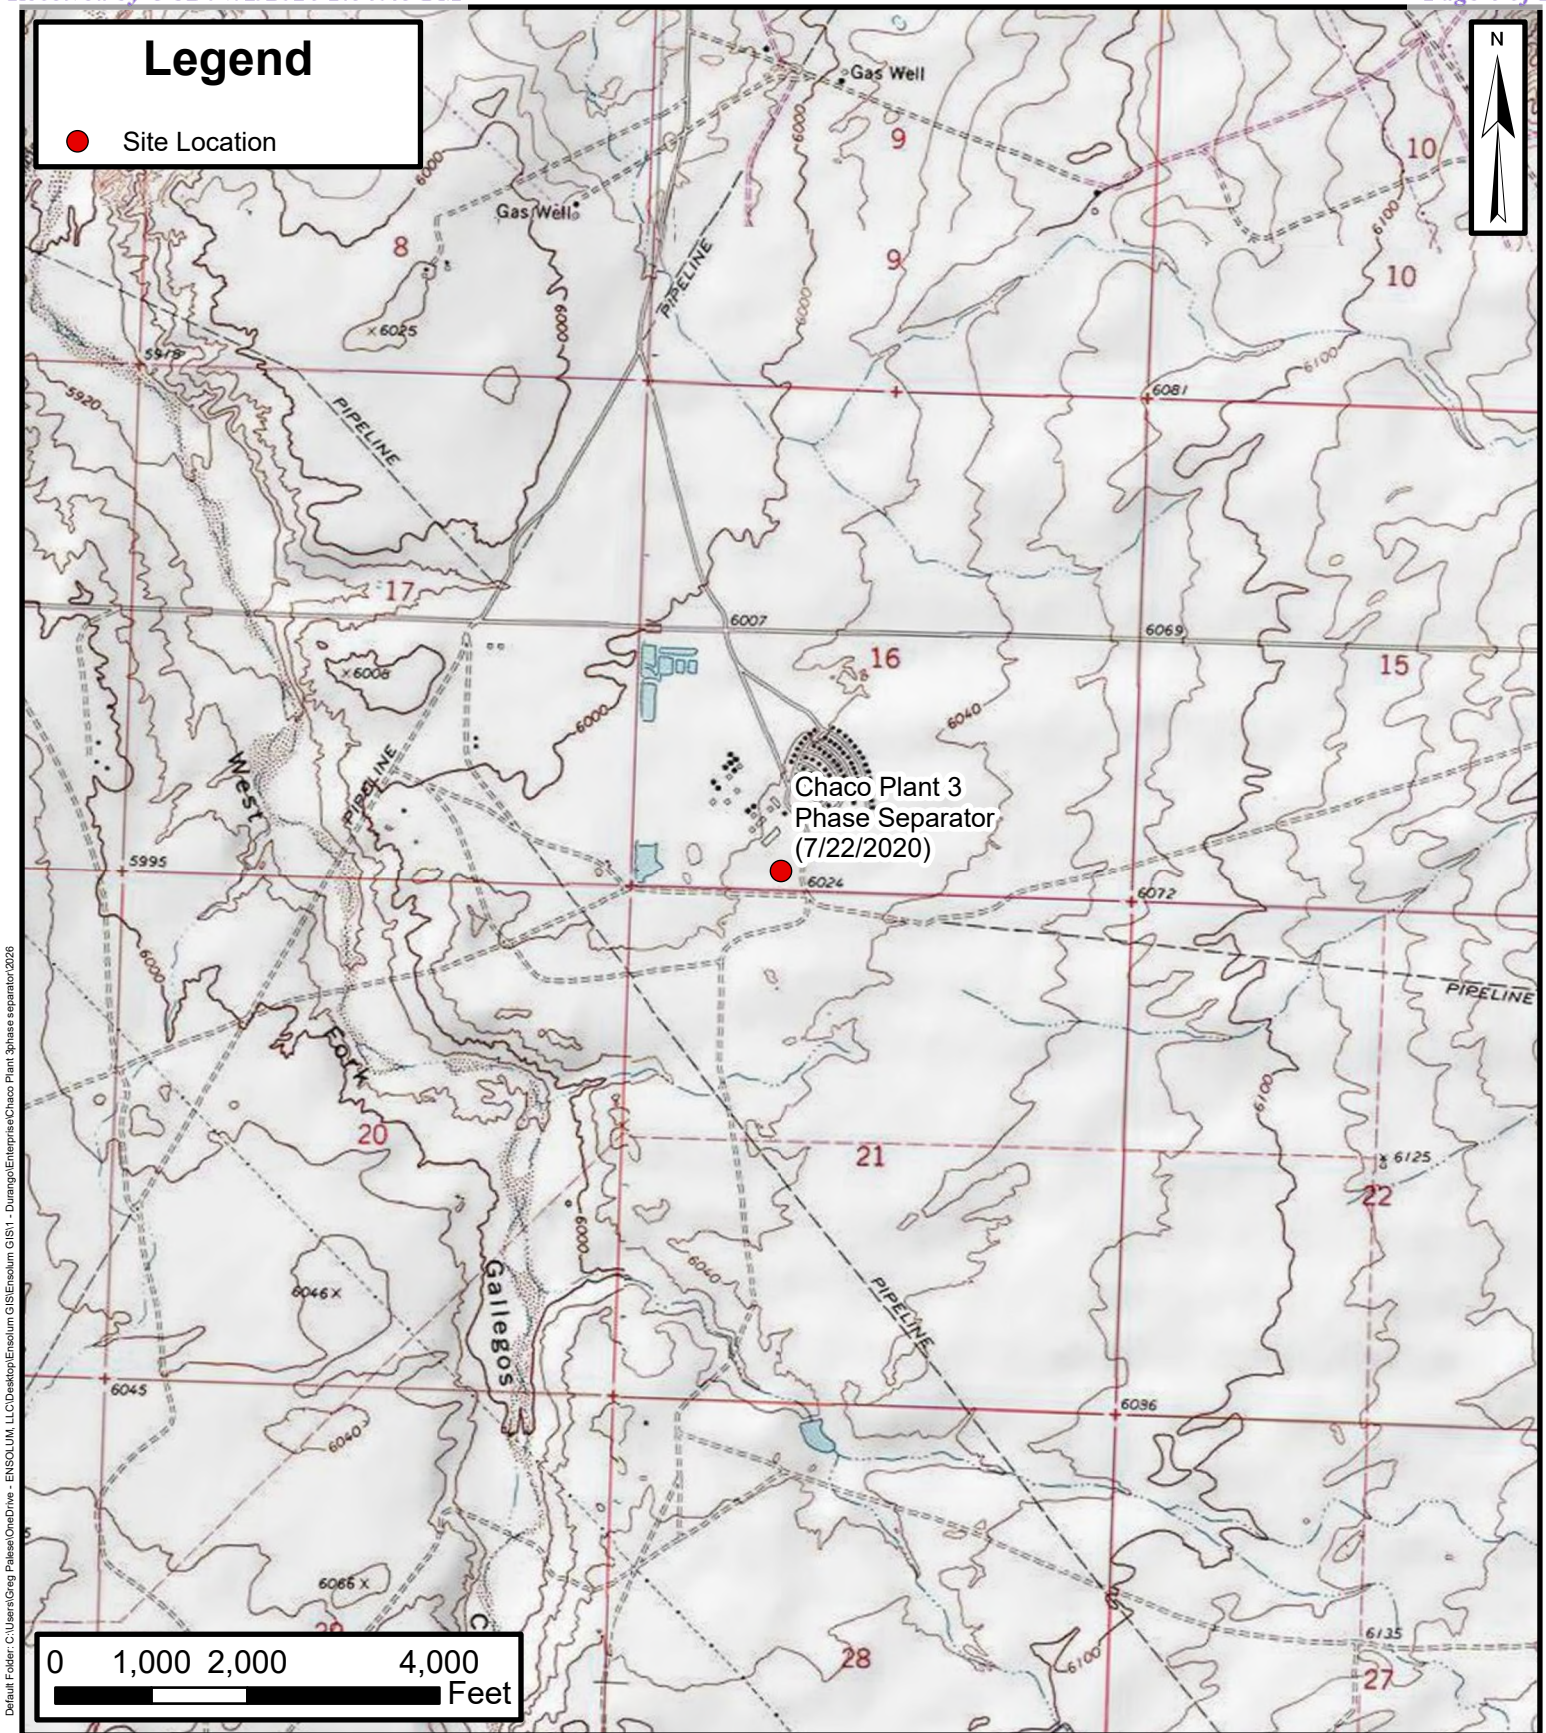

Site Location Map
 Enterprise Field Services, LLC
 Chaco Plant 3 Phase Separator
 (7/22/2020)
 36.481637, -108.120470
 Unit Letter N, S16 T26N R12W
 San Juan County, New Mexico

FIGURE
1

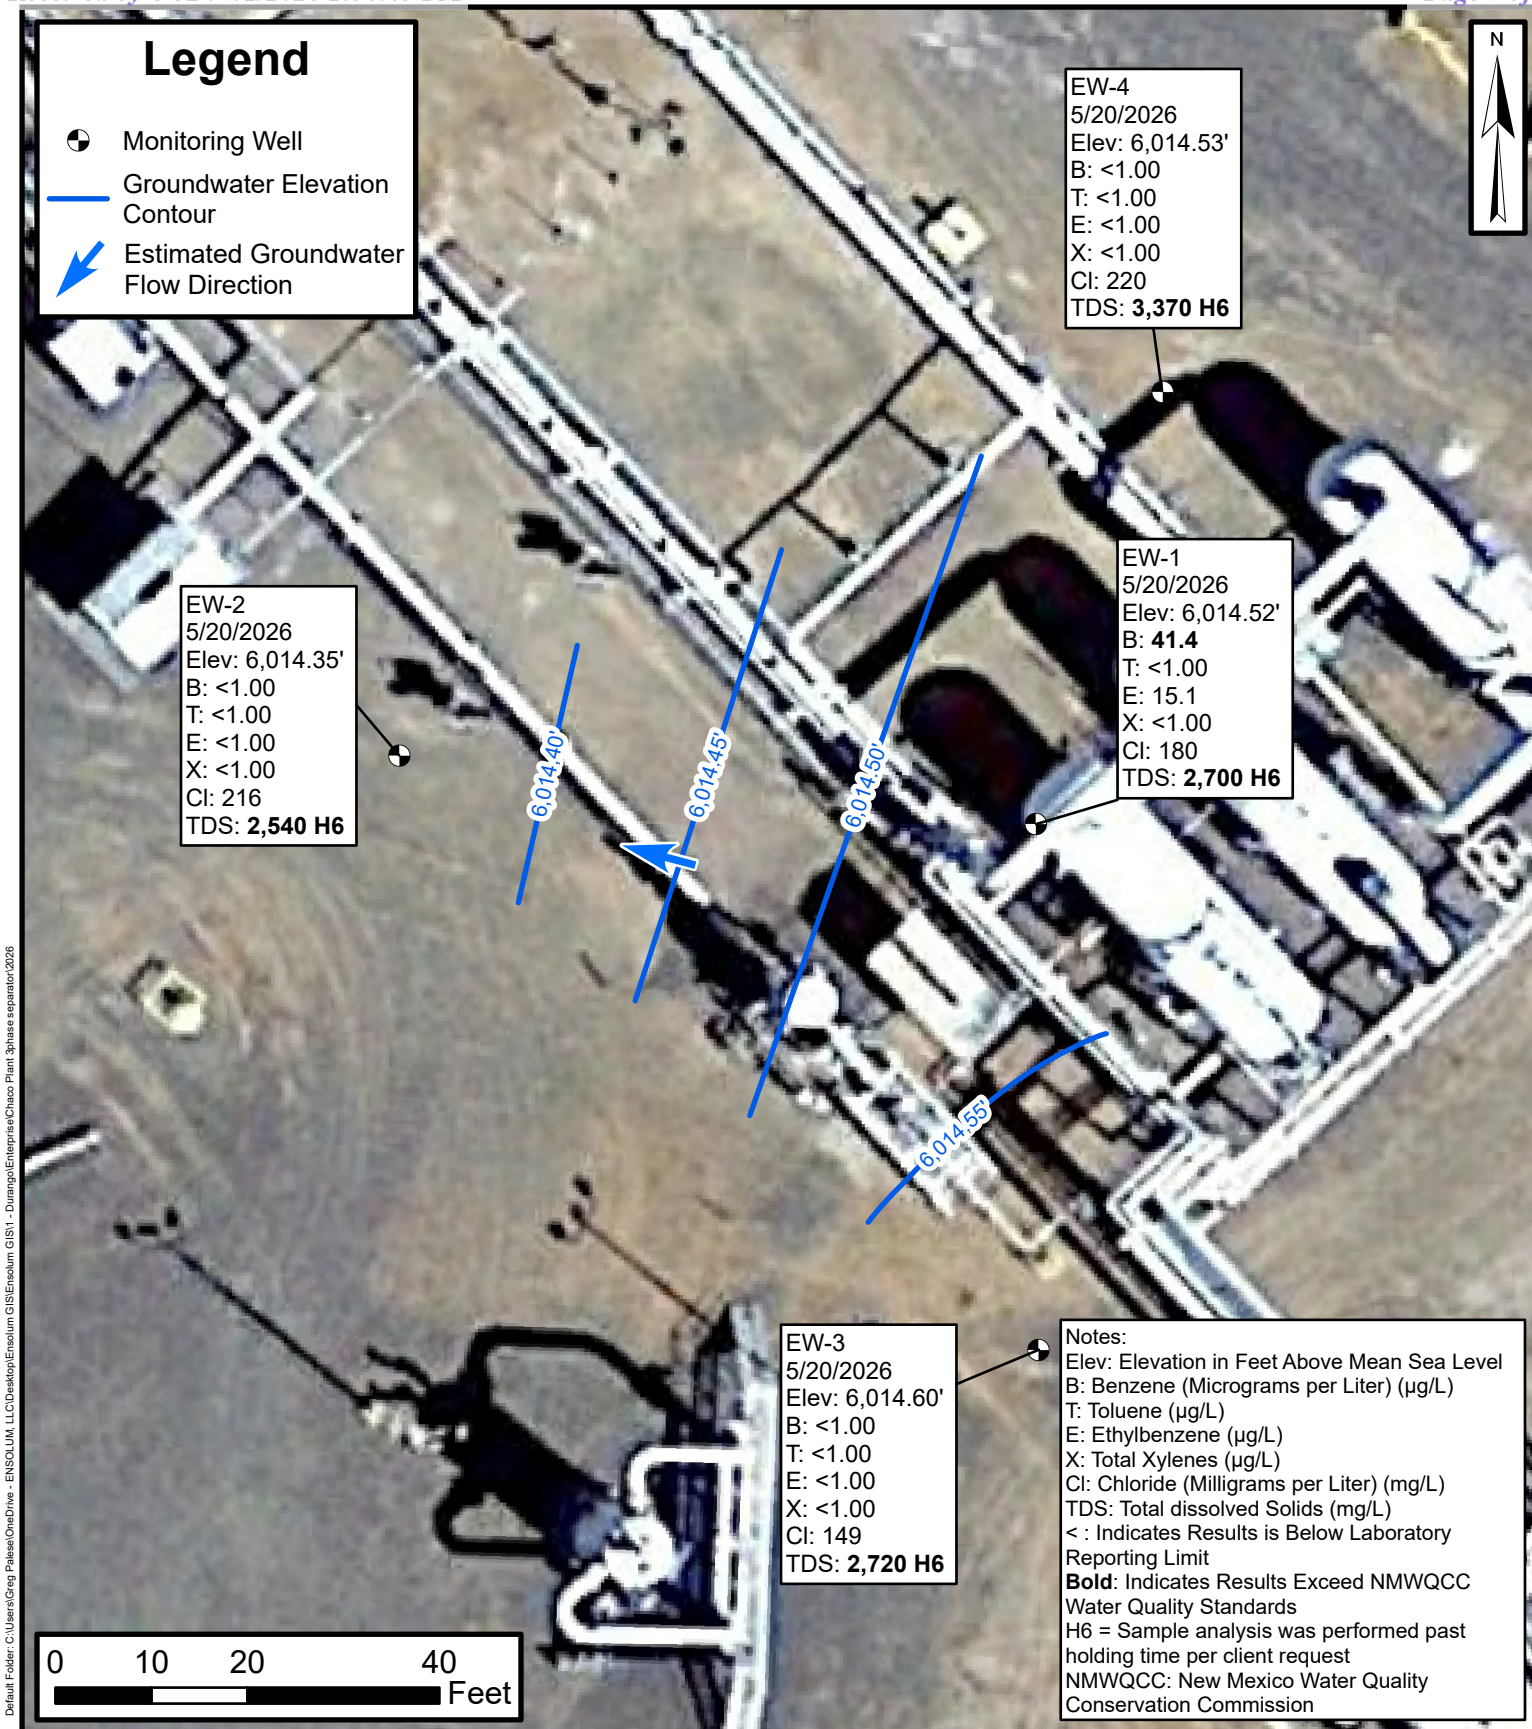

Groundwater Elevation and Analytical Results (May 2026)

Enterprise Field Services, LLC
Chaco Plant 3 Phase Separator
(7/22/2020)
36.481637, -108.120470
Unit Letter N, S16 T26N R12W
San Juan County, New Mexico

**FIGURE
3**



TABLES



TABLE 1 GROUNDWATER ELEVATIONS Chaco Plant 3 Phase Separator (7/22/20) Enterprise Field Services LLC San Juan County, New Mexico								
Well I.D.	Date	Depth to Product (feet BTOC)	Depth to Water (feet BTOC)	Product Thickness	Total Well Depth (feet BTOC)	Screen Interval (feet BTOC)	TOC Elevations (feet AMSL)	Groundwater Elevation (feet AMSL)
EW-1	08/06/2021	ND	12.29	ND	20	10-20	6,026.96	6,014.67
	02/22/2022	ND	12.45	ND				6,014.51
	09/12/2022	ND	12.20	ND				6,014.76
	02/07/2023 ^A	NG	NG	NG				NG
	08/23/2023	ND	12.00	ND				6,014.96
	02/20/2024	ND	12.47	ND				6,014.49
	12/30/2024	ND	12.18	ND				6,014.78
	04/17/2025	ND	12.23	ND				6,014.73
	03/18/2026	ND	12.54	ND				6,014.42
	05/20/2026	ND	12.44	ND				6,014.52
EW-2	08/06/2021	ND	12.27	ND	20	10-20	6,026.78	6,014.51
	02/22/2022	ND	12.43	ND				6,014.35
	09/12/2022	ND	12.16	ND				6,014.62
	02/07/2023	ND	12.40	ND				6,014.38
	08/23/2023	ND	11.92	ND				6,014.86
	02/20/2024	ND	12.43	ND				6,014.35
	12/30/2024	ND	12.14	ND				6,014.64
	04/17/2025	ND	12.31	ND				6,014.47
	03/18/2026	ND	12.55	ND				6,014.23
	05/20/2026	ND	12.43	ND				6,014.35
EW-3	08/06/2021	ND	13.55	ND	20	10-20	6,028.28	6,014.73
	02/22/2022	ND	13.71	ND				6,014.57
	09/12/2022	ND	13.48	ND				6,014.80
	02/07/2023	ND	13.71	ND				6,014.57
	08/23/2023	ND	13.34	ND				6,014.94
	02/20/2024	ND	13.72	ND				6,014.56
	12/30/2024	ND	13.43	ND				6,014.85
	04/17/2025	ND	13.56	ND				6,014.72
	03/18/2026	ND	13.78	ND				6,014.50
	05/20/2026	ND	13.68	ND				6,014.60
EW-4	08/06/2021	ND	12.14	ND	20	10-20	6,026.83	6,014.69
	02/22/2022	ND	12.30	ND				6,014.53
	09/12/2022	ND	12.03	ND				6,014.80
	02/07/2023	ND	12.30	ND				6,014.53
	08/23/2023	ND	11.77	ND				6,015.06
	02/20/2024	ND	12.33	ND				6,014.50
	12/30/2024	ND	12.01	ND				6,014.82
	04/17/2025	ND	12.13	ND				6,014.70
	3/18/2026	ND	12.39	ND				6014.44
	5/20/2026	ND	12.30	ND				6014.53

Notes:

Monitoring wells surveyed in September 2021

^A - Monitoring well EW-1 was not gauged due to ice covering the well head.

BTOC - below top of casing

AMSL - above mean sea level

TOC - top of casing

TABLE 2
GROUNDWATER ANALYTICAL SUMMARY - DETECTED VOLATILE ORGANIC COMPOUNDS
 Chaco Plant 3 Phase Separator (7/22/20)
 Enterprise Field Services LLC
 San Juan County, New Mexico

Sample I.D.	Sample Date	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylenes (µg/L)	Naphthalene (µg/L)	Chloroform (µg/L)	Carbon Tetrachloride (µg/L)	Tetrachloroethene (PCE) (µg/L)	Trichloroethene (TCE) (µg/L)	Bromodichloromethane ² (µg/L)	Bromoform ¹ (µg/L)	Chlorobenzene ¹ (µg/L)	1,2,4-Trimethylbenzene ^{1,2} (µg/L)	1,3,5-Trimethylbenzene ^{1,2} (µg/L)	2-Chlorotoluene ^{1,2} (µg/L)	4-Chlorotoluene ^{1,2} (µg/L)	Di bromochloromethane ¹ (µg/L)	Iso propylbenzene ^{1,2} (µg/L)	n-Propylbenzene ^{1,2} (µg/L)	sec-Butylbenzene ^{1,2} (µg/L)
New Mexico Water Quality Control Commission Human Health Standards		5	1,000	700	620	30	100	5	5	5	NE	NE	NE	NE	NE	NE	NE	NE	NE	NE	NE
Water Sample Collected from the Temporary Monitoring Well																					
TW-1/EW-1	03/24/2021	88	<1.0	29	170	2.7	3.3	<1.0	<1.0	<1.0	1.6	<1.0	4.4	10	4.3	5.1	1.3	1.1	3.2	1.5	<1.0
Water Samples Collected from the Monitoring Wells																					
EW-1	08/06/2021	53	<5.0	58	10	<10	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	9.3	9.1	<5.0	6.0	<5.0	<5.0	12	<5.0	<5.0
	02/22/2022	12	<2.0	40	<3.0	<4.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	7.8	16	<2.0	6.5	<2.0	<2.0	10	4.1	<2.0
	09/12/2022	11	<1.0	18	1.7	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	4.6	5.9	<1.0	4.4	<1.0	<1.0	5.9	2.2	2.4
	02/07/2023 ⁴	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	08/23/2023	22	<1.0	23	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	5.6	<1.0	<1.0	4.3	<1.0	<1.0	8.5	2.7	3.0
	02/20/2024	17	<1.0	26	1.8	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	5.6	<1.0	<1.0	4.2	<1.0	<1.0	9.4	2.5	2.3
	12/30/2024	54	<1.0	21	2.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	04/17/2025	32	<1.0	11	<2.0	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	3/18/2026	34	<2.0	18	<3.0	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	5/20/2026	41.4	<1.00	15.1	<1.00	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
EW-2	08/06/2021	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	6.2	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	02/22/2022	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	4.7	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	09/12/2022	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	5.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	02/07/2023	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	2.6	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	08/23/2023	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	4.4	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	02/20/2024	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	2.3	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	12/30/2024	<1.0	<1.0	<1.0	<2.0	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	04/17/2025	<1.0	<1.0	<1.0	<2.0	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	3/18/2026	<1.0	<1.0	<1.0	<1.5	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	5/20/2026	<1.00	<1.00	<1.00	<1.00	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	08/06/2021	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	02/22/2022	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	09/12/2022	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	02/07/2023	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0

TABLE 2
GROUNDWATER ANALYTICAL SUMMARY - DETECTED VOLATILE ORGANIC COMPOUNDS
 Chaco Plant 3 Phase Separator (7/22/20)
 Enterprise Field Services LLC
 San Juan County, New Mexico

Sample I.D.	Sample Date	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylenes (µg/L)	Naphthalene (µg/L)	Chloroform (µg/L)	Carbon Tetrachloride (µg/L)	Tetrachloroethene (PCE) (µg/L)	Trichloroethene (TCE) (µg/L)	Bromodichloromethane ² (µg/L)	Bromoform ¹ (µg/L)	Chlorobenzene ¹ (µg/L)	1,2,4-Trimethylbenzene ^{1,2} (µg/L)	1,3,5-Trimethylbenzene ^{1,2} (µg/L)	2-Chlorotoluene ^{1,2} (µg/L)	4-Chlorotoluene ^{1,2} (µg/L)	Dibromochloromethane ¹ (µg/L)	Iso propylbenzene ^{1,2} (µg/L)	n-Propylbenzene ^{1,2} (µg/L)	sec-Butylbenzene ^{1,2} (µg/L)
New Mexico Water Quality Control Commission Human Health Standards		5	1,000	700	620	30	100	5	5	5	NE	NE	NE	NE	NE	NE	NE	NE	NE	NE	NE
EW-3	08/23/2023	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	02/20/2024	<1.0	<1.0	<1.0	<1.5	<2.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	12/30/2024	<1.0	<1.0	<1.0	<2.0	NS	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	04/17/2025	<1.0	<1.0	<1.0	<2.0	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	3/18/2026	<1.0	<1.0	<1.0	<1.5	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	5/20/2026	<1.00	<1.00	<1.00	<1.00	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
EW-4	08/06/2021	<5.0	<5.0	<5.0	<7.5	<10	100	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
	02/22/2022	<2.0	<2.0	<2.0	<3.0	<4.0	49	<2.0	<2.0	<2.0	2.1	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0
	09/12/2022	<1.0	<1.0	<1.0	<1.5	<2.0	18	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	02/07/2023	<1.0	<1.0	<1.0	<1.5	<2.0	120	2.4	2.6	1.2	5.7	2.0	<1.0	<1.0	<1.0	<1.0	<1.0	2.4	<1.0	<1.0	<1.0
	08/23/2023	<1.0	<1.0	<1.0	<1.5	<2.0	150	3.1	3.3	1.3	5.1	1.9	<1.0	<1.0	<1.0	<1.0	<1.0	2.2	<1.0	<1.0	<1.0
	02/20/2024	<1.0	<1.0	<1.0	<1.5	<2.0	22	<1.0	<1.0	<1.0	<1.0	<1.0	1.1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
	12/30/2024	<1.0	<1.0	<1.0	<2.0	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	04/17/2025	<1.0	<1.0	<1.0	<2.0	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	3/18/2026	<1.0	<1.0	<1.0	<1.5	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
	5/20/2026	<1.00	<1.00	<1.00	<1.00	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA

Notes:

Concentrations in **bold** and **yellow** exceed the applicable WQCC HHS

NE = Not Established

¹ = Constituent is not identified as "toxic pollutant" under 20.6.2 New Mexico Administrative Code (NMAC).

NA = Not Analyzed

² = Constituent is not identified as a priority pollutant under the Federal Clean Water Act (CWA).

NS = Not Sampled

^A - Monitoring well EW-1 was not sampled due to ice covering the well head.

<1.0 = The numeral (in this case "1.0") identifies the laboratory reporting limit (RL) or practical quantitation limit (PQL).

µg/L = microgram per liter

TABLE 3
GROUNDWATER ANALYTICAL SUMMARY - INORGANICS
 Chaco Plant 3 Phase Separator (7/22/20)
 Enterprise Field Services LLC
 San Juan County, New Mexico

Sample I.D.	Sample Date	Fluoride (mg/L)	Chloride (mg/L)	Sulfate (mg/L)	Nitrate + Nitrite (mg/L)	Bromide (mg/L)	Phosphorus (mg/L)	Calcium (mg/L)	Magnesium (mg/L)	Potassium (mg/L)	Sodium (mg/L)	pH	Total Dissolved Solids (mg/L)	Conductivity (µmhos/c)	Total Alkalinity (mg/L Ca)
New Mexico Water Quality Control Commission Human Health Standards and Domestic Water Supply Standards		1.6	250	600	11	NE	NE	NE	NE	NE	NE	6-9	1,000	NE	NE
Water Sample Collected from the Temporary Monitoring Well															
TW-1/EW-1	03/24/2021	1.4	93	510	<1.00	0.90	<2.5	29	11	3.1	690	8.10	1,810	2,800	827.2
	03/18/2026	NA	170	NA	NA	NA	NA	NA	NA	NA	NA	NA	2,600	NA	NA
	05/20/2026	NA	180	NA	NA	NA	NA	NA	NA	NA	NA	NA	2,700 H6	NA	NA
EW-2	03/18/2026	NA	220	NA	NA	NA	NA	NA	NA	NA	NA	NA	2,700	NA	NA
	05/20/2026	NA	216	NA	NA	NA	NA	NA	NA	NA	NA	NA	2,540 H6	NA	NA
EW-3	03/18/2026	NA	160	NA	NA	NA	NA	NA	NA	NA	NA	NA	2,800	NA	NA
	05/20/2026	NA	149	NA	NA	NA	NA	NA	NA	NA	NA	NA	2,720 H6	NA	NA
EW-4	03/18/2026	NA	230	NA	NA	NA	NA	NA	NA	NA	NA	NA	3,400 E	NA	NA
	05/20/2026	NA	220	NA	NA	NA	NA	NA	NA	NA	NA	NA	3,370 H6	NA	NA

Notes:

Concentrations in **bold** and yellow exceed the applicable WQCC HHS or DWSS

mg/L = milligram per liter

µmhos/c = micromhos per centimeter

NA = Not Analyzed

NE = Not Established

<1.0 = The numeral (in this case "1.0") identifies the laboratory reporting limit (RL) or practical quantitation limit (PQL).




H6 = Sample analysis was performed past holding time per client request

E: The reported concentration exceeded the laboratory calibration range



APPENDIX A

Report to:
Dan Moir

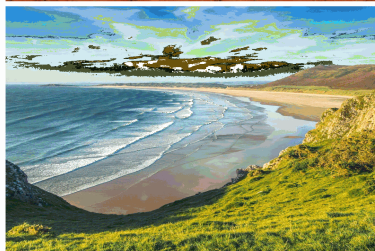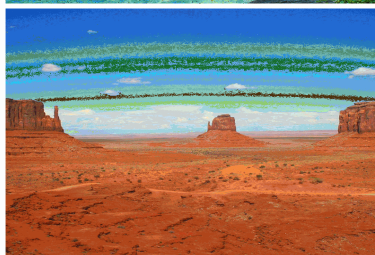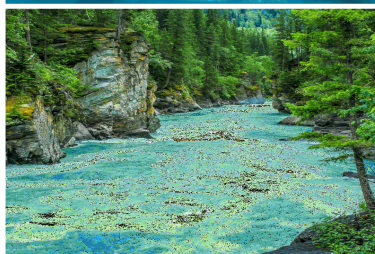

envirotech

Practical Solutions for a Better Tomorrow

Analytical Report

Ensolum LLC- Farmington

Project Name: Chaco 3 Phase Separator (July 2020)

Work Order: E605216

Job Number: 23003-0003

Received: 5/20/2026

Revision: 3

Report Reviewed By:

Walter Hinchman
Laboratory Director
6/2/26

5796 U.S. Hwy 64
Farmington, NM 87401

Phone: (505) 632-1881
Envirotech-inc.com



Envirotech Inc. certifies the test results meet all requirements of TNI unless noted otherwise.
Statement of Data Authenticity: Envirotech Inc. attests the data reported has not been altered in any way.
Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech Inc.
Envirotech Inc. holds the Utah TNI certification NM00979 for data reported.
Envirotech Inc. holds the Texas TNI certification T104704557 for data reported.

Date Reported: 6/2/26

Dan Moir
848 E 2nd Ave
Durango, CO 81301



Project Name: Chaco 3 Phase Separator (July 2020)
Workorder: E605216
Date Received: 5/20/2026 2:29:00PM

Dan Moir,

Thank you for choosing Envirotech, Inc. as your analytical testing laboratory for the sample(s) received on, 5/20/2026 2:29:00PM, under the Project Name: Chaco 3 Phase Separator (July 2020).

The analytical test results summarized in this report with the Project Name: Chaco 3 Phase Separator (July 2020) apply to the individual samples collected, identified and submitted bearing the project name on the enclosed chain-of-custody. Subcontracted sample analyses not conducted by Envirotech, Inc., are attached in full as issued by the subcontract laboratory.

Please review the Chain-of-Custody (COC) and Sample Receipt Checklist (SRC) for any issues regarding sample receipt temperature, containers, preservation etc. To best understand your test results, review the entire report summarizing your sample data and the associated quality control batch data.

All reported data in this analytical report were analyzed according to the referenced method(s) and are in compliance with the latest NELAC/TNI standards, unless otherwise noted. Samples or analytical quality control parameters not meeting specific QC criteria are qualified with a data flag. Data flag definitions are located in the Notes and Definitions section of this analytical report.

If you have any questions concerning this report, please feel free to contact Envirotech, Inc.

Respectfully,

Walter Hinchman
Laboratory Director
Office: 505-632-1881
Cell: 775-287-1762
whinchman@envirotech-inc.com

Raina Schwanz
Laboratory Administrator
Office: 505-632-1881
rainaschwanz@envirotech-inc.com

Field Offices:

Southern New Mexico Area

Lynn Jarboe
Laboratory Technical Representative
Office: 505-421-LABS(5227)
Cell: 505-320-4759
ljjarboe@envirotech-inc.com

Michelle Gonzales
Client Representative
Office: 505-421-LABS(5227)
Cell: 505-947-8222
mgonzaless@envirotech-inc.com

Envirotech Web Address: www.envirotech-inc.com

Table of Contents

Title Page	1
Cover Page	2
Table of Contents	3
Sample Summary	4
Sample Data	5
TW-1/EW-1	5
EW-2	6
EW-3	7
EW-4	8
QC Summary Data	9
QC - Volatile Organic Compounds by EPA 8260B	9
QC - Wet Chem/Gravimetric by SM2540C	10
QC - Anions by EPA 300.0/9056A	11
Definitions and Notes	12
Chain of Custody etc.	13

Sample Summary

Ensolum LLC- Farmington 848 E 2nd Ave Durango CO, 81301	Project Name: Chaco 3 Phase Separator (July 2020) Project Number: 23003-0003 Project Manager: Dan Moir	Reported: 06/02/26 10:41
---	--	-----------------------------

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
TW-1/EW-1	E605216-01A	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-01B	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-01C	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-01D	Aqueous	05/20/26	05/20/26	Poly 500mL
EW-2	E605216-02A	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-02B	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-02C	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-02D	Aqueous	05/20/26	05/20/26	Poly 500mL
EW-3	E605216-03A	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-03B	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-03C	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-03D	Aqueous	05/20/26	05/20/26	Poly 500mL
EW-4	E605216-04A	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-04B	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-04C	Aqueous	05/20/26	05/20/26	VOA Vial, 40mL; HCl
	E605216-04D	Aqueous	05/20/26	05/20/26	Poly 500mL



Sample Data

Ensolum LLC- Farmington
848 E 2nd Ave
Durango CO, 81301

Project Name: Chaco 3 Phase Separator (July 2020)
Project Number: 23003-0003
Project Manager: Dan Moir

Reported:
6/2/2026 10:41:18AM

TW-1/EW-1

E605216-01

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organic Compounds by EPA 8260B						
	ug/L	ug/L		Analyst: BA		Batch: 2622073
Benzene	41.4	1.00	1	05/27/26	05/27/26	
Ethylbenzene	15.1	1.00	1	05/27/26	05/27/26	
Toluene	ND	1.00	1	05/27/26	05/27/26	
o-Xylene	ND	1.00	1	05/27/26	05/27/26	
p,m-Xylene	ND	2.00	1	05/27/26	05/27/26	
Total Xylenes	ND	1.00	1	05/27/26	05/27/26	
Surrogate: Bromofluorobenzene	108 %	70-130		05/27/26	05/27/26	
Surrogate: 1,2-Dichloroethane-d4	98.7 %	70-130		05/27/26	05/27/26	
Surrogate: Toluene-d8	101 %	70-130		05/27/26	05/27/26	
Wet Chem/Gravimetric by SM2540C						
	mg/L	mg/L		Analyst: CP		Batch: 2622118
Total Dissolved Solids	2700	25.0	1	05/29/26	06/01/26	H6
Anions by EPA 300.0/9056A						
	mg/L	mg/L		Analyst: RAS		Batch: 2621114
Chloride	180	20.0	10	05/21/26	05/21/26	



Sample Data

Ensolum LLC- Farmington
848 E 2nd Ave
Durango CO, 81301

Project Name: Chaco 3 Phase Separator (July 2020)
Project Number: 23003-0003
Project Manager: Dan Moir

Reported:
6/2/2026 10:41:18AM

EW-2

E605216-02

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organic Compounds by EPA 8260B						
	ug/L	ug/L	Analyst: BA		Batch: 2622073	
Benzene	ND	1.00	1	05/27/26	05/27/26	
Ethylbenzene	ND	1.00	1	05/27/26	05/27/26	
Toluene	ND	1.00	1	05/27/26	05/27/26	
o-Xylene	ND	1.00	1	05/27/26	05/27/26	
p,m-Xylene	ND	2.00	1	05/27/26	05/27/26	
Total Xylenes	ND	1.00	1	05/27/26	05/27/26	
Surrogate: Bromofluorobenzene	101 %	70-130		05/27/26	05/27/26	
Surrogate: 1,2-Dichloroethane-d4	96.5 %	70-130		05/27/26	05/27/26	
Surrogate: Toluene-d8	101 %	70-130		05/27/26	05/27/26	
Wet Chem/Gravimetric by SM2540C						
	mg/L	mg/L	Analyst: CP		Batch: 2622118	
Total Dissolved Solids	2540	25.0	1	05/29/26	06/01/26	H6
Anions by EPA 300.0/9056A						
	mg/L	mg/L	Analyst: RAS		Batch: 2621114	
Chloride	216	20.0	10	05/21/26	05/21/26	



Sample Data

Ensolum LLC- Farmington
848 E 2nd Ave
Durango CO, 81301

Project Name: Chaco 3 Phase Separator (July 2020)
Project Number: 23003-0003
Project Manager: Dan Moir

Reported:
6/2/2026 10:41:18AM

EW-3

E605216-03

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organic Compounds by EPA 8260B						
	ug/L	ug/L	Analyst: BA		Batch: 2622073	
Benzene	ND	1.00	1	05/27/26	05/27/26	
Ethylbenzene	ND	1.00	1	05/27/26	05/27/26	
Toluene	ND	1.00	1	05/27/26	05/27/26	
o-Xylene	ND	1.00	1	05/27/26	05/27/26	
p,m-Xylene	ND	2.00	1	05/27/26	05/27/26	
Total Xylenes	ND	1.00	1	05/27/26	05/27/26	
Surrogate: Bromofluorobenzene		103 %	70-130	05/27/26	05/27/26	
Surrogate: 1,2-Dichloroethane-d4		100 %	70-130	05/27/26	05/27/26	
Surrogate: Toluene-d8		100 %	70-130	05/27/26	05/27/26	
Wet Chem/Gravimetric by SM2540C						
	mg/L	mg/L	Analyst: CP		Batch: 2622118	
Total Dissolved Solids	2720	25.0	1	05/29/26	06/01/26	H6
Anions by EPA 300.0/9056A						
	mg/L	mg/L	Analyst: RAS		Batch: 2621114	
Chloride	149	20.0	10	05/21/26	05/21/26	



Sample Data

Ensolum LLC- Farmington
848 E 2nd Ave
Durango CO, 81301

Project Name: Chaco 3 Phase Separator (July 2020)
Project Number: 23003-0003
Project Manager: Dan Moir

Reported:
6/2/2026 10:41:18AM

EW-4

E605216-04

Analyte	Result	Reporting Limit	Dilution	Prepared	Analyzed	Notes
Volatile Organic Compounds by EPA 8260B						
	ug/L	ug/L	Analyst: BA		Batch: 2622073	
Benzene	ND	1.00	1	05/27/26	05/27/26	
Ethylbenzene	ND	1.00	1	05/27/26	05/27/26	
Toluene	ND	1.00	1	05/27/26	05/27/26	
o-Xylene	ND	1.00	1	05/27/26	05/27/26	
p,m-Xylene	ND	2.00	1	05/27/26	05/27/26	
Total Xylenes	ND	1.00	1	05/27/26	05/27/26	
Surrogate: Bromofluorobenzene	103 %	70-130		05/27/26	05/27/26	
Surrogate: 1,2-Dichloroethane-d4	100 %	70-130		05/27/26	05/27/26	
Surrogate: Toluene-d8	101 %	70-130		05/27/26	05/27/26	
Wet Chem/Gravimetric by SM2540C						
	mg/L	mg/L	Analyst: CP		Batch: 2622118	
Total Dissolved Solids	3370	25.0	1	05/29/26	06/01/26	H6
Anions by EPA 300.0/9056A						
	mg/L	mg/L	Analyst: RAS		Batch: 2621114	
Chloride	220	20.0	10	05/21/26	05/21/26	



QC Summary Data

Ensolum LLC- Farmington	Project Name:	Chaco 3 Phase Separator (July 2020)	Reported:
848 E 2nd Ave	Project Number:	23003-0003	
Durango CO, 81301	Project Manager:	Dan Moir	6/2/2026 10:41:18AM

Volatile Organic Compounds by EPA 8260B

Analyst: BA

Analyte	Result	Reporting Limit	Spike Level	Source Result	Rec	Rec Limits	RPD	RPD Limit	Notes
	ug/L	ug/L	ug/L	ug/L	%	%	%	%	

Blank (2622073-BLK1)

Prepared: 05/27/26 Analyzed: 05/27/26

Benzene	ND	1.00							
Ethylbenzene	ND	1.00							
Toluene	ND	1.00							
o-Xylene	ND	1.00							
p,m-Xylene	ND	2.00							
Total Xylenes	ND	1.00							
Surrogate: Bromofluorobenzene	10.2		10.0		102	70-130			
Surrogate: 1,2-Dichloroethane-d4	9.81		10.0		98.1	70-130			
Surrogate: Toluene-d8	10.1		10.0		101	70-130			

LCS (2622073-BS1)

Prepared: 05/27/26 Analyzed: 05/27/26

Benzene	43.1	1.00	50.0		86.2	70-130			
Ethylbenzene	43.9	1.00	50.0		87.7	80-120			
Toluene	43.6	1.00	50.0		87.1	80-120			
o-Xylene	44.7	1.00	50.0		89.3	70-130			
p,m-Xylene	89.3	2.00	100		89.3	70-130			
Total Xylenes	134	1.00	150		89.3	70-130			
Surrogate: Bromofluorobenzene	10.2		10.0		102	70-130			
Surrogate: 1,2-Dichloroethane-d4	9.71		10.0		97.1	70-130			
Surrogate: Toluene-d8	10.1		10.0		101	70-130			

LCS Dup (2622073-BSD1)

Prepared: 05/27/26 Analyzed: 05/27/26

Benzene	47.6	1.00	50.0		95.2	70-130	9.96	20	
Ethylbenzene	48.6	1.00	50.0		97.3	80-120	10.3	20	
Toluene	48.5	1.00	50.0		97.0	80-120	10.8	20	
o-Xylene	48.8	1.00	50.0		97.6	70-130	8.84	20	
p,m-Xylene	98.2	2.00	100		98.2	70-130	9.49	20	
Total Xylenes	147	1.00	150		98.0	70-130	9.27	20	
Surrogate: Bromofluorobenzene	10.4		10.0		104	70-130			
Surrogate: 1,2-Dichloroethane-d4	10.0		10.0		100	70-130			
Surrogate: Toluene-d8	10.2		10.0		102	70-130			



QC Summary Data

Ensolum LLC- Farmington	Project Name:	Chaco 3 Phase Separator (July 2020)	Reported:
848 E 2nd Ave	Project Number:	23003-0003	
Durango CO, 81301	Project Manager:	Dan Moir	6/2/2026 10:41:18AM

Wet Chem/Gravimetric by SM2540C

Analyst: CP

Analyte	Result	Reporting Limit	Spike Level	Source Result	Rec	Rec Limits	RPD	RPD Limit	Notes
	mg/L	mg/L	mg/L	mg/L	%	%	%	%	

Blank (2622118-BLK1)					Prepared: 05/29/26 Analyzed: 06/01/26				
Total Dissolved Solids	ND	10.0							
LCS (2622118-BS1)					Prepared: 05/29/26 Analyzed: 06/01/26				
Total Dissolved Solids	109	10.0	100		109	56-143			
Duplicate (2622118-DUP1)					Source: E605268-03		Prepared: 05/29/26 Analyzed: 06/01/26		
Total Dissolved Solids	1960	10.0		1950		0.461	5		



QC Summary Data

Ensolum LLC- Farmington	Project Name:	Chaco 3 Phase Separator (July 2020)	Reported:
848 E 2nd Ave	Project Number:	23003-0003	
Durango CO, 81301	Project Manager:	Dan Moir	6/2/2026 10:41:18AM

Anions by EPA 300.0/9056A

Analyst: RAS

Analyte	Result	Reporting Limit	Spike Level	Source Result	Rec	Rec Limits	RPD	RPD Limit	Notes
	mg/L	mg/L	mg/L	mg/L	%	%	%	%	

Blank (2621114-BLK1)					Prepared: 05/21/26 Analyzed: 05/21/26				
Chloride	ND	2.00							
LCS (2621114-BS1)					Prepared: 05/21/26 Analyzed: 05/21/26				
Chloride	25.5	2.00	25.0		102	90-110			
LCS Dup (2621114-BSD1)					Prepared: 05/21/26 Analyzed: 05/21/26				
Chloride	25.8	2.00	25.0		103	90-110	0.889	20	

QC Summary Report Comment:
Calculations are based off of the raw (non-rounded) data. However, for reporting purposes all QC data is rounded to three significant figures.
Therefore, hand calculated values may differ slightly.



Definitions and Notes

Ensolum LLC- Farmington	Project Name:	Chaco 3 Phase Separator (July 2020)	
848 E 2nd Ave	Project Number:	23003-0003	Reported:
Durango CO, 81301	Project Manager:	Dan Moir	06/02/26 10:41

- H6 Sample analysis was performed past holding time per client request.
- ND Analyte NOT DETECTED at or above the reporting limit
- NR Not Reported
- RPD Relative Percent Difference
- DNI Did Not Ignite
- DNR Did not react with the addition of acid or base.

Note (1): Methods marked with ** are non-accredited methods.

Note (2): Soil data is reported on an "as received" weight basis, unless reported otherwise.



Client Information				Invoice Information				Lab Use Only				TAT				State							
Client: Ensolum LLC Project Name: Chase Produced Water (7092) Project Manager: Dan Mair Address: 645 E 2nd Ave City, State, Zip: Durango CO 81301 Phone: Email: dmair@ensolum.com				Company: Address: City, State, Zip: Phone: Email: Miscellaneous: Project #: C5B1226018				Lab WO# Job Number EL052160 23003.0003				1D 2D 3D Std X				NM CO UT TX X							
												Analysis and Method								EPA Program			
												VOC by 8260 BTEX Chloride 300.0								SDWA CWA RCRA			
																				Compliance Y or N			
																				PWSID #			
																				Sample Temp Remarks			
Sample Information																							
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Field Filter	Lab Number																	
1120	5/19/26	GW	4	TW-1/EW-1		1				X	X							4.2					
1323				EW-2		2												4.0					
1247				EW-3		3												3.9					
1202	X	X	X	EW-4		4				X	X							4.2					
Additional Instructions: CC: Hpeck@ensolum.com, wulicher@ensolum.com, & vphippse@epred.com																							
I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.																							
Sampled by: Grace Swanson																							
Relinquished by: (Signature)				Date		Time		Received by: (Signature)				Date		Time		Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: (Y/N)							
Relinquished by: (Signature)				Date		Time		Received by: (Signature)				Date		Time									
Relinquished by: (Signature)				Date		Time		Received by: (Signature)				Date		Time									
Relinquished by: (Signature)				Date		Time		Received by: (Signature)				Date		Time									
Relinquished by: (Signature)				Date		Time		Received by: (Signature)				Date		Time									
Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA																							
Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.																							



Chain of Custody

Page 1 of 1

Project Name: Chaco 3 Phase Separator (July 2020)

Client Information				Invoice Information		Lab Use Only		TAT		State			
Client: <u>Ensochem LLC</u>				Company: <u>Ensochem LLC</u>		Lab WO# <u>EL052110</u>		Job Number <u>23003.0003</u>		1D	2D	3D	Std
Project Name: <u>Chaco Produced Water (7029)</u>				Address: <u>5450 E 2nd Ave</u>									
Project Manager: <u>Don Mair</u>				City, State, Zip: <u>Durango CO 81301</u>									
Address: <u>5450 E 2nd Ave</u>				Phone: <u></u>									
City, State, Zip: <u>Durango CO 81301</u>				Email: <u>dmair@ensochem.com</u>									
Phone: <u></u>				Miscellaneous: <u>Project #05B1226018</u>									
Email: <u>dmair@ensochem.com</u>													
Sample Information				Analysis and Method		EPA Program							
Time Sampled	Date Sampled	Matrix	No. of Containers	Sample ID	Field Filter	Lab Number	VOC by 8260	Chloride 300.0	TDS	SDWA	CWA	RCRA	
1120	5/29/20	GW	4	TW-1/EW-1		1	X	X	X	4.2			Corrected
1323				EW-2		2				4.0			Project
1247				EW-3		3				3.9			Name ?
1202				EW-4		4	X	X		4.2			Project number
													per H.P.
													NS 5-29-26
													Added analysis
													per H.P.
													NS 5-29-26
Additional Instructions: CC: <u>Hpeck@ensochem.com</u> , <u>wallicker@ensochem.com</u> , <u>Yphippse@epco.com</u>													
I, (field sampler), attest to the validity and authenticity of this sample. I am aware that tampering with or intentionally mislabeling the sample location, date or time of collection is considered fraud and may be grounds for legal action.													
Sampled by: <u>Grace Swanson</u>													
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time	Samples requiring thermal preservation must be received on ice the day they are sampled or received packed on ice at a temp above 0 but less than 6°C on subsequent days. Lab Use Only Received on ice: <u>(Y/N)</u>							
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time								
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time								
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time								
Relinquished by: (Signature)	Date	Time	Received by: (Signature)	Date	Time								
Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other													
Container Type: g - glass, p - poly/plastic, ag - amber glass, v - VOA													
Note: Samples are discarded 14 days after results are reported unless other arrangements are made. Hazardous samples will be returned to client or disposed of at the client expense. The report for the analysis of the above samples is applicable only to those samples received by the laboratory with this COC. The liability of the laboratory is limited to the amount paid for on the report.													

Envirotech Analytical Laboratory

Printed: 5/29/2026 12:33:47PM

Sample Receipt Checklist (SRC)

Instructions: Please take note of any NO checkmarks.

If we receive no response concerning these items within 24 hours of the date of this notice, all the samples will be analyzed as requested.

Client:	Ensolum LLC- Farmington	Date Received:	05/20/26 14:29	Work Order ID:	E605216
Phone:	(970) 903-1607	Date Logged In:	05/21/26 11:21	Logged In By:	Caitlin Mars
Email:	dmoir@ensolum.com	Due Date:	05/28/26 17:00 (5 day TAT)		

Chain of Custody (COC)

1. Does the sample ID match the COC? Yes
2. Does the number of samples per sampling site location match the COC? Yes
3. Were samples dropped off by client or carrier? Yes
4. Was the COC complete, i.e., signatures, dates/times, requested analyses? Yes
5. Were all samples received within holding time? Yes

Note: Analysis, such as pH which should be conducted in the field, i.e., 15 minute hold time, are not included in this discussion.

Carrier: Grace SwansonComments/Resolution

Client requested TDS to be analyzed past hold time.

Sample Turn Around Time (TAT)

6. Did the COC indicate standard TAT, or Expedited TAT? Yes

Sample Cooler

7. Was a sample cooler received? Yes
8. If yes, was cooler received in good condition? Yes
9. Was the sample(s) received intact, i.e., not broken? Yes
10. Were custody/security seals present? No
11. If yes, were custody/security seals intact? NA
12. Was the sample received on ice? Yes

Note: Thermal preservation is not required, if samples are received within 15 minutes of sampling

13. See COC for individual sample temps. Samples outside of 0°C-6°C will be recorded in comments.

Sample Container

14. Are aqueous VOC samples present? Yes
15. Are VOC samples collected in VOA Vials? Yes
16. Is the head space less than 6-8 mm (pea sized or less)? Yes
17. Was a trip blank (TB) included for VOC analyses? No
18. Are non-VOC samples collected in the correct containers? Yes
19. Is the appropriate volume/weight or number of sample containers collected? Yes

Field Label

20. Were field sample labels filled out with the minimum information:
 - Sample ID? Yes
 - Date/Time Collected? Yes
 - Collectors name? Yes

Sample Preservation

21. Does the COC or field labels indicate the samples were preserved? Yes
22. Are sample(s) correctly preserved? Yes
24. Is lab filtration required and/or requested for dissolved metals? No

Multiphase Sample Matrix

26. Does the sample have more than one phase, i.e., multiphase? No
27. If yes, does the COC specify which phase(s) is to be analyzed? NA

Subcontract Laboratory

28. Are samples required to get sent to a subcontract laboratory? No
29. Was a subcontract laboratory specified by the client and if so who? NA Subcontract Lab: NA

Client Instruction

Signature of client authorizing changes to the COC or sample disposition.

Date



envirotech Inc.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/oed/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 601654

CONDITIONS

Operator: ENTERPRISE FIELD SERVICES L.L.C. PO Box 4324 Houston, TX 77210	OGRID: 151618
	Action Number: 601654
	Action Type: [UF-GWA] Ground Water Abatement (GROUND WATER ABATEMENT)

CONDITIONS

Created By	Condition	Condition Date
amaxwell	Report accepted for record.	7/27/2026