



Hobbs Water Station Injection Line

nAPP2613655309

Remediation Closure Request

Facility Number: fTO1500855040

N-29-18S-38E

Private Surface

32.713808,-103.17432 NAD83



2525 NW County Rd
Hobbs, NM 88240
[\(575\) 392-9996](tel:(575)392-9996)

Table of Contents

Introduction	1
Site Information	1
Incident History	1
Water Resources and Remediation Considerations	3
Soil Remediation Standards	4
Remediation Activities	4
Conclusion	7

Appendices

Appendix A – Depth to Groundwater and Topographical Information
Appendix B – Site Delineation Mapping and Summary Report
Appendix C – Site Photography and Field Notes
Appendix D – Communications and Historical Records
Appendix E – Environmental Resources Review
Appendix F – Lab Results Originals

Introduction

Diamondback Disposal Services, Inc. has prepared this Remediation Closure Report for the Hobbs Water Station Injection Line incident site, identified as Incident ID nAPP2613655309, located in Lea County, New Mexico. This report documents the remediation and corrective actions completed in response to the release and is submitted in support of regulatory review and closure by the New Mexico Oil Conservation Division. The incident occurred on private surface associated with the Hobbs H2O Station Battery facility.

The scope of this report includes site characterization, remediation activities, confirmation sampling, and closure documentation for impacted soils within the project footprint. All remediation activities and closure evaluations were conducted in accordance with 19.15.29 NMAC and applicable New Mexico Oil Conservation Division requirements.

Site Information

Operator of Record: EW Operating (NM), LLC

Facility Name: HOBBS H2O STATION BATTERY

Facility Number: fTO1500855040

Incident ID: nAPP2613655309

GPS Coordinates: 32.713093, -103.174553 (NAD83)

PLSS: N-29-18S-38E (704 FSL, 203 FWL)

Surface Ownership: Property owned by Frac Tank Rentals

The site can be accessed from the intersection of NW County rd and W sanger.

- Head North on NW County rd for approximately .16 miles, then turn right into yard.

A directional map is provided on the first page of Appendix B.

Incident History

- An equipment failure involving the Hobbs Water Station Injection Line was discovered on May 16, 2026, and the incident was documented under OCD Incident ID nAPP2613655309. The release is associated with the Hobbs H2O Station Battery facility and occurred along an

injection flow line on private surface in Lea County, New Mexico. The failure occurred at a joint located at the bond between a previous repair and the existing line.

- The equipment failure resulted in a major release as defined under 19.15.29.7(A) NMAC. The release was reported as a produced water release from an injection flow line. Spill volume calculations were prepared using a mapped affected area of approximately 14,458 square feet, a saturated soil depth of 9 inches, a liquid holding factor of 0.08 gallons of liquid per gallon of soil, and 240 barrels of recovered free liquid. Based on those inputs, the total estimated produced water release was calculated at 394.5 barrels, including 154.5 barrels estimated within the affected soil and 240 barrels of recovered free liquid. The spill volume calculation is included in Appendix D.
- Due to the timing of the initial response and the need to proceed with containment and recovery activities, a representative sample of the released produced water was not collected for laboratory chloride analysis. For regulatory reporting purposes, and consistent with the conservative classification used for produced water releases, the release was reported as produced water with chloride concentrations greater than 10,000 mg/L. The release was therefore evaluated under the applicable requirements of 19.15.29 NMAC for produced water impacts.
- Upon discovery, the source of the release was stopped by closing the manual shutoff valve on the line. The impacted area was secured to protect human health and the environment, and free liquid was immediately recovered using vacuum trucks. The volume of free liquid removed by vacuum truck was used to determine the recovered volume for reporting and spill volume calculation purposes. Recovered fluids were properly managed, and all response actions were conducted in accordance with the requirements of 19.15.29 NMAC.
- Site characterization and confirmation sampling were conducted to evaluate the lateral and vertical extent of impacts associated with the release. The lateral and vertical extents of contamination were fully delineated, and the release was not entirely contained within a lined containment area. Analytical results from the final confirmation samples were below the applicable Table 1 closure criteria selected for the site. The highest reported confirmation sample values used for closure evaluation were 80 mg/kg chloride, 133 mg/kg total TPH, and 61.6 mg/kg GRO plus DRO. BTEX and benzene were reported as non-detect in the summary results.

Water Resources and Remediation Considerations

(See Appendix A for topographical information and mapping)

- Groundwater beneath the affected area is estimated to be between 26 and 50 feet below ground surface. This estimate was based on a review of the New Mexico Office of the State Engineer iWATERS database, with reference to well L07005, located approximately 0.18 miles from the release area. Based on available site characterization information, the release did not impact groundwater or surface water.
- The nearest continuously flowing watercourse or significant watercourse is between 1 and 5 miles from the release area. The nearest mapped feature is identified as a blue line on a USGS 7.5 minute quadrangle topographic map and is located approximately 2.1 miles southeast of the release area.
- The nearest lakebed, sinkhole, or playa lake is between 1,000 feet and 1/2 mile from the release area. The nearest identified feature is a freshwater emergent wetland with an obvious defined bank, located approximately 0.43 miles southeast of the release area.
- The nearest occupied permanent residence, school, hospital, institution, or church is between 1,000 feet and 1/2 mile from the release area. The nearest identified residence is located approximately 0.46 miles southwest of the release area.
- The nearest private domestic fresh water well used by less than five households for domestic or stock watering purposes is between 1,000 feet and 1/2 mile from the release area. The nearest identified well in this category is agricultural well L00382, located approximately 0.36 miles southwest of the release area.
- The nearest other fresh water well or spring is between 500 and 1,000 feet from the release area. The nearest identified fresh water well is L13997, located approximately 0.17 miles northeast of the release area.
- The release area is located within an incorporated municipal boundary or defined municipal fresh water well field. Specifically, the site lies within the Hobbs Municipal Freshwater Field.

- The nearest wetland is between 1,000 feet and 1/2 mile from the release area. The nearest identified wetland features include manmade freshwater ponds located within approximately one half mile of the release area.
- The nearest subsurface mine is greater than 5 miles from the release area. The nearest identified subsurface mine is the Intrepid Potash Mine, located approximately 37.94 miles east of the release area.
- No non-karst unstable areas were identified within 5 miles of the release area.
- Karst mapping classifies the site as low potential, and the site is classified as a non-karst area.
- The nearest mapped 100-year floodplain is between 1 and 5 miles from the release area. The nearest mapped floodplain is located approximately 1.17 miles northeast of the release area.
- The release impacted an area not located on an exploration, development, production, or storage site.

Soil Remediation Standards

Soil remediation and closure criteria were applied in accordance with Table 1 of 19.15.29.12 NMAC. Because groundwater beneath the affected area is estimated to be between 26 and 50 feet below ground surface and the site lies within the Hobbs Municipal Freshwater Field, the most conservative applicable closure criteria were used for evaluation of the release area.

In accordance with this approach, all excavation areas, sidewalls, and confirmation samples were evaluated using the Table 1 closure criteria applicable to groundwater depths less than 50 feet below ground surface. This standard was applied uniformly across the entire excavation footprint to ensure protection of potential groundwater resources and compliance with 19.15.29 NMAC.

(See Table Below)

Table 1: NMAC 19.15.29.12 Closure Criteria

Groundwater Depth	BTEX (mg/kg)	Benzene (mg/kg)	GRO+DRO (mg/kg)	TPH (GRO+DRO+MRO) (mg/kg)	Chloride (mg/kg)
<50 feet	50	10	N/A	100	600

Remediation Activities

Remediation activities began on May 28, 2026, shortly after discovery of the release. Excavation activities were conducted on May 28, May 29, and June 1, 2026. Excavation was focused on the affected area associated with the produced water release from the Hobbs Water Station Injection Line. Field observations and sampling were used to guide excavation and confirm that impacted material was removed from the release area. The total remediated surface area was approximately 14,458 square feet, and the total remediated volume was approximately 400 cubic yards.

Excavated material was loaded and transported off site for disposal at Lea Land, LLC, an NMOCD approved disposal facility. A total of 37 loads, representing approximately 400.16 tons, were hauled out for disposal. Haul out activities included 13 loads on May 28, 2026, 20 loads on May 29, 2026, and 4 loads on June 1, 2026.

Prior to confirmation sampling, the New Mexico Oil Conservation Division was notified through submitted C-141N final sampling notifications. The accepted notifications documented sampling events scheduled for May 29, 2026 at 1:30 p.m. and June 1, 2026 at 8:00 a.m. A third notification was also accepted for June 2, 2026 in the event additional sampling was needed based on field conditions.

Confirmation sampling was conducted on May 29, 2026 and June 1, 2026. Confirmation sampling included excavation base samples, sidewall samples, horizontal samples, and a backfill sample. Excavation base samples were identified as B series samples, sidewall samples were identified as W series samples, horizontal confirmation samples were identified as H series samples, and the backfill sample was identified as BC. Excavation base and sidewall confirmation samples were collected as five point composite samples, with each composite representing no more than 200 square feet of excavation surface area. Each composite sample was placed into laboratory supplied sterile glass jars, immediately placed on ice, and submitted under chain of custody to Cardinal Laboratories for analysis of chloride, total petroleum hydrocarbons, and BTEX compounds.

During confirmation sampling, three excavation base samples showed slightly elevated TPH concentrations above the applicable closure criterion of 100 mg/kg for total TPH. Sample B2 @ 9

inches reported total TPH at 133 mg/kg, sample B7 @ 6 inches reported total TPH at 114.2 mg/kg, and sample B8 @ 6 inches reported total TPH at 130.7 mg/kg. These exceedances were limited to total TPH, and the affected areas were subsequently excavated further and resampled.

Follow-up confirmation samples were collected after the additional excavation. Sample B2 was resampled at 1 foot, sample B7 was resampled at 9 inches, and sample B8 was resampled at 9 inches. The follow-up confirmation results for these locations reported TPH below laboratory reporting limits, demonstrating that the additional excavation removed the slightly elevated petroleum impacts. Final confirmation sample results demonstrated that the remediation footprint met the applicable Table 1 closure criteria selected for the site.

The highest reported final confirmation sample values used for closure evaluation were 80 mg/kg chloride, 133 mg/kg total TPH, and 61.6 mg/kg GRO plus DRO. BTEX and benzene were reported as non-detect in the summary results. Although the initial TPH results for B2, B7, and B8 are included in the analytical summary for documentation purposes, the subsequent resample results demonstrate compliance at those locations following additional excavation.

Following confirmation that the excavation met the applicable closure criteria, the excavation was backfilled and restored using imported caliche. Backfill and reclamation activities were conducted on June 1 and June 2, 2026. A total of 34 loads, representing approximately 408 cubic yards of caliche, were hauled in for backfilling and site restoration. Haul in activities included 1 load on May 28, 2026, 8 loads on June 1, 2026, and 25 loads on June 2, 2026.

The affected area was returned to grade and stabilized to prevent ponding, minimize erosion, and control dust. Reseeding was not applicable for this remediation area. Analytical summaries and supporting site maps are provided in Appendix B. Site photographs and field notes are provided in Appendix C. Communications, historical records, and the spill volume calculation are provided in Appendix D. Complete laboratory analytical reports are included in Appendix F.

Conclusion

Remediation activities at the Hobbs Water Station Injection Line site in Lea County, New Mexico, were conducted in response to OCD Incident ID nAPP2613655309 involving a produced water release. Impacted soils associated with the May 16, 2026 incident were excavated and properly removed for offsite disposal at Lea Land, LLC. Confirmation sampling was conducted in accordance with 19.15.29 NMAC and demonstrated compliance with the applicable Table 1 closure criteria set forth in 19.15.29.12 NMAC.

All remediation earthwork, backfilling, and grading activities have been completed. The affected area was backfilled with clean imported caliche, returned to grade, and stabilized to prevent ponding, minimize erosion, and control dust. Reseeding was not applicable for this remediation area.

Based on the completion of corrective actions and the results of confirmation sampling, Diamondback Disposal Services, Inc. respectfully requests remediation closure approval for Incident ID nAPP2613655309 from the New Mexico Oil Conservation Division.

Diamondback Disposal Services, Inc. appreciates the time and consideration provided by the New Mexico Oil Conservation Division in reviewing this submittal. We remain available to provide any additional information or clarification as needed.

Appendix A

Depth to Groundwater


Topographical Information



Diamondback Disposal
Services, Inc
P.O. Box 2491
Hobbs, NM 88241
575-392-9996

Map Contents:
Water Well Information

- Release Area
- OSE Pod's By Depth
- No Depth Reported
 - < 50ft BGS
 - 50 to 99ft BGS
 - >100ft BGS

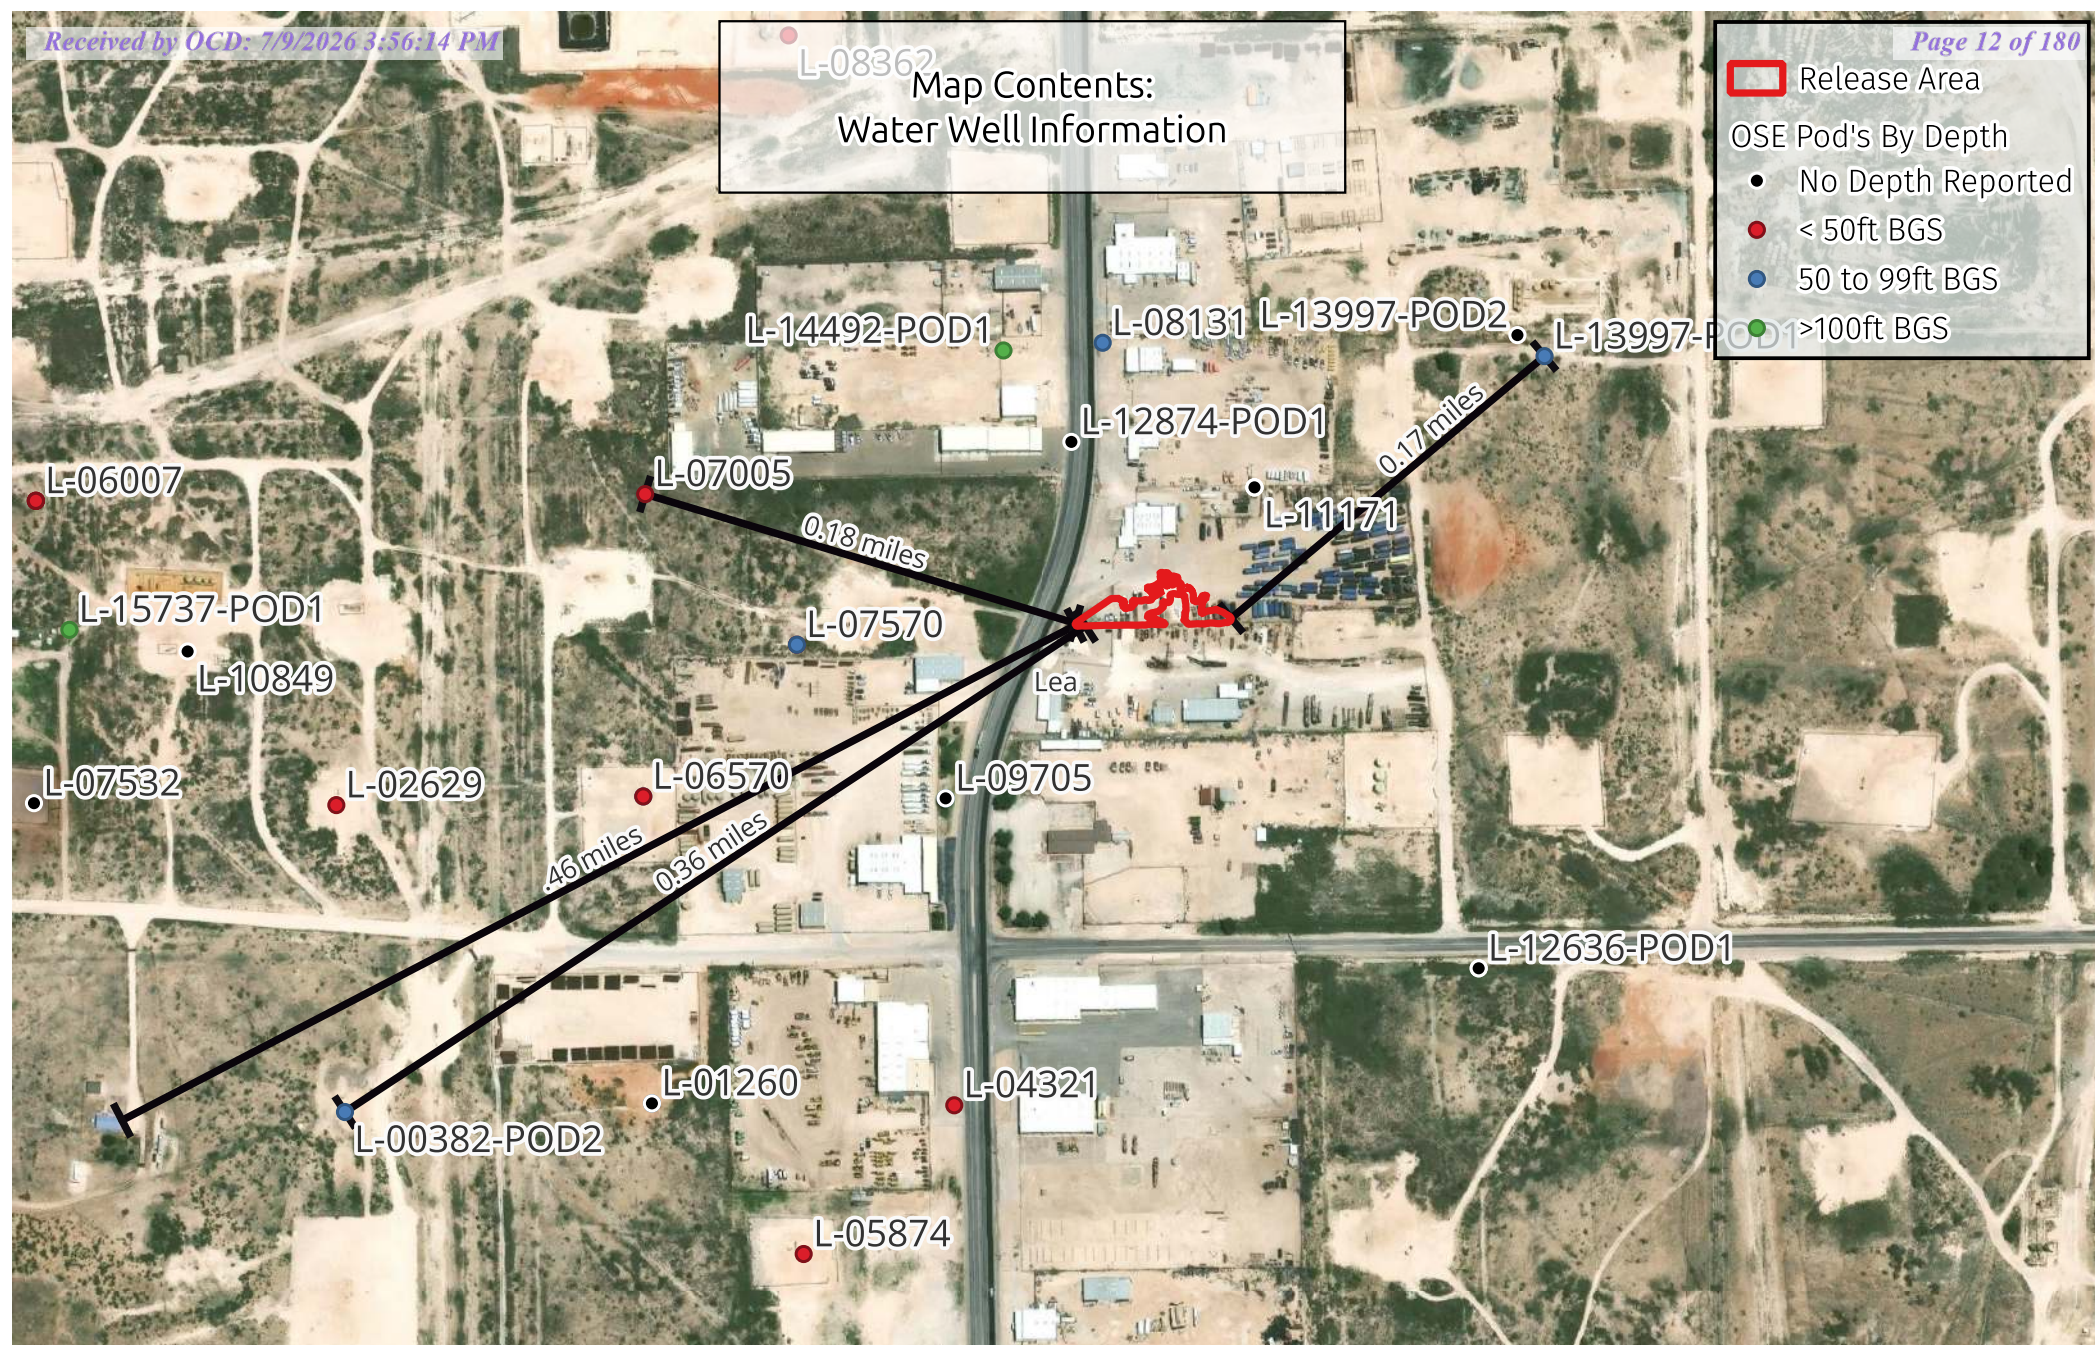

Company
Hobbs Water Station Injection Line
Incident #nAPP2613655309
32.713093,-103.174553 NAD83
Private Surface




0 0.075 0.15 mi


Diamondback Disposal
Services, Inc
P.O. Box 2491
Hobbs, NM 88241
575-392-9996

Map Contents:
 Lakebed, Sinkhole or Playa Lake
 Nearest Occupied Residence
 Nearest Wetland

-  Release Area
- SENM Wetlands
 -  Freshwater Emergent Wetland
 -  Freshwater Forested/Shrub Wetland
 -  Freshwater Pond
 -  Lake
 -  Other
 -  Riverine

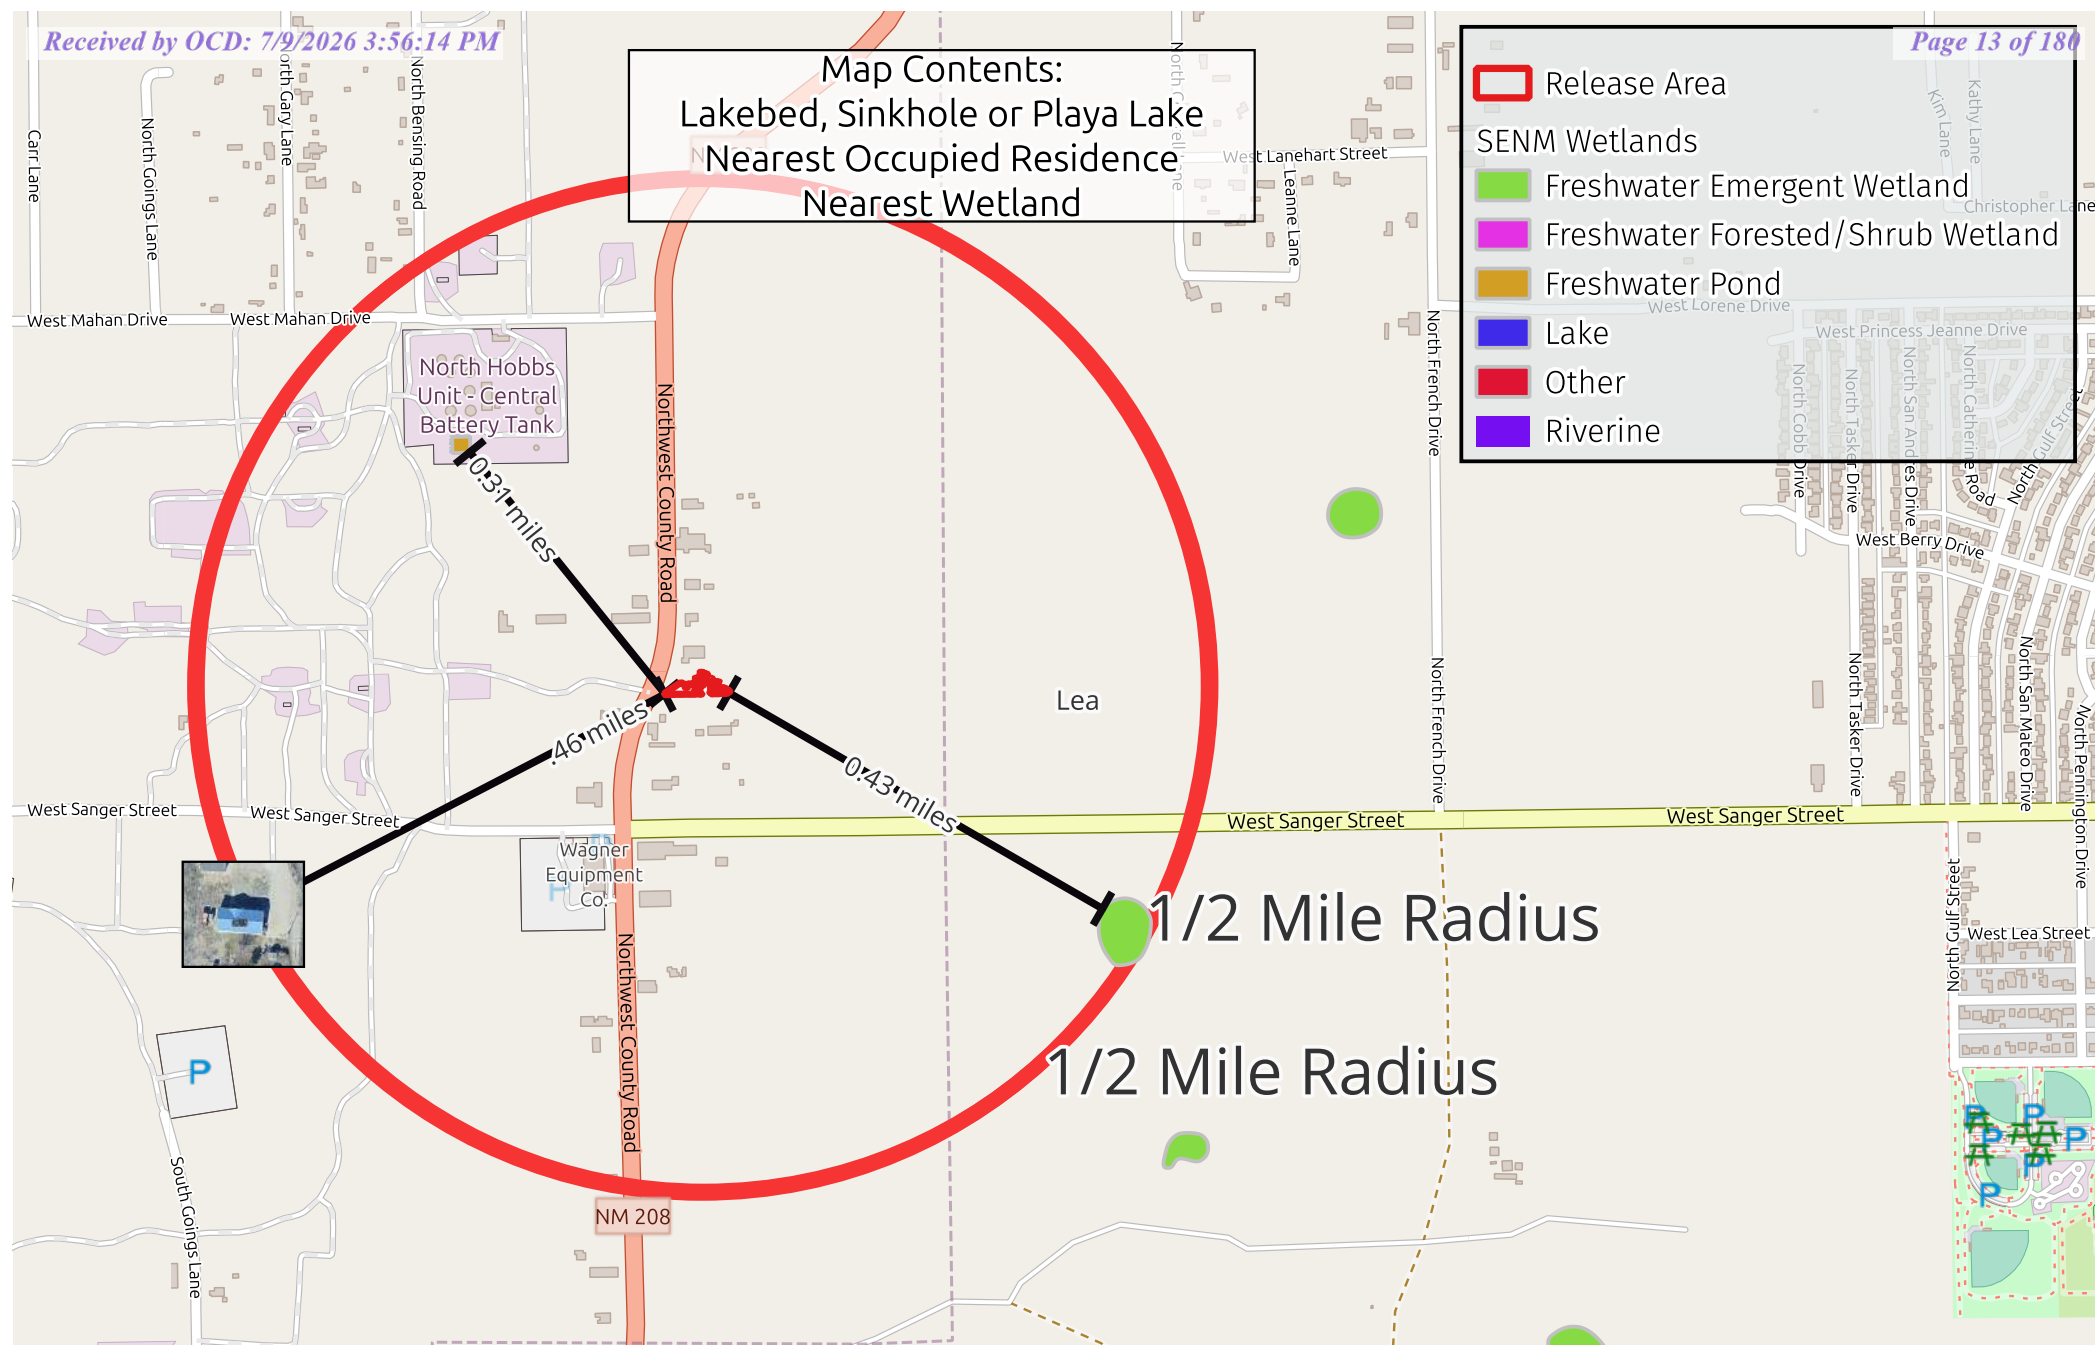


Company
 Hobbs Water Station Injection Line
 Incident #nAPP2613655309
 32.713093,-103.174553 NAD83
 Private Surface



Diamondback Disposal
 Services, Inc
 P.O. Box 2491
 Hobbs, NM 88241
 575-392-9996

Map Contents:
Continuously Flowing Watercourse
Flood Hazard Zone

- Release Area
- Flood Hazard Zones
- 1% Annual Chance Flood Hazard
 - 0.2% Annual Chance Flood Hazard

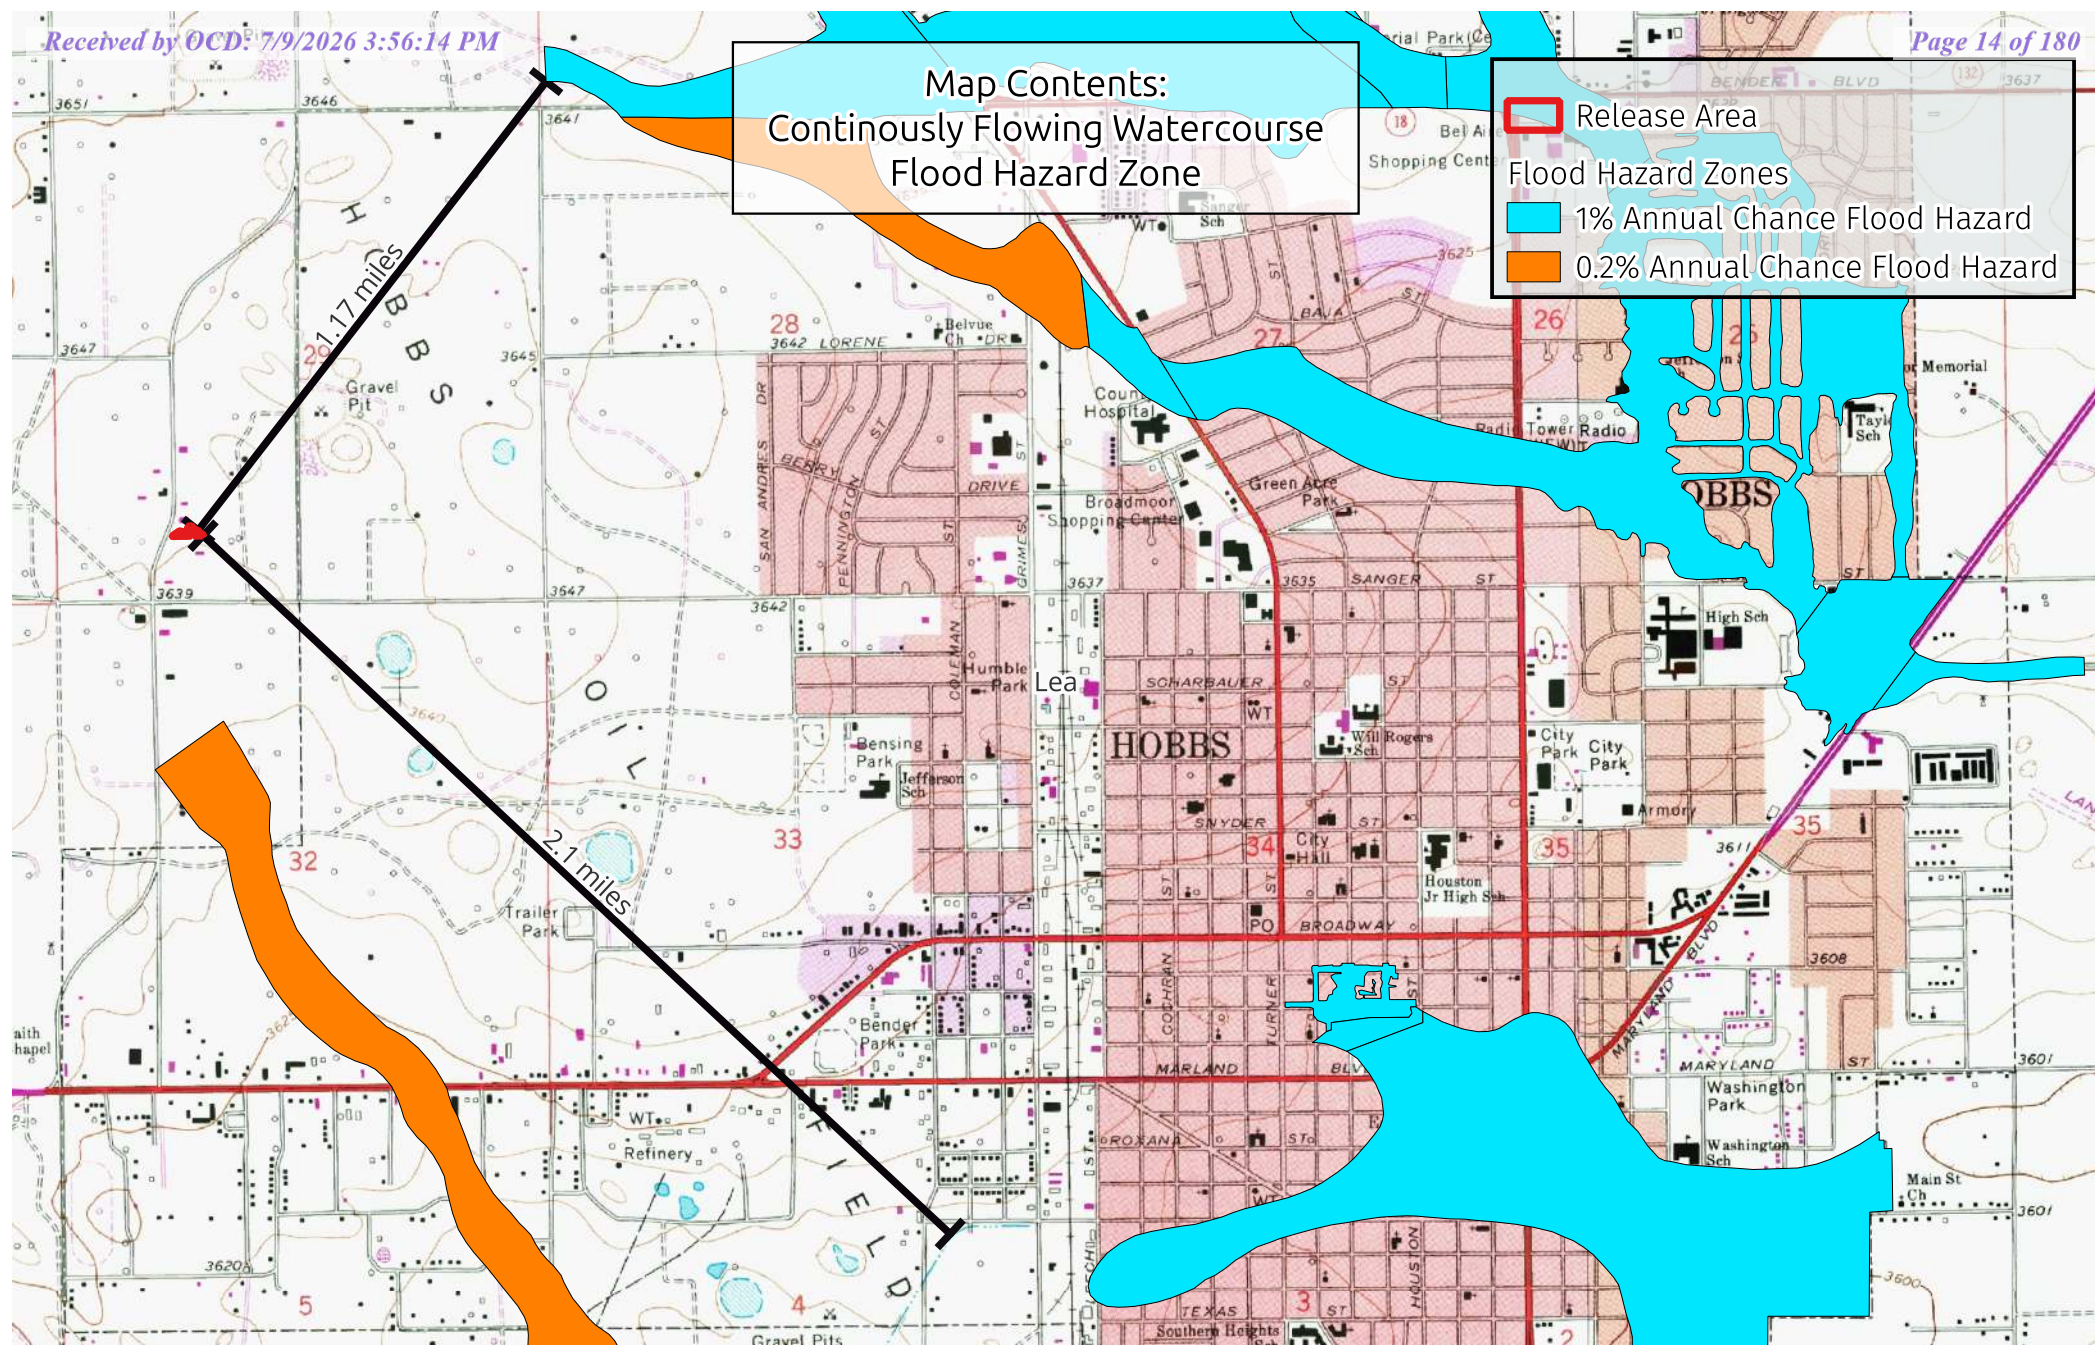

Company
Hobbs Water Station Injection Line
Incident #nAPP2613655309
32.713093,-103.174553 NAD83
Private Surface



0.00515 mi




Diamondback Disposal
Services, Inc
P.O. Box 2491
Hobbs, NM 88241
575-392-9996

Map Contents:
Nearest Subsurface Mine
Karst Potential


-  Release Area
-  Potash
- BLM Karst Potential
 -  Critical
 -  High - Survey Required
 -  Not Karst
 -  Medium

5 Mile Radius

37.92 miles

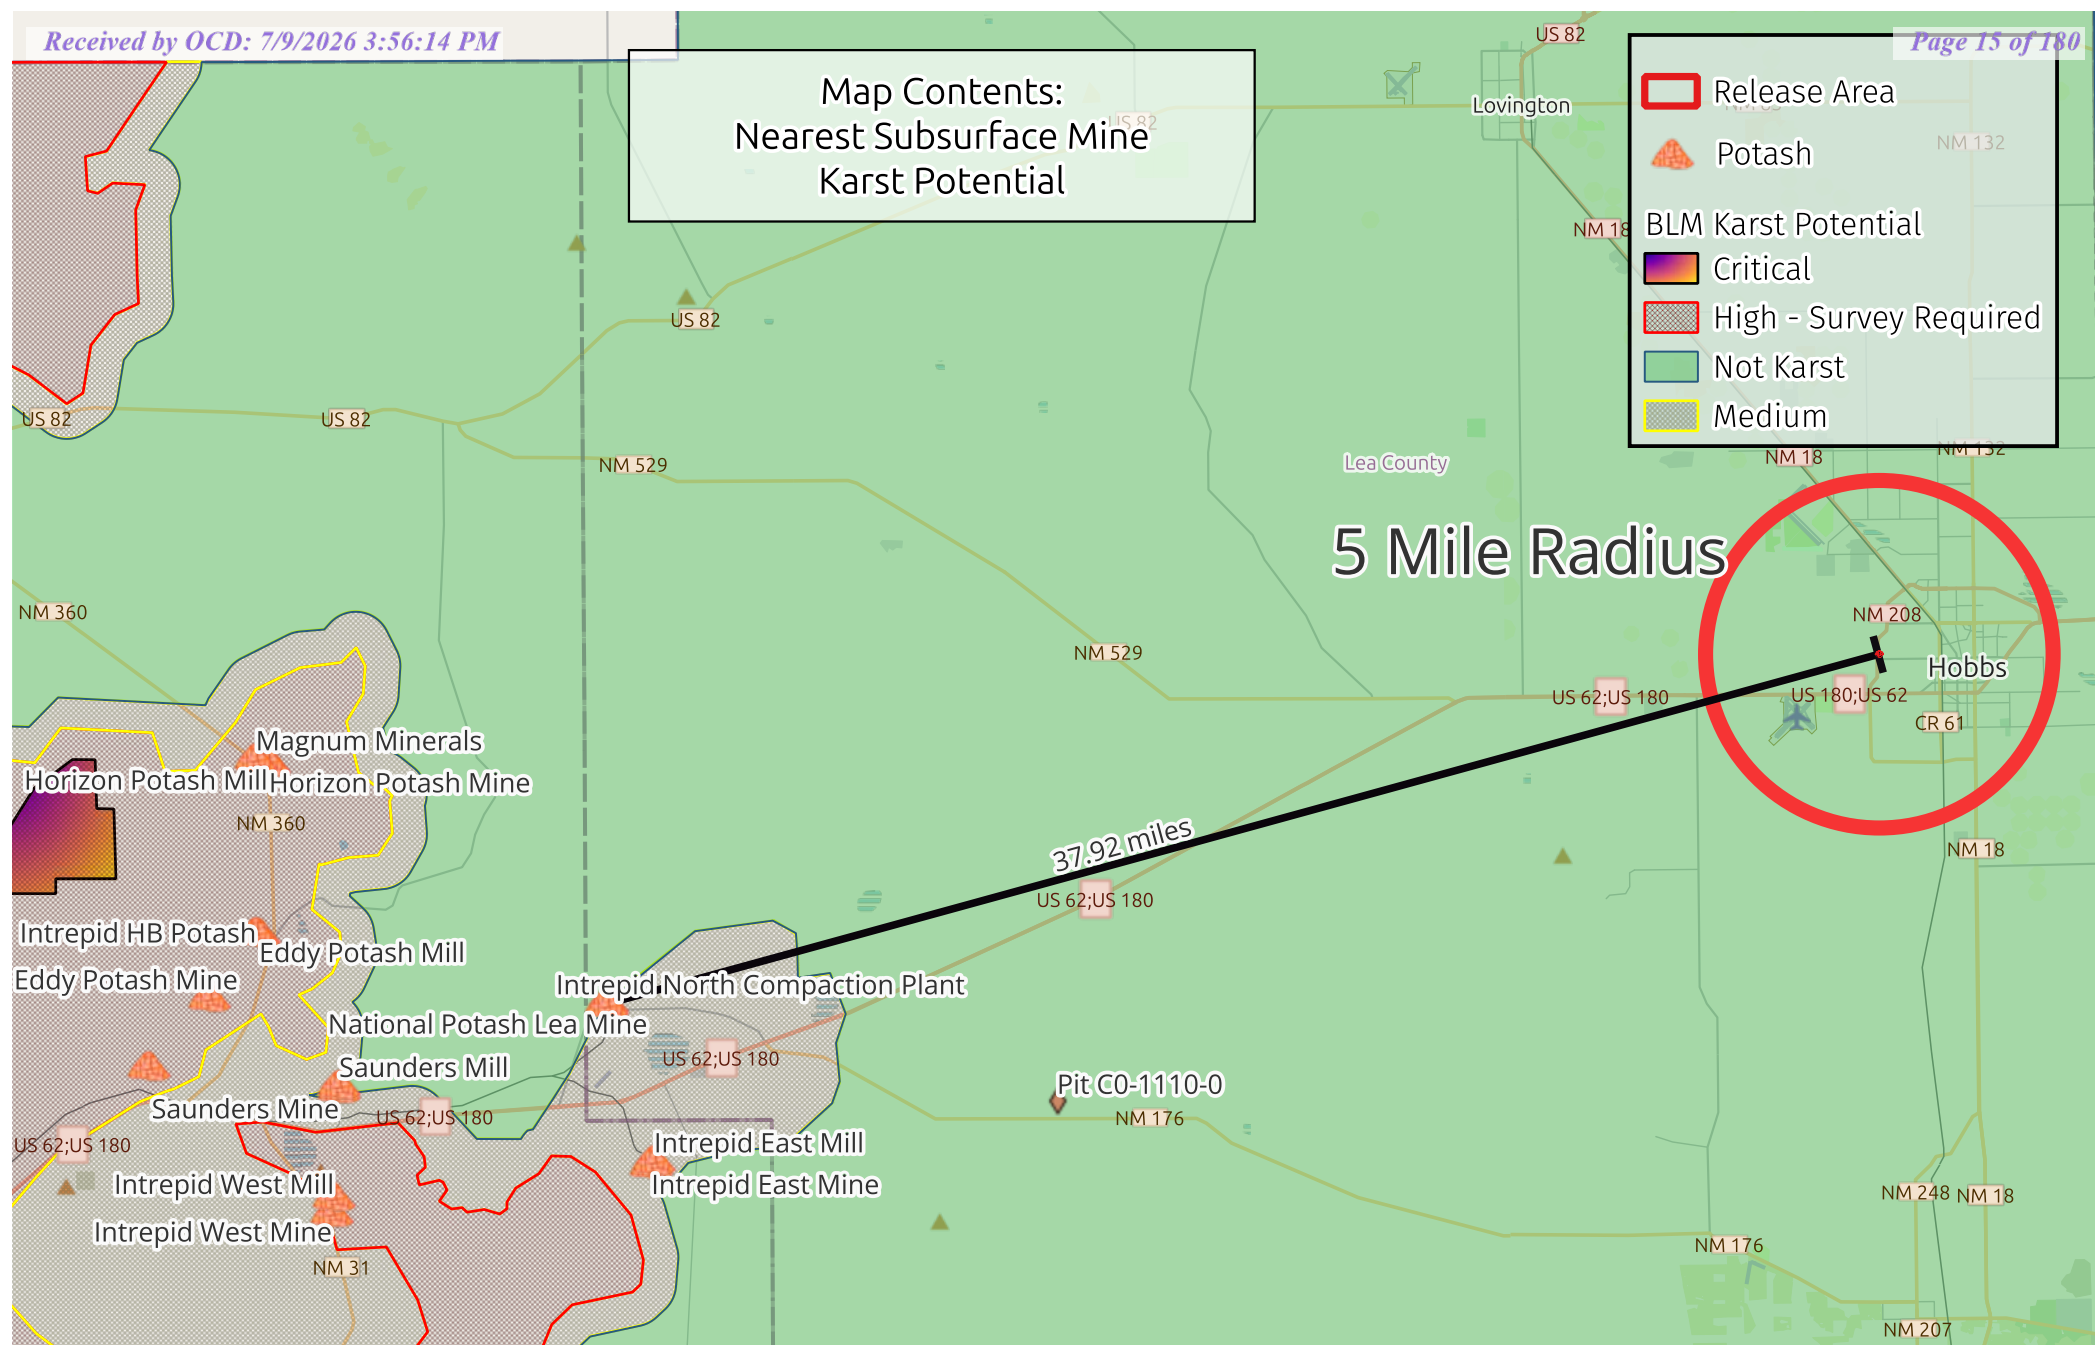

Company
Hobbs Water Station Injection Line
Incident #nAPP2613655309
32.713093,-103.174553 NAD83
Private Surface

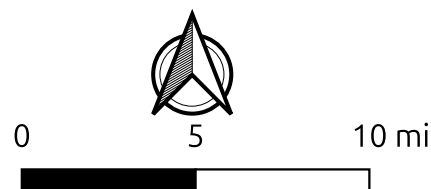

Diamondback Disposal
Services, Inc
P.O. Box 2491
Hobbs, NM 88241
575-392-9996

Appendix B

Site Delineation Mapping and Summary Report

Hobbs Water Station Injection Line – nAPP2613655309

5PC – Side Wall Summary

SAMPLE ID	LAB ID NUMBER	SAMPLE DATE	BENZENE	TOLUENE (mg/kg)	ETHYL-BENZENE (mg/kg)	TOTAL XYLENES (mg/kg)	TOTAL BTEX (mg/kg)	GRO C6-C10 (mg/kg)	DRO C10-C28 (mg/kg)	EXT DRO C28-C36 (mg/kg)	TOTAL TPH C6-C36 (mg/kg)	CHLORIDE
W1 @ 0-1'	H263089-01	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
W2 @ 0-1'	H263089-02	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
W3 @ 0-1'	H263089-03	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	<16.0
W4 @ 0-1'	H263089-04	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	<16.0
W5 @ 0-1'	H263089-05	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
W6 @ 0-1'	H263089-06	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	<16.0

Hobbs Water Station Injection Line – nAPP2613655309

G – Horizontal Summary

SAMPLE ID	LAB ID NUMBER	SAMPLE DATE	BENZENE	TOLUENE (mg/kg)	ETHYL-BENZENE (mg/kg)	TOTAL XYLENES (mg/kg)	TOTAL BTEX (mg/kg)	GRO C6-C10 (mg/kg)	DRO C10-C28 (mg/kg)	EXT DRO C28-C36 (mg/kg)	TOTAL TPH C6-C36 (mg/kg)	CHLORIDE
H1 @ S	H263090-01	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
H2 @ S	H263090-02	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
H3 @ S	H263090-03	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
H4 @ S	H263090-04	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16


Hobbs Water Station Injection Line – nAPP2613655309

5PC – Backfill Sample Summary

SAMPLE ID	LAB ID NUMBER	SAMPLE DATE	BENZENE	TOLUENE (mg/kg)	ETHYL-BENZENE (mg/kg)	TOTAL XYLENES (mg/kg)	TOTAL BTEX (mg/kg)	GRO C6-C10 (mg/kg)	DRO C10-C28 (mg/kg)	EXT DRO C28-C36 (mg/kg)	TOTAL TPH C6-C36 (mg/kg)	CHLORIDE
BC	H263091-01	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32



Company
Hobbs Water Station Injection Line
Incident #nAPP2613655309
32.713093,-103.174553 NAD83
Private Surface

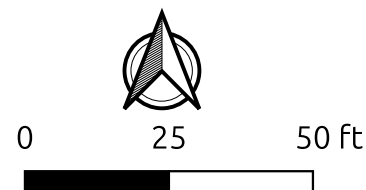

Diamondback Disposal
Services, Inc
P.O. Box 2491
Hobbs, NM 88241
575-392-9996

Hobbs Water Station Injection Line – nAPP2613655309
5PC – Excavation Base Summary

SAMPLE ID	LAB ID NUMBER	SAMPLE DATE	BENZENE	TOLUENE (mg/kg)	ETHYL-BENZENE (mg/kg)	TOTAL XYLENES (mg/kg)	TOTAL BTEX (mg/kg)	GRO C6-C10 (mg/kg)	DRO C10-C28 (mg/kg)	EXT DRO C28-C36 (mg/kg)	TOTAL TPH C6-C36 (mg/kg)	CHLORIDE
B1 @ 1'	H263068-01	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	31.3	36.6	67.9	32
B2 @ 9"	H263068-02	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	61.6	71.4	133	32
B2 @ 1'	H263087-01	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B3 @ 1'	H263068-03	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	40.8	54.3	95.1	32
B4 @ 6"	H263068-04	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	30.7	46.7	77.4	32
B5 @ 6"	H263068-05	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	40.9	51.1	92	32
B6 @ 6"	H263068-06	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	39.7	52	91.7	32
B7 @ 6"	H263068-07	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	51.4	62.8	114.2	32
B7 @ 9"	H263087-02	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B8 @ 6"	H263068-08	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	59.1	71.6	130.7	32
B8 @ 9"	H263087-03	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B9 @ 1'	H263068-09	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	16.8	<10.0	16.8	32
B10 @ 1'	H263068-10	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	24.3	24.5	48.8	48
B11 @ 1'	H263068-11	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	18.1	18	36.1	32
B12 @ 1'	H263068-12	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	19.8	18.8	38.6	32
B13 @ 1'	H263068-13	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	43.8	38.1	81.9	32
B14 @ 1'	H263068-14	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	46.6	44.8	91.4	32
B15 @ 1'	H263068-15	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	38.9	35.8	74.7	32
B16 @ 6"	H263068-16	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B17 @ 6"	H263068-17	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B18 @ 6"	H263068-18	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	29	23.2	52.2	16
B19 @ 6"	H263068-19	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	38.5	33.9	72.4	16
B20 @ 6"	H263068-20	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	11.1	<10.0	11.1	32
B21 @ 6"	H263068-21	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	16.6	<10.0	16.6	16
B22 @ 6"	H263068-22	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	49.2	46.5	95.7	32
B23 @ 6"	H263068-23	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	14.5	16.6	31.1	16
B24 @ 6"	H263068-24	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	45	37.9	82.9	32
B25 @ 6"	H263068-25	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	43.2	37.1	80.3	16
B26 @ 6"	H263068-26	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	42.9	38.3	81.2	32
B27 @ 6"	H263068-27	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	13.2	12.9	26.1	16
B28 @ 6"	H263068-28	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	16	13.3	29.3	32
B29 @ 6"	H263068-29	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B30 @ 6"	H263068-30	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B31 @ 1'	H263068-31	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	22.7	<10.0	22.7	48
B32 @ 1'	H263068-32	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	53.4	36.3	89.7	48
B33 @ 1'	H263068-33	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	57	40.6	97.6	32
B34 @ 1'	H263068-34	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	53	39.1	92.1	16
B35 @ 1'	H263068-35	5/29/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	12.9	<10.0	12.9	16
B36 @ 1'	H263088-01	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B37 @ 1'	H263088-02	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B38 @ 1'	H263088-03	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	<16.0
B39 @ 1'	H263088-04	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B40 @ 1'	H263088-05	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B41 @ 1'	H263088-06	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B42 @ 1'	H263088-07	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B43 @ 1'	H263088-08	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B44 @ 1'	H263088-09	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B45 @ 1'	H263088-10	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B46 @ 1'	H263088-11	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	<16.0

Hobbs Water Station Injection Line – nAPP2613655309
5PC – Excavation Base Summary


SAMPLE ID	LAB ID NUMBER	SAMPLE DATE	BENZENE	TOLUENE (mg/kg)	ETHYL-BENZENE (mg/kg)	TOTAL XYLENES (mg/kg)	TOTAL BTEX (mg/kg)	GRO C6-C10 (mg/kg)	DRO C10-C28 (mg/kg)	EXT DRO C28-C36 (mg/kg)	TOTAL TPH C6-C36 (mg/kg)	CHLORIDE
B47 @ 6"	H263088-12	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B48 @ 6"	H263088-13	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B49 @ 6"	H263088-14	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B50 @ 6"	H263088-15	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B51 @ 6"	H263088-16	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B52 @ 6"	H263088-17	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B53 @ 6"	H263088-18	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B54 @ 6"	H263088-19	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B55 @ 6"	H263088-20	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B56 @ 6"	H263088-21	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B57 @ 6"	H263088-22	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B58 @ 6"	H263088-23	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B59 @ 6"	H263088-24	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B60 @ 6"	H263088-25	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B61 @ 6"	H263088-26	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B62 @ 6"	H263088-27	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	80
B63 @ 6"	H263088-28	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B64 @ 6"	H263088-29	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	64
B65 @ 6"	H263088-30	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B66 @ 6"	H263088-31	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B67 @ 6"	H263088-32	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	32
B68 @ 6"	H263088-33	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	80
B69 @ 6"	H263088-34	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B70 @ 6"	H263088-35	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B71 @ 6"	H263088-36	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B72 @ 6"	H263088-37	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B73 @ 6"	H263088-38	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	80
B74 @ 6"	H263088-39	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B75 @ 6"	H263088-40	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	64
B76 @ 6"	H263088-41	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B77 @ 6"	H263088-42	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B78 @ 6"	H263088-43	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B79 @ 6"	H263088-44	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	<16.0
B80 @ 6"	H263088-45	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B81 @ 6"	H263088-46	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	16
B82 @ 6"	H263088-47	6/1/26	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	<10.0	80

The highlighted samples exceeded the applicable RRALs. These areas have since been excavated and resampled.

- Excavated Area
- Excavation Base "B"



Company
Hobbs Water Station Injection Line
Incident #nAPP2613655309
32.713093,-103.174553 NAD83
Private Surface

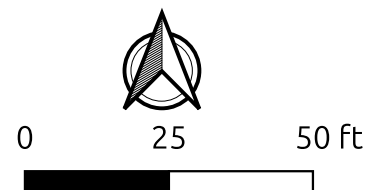

Diamondback Disposal
Services, Inc
P.O. Box 2491
Hobbs, NM 88241
575-392-9996


Appendix C Site Photography And Field Notes

Map Contents:
Excavation Photo Locations

- Excavated Area
- Excavation Base "B"



Company
Hobbs Water Station Injection Line
Incident #nAPP2613655309
32.713093,-103.174553 NAD83
Private Surface

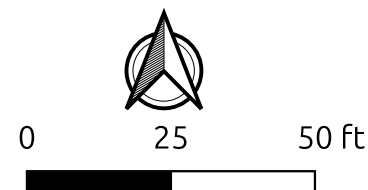

Diamondback Disposal
Services, Inc
P.O. Box 2491
Hobbs, NM 88241
575-392-9996

Hobbs Water Station Injection Line – nAPP2613655309

Final Excavation Photos



Figure 1



Figure 2



Figure 3



Figure 4



Figure 5



Figure 6

Hobbs Water Station Injection Line – nAPP2613655309

Final Excavation Photos



Figure 7



Figure 8



Figure 9



Figure 10



Figure 1 2

Appendix D

Communications / Historical Records

SPILL VOLUME CALCULATIONS

INPUT DATA: (click "Reset Page" button to return all values to zero)											
Total Area Calculations					Standing Liquid Calculations						
					(leave blank if 100% of free liquid has been recovered)						
Total Surface Area			saturated soil depth	% oil	Total Surface Area			liquid depth	% oil		
Known Area #1	0 acres	or	14,458 sq. ft.	9 in	0%	Known Area #1	0 acres	or	0 sq. ft.	0 in	0%
Known Area #2	0 acres	or	0 sq. ft.	0 in	0%	Known Area #2	0 acres	or	0 sq. ft.	0 in	0%
Known Area #3	0 acres	or	0 sq. ft.	0 in	0%	Known Area #3	0 acres	or	0 sq. ft.	0 in	0%
Known Area #4	0 acres	or	0 sq. ft.	0 in	0%	Known Area #4	0 acres	or	0 sq. ft.	0 in	0%
width		length				width		length			
Rectangle Area #1	0 ft		0 ft	0 in	0%	Rectangle Area #1	0 ft		0 ft	0 in	0%
Rectangle Area #2	0 ft		0 ft	0 in	0%	Rectangle Area #2	0 ft		0 ft	0 in	0%
Rectangle Area #3	0 ft		0 ft	0 in	0%	Rectangle Area #3	0 ft		0 ft	0 in	0%
Rectangle Area #4	0 ft		0 ft	0 in	0%	Rectangle Area #4	0 ft		0 ft	0 in	0%
diameter			saturated soil depth	% oil		diameter			liquid depth	% oil	
Circle Area #1	0 ft		0 in	0%		Circle Area #1	0 ft		0 in	0%	
Circle Area #2	0 ft		0 in	0%		Circle Area #2	0 ft		0 in	0%	
Circle Area #3	0 ft		0 in	0%		Circle Area #3	0 ft		0 in	0%	
Circle Area #4	0 ft		0 in	0%		Circle Area #4	0 ft		0 in	0%	

Amount of Free Liquid Recovered: 240 bbl	Percentage of Oil in Free Liquid Recovered: 0%
Liquid Holding Factor*: 0.08 gal liquid/gal soil (see below)	
Use the following when the spill wets the grains of the soil. * sand = .08 gallon liquid per gallon volume of soil. * gravelly (caliche) loam = .14 gallon liquid per gallon volume of soil. * sandy clay loam soil = .14 gallon liquid per gallon volume of soil. * clay loam = .16 gallon liquid per gallon volume of soil.	Use the following when the liquid completely fills the pore space of the soil: Occurs when the spill soaked soil is contained by barriers, natural (or not). * gravelly (caliche) loam = .25 gallon liquid per gallon volume of soil. * sandy loam = .5 gallon liquid per gallon volume of soil.

OUTPUT DATA:																			
<u>Saturated Soil Volume Calculations</u> Total Contaminated Volume: 10,843.5 cu. ft. 401.6 yds. <u>Estimated Volumes Spilled</u> <table style="width: 100%; border: none;"> <tr> <td></td> <td style="text-align: center; border-bottom: 1px solid black;">Water</td> <td style="text-align: center; border-bottom: 1px solid black;">Oil</td> </tr> <tr> <td>Liquid in Soil:</td> <td style="text-align: right;">154.5 BBL</td> <td style="text-align: right;">0.0 BBL</td> </tr> <tr> <td>Free Liquid:</td> <td style="text-align: right;">0.0 BBL</td> <td style="text-align: right;">0.0 BBL</td> </tr> <tr> <td>Free Liquid Recovered:</td> <td style="text-align: right;">240.0 BBL</td> <td style="text-align: right;">0.0 BBL</td> </tr> </table>		Water	Oil	Liquid in Soil:	154.5 BBL	0.0 BBL	Free Liquid:	0.0 BBL	0.0 BBL	Free Liquid Recovered:	240.0 BBL	0.0 BBL	<u>Free Liquid Volume Calculations</u> <table style="width: 100%; border: none;"> <tr> <td></td> <td style="text-align: center; border-bottom: 1px solid black;">Water</td> <td style="text-align: center; border-bottom: 1px solid black;">Oil</td> </tr> <tr> <td>Total Free Liquid:</td> <td style="text-align: right;">0.0 BBL</td> <td style="text-align: right;">0.0 BBL</td> </tr> </table> <u>Estimated Surface Damage</u> Surface Area: 14,458.0 sq. ft. Surface Area: 0.3 acres <u>Recovered Volumes</u> Estimated oil recovered: 0.0 BBL Estimated water recovered: 240.0 BBL		Water	Oil	Total Free Liquid:	0.0 BBL	0.0 BBL
	Water	Oil																	
Liquid in Soil:	154.5 BBL	0.0 BBL																	
Free Liquid:	0.0 BBL	0.0 BBL																	
Free Liquid Recovered:	240.0 BBL	0.0 BBL																	
	Water	Oil																	
Total Free Liquid:	0.0 BBL	0.0 BBL																	
Total Liquid Spilled:	394.5 BBL	0.0 BBL																	
	16,568.7 gal	0.0 gal																	

Sent (Local): 2026-05-27 16:15:28 MDT
From: "OCDOnline@emnrd.nm.gov" <OCDOnline@emnrd.nm.gov>
To: Randall Crawford <randall.crawford@ewllc.com>
Cc:
Subject: The Oil Conservation Division (OCD) has accepted the application, Application ID: 588789
Source: The Oil Conservation Division _OCD_ has accepted the application, Application ID: 588789

[EXTERNAL]: This email originated outside of our company. Do not click links or open attachments unless you recognize the sender and know the content is safe.

To whom it may concern (c/o Gary Crawford for EW Operating (NM), LLC),

The OCD has received the submitted *Notification for (Final) Sampling of a Release* (C-141N), for incident ID (n#) nAPP2613655309.

The sampling event is expected to take place:

When: 05/29/2026 @ 13:30

Where: N-29-18S-38E 610 FNL 135 FWL (32.713093,-103.174553)

Additional Information: Julio Rivera w/ Diamondback Disposal Services 806-837-6057

Additional Instructions: Start at the intersection of Marland Road and NW County Road. Travel north on NW County Road for approximately 1.2 miles. The site is located on the right near the frac tank rental facility.

An OCD representative may be available onsite at the date and time reported. In the absence or presence of an OCD representative, sampling pursuant to 19.15.29.12.D NMAC is required. Sampling must be performed following an approved sampling plan or pursuant to 19.15.29.12.D.(1).(c) NMAC. Should there be a change in the scheduled date and time of the sampling event, then another notification should be resubmitted through OCD permitting as soon as possible.

- **Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.**
- **If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.**

If you have any questions regarding this application, or don't know why you have received this email, please contact us.

New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

Sent (Local): 2026-05-27 16:18:29 MDT
From: "OCDOnline@emnrd.nm.gov" <OCDOnline@emnrd.nm.gov>
To: Randall Crawford <randall.crawford@ewllc.com>
Cc:
Subject: The Oil Conservation Division (OCD) has accepted the application, Application ID: 588791
Source: The Oil Conservation Division _OCD_ has accepted the application, Application ID: 588791

[EXTERNAL]: This email originated outside of our company. Do not click links or open attachments unless you recognize the sender and know the content is safe.

To whom it may concern (c/o Gary Crawford for EW Operating (NM), LLC),

The OCD has received the submitted *Notification for (Final) Sampling of a Release* (C-141N), for incident ID (n#) nAPP2613655309.

The sampling event is expected to take place:

When: 06/01/2026 @ 08:00

Where: N-29-18S-38E 610 FNL 135 FWL (32.713093,-103.174553)

Additional Information: Julio Rivera w/ Diamondback Disposal Services 806-837-6057

Additional Instructions: Start at the intersection of Marland Road and NW County Road. Travel north on NW County Road for approximately 1.2 miles. The site is located on the right near the frac tank rental facility.

An OCD representative may be available onsite at the date and time reported. In the absence or presence of an OCD representative, sampling pursuant to 19.15.29.12.D NMAC is required. Sampling must be performed following an approved sampling plan or pursuant to 19.15.29.12.D.(1).(c) NMAC. Should there be a change in the scheduled date and time of the sampling event, then another notification should be resubmitted through OCD permitting as soon as possible.

- **Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.**
- **If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.**

If you have any questions regarding this application, or don't know why you have received this email, please contact us.

New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

Sent (Local): 2026-05-27 16:20:41 MDT
From: "OCDOnline@emnrd.nm.gov" <OCDOnline@emnrd.nm.gov>
To: Randall Crawford <randall.crawford@ewllc.com>
Cc:
Subject: The Oil Conservation Division (OCD) has accepted the application, Application ID: 588793
Source: The Oil Conservation Division _OCD_ has accepted the application, Application ID: 588793

[EXTERNAL]: This email originated outside of our company. Do not click links or open attachments unless you recognize the sender and know the content is safe.

To whom it may concern (c/o Gary Crawford for EW Operating (NM), LLC),

The OCD has received the submitted *Notification for (Final) Sampling of a Release* (C-141N), for incident ID (n#) nAPP2613655309.

The sampling event is expected to take place:

When: 06/02/2026 @ 08:00

Where: N-29-18S-38E 610 FNL 135 FWL (32.713093,-103.174553)

Additional Information: Julio Rivera w/ Diamondback Disposal Services 806-837-6057, sampling dependent on forecast.

Additional Instructions: Start at the intersection of Marland Road and NW County Road. Travel north on NW County Road for approximately 1.2 miles. The site is located on the right near the frac tank rental facility.

An OCD representative may be available onsite at the date and time reported. In the absence or presence of an OCD representative, sampling pursuant to 19.15.29.12.D NMAC is required. Sampling must be performed following an approved sampling plan or pursuant to 19.15.29.12.D.(1).(c) NMAC. Should there be a change in the scheduled date and time of the sampling event, then another notification should be resubmitted through OCD permitting as soon as possible.

- **Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.**
- **If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.**

If you have any questions regarding this application, or don't know why you have received this email, please contact us.

New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

Appendix E

Environmental Resources Review



United States
Department of
Agriculture

NRCS

Natural
Resources
Conservation
Service

A product of the National
Cooperative Soil Survey,
a joint effort of the United
States Department of
Agriculture and other
Federal agencies, State
agencies including the
Agricultural Experiment
Stations, and local
participants

Custom Soil Resource Report for Lea County, New Mexico



April 19, 2026

Preface

Soil surveys contain information that affects land use planning in survey areas. They highlight soil limitations that affect various land uses and provide information about the properties of the soils in the survey areas. Soil surveys are designed for many different users, including farmers, ranchers, foresters, agronomists, urban planners, community officials, engineers, developers, builders, and home buyers. Also, conservationists, teachers, students, and specialists in recreation, waste disposal, and pollution control can use the surveys to help them understand, protect, or enhance the environment.

Various land use regulations of Federal, State, and local governments may impose special restrictions on land use or land treatment. Soil surveys identify soil properties that are used in making various land use or land treatment decisions. The information is intended to help the land users identify and reduce the effects of soil limitations on various land uses. The landowner or user is responsible for identifying and complying with existing laws and regulations.

Although soil survey information can be used for general farm, local, and wider area planning, onsite investigation is needed to supplement this information in some cases. Examples include soil quality assessments (<http://www.nrcs.usda.gov/wps/portal/nrcs/main/soils/health/>) and certain conservation and engineering applications. For more detailed information, contact your local USDA Service Center (<https://offices.sc.egov.usda.gov/locator/app?agency=nrcs>) or your NRCS State Soil Scientist (http://www.nrcs.usda.gov/wps/portal/nrcs/detail/soils/contactus/?cid=nrcs142p2_053951).

Great differences in soil properties can occur within short distances. Some soils are seasonally wet or subject to flooding. Some are too unstable to be used as a foundation for buildings or roads. Clayey or wet soils are poorly suited to use as septic tank absorption fields. A high water table makes a soil poorly suited to basements or underground installations.

The National Cooperative Soil Survey is a joint effort of the United States Department of Agriculture and other Federal agencies, State agencies including the Agricultural Experiment Stations, and local agencies. The Natural Resources Conservation Service (NRCS) has leadership for the Federal part of the National Cooperative Soil Survey.

Information about soils is updated periodically. Updated information is available through the NRCS Web Soil Survey, the site for official soil survey information.

The U.S. Department of Agriculture (USDA) prohibits discrimination in all its programs and activities on the basis of race, color, national origin, age, disability, and where applicable, sex, marital status, familial status, parental status, religion, sexual orientation, genetic information, political beliefs, reprisal, or because all or a part of an individual's income is derived from any public assistance program. (Not all prohibited bases apply to all programs.) Persons with disabilities who require

alternative means for communication of program information (Braille, large print, audiotape, etc.) should contact USDA's TARGET Center at (202) 720-2600 (voice and TDD). To file a complaint of discrimination, write to USDA, Director, Office of Civil Rights, 1400 Independence Avenue, S.W., Washington, D.C. 20250-9410 or call (800) 795-3272 (voice) or (202) 720-6382 (TDD). USDA is an equal opportunity provider and employer.

Contents

Preface..... 2

How Soil Surveys Are Made.....5

Soil Map..... 8

 Soil Map.....9

 Legend.....10

 Map Unit Legend..... 11

 Map Unit Descriptions.....11

 Lea County, New Mexico..... 13

 KU—Kimbrough-Lea complex, dry, 0 to 3 percent slopes..... 13

 PG—Lovington-Delphos fine sandy loams, 0 to 3 percent slopes..... 15

References..... 18

How Soil Surveys Are Made

Soil surveys are made to provide information about the soils and miscellaneous areas in a specific area. They include a description of the soils and miscellaneous areas and their location on the landscape and tables that show soil properties and limitations affecting various uses. Soil scientists observed the steepness, length, and shape of the slopes; the general pattern of drainage; the kinds of crops and native plants; and the kinds of bedrock. They observed and described many soil profiles. A soil profile is the sequence of natural layers, or horizons, in a soil. The profile extends from the surface down into the unconsolidated material in which the soil formed or from the surface down to bedrock. The unconsolidated material is devoid of roots and other living organisms and has not been changed by other biological activity.

Currently, soils are mapped according to the boundaries of major land resource areas (MLRAs). MLRAs are geographically associated land resource units that share common characteristics related to physiography, geology, climate, water resources, soils, biological resources, and land uses (USDA, 2006). Soil survey areas typically consist of parts of one or more MLRA.

The soils and miscellaneous areas in a survey area occur in an orderly pattern that is related to the geology, landforms, relief, climate, and natural vegetation of the area. Each kind of soil and miscellaneous area is associated with a particular kind of landform or with a segment of the landform. By observing the soils and miscellaneous areas in the survey area and relating their position to specific segments of the landform, a soil scientist develops a concept, or model, of how they were formed. Thus, during mapping, this model enables the soil scientist to predict with a considerable degree of accuracy the kind of soil or miscellaneous area at a specific location on the landscape.

Commonly, individual soils on the landscape merge into one another as their characteristics gradually change. To construct an accurate soil map, however, soil scientists must determine the boundaries between the soils. They can observe only a limited number of soil profiles. Nevertheless, these observations, supplemented by an understanding of the soil-vegetation-landscape relationship, are sufficient to verify predictions of the kinds of soil in an area and to determine the boundaries.

Soil scientists recorded the characteristics of the soil profiles that they studied. They noted soil color, texture, size and shape of soil aggregates, kind and amount of rock fragments, distribution of plant roots, reaction, and other features that enable them to identify soils. After describing the soils in the survey area and determining their properties, the soil scientists assigned the soils to taxonomic classes (units). Taxonomic classes are concepts. Each taxonomic class has a set of soil characteristics with precisely defined limits. The classes are used as a basis for comparison to classify soils systematically. Soil taxonomy, the system of taxonomic classification used in the United States, is based mainly on the kind and character of soil properties and the arrangement of horizons within the profile. After the soil

Custom Soil Resource Report

scientists classified and named the soils in the survey area, they compared the individual soils with similar soils in the same taxonomic class in other areas so that they could confirm data and assemble additional data based on experience and research.

The objective of soil mapping is not to delineate pure map unit components; the objective is to separate the landscape into landforms or landform segments that have similar use and management requirements. Each map unit is defined by a unique combination of soil components and/or miscellaneous areas in predictable proportions. Some components may be highly contrasting to the other components of the map unit. The presence of minor components in a map unit in no way diminishes the usefulness or accuracy of the data. The delineation of such landforms and landform segments on the map provides sufficient information for the development of resource plans. If intensive use of small areas is planned, onsite investigation is needed to define and locate the soils and miscellaneous areas.

Soil scientists make many field observations in the process of producing a soil map. The frequency of observation is dependent upon several factors, including scale of mapping, intensity of mapping, design of map units, complexity of the landscape, and experience of the soil scientist. Observations are made to test and refine the soil-landscape model and predictions and to verify the classification of the soils at specific locations. Once the soil-landscape model is refined, a significantly smaller number of measurements of individual soil properties are made and recorded. These measurements may include field measurements, such as those for color, depth to bedrock, and texture, and laboratory measurements, such as those for content of sand, silt, clay, salt, and other components. Properties of each soil typically vary from one point to another across the landscape.

Observations for map unit components are aggregated to develop ranges of characteristics for the components. The aggregated values are presented. Direct measurements do not exist for every property presented for every map unit component. Values for some properties are estimated from combinations of other properties.

While a soil survey is in progress, samples of some of the soils in the area generally are collected for laboratory analyses and for engineering tests. Soil scientists interpret the data from these analyses and tests as well as the field-observed characteristics and the soil properties to determine the expected behavior of the soils under different uses. Interpretations for all of the soils are field tested through observation of the soils in different uses and under different levels of management. Some interpretations are modified to fit local conditions, and some new interpretations are developed to meet local needs. Data are assembled from other sources, such as research information, production records, and field experience of specialists. For example, data on crop yields under defined levels of management are assembled from farm records and from field or plot experiments on the same kinds of soil.

Predictions about soil behavior are based not only on soil properties but also on such variables as climate and biological activity. Soil conditions are predictable over long periods of time, but they are not predictable from year to year. For example, soil scientists can predict with a fairly high degree of accuracy that a given soil will have a high water table within certain depths in most years, but they cannot predict that a high water table will always be at a specific level in the soil on a specific date.

After soil scientists located and identified the significant natural bodies of soil in the survey area, they drew the boundaries of these bodies on aerial photographs and

Custom Soil Resource Report

identified each as a specific map unit. Aerial photographs show trees, buildings, fields, roads, and rivers, all of which help in locating boundaries accurately.

Soil Map

The soil map section includes the soil map for the defined area of interest, a list of soil map units on the map and extent of each map unit, and cartographic symbols displayed on the map. Also presented are various metadata about data used to produce the map, and a description of each soil map unit.

Custom Soil Resource Report
Soil Map

Custom Soil Resource Report

MAP LEGEND

Area of Interest (AOI)

 Area of Interest (AOI)

Soils

 Soil Map Unit Polygons

 Soil Map Unit Lines

 Soil Map Unit Points

Special Point Features

 Blowout

 Borrow Pit

 Clay Spot

 Closed Depression

 Gravel Pit

 Gravelly Spot

 Landfill

 Lava Flow

 Marsh or swamp

 Mine or Quarry

 Miscellaneous Water

 Perennial Water

 Rock Outcrop

 Saline Spot

 Sandy Spot

 Severely Eroded Spot

 Sinkhole

 Slide or Slip

 Sodic Spot

 Spoil Area

 Stony Spot

 Very Stony Spot

 Wet Spot

 Other

 Special Line Features

Water Features

 Streams and Canals

Transportation

 Rails

 Interstate Highways

 US Routes

 Major Roads

 Local Roads

Background

 Aerial Photography

MAP INFORMATION

The soil surveys that comprise your AOI were mapped at 1:20,000.

Warning: Soil Map may not be valid at this scale.

Enlargement of maps beyond the scale of mapping can cause misunderstanding of the detail of mapping and accuracy of soil line placement. The maps do not show the small areas of contrasting soils that could have been shown at a more detailed scale.

Please rely on the bar scale on each map sheet for map measurements.

Source of Map: Natural Resources Conservation Service
Web Soil Survey URL:
Coordinate System: Web Mercator (EPSG:3857)

Maps from the Web Soil Survey are based on the Web Mercator projection, which preserves direction and shape but distorts distance and area. A projection that preserves area, such as the Albers equal-area conic projection, should be used if more accurate calculations of distance or area are required.

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.

Soil Survey Area: Lea County, New Mexico
Survey Area Data: Version 22, Sep 9, 2025

Soil map units are labeled (as space allows) for map scales 1:50,000 or larger.

Date(s) aerial images were photographed: Jan 18, 2020—Feb 17, 2020

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

Custom Soil Resource Report

Map Unit Legend

Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI
KU	Kimbrough-Lea complex, dry, 0 to 3 percent slopes	1.1	68.1%
PG	Lovington-Delphos fine sandy loams, 0 to 3 percent slopes	0.5	31.9%
Totals for Area of Interest		1.6	100.0%

Map Unit Descriptions

The map units delineated on the detailed soil maps in a soil survey represent the soils or miscellaneous areas in the survey area. The map unit descriptions, along with the maps, can be used to determine the composition and properties of a unit.

A map unit delineation on a soil map represents an area dominated by one or more major kinds of soil or miscellaneous areas. A map unit is identified and named according to the taxonomic classification of the dominant soils. Within a taxonomic class there are precisely defined limits for the properties of the soils. On the landscape, however, the soils are natural phenomena, and they have the characteristic variability of all natural phenomena. Thus, the range of some observed properties may extend beyond the limits defined for a taxonomic class. Areas of soils of a single taxonomic class rarely, if ever, can be mapped without including areas of other taxonomic classes. Consequently, every map unit is made up of the soils or miscellaneous areas for which it is named and some minor components that belong to taxonomic classes other than those of the major soils.

Most minor soils have properties similar to those of the dominant soil or soils in the map unit, and thus they do not affect use and management. These are called noncontrasting, or similar, components. They may or may not be mentioned in a particular map unit description. Other minor components, however, have properties and behavioral characteristics divergent enough to affect use or to require different management. These are called contrasting, or dissimilar, components. They generally are in small areas and could not be mapped separately because of the scale used. Some small areas of strongly contrasting soils or miscellaneous areas are identified by a special symbol on the maps. If included in the database for a given area, the contrasting minor components are identified in the map unit descriptions along with some characteristics of each. A few areas of minor components may not have been observed, and consequently they are not mentioned in the descriptions, especially where the pattern was so complex that it was impractical to make enough observations to identify all the soils and miscellaneous areas on the landscape.

The presence of minor components in a map unit in no way diminishes the usefulness or accuracy of the data. The objective of mapping is not to delineate pure taxonomic classes but rather to separate the landscape into landforms or landform segments that have similar use and management requirements. The delineation of such segments on the map provides sufficient information for the development of resource plans. If intensive use of small areas is planned, however,

Custom Soil Resource Report

onsite investigation is needed to define and locate the soils and miscellaneous areas.

An identifying symbol precedes the map unit name in the map unit descriptions. Each description includes general facts about the unit and gives important soil properties and qualities.

Soils that have profiles that are almost alike make up a *soil series*. Except for differences in texture of the surface layer, all the soils of a series have major horizons that are similar in composition, thickness, and arrangement.

Soils of one series can differ in texture of the surface layer, slope, stoniness, salinity, degree of erosion, and other characteristics that affect their use. On the basis of such differences, a soil series is divided into *soil phases*. Most of the areas shown on the detailed soil maps are phases of soil series. The name of a soil phase commonly indicates a feature that affects use or management. For example, Alpha silt loam, 0 to 2 percent slopes, is a phase of the Alpha series.

Some map units are made up of two or more major soils or miscellaneous areas. These map units are complexes, associations, or undifferentiated groups.

A *complex* consists of two or more soils or miscellaneous areas in such an intricate pattern or in such small areas that they cannot be shown separately on the maps. The pattern and proportion of the soils or miscellaneous areas are somewhat similar in all areas. Alpha-Beta complex, 0 to 6 percent slopes, is an example.

An *association* is made up of two or more geographically associated soils or miscellaneous areas that are shown as one unit on the maps. Because of present or anticipated uses of the map units in the survey area, it was not considered practical or necessary to map the soils or miscellaneous areas separately. The pattern and relative proportion of the soils or miscellaneous areas are somewhat similar. Alpha-Beta association, 0 to 2 percent slopes, is an example.

An *undifferentiated group* is made up of two or more soils or miscellaneous areas that could be mapped individually but are mapped as one unit because similar interpretations can be made for use and management. The pattern and proportion of the soils or miscellaneous areas in a mapped area are not uniform. An area can be made up of only one of the major soils or miscellaneous areas, or it can be made up of all of them. Alpha and Beta soils, 0 to 2 percent slopes, is an example.

Some surveys include *miscellaneous areas*. Such areas have little or no soil material and support little or no vegetation. Rock outcrop is an example.

Custom Soil Resource Report

Lea County, New Mexico**KU—Kimbrough-Lea complex, dry, 0 to 3 percent slopes****Map Unit Setting**

National map unit symbol: 2tw46
Landscape: Plateaus
Elevation: 2,500 to 4,800 feet
Mean annual precipitation: 14 to 16 inches
Mean annual air temperature: 57 to 63 degrees F
Frost-free period: 180 to 220 days
Farmland classification: Not prime farmland

Map Unit Composition

Kimbrough and similar soils: 45 percent
Lea and similar soils: 25 percent
Minor components: 30 percent
Estimates are based on observations, descriptions, and transects of the mapunit.

Description of Kimbrough**Setting**

Landscape: Plateaus
Landform: Plains, Playa rims
Down-slope shape: Linear, convex
Across-slope shape: Linear, concave
Parent material: Loamy eolian deposits derived from sedimentary rock

Typical profile

A - 0 to 3 inches: gravelly loam
Bw - 3 to 10 inches: loam
Bkkm1 - 10 to 16 inches: cemented material
Bkkm2 - 16 to 80 inches: cemented material

Properties and qualities

Slope: 0 to 3 percent
Depth to restrictive feature: 4 to 18 inches to petrocalcic
Drainage class: Well drained
Runoff class: Very high
Capacity of the most limiting layer to transmit water (Ksat): Very low to moderately low (0.00 to 0.01 in/hr)
Depth to water table: More than 80 inches
Frequency of flooding: None
Frequency of ponding: None
Calcium carbonate, maximum content: 95 percent
Maximum salinity: Nonsaline to very slightly saline (0.0 to 2.0 mmhos/cm)
Sodium adsorption ratio, maximum: 1.0
Available water supply, 0 to 60 inches: Very low (about 1.4 inches)

Interpretive groups

Land capability classification (irrigated): None specified
Land capability classification (nonirrigated): 7s
Hydrologic Soil Group: D
Ecological site: R077DY049TX - Very Shallow 12-17" PZ
Hydric soil rating: No

Custom Soil Resource Report

Description of Lea**Setting**

Landscape: Plateaus

Landform: Plains

Down-slope shape: Convex

Across-slope shape: Linear

Parent material: Calcareous, loamy eolian deposits from the blackwater draw formation of pleistocene age over indurated caliche of pliocene age

Typical profile

A - 0 to 10 inches: loam

Bk - 10 to 18 inches: loam

Bkk - 18 to 26 inches: gravelly fine sandy loam

Bkkm - 26 to 80 inches: cemented material

Properties and qualities

Slope: 0 to 3 percent

Depth to restrictive feature: 22 to 30 inches to petrocalcic

Drainage class: Well drained

Runoff class: High

Capacity of the most limiting layer to transmit water (Ksat): Very low to moderately low (0.00 to 0.06 in/hr)

Depth to water table: More than 80 inches

Frequency of flooding: None

Frequency of ponding: None

Calcium carbonate, maximum content: 90 percent

Maximum salinity: Nonsaline to very slightly saline (0.0 to 2.0 mmhos/cm)

Sodium adsorption ratio, maximum: 3.0

Available water supply, 0 to 60 inches: Very low (about 2.9 inches)

Interpretive groups

Land capability classification (irrigated): None specified

Land capability classification (nonirrigated): 7s

Hydrologic Soil Group: D

Ecological site: R077DY047TX - Sandy Loam 12-17" PZ

Hydric soil rating: No

Minor Components**Douro**

Percent of map unit: 12 percent

Landscape: Plateaus

Landform: Plains

Down-slope shape: Linear

Across-slope shape: Linear

Ecological site: R077DY047TX - Sandy Loam 12-17" PZ

Other vegetative classification: Unnamed (G077DH000TX)

Hydric soil rating: No

Kenhill

Percent of map unit: 12 percent

Landscape: Plateaus

Landform: Plains

Down-slope shape: Linear

Across-slope shape: Linear

Custom Soil Resource Report

Ecological site: R077DY038TX - Clay Loam 12-17" PZ

Hydric soil rating: No

Spraberry

Percent of map unit: 6 percent

Landscape: Plateaus

Landform: Plains, Playa rims

Down-slope shape: Linear, convex

Across-slope shape: Linear

Ecological site: R077DY049TX - Very Shallow 12-17" PZ

Other vegetative classification: Unnamed (G077DH000TX)

Hydric soil rating: No

PG—Lovington-Delphos fine sandy loams, 0 to 3 percent slopes**Map Unit Setting**

National map unit symbol: 308qm

Landscape: High plains

Elevation: 2,500 to 4,800 feet

Mean annual precipitation: 14 to 16 inches

Mean annual air temperature: 57 to 63 degrees F

Frost-free period: 180 to 220 days

Farmland classification: Farmland of statewide importance

Map Unit Composition

Lovington and similar soils: 45 percent

Delphos and similar soils: 40 percent

Minor components: 15 percent

Estimates are based on observations, descriptions, and transects of the mapunit.

Description of Lovington**Setting**

Landscape: High plains

Landform: Playa steps, Playa floors

Down-slope shape: Convex, concave

Across-slope shape: Linear, concave

Parent material: Calcareous loamy lacustrine deposits of quaternary age

Typical profile

A - 0 to 10 inches: fine sandy loam

Bw - 10 to 19 inches: clay loam

Bk1 - 19 to 60 inches: sandy clay loam

2Bk2 - 60 to 80 inches: fine sandy loam

Properties and qualities

Slope: 0 to 3 percent

Depth to restrictive feature: More than 80 inches

Drainage class: Well drained

Runoff class: Negligible

Custom Soil Resource Report

Capacity of the most limiting layer to transmit water (Ksat): Moderately high (0.20 to 0.60 in/hr)
Depth to water table: More than 80 inches
Frequency of flooding: None
Frequency of ponding: None
Calcium carbonate, maximum content: 60 percent
Maximum salinity: Nonsaline to very slightly saline (0.0 to 2.0 mmhos/cm)
Sodium adsorption ratio, maximum: 1.5
Available water supply, 0 to 60 inches: High (about 10.2 inches)

Interpretive groups

Land capability classification (irrigated): 2s
Land capability classification (nonirrigated): 2s
Hydrologic Soil Group: B
Ecological site: R077DY041TX - Lakebed 12-17" PZ
Hydric soil rating: No

Description of Delphos**Setting**

Landscape: High plains
Landform: Plains, Playa steps
Landform position (two-dimensional): Backslope, footslope
Down-slope shape: Linear, concave
Across-slope shape: Linear
Parent material: Calcareous loamy eolian deposits from the blackwater draw formation of pleistocene age

Typical profile

A - 0 to 6 inches: fine sandy loam
Bw - 6 to 12 inches: loamy fine sand
2Bk1 - 12 to 29 inches: sandy clay loam
2Bk2 - 29 to 61 inches: fine sandy loam
3Btk - 61 to 80 inches: fine sandy loam

Properties and qualities

Slope: 0 to 3 percent
Depth to restrictive feature: More than 80 inches
Drainage class: Well drained
Runoff class: Low
Capacity of the most limiting layer to transmit water (Ksat): Moderately high to high (0.57 to 1.98 in/hr)
Depth to water table: More than 80 inches
Frequency of flooding: None
Frequency of ponding: None
Calcium carbonate, maximum content: 40 percent
Maximum salinity: Nonsaline to very slightly saline (0.0 to 2.0 mmhos/cm)
Sodium adsorption ratio, maximum: 2.0
Available water supply, 0 to 60 inches: Moderate (about 8.4 inches)

Interpretive groups

Land capability classification (irrigated): 3e
Land capability classification (nonirrigated): 6e
Hydrologic Soil Group: B
Ecological site: R077DY046TX - Sandy 12-17" PZ
Hydric soil rating: No

Custom Soil Resource Report

Minor Components**Amarose**

Percent of map unit: 7 percent
Landscape: High plains
Landform: Plains, Playa slopes
Landform position (two-dimensional): Backslope, footslope
Down-slope shape: Linear, concave
Across-slope shape: Linear
Ecological site: R077DY047TX - Sandy Loam 12-17" PZ
Hydric soil rating: No

Lea

Percent of map unit: 5 percent
Landscape: High plains
Landform: Playa slopes, Plains
Landform position (two-dimensional): Backslope, footslope
Down-slope shape: Concave, linear, convex
Across-slope shape: Linear
Ecological site: R077DY047TX - Sandy Loam 12-17" PZ
Hydric soil rating: No

Douro

Percent of map unit: 3 percent
Landscape: High plains
Landform: Playa slopes, Plains
Landform position (two-dimensional): Backslope, footslope
Down-slope shape: Concave, linear
Across-slope shape: Linear
Ecological site: R077DY046TX - Sandy 12-17" PZ
Hydric soil rating: No

References

- American Association of State Highway and Transportation Officials (AASHTO). 2004. Standard specifications for transportation materials and methods of sampling and testing. 24th edition.
- American Society for Testing and Materials (ASTM). 2005. Standard classification of soils for engineering purposes. ASTM Standard D2487-00.
- Cowardin, L.M., V. Carter, F.C. Golet, and E.T. LaRoe. 1979. Classification of wetlands and deep-water habitats of the United States. U.S. Fish and Wildlife Service FWS/OBS-79/31.
- Federal Register. July 13, 1994. Changes in hydric soils of the United States.
- Federal Register. September 18, 2002. Hydric soils of the United States.
- Hurt, G.W., and L.M. Vasilas, editors. Version 6.0, 2006. Field indicators of hydric soils in the United States.
- National Research Council. 1995. Wetlands: Characteristics and boundaries.
- Soil Survey Division Staff. 1993. Soil survey manual. Soil Conservation Service. U.S. Department of Agriculture Handbook 18. http://www.nrcs.usda.gov/wps/portal/nrcs/detail/national/soils/?cid=nrcs142p2_054262
- Soil Survey Staff. 1999. Soil taxonomy: A basic system of soil classification for making and interpreting soil surveys. 2nd edition. Natural Resources Conservation Service, U.S. Department of Agriculture Handbook 436. http://www.nrcs.usda.gov/wps/portal/nrcs/detail/national/soils/?cid=nrcs142p2_053577
- Soil Survey Staff. 2010. Keys to soil taxonomy. 11th edition. U.S. Department of Agriculture, Natural Resources Conservation Service. http://www.nrcs.usda.gov/wps/portal/nrcs/detail/national/soils/?cid=nrcs142p2_053580
- Tiner, R.W., Jr. 1985. Wetlands of Delaware. U.S. Fish and Wildlife Service and Delaware Department of Natural Resources and Environmental Control, Wetlands Section.
- United States Army Corps of Engineers, Environmental Laboratory. 1987. Corps of Engineers wetlands delineation manual. Waterways Experiment Station Technical Report Y-87-1.
- United States Department of Agriculture, Natural Resources Conservation Service. National forestry manual. http://www.nrcs.usda.gov/wps/portal/nrcs/detail/soils/home/?cid=nrcs142p2_053374
- United States Department of Agriculture, Natural Resources Conservation Service. National range and pasture handbook. <http://www.nrcs.usda.gov/wps/portal/nrcs/detail/national/landuse/rangepasture/?cid=stelprdb1043084>

Custom Soil Resource Report

United States Department of Agriculture, Natural Resources Conservation Service. National soil survey handbook, title 430-VI. http://www.nrcs.usda.gov/wps/portal/nrcs/detail/soils/scientists/?cid=nrcs142p2_054242

United States Department of Agriculture, Natural Resources Conservation Service. 2006. Land resource regions and major land resource areas of the United States, the Caribbean, and the Pacific Basin. U.S. Department of Agriculture Handbook 296. http://www.nrcs.usda.gov/wps/portal/nrcs/detail/national/soils/?cid=nrcs142p2_053624

United States Department of Agriculture, Soil Conservation Service. 1961. Land capability classification. U.S. Department of Agriculture Handbook 210. http://www.nrcs.usda.gov/Internet/FSE_DOCUMENTS/nrcs142p2_052290.pdf

Appendix F Lab Results Originals



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 01, 2026

JUSTIN ROBERTS

DIAMONDBACK DISPOSAL SERVICE INC.

P. O. BOX 2491

HOBBS, NM 88241

RE: HOBBS WATER STATION

Enclosed are the results of analyses for samples received by the laboratory on 05/29/26 16:45.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' at the beginning.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 1 @ 1' (H263068-01)

BTX 8021B			mg/kg		Analyzed By: JH				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47	QR-03
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05	
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61	
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39	
Total BTX	<0.300	0.300	05/29/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 94.9 % 70.4-141

Chloride, SM4500Cl-B			mg/kg		Analyzed By: ED				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64	

TPH 8015M			mg/kg		Analyzed By: JF				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	31.3	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	36.6	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 91.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 82.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 2 @ 1' (H263068-02)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.5 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	61.6	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	71.4	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 88.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 3 @ 1' (H263068-03)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	40.8	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	54.3	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 89.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 4 @ 6" (H263068-04)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.5 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	30.7	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	46.7	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 93.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 85.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 5 @ 6" (H263068-05)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	40.9	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	51.1	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 90.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 6 @ 6" (H263068-06)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	39.7	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	52.0	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 93.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 85.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 7 @ 6" (H263068-07)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	51.4	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	62.8	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 94.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 86.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 8 @ 6" (H263068-08)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	223	111	200	2.04	
DRO >C10-C28*	59.1	10.0	05/30/2026	ND	226	113	200	3.10	
EXT DRO >C28-C36	71.6	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 87.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 9 @ 1' (H263068-09)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	16.8	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	<10.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 74.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 65.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 10 @ 1' (H263068-10)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.5 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	48.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	24.3	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	24.5	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 76.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 67.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 11 @ 1' (H263068-11)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	18.1	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	18.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 75.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 66.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 12 @ 1' (H263068-12)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	19.8	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	18.8	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 75.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 67.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 13 @ 1' (H263068-13)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	43.8	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	38.1	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 73.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 67.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 14 @ 1' (H263068-14)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	46.6	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	44.8	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 77.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 69.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 15 @ 1' (H263068-15)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/29/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	38.9	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	35.8	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 75.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 68.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 16 @ 6" (H263068-16)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/30/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/30/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/30/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/30/2026	ND	5.82	97.0	6.00	6.39		
Total BTEx	<0.300	0.300	05/30/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.8 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 70.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 68.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 17 @ 6" (H263068-17)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/30/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/30/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/30/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/30/2026	ND	5.82	97.0	6.00	6.39		
Total BTEX	<0.300	0.300	05/30/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	<10.0	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	<10.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 74.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 65.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 18 @ 6" (H263068-18)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/30/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/30/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/30/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/30/2026	ND	5.82	97.0	6.00	6.39		
Total BTEx	<0.300	0.300	05/30/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	29.0	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	23.2	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 76.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 67.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 19 @ 6" (H263068-19)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	05/30/2026	ND	2.19	110	2.00	4.47	
Toluene*	<0.050	0.050	05/30/2026	ND	1.91	95.3	2.00	4.05	
Ethylbenzene*	<0.050	0.050	05/30/2026	ND	1.92	95.9	2.00	6.61	
Total Xylenes*	<0.150	0.150	05/30/2026	ND	5.82	97.0	6.00	6.39	
Total BTEX	<0.300	0.300	05/30/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 99.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	38.5	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	33.9	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 74.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 66.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 20 @ 6" (H263068-20)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/30/2026	ND	2.19	110	2.00	4.47		
Toluene*	<0.050	0.050	05/30/2026	ND	1.91	95.3	2.00	4.05		
Ethylbenzene*	<0.050	0.050	05/30/2026	ND	1.92	95.9	2.00	6.61		
Total Xylenes*	<0.150	0.150	05/30/2026	ND	5.82	97.0	6.00	6.39		
Total BTX	<0.300	0.300	05/30/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.7 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	11.1	10.0	06/01/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 77.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 71.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 21 @ 6" (H263068-21)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22	
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3	
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5	
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6	
Total BTEX	<0.300	0.300	05/29/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 96.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	16.6	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	<10.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 75.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 66.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 22 @ 6" (H263068-22)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 107 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	49.2	10.0	05/29/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	46.5	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 71.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 66.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 23 @ 6" (H263068-23)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 117 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	14.5	10.0	05/30/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	16.6	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 78.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 68.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 24 @ 6" (H263068-24)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 101 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	45.0	10.0	05/30/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	37.9	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 78.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 70.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 25 @ 6" (H263068-25)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 110 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	43.2	10.0	05/30/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	37.1	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 75.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 66.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 26 @ 6" (H263068-26)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	42.9	10.0	05/30/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	38.3	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 76.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 69.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 27 @ 6" (H263068-27)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22	
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3	
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5	
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6	
Total BTEX	<0.300	0.300	05/29/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 120 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	13.2	10.0	05/30/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	12.9	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 75.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 66.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 28 @ 6" (H263068-28)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 110 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/30/2026	ND	186	93.1	200	0.0107	
DRO >C10-C28*	16.0	10.0	05/30/2026	ND	186	93.1	200	4.59	
EXT DRO >C28-C36	13.3	10.0	05/30/2026	ND					

Surrogate: 1-Chlorooctane 71.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 62.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 29 @ 6" (H263068-29)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 105 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	200	100	200	1.43	
DRO >C10-C28*	<10.0	10.0	05/29/2026	ND	194	97.1	200	1.28	
EXT DRO >C28-C36	<10.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 84.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 74.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 30 @ 6" (H263068-30)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 112 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	200	100	200	1.43	
DRO >C10-C28*	<10.0	10.0	05/29/2026	ND	194	97.1	200	1.28	
EXT DRO >C28-C36	<10.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 82.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 72.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 31 @ 1' (H263068-31)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	48.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	200	100	200	1.43	
DRO >C10-C28*	22.7	10.0	05/29/2026	ND	194	97.1	200	1.28	
EXT DRO >C28-C36	<10.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 83.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 74.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 32 @ 1' (H263068-32)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 106 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	48.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	200	100	200	1.43	
DRO >C10-C28*	53.4	10.0	05/29/2026	ND	194	97.1	200	1.28	
EXT DRO >C28-C36	36.3	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 78.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 73.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 33 @ 1' (H263068-33)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTX	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 107 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	06/01/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	200	100	200	1.43	
DRO >C10-C28*	57.0	10.0	05/29/2026	ND	194	97.1	200	1.28	
EXT DRO >C28-C36	40.6	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 85.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 34 @ 1' (H263068-34)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/29/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/29/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/29/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/29/2026	ND	6.55	109	6.00	13.6		
Total BTEx	<0.300	0.300	05/29/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 127 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	200	100	200	1.43	
DRO >C10-C28*	53.0	10.0	05/29/2026	ND	194	97.1	200	1.28	
EXT DRO >C28-C36	39.1	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 85.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 82.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	05/29/2026	Sampling Date:	05/29/2026
Reported:	06/01/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 35 @ 1' (H263068-35)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	05/30/2026	ND	2.15	108	2.00	3.22		
Toluene*	<0.050	0.050	05/30/2026	ND	1.97	98.6	2.00	11.3		
Ethylbenzene*	<0.050	0.050	05/30/2026	ND	2.17	109	2.00	13.5		
Total Xylenes*	<0.150	0.150	05/30/2026	ND	6.55	109	6.00	13.6		
Total BTEX	<0.300	0.300	05/30/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 111 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/01/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	05/29/2026	ND	200	100	200	1.43	
DRO >C10-C28*	12.9	10.0	05/29/2026	ND	194	97.1	200	1.28	
EXT DRO >C28-C36	<10.0	10.0	05/29/2026	ND					

Surrogate: 1-Chlorooctane 84.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 78.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Notes and Definitions

QR-04	The RPD for the BS/BSD was outside of historical limits.
QR-03	The RPD value for the sample duplicate or MS/MSD was outside of QC acceptance limits due to matrix interference. QC batch accepted based on LCS and/or LCSD recovery and/or RPD values.
BS-3	Blank spike recovery outside of lab established statistical limits, but still within method limits. Data is not adversely affected.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Diamondback Disposal Services		P.O. #:		BILL TO				ANALYSIS REQUEST			
Project Manager: Justin Roberts		Address: 2525 NW County Rd		Company: DIAMONDBACK							
City: Hobbs		State: NM Zip: 88240		Attn: YESENIAL							
Phone #: (575) 392-9996		Fax #:		Address:							
Project #: EWK-108		Project Owner:		City:							
Project Name: HOBBS WATER STATION		State:		Zip:							
Project Location: 32.712832, -103.175452		Phone #:									
Sample Name: JULIO RIVERA		Fax #:									

Lab I.D.	Sample I.D.	(G)RAB OR (C)OMP.	# CONTAINERS	MATRIX						OTHER :	ACID/BASE:	ICE / COOL	OTHER :	DATE	TIME	CL	BTX	EXT TPH	FULL TCLIP	NORM	
				GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	PRESERV.												SAMPLING
421030108	B1 @ 1'	C	1	X										05-29-26	2:00 PM	X	X				
	B2 @ 1'	C	1	X										05-29-26	2:02 PM	X	X				
	B3 @ 1'	C	1	X										05-29-26	2:04 PM	X	X				
	B4 @ 6"	C	1	X										05-29-26	2:06 PM	X	X				
	B5 @ 6"	C	1	X										05-29-26	2:08 PM	X	X				
	B6 @ 6"	C	1	X										05-29-26	2:10 PM	X	X				
	B7 @ 6"	C	1	X										05-29-26	2:20 PM	X	X				
	B8 @ 6"	C	1	X										05-29-26	2:22 PM	X	X				
	B9 @ 1'	C	1	X										05-29-26	2:24 PM	X	X				
	B10 @ 1'	C	1	X										05-29-26	2:28 PM	X	X				

PLEASE NOTE: Liability and Damages: Cardinal's liability and claims are limited to the amount paid by the client for the sample. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruption, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Relinquished By: *Julio Rivera* Date: 05-29-26 Time: 16:45
Received By: *APAC*

Delivered By: (Circle One) ☒ UPS - ☐ Bus - ☐ Other:
Sampler - ☐ UPS - ☐ Bus - ☐ Other:
Observed Temp. °C: 3.3
Corrected Temp. °C: 3.4
Sample Condition: ☒ Cool ☐ Intact
CHECKED BY: (Initials) *AP*

Turnaround Time: 24 HOURS
Thermometer ID #140
Correction Factor +0.1°C
Standard ☒ Bacteria (only) ☐ Sample Condition ☐ Observed Temp. °C
Cool ☐ Intact ☐ Yes ☐ No ☐ Corrected Temp. °C

Verbal Result: ☐ Yes ☐ No Add'l Phone #: *5040241K*
All Results are emailed. Please provide Email address: *Environmental@Diamondbacknm.com*
REMARKS:

† Cardinal cannot accept verbal changes. Please email changes to *celey.keene@cardinallabsnm.com*



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Diamondback Disposal Services Project Manager: Justin Roberts Address: 2625 NW County Rd. City: Hobbs State: NM Zip: 88240 Phone #: (575)392-9996 Fax #: Project #: EWK-108 Project Owner: Project Name: HOBBS WATER STATION Project Location: 32.712832,-103.175452 Sampler Name: JULIO RIVERA				BILL TO P.O. #: Company: DIAMONDBACK Attn: YESENIA L Address: City: State: Zip: Phone #: Fax #:				ANALYSIS REQUEST			
FOR LAB USE ONLY		Matrix ☐ GROUNDWATER ☐ WASTEWATER ☐ SOIL ☐ OIL ☐ SLUDGE OTHER :		PRESERV. ☐ ACID/BASE: ☐ ICE / COOL OTHER :		SAMPLING DATE TIME		CL BTEX EXT TPH FULL TCLIP NORM			
Lab I.D. 11030008	Sample I.D. B11 @ 1' B12 @ 1' B13 @ 1' B14 @ 1' B15 @ 1' B16 @ 6" B17 @ 6" B18 @ 6" B19 @ 6" B20 @ 6"	(G)RAB OR (C)OMP. # CONTAINERS GROUNDWATER WASTEWATER SOIL OIL SLUDGE OTHER : ACID/BASE: ICE / COOL OTHER : DATE TIME	C 1 C 1 C 1 C 1 C 1 C 1 C 1 C 1 C 1 C 1	X X X X X X X X X X	X X X X X X X X X X	X X X X X X X X X X	X X X X X X X X X X	X X X X X X X X X X	X X X X X X X X X X		
PLEASE NOTE: Liability and Damages. Cardinal's liability and claims are limited to the amount paid by the client for the analyses. All claims including those for negligence and any other claims whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruption, loss of use, or loss of profits incurred by client, its subcontractors, affiliates or successors arising out of or related to the performance of services rendered by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.											
Relinquished By: <i>Julio Rivera</i> Date: 05-29-26 Time: 10:45 Received By: <i>Julio Rivera</i> Date: 05-29-26 Time: 10:45 Received By: <i>Julio Rivera</i>		Verbal Result: ☐ Yes ☐ No ☐ Add'l Phone #: All Results are emailed. Please provide Email address: Environmental@Diamondbacknm.com REMARKS: 24 HOURS Turnaround Time: Standard ☐ Rush ☒ Thermometer ID #140 Correction Factor +0.1°C Bacteria (only) Sample Condition Cool ☐ Intact ☐ Yes ☐ No ☐ Yes ☐ No Observed Temp. °C Corrected Temp. °C									
Delivered By: (Circle One) Sampler - UPS - Bus - Other:		Observed Temp. °C 3.3 Corrected Temp. °C 3.4		Sample Condition Cool ☒ Intact ☐ Yes ☐ No ☐ Yes ☐ No ☐ No		CHECKED BY: (Initials) <i>HR</i>		Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinalabnm.com			



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Diamondback Disposal Services Project Manager: Justin Roberts Address: 2525 NW County Rd City: Hobbs State: NM Zip: 88240 Phone #: [575]392-9996 Fax #: Project #: EWM-108 Project Owner: Project Name: HOBBS WATER STATION Project Location: 32.712832, -103.175452 Sample Name: JULIO RIVERA		P.O. #: Company: DIAMONDBACK Attn: YESENIA L Address: City: State: Phone #: Fax #:	
BILL TO		ANALYSIS REQUEST	
Lab I.D. B21 @ 6" B22 @ 6" B23 @ 6" B24 @ 6" B25 @ 6" B26 @ 6" B27 @ 6" B28 @ 6" B29 @ 6" B30 @ 6"	Sample I.D. (G)RAB OR (C)OMP. # CONTAINERS GROUNDWATER WASTEWATER SOIL OIL SLUDGE OTHER : ACID/BASE: ICE / COOL OTHER : DATE TIME	MATRIX PRESERV. SAMPLING	CL BTEX EXT TPH FULL TCLIP NORM
Relinquished By: <i>[Signature]</i> Date: 05-29-26 Time: 1:45 PM Received By: <i>[Signature]</i> Date: 05-29-26 Time:	Delivered By: (Circle One) Sampler - UPS - Bus - Other: Observed Temp. °C: 3.3 Corrected Temp. °C: 3.4 Sample Condition: Cool ☒ Yes ☐ No Intact ☒ Yes ☐ No CHECKED BY: (Initials) <i>[Signature]</i> Turnaround Time: Standard ☒ Rush ☐ Thermometer ID #140 Correction Factor +0.1°C Bacteria (only) Sample Condition: Cool ☒ Yes ☐ No Intact ☒ Yes ☐ No Observed Temp. °C Corrected Temp. °C	Verbal Result: ☐ Yes ☐ No All Results are emailed. Please provide Email address: Environmental@Diamondbacknm.com REMARKS: 24 HOURS	Add'l Phone #:

FORM-006 R 3.6 02/12/25

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Diamondback Disposal Services Project Manager: Justin Roberts Address: 2525 NW County Rd. City: Hobbs State: NM Zip: 88240 Phone #: (575) 392-9996 Fax #: Project #: EWC-108 Project Name: HOBBS WATER STATION Project Location: 32.712832, -103.175452 Sampler Name: JULIO RIVERA FOR LAB USE ONLY		P.O. #: Company: DIAMONDBACK Attn: YENESIAL Address: City: State: Phone #: Fax #:	
Lab I.D. Sample I.D.		BILL TO	
Matrix: (G)RAB OR (C)OMP. # CONTAINERS GROUNDWATER WASTEWATER SOIL OIL SLUDGE OTHER:		ANALYSIS REQUEST CL BTEX EXT TPH FULL TCLIP NORM	
DATE 05-29-26 TIME 3:30 PM 3:32 PM 3:34 PM 3:36 PM 05-29-26 3:40 PM		SAMPLING X X X X X X	
Verbal Result: ☐ Yes ☐ No ☐ Add'l Phone #: Environmental@Diamondbacknm.com REMARKS: 24 HOURS Turnaround Time: Thermometer ID #140 Correction Factor +0.1°C		Standard ☐ Bacteria (only) ☐ Cool Intact ☐ ☐ Observed Temp. °C Corrected Temp. °C	



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 02, 2026

JUSTIN ROBERTS

DIAMONDBACK DISPOSAL SERVICE INC.

P. O. BOX 2491

HOBBS, NM 88241

RE: HOBBS WATER STATION

Enclosed are the results of analyses for samples received by the laboratory on 06/01/26 14:56.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' at the beginning.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B2 @ 9" (H263087-01)

BTX 8021B			mg/kg		Analyzed By: JH				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84	
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76	
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21	
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84	
Total BTX	<0.300	0.300	06/01/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 122 % 70.4-141

Chloride, SM4500Cl-B			mg/kg		Analyzed By: AC				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M			mg/kg		Analyzed By: JF				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 88.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 86.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B7 @ 9" (H263087-02)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84	
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76	
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21	
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84	
Total BTEX	<0.300	0.300	06/01/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 126 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 86.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 83.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B8 @ 9" (H263087-03)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84		
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 133 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 78.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene", is written over a horizontal line.

Celey D. Keene, Lab Director/Quality Manager



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

[illegible]



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 02, 2026

JUSTIN ROBERTS

DIAMONDBACK DISPOSAL SERVICE INC.

P. O. BOX 2491

HOBBS, NM 88241

RE: HOBBS WATER STATION

Enclosed are the results of analyses for samples received by the laboratory on 06/01/26 14:56.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is fluid and cursive, with the first name "Celey" and last name "Keene" clearly distinguishable.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 36 @ 1' (H263088-01)

BTX 8021B			mg/kg		Analyzed By: JH				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84	
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76	
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21	
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84	
Total BTX	<0.300	0.300	06/01/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 122 % 70.4-141

Chloride, SM4500Cl-B			mg/kg		Analyzed By: AC				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M			mg/kg		Analyzed By: JF				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 82.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 37 @ 1' (H263088-02)

BTEx 8021B			mg/kg		Analyzed By: JH				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84	
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76	
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21	
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84	
Total BTEX	<0.300	0.300	06/01/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 128 % 70.4-141

Chloride, SM4500Cl-B			mg/kg		Analyzed By: AC				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M			mg/kg		Analyzed By: JF				
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 82.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 38 @ 1' (H263088-03)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84		
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 141 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 73.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 70.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 39 @ 1' (H263088-04)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84		
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84		
Total BTX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 139 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 86.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 84.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 40 @ 1' (H263088-05)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.17	109	2.00	1.84		
Toluene*	<0.050	0.050	06/01/2026	ND	2.15	107	2.00	3.76		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.39	119	2.00	5.21		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	7.19	120	6.00	5.84		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 130 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 83.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 84.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 41 @ 1' (H263088-06)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.17	109	2.00	1.84		
Toluene*	<0.050	0.050	06/02/2026	ND	2.15	107	2.00	3.76		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	2.39	119	2.00	5.21		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	7.19	120	6.00	5.84		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 125 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 71.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 69.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 42 @ 1' (H263088-07)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.17	109	2.00	1.84		
Toluene*	<0.050	0.050	06/02/2026	ND	2.15	107	2.00	3.76		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	2.39	119	2.00	5.21		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	7.19	120	6.00	5.84		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 137 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 85.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 83.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 43 @ 1' (H263088-08)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.17	109	2.00	1.84		
Toluene*	<0.050	0.050	06/02/2026	ND	2.15	107	2.00	3.76		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	2.39	119	2.00	5.21		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	7.19	120	6.00	5.84		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 126 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 67.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 65.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 44 @ 1' (H263088-09)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 87.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 86.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 45 @ 1' (H263088-10)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.4 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 72.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 70.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 46 @ 1' (H263088-11)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/01/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/01/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/01/2026	ND					

Surrogate: 1-Chlorooctane 80.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 79.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 47 @ 6" (H263088-12)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 73.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 73.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 48 @ 6" (H263088-13)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEx	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.1 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 79.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 78.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 49 @ 6" (H263088-14)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.0 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	167	83.5	200	5.12	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	162	81.2	200	8.68	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 75.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 50 @ 6" (H263088-15)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 71.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 70.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 51 @ 6" (H263088-16)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 52 @ 6" (H263088-17)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 70.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 69.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 53 @ 6" (H263088-18)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 70.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 68.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 54 @ 6" (H263088-19)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 55 @ 6" (H263088-20)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 56 @ 6" (H263088-21)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 57 @ 6" (H263088-22)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 76.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 58 @ 6" (H263088-23)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 75.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 74.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 59 @ 6" (H263088-24)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 74.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 72.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 60 @ 6" (H263088-25)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 61 @ 6" (H263088-26)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/01/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 62 @ 6" (H263088-27)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/02/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 78.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 77.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 63 @ 6" (H263088-28)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.24	112	2.00	4.26		
Toluene*	<0.050	0.050	06/02/2026	ND	2.16	108	2.00	4.92		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	5.38		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	6.13	102	6.00	5.71		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 76.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 64 @ 6" (H263088-29)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 86.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	64.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 65 @ 6" (H263088-30)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 86.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 76.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 74.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 66 @ 6" (H263088-31)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 84.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 67 @ 6" (H263088-32)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 86.8 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 74.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 72.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 68 @ 6" (H263088-33)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 85.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 84.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 85.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 69 @ 6" (H263088-34)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 86.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	193	96.4	200	0.375	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	187	93.6	200	1.67	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 85.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 84.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 70 @ 6" (H263088-35)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 84.0 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 83.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 78.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 71 @ 6" (H263088-36)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 78.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 88.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 85.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 72 @ 6" (H263088-37)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 84.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 86.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 82.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 73 @ 6" (H263088-38)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988	
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82	
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69	
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65	
Total BTEX	<0.300	0.300	06/02/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 87.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 83.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 74 @ 6" (H263088-39)

BTEX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988	
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82	
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69	
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65	
Total BTEX	<0.300	0.300	06/02/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 87.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 83.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 75 @ 6" (H263088-40)

BTEX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988	
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82	
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69	
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65	
Total BTEX	<0.300	0.300	06/02/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 87.5 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	64.0	16.0	06/02/2026	ND	448	112	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 84.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 79.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 76 @ 6" (H263088-41)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 86.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 86.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 77 @ 6" (H263088-42)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 86.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 82.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 78.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 78 @ 6" (H263088-43)

BTEX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988	
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82	
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69	
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65	
Total BTEX	<0.300	0.300	06/02/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 87.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 77.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 74.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 79 @ 6" (H263088-44)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 85.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 79.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 80 @ 6" (H263088-45)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988	
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82	
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69	
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65	
Total BTEx	<0.300	0.300	06/02/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 86.2 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 83.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 78.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 81 @ 6" (H263088-46)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988	
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82	
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69	
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65	
Total BTX	<0.300	0.300	06/02/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 85.2 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 78.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 73.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: B 82 @ 6" (H263088-47)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988		
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82		
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69		
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65		
Total BTEX	<0.300	0.300	06/02/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 85.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 78.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 73.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

BS-3	Blank spike recovery outside of lab established statistical limits, but still within method limits. Data is not adversely affected.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "C. D. Keene", is written over a horizontal line.


Celey D. Keene, Lab Director/Quality Manager



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Diamondback Disposal Services										BILL TO										ANALYSIS REQUEST									
Project Manager: Justin Roberts										P.O. #:																			
Address: 2525 NW County Rd										Company: DIAMONDBACK																			
City: Hobbs										Attn: YESENIAL																			
Phone #: [575]392-9996										Address:																			
Project #: EWK-108										City:																			
Project Name: HOBBS WATER STATION										State:																			
Project Location: 32.712832,-103.175452										Phone #:																			
Sample Name: JULIO RIVERA										Fax #:																			
FOR LAB USE ONLY																													
Lab I.D. Sample I.D.																													
1400305																													
B37 @ 1'										C 1										X									
B38 @ 1'										C 1										X									
B39 @ 1'										C 1										X									
B40 @ 1'										C 1										X									
B41 @ 1'										C 1										X									
B42 @ 1'										C 1										X									
B43 @ 1'										C 1										X									
B44 @ 1'										C 1										X									
B45 @ 1'										C 1										X									
10																													
PLEASE NOTE: Liability and Damages. Customer's liability and damage is limited to the amount paid by the client for the analysis. All claims including those for negligence and any other claims shall be made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruption, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services furnished by Cardinal, regardless of whether such claims are based upon any of the above stated reasons or otherwise.																													
Relinquished By: [Signature]										Date: 6-1-26																			
Relinquished By: [Signature]										Time: 1450																			
Date: 6-1-26																													
Time: 1450																													
Received By: [Signature]																													
Received By: [Signature]																													
Date: 6-1-26																													
Time: 1450																													
Sample Condition																													
Cool Intact																													
Yes No																													
No No																													
CHECKED BY: (Initials)																													
Turnaround Time: 24 HOUR RUSH																													
Thermometer I.D. #140																													
Correction Factor +0.1°C																													
Standard Rush																													
Bacteria (only) Sample Condition																													
Cool Intact																													
Yes No																													
No No																													
Corrected Temp. °C																													

**BILL TO**

Lab I.D.	Sample I.D.
----------	-------------

[illegible]

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com




101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

BILL TO										ANALYSIS REQUEST																													
Company Name: Diamondback Disposal Services					P.O. #:																																		
Project Manager: Justin Roberts					Company: DIAMONDBACK																																		
Address: 2525 NW County Rd.					Attn: YESENIAL																																		
City: Hobbs					State: NM Zip: 88240																																		
Phone #: (575)392-9996					Fax #:																																		
Project #: EWK-108					Project Owner:																																		
Project Name: HOBBS WATER STATION					State: Zip:																																		
Project Location: 32.712832,-103.175452					Phone #:																																		
Sampler Name: JULIO RIVERA					Fax #:																																		
FOR LAB USE ONLY																																							
Lab I.D.		Sample I.D.		(G)RAB OR (C)OMP.		# CONTAINERS		GROUNDWATER		WASTEWATER		SOIL		OIL		SLUDGE		OTHER :		ACID/BASE:		ICE / COOL		OTHER :		DATE		TIME											
B56 @ 6"		B57 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		11:30 AM											
B57 @ 6"		B58 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		11:32 AM											
B58 @ 6"		B59 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		11:34 AM											
B59 @ 6"		B60 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		11:36 AM											
B60 @ 6"		B61 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		1:00 PM											
B61 @ 6"		B62 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		1:05 PM											
B62 @ 6"		B63 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		1:10 PM											
B63 @ 6"		B64 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		1:15 PM											
B64 @ 6"		B65 @ 6"		C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		1:20 PM											
B65 @ 6"				C 1		1		X		X		X		X		X		X		X		X		X		06-01-26		1:25 PM											
PLEASE NOTE: Liability and Damages. Cardinal's liability and damage remedy for any claim arising from this contract or work, shall be limited to the amount paid by the client for the analysis. All claims, including those for negligence and any other causes whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.																																							
Relinquished By: <i>Julio Rivera</i>										Received By: <i>Julio Rivera</i>										Verbal Result: ☐ Yes ☐ No ☐ Add'l Phone #:																			
Date: 6-1-26										Time: 1:45										All Results are emailed. Please provide Email address: Environmental@Diamondbacknm.com																			
Relinquished By: <i>Julio Rivera</i>										Received By: <i>Julio Rivera</i>										REMARKS: 24 HOUR RUSH																			
Date:										Time:																													
Delivered By: (Circle One)										Observed Temp. °C: 40.0										Sample Condition: ☒ Cool ☐ Intact ☐ Yes ☐ No										CHECKED BY: (Initials) <i>AR</i>									
Sampler - UPS - Bus - Other:										Corrected Temp. °C: -0.5										Cool ☐ Intact ☐ Yes ☐ No																			

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com

Company Name:	Diamondback Disposal Services
---------------	-------------------------------

BILL TO

ANALYSIS REQUEST

[illegible]



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 02, 2026

JUSTIN ROBERTS

DIAMONDBACK DISPOSAL SERVICE INC.

P. O. BOX 2491

HOBBS, NM 88241

RE: HOBBS WATER STATION

Enclosed are the results of analyses for samples received by the laboratory on 06/01/26 14:56.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' and 'K'.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: W1 @ 0-1' (H263089-01)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/02/2026	ND	2.10	105	2.00	0.988	
Toluene*	<0.050	0.050	06/02/2026	ND	1.99	99.7	2.00	1.82	
Ethylbenzene*	<0.050	0.050	06/02/2026	ND	1.95	97.4	2.00	1.69	
Total Xylenes*	<0.150	0.150	06/02/2026	ND	5.90	98.4	6.00	1.65	
Total BTX	<0.300	0.300	06/02/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 84.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 81.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 78.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: W2 @ 0-1' (H263089-02)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.23	112	2.00	3.57		
Toluene*	<0.050	0.050	06/01/2026	ND	2.06	103	2.00	4.87		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.18	109	2.00	4.76		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.42	107	6.00	4.97		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 107 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 81.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 76.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: W3 @ 0-1' (H263089-03)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.23	112	2.00	3.57		
Toluene*	<0.050	0.050	06/01/2026	ND	2.06	103	2.00	4.87		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.18	109	2.00	4.76		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.42	107	6.00	4.97		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 105 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 84.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: W4 @ 0-1' (H263089-04)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.23	112	2.00	3.57		
Toluene*	<0.050	0.050	06/01/2026	ND	2.06	103	2.00	4.87		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.18	109	2.00	4.76		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.42	107	6.00	4.97		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 108 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 82.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 77.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: W5 @ 0-1' (H263089-05)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/01/2026	ND	2.23	112	2.00	3.57	
Toluene*	<0.050	0.050	06/01/2026	ND	2.06	103	2.00	4.87	
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.18	109	2.00	4.76	
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.42	107	6.00	4.97	
Total BTX	<0.300	0.300	06/01/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 106 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: HM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/02/2026	ND	448	112	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 85.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/02/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: W6 @ 0-1' (H263089-06)

BTEx 8021B			mg/kg							
			Analyzed By: JH							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/01/2026	ND	2.23	112	2.00	3.57		
Toluene*	<0.050	0.050	06/01/2026	ND	2.06	103	2.00	4.87		
Ethylbenzene*	<0.050	0.050	06/01/2026	ND	2.18	109	2.00	4.76		
Total Xylenes*	<0.150	0.150	06/01/2026	ND	6.42	107	6.00	4.97		
Total BTEX	<0.300	0.300	06/01/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 106 % 70.4-141

Chloride, SM4500Cl-B			mg/kg							
			Analyzed By: HM							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	06/02/2026	ND	448	112	400	3.64		

TPH 8015M			mg/kg							
			Analyzed By: JF							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	186	93.1	200	3.02		
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	192	96.0	200	4.34		
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND						

Surrogate: 1-Chlorooctane 82.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

BS-3	Blank spike recovery outside of lab established statistical limits, but still within method limits. Data is not adversely affected.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Diamondback Disposal Services

Project Manager: Justin Roberts

Address: 2525 NW County Rd

City: Hobbs

Phone #: [575]392-9996

Project #: EWK-108

Project Name: HOBBS WATER STATION

Project Location: 32.712832, -103.175452

Sampler Name: JULIO RIVERA

P.O. #:

Company: DIAMONDBACK

Attn: YESENIA L

Address:

City:

State:

Zip:

Phone #:

Fax #:

State: NM

Zip: 88240

State:

Zip:

Phone #:

Fax #:

FOR LAB USE ONLY

Lab I.D.	Sample I.D.	(G)RAB OR (C)OMP.	# CONTAINERS	MATRIX					OTHER :	ACID/BASE:	ICE / COOL	OTHER :	DATE	TIME	ANALYSIS REQUEST						
				GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE							CL	BTEX	EXT TPH	FULL TCLIP	NORM		
119103009	W1 @ 0-1'	C	1	X									06-01-26	10:30 AM	X	X	X				
	W2 @ 0-1'	C	1	X									06-01-26	10:32 AM	X	X	X				
	W3 @ 0-1'	C	1	X									06-01-26	10:34 AM	X	X	X				
	W4 @ 0-1'	C	1	X									06-01-26	10:36 AM	X	X	X				
	W5 @ 0-1'	C	1	X									06-01-26	10:38 AM	X	X	X				
	W6 @ 0-1'	C	1	X									06-01-26	10:40 AM	X	X	X				

PLEASE NOTE: Liability and Damages. Cardinal's liability and clients' exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analysis. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal. Cardinal's liability shall be limited to the amount paid by the client for the analysis.

Relinquished By: [Signature] **Date:** 11-1-20 **Received By:** [Signature] **Date:** 11-1-20

Relinquished By: [Signature] **Date:** 11-1-20 **Received By:** [Signature] **Date:** 11-1-20

Delivered By: (Circle One) **Observed Temp. °C** -0.6 **Sample Condition** ☒ Cool ☐ Intact ☐ Yes ☒ No ☐ Yes

Sampler - UPS - Bus - Other: **Corrected Temp. °C** -0.5 **Checked By:** [Signature] **Initials** [Signature]

REMARKS: 24 HOUR RUSH

Verbal Result: ☐ Yes ☒ No **Add'l Phone #:** 0402401K

All Results are emailed. Please provide Email address: Environmental@Diamondbacknm.com

Standard ☒ **Bacteria (only)** ☐ **Sample Condition** ☐ Cool ☐ Intact ☐ Yes ☒ No ☐ Yes **Observed Temp. °C** **Corrected Temp. °C**



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 05, 2026

JUSTIN ROBERTS

DIAMONDBACK DISPOSAL SERVICE INC.

P. O. BOX 2491

HOBBS, NM 88241

RE: HOBBS WATER STATION

Enclosed are the results of analyses for samples received by the laboratory on 06/01/26 14:56.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Mike Snyder". The signature is fluid and cursive, with the first name "Mike" and last name "Snyder" clearly distinguishable.

Mike Snyder For Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/05/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: H1 @ SURFACE (H263090-01)

BTX 8021B		mg/kg		Analyzed By: SK					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/04/2026	ND	2.07	103	2.00	1.88	
Toluene*	<0.050	0.050	06/04/2026	ND	2.16	108	2.00	1.79	
Ethylbenzene*	<0.050	0.050	06/04/2026	ND	2.14	107	2.00	0.194	
Total Xylenes*	<0.150	0.150	06/04/2026	ND	6.51	109	6.00	0.699	
Total BTX	<0.300	0.300	06/04/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 108 % 61.5-142

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	06/03/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	199	99.6	200	1.92	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	213	107	200	1.64	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 82.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 77.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/05/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: H2 @ SURFACE (H263090-02)

BTX 8021B		mg/kg		Analyzed By: SK						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	06/04/2026	ND	2.07	103	2.00	1.88		
Toluene*	<0.050	0.050	06/04/2026	ND	2.16	108	2.00	1.79		
Ethylbenzene*	<0.050	0.050	06/04/2026	ND	2.14	107	2.00	0.194		
Total Xylenes*	<0.150	0.150	06/04/2026	ND	6.51	109	6.00	0.699		
Total BTX	<0.300	0.300	06/04/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 108 % 61.5-142

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/03/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	199	99.6	200	1.92	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	213	107	200	1.64	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 90.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 84.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/05/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: H3 @ SURFACE (H263090-03)

BTX 8021B		mg/kg		Analyzed By: SK					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/04/2026	ND	2.07	103	2.00	1.88	
Toluene*	<0.050	0.050	06/04/2026	ND	2.16	108	2.00	1.79	
Ethylbenzene*	<0.050	0.050	06/04/2026	ND	2.14	107	2.00	0.194	
Total Xylenes*	<0.150	0.150	06/04/2026	ND	6.51	109	6.00	0.699	
Total BTX	<0.300	0.300	06/04/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 99.6 % 61.5-142

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/03/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	199	99.6	200	1.92	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	213	107	200	1.64	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 94.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 87.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/05/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: H4 @ SURFACE (H263090-04)

BTX 8021B		mg/kg		Analyzed By: SK					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/04/2026	ND	2.07	103	2.00	1.88	
Toluene*	<0.050	0.050	06/04/2026	ND	2.16	108	2.00	1.79	
Ethylbenzene*	<0.050	0.050	06/04/2026	ND	2.14	107	2.00	0.194	
Total Xylenes*	<0.150	0.150	06/04/2026	ND	6.51	109	6.00	0.699	
Total BTX	<0.300	0.300	06/04/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 101 % 61.5-142

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	06/03/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	199	99.6	200	1.92	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	213	107	200	1.64	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 73.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 70.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Mike Snyder", is written over a horizontal line.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Diamondback Disposal Services Project Manager: Justin Roberts Address: 2525 NW County Rd. City: Hobbs Phone #: [575]392-9996 Project #: EWK-108 Project Name: HOBBS WATER STATION Project Location: 32.712832, -103.175452 Sample Name: JULIO RIVERA FOR LAB USE ONLY				P.O. #: Company: DIAMONDBACK Attn: YESENIAL Address: City: State: Phone #: Zip: Fax #:				BILL TO				ANALYSIS REQUEST																																																																																																																																																																																																																			
Lab I.D. Sample I.D.												<table border="1" style="width:100%; border-collapse: collapse;"> <tr> <th rowspan="2">Lab I.D.</th> <th rowspan="2">Sample I.D.</th> <th rowspan="2">(G)RAB OR (C)OMP.</th> <th rowspan="2"># CONTAINERS</th> <th colspan="5">MATRIX</th> <th rowspan="2">OTHER :</th> <th rowspan="2">ACID/BASE:</th> <th rowspan="2">ICE / COOL</th> <th rowspan="2">OTHER :</th> <th rowspan="2">DATE</th> <th rowspan="2">TIME</th> <th rowspan="2"></th> <th rowspan="2"></th> <th rowspan="2"></th> <th rowspan="2"></th> <th rowspan="2"></th> <th rowspan="2"></th> <th rowspan="2"></th> <th rowspan="2"></th> </tr> <tr> <th>GROUNDWATER</th> <th>WASTEWATER</th> <th>SOIL</th> <th>OIL</th> <th>SLUDGE</th> </tr> </table>												Lab I.D.	Sample I.D.	(G)RAB OR (C)OMP.	# CONTAINERS	MATRIX					OTHER :	ACID/BASE:	ICE / COOL	OTHER :	DATE	TIME									GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE																																																																																																																																																																												
Lab I.D.	Sample I.D.	(G)RAB OR (C)OMP.	# CONTAINERS	MATRIX					OTHER :	ACID/BASE:	ICE / COOL	OTHER :	DATE	TIME																																																																																																																																																																																																																	
				GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE																																																																																																																																																																																																																							
<table border="1" style="width:100%; border-collapse: collapse;"> <tr> <td>H4 @ SURFACE</td> <td>C</td> <td>1</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>06-01-26</td> <td>10:00 AM</td> <td>X</td> <td>X</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>H2 @ SURFACE</td> <td>C</td> <td>1</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>06-01-26</td> <td>10:02 AM</td> <td>X</td> <td>X</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>H3 @ SURFACE</td> <td>C</td> <td>1</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>06-01-26</td> <td>10:04 AM</td> <td>X</td> <td>X</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>H4 @ SURFACE</td> <td>C</td> <td>1</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>06-01-26</td> <td>10:06 AM</td> <td>X</td> <td>X</td> <td>X</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </table>												H4 @ SURFACE	C	1	X										06-01-26	10:00 AM	X	X	X								H2 @ SURFACE	C	1	X										06-01-26	10:02 AM	X	X	X								H3 @ SURFACE	C	1	X										06-01-26	10:04 AM	X	X	X								H4 @ SURFACE	C	1	X										06-01-26	10:06 AM	X	X	X								<table border="1" style="width:100%; border-collapse: collapse;"> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </table>																																																																																																															
H4 @ SURFACE	C	1	X										06-01-26	10:00 AM	X	X	X																																																																																																																																																																																																														
H2 @ SURFACE	C	1	X										06-01-26	10:02 AM	X	X	X																																																																																																																																																																																																														
H3 @ SURFACE	C	1	X										06-01-26	10:04 AM	X	X	X																																																																																																																																																																																																														
H4 @ SURFACE	C	1	X										06-01-26	10:06 AM	X	X	X																																																																																																																																																																																																														
Relinquished By: <i>[Signature]</i> Date: 6-1-24 Time: 11:30 Received By: <i>[Signature]</i>												Verbal Result: ☐ Yes ☐ No ☐ Add'l Phone #: REMARKS: Environmental@Diamondbacknm.com Turnaround Time: Standard ☒ Rush Bacteria (only) Sample Condition: Cool ☐ Intact ☐ Yes ☐ No ☐ Corrected Temp. °C																																																																																																																																																																																																																			
Delivered By: (Circle One) Sampler - UPS - Bus - Other:												Observed Temp. °C: -0.0 Corrected Temp. °C: -0.5 Sample Condition: Cool ☐ Intact ☒ Yes ☐ No CHECKED BY: <i>[Signature]</i>																																																																																																																																																																																																																			



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 05, 2026

JUSTIN ROBERTS

DIAMONDBACK DISPOSAL SERVICE INC.

P. O. BOX 2491

HOBBS, NM 88241

RE: HOBBS WATER STATION

Enclosed are the results of analyses for samples received by the laboratory on 06/01/26 14:56.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Mike Snyder". The signature is fluid and cursive, with the first name "Mike" and last name "Snyder" clearly distinguishable.

Mike Snyder For Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

DIAMONDBACK DISPOSAL SERVICE INC.
 JUSTIN ROBERTS
 P. O. BOX 2491
 HOBBS NM, 88241
 Fax To: (575) 392-9376

Received:	06/01/2026	Sampling Date:	06/01/2026
Reported:	06/05/2026	Sampling Type:	Soil
Project Name:	HOBBS WATER STATION	Sampling Condition:	Cool & Intact
Project Number:	EWK - 108	Sample Received By:	Alyssa Parras
Project Location:	32.712832-103.175452		

Sample ID: BACKFILL CALICHE (H263091-01)

BTEX 8021B		mg/kg		Analyzed By: SK					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/04/2026	ND	2.07	103	2.00	1.88	
Toluene*	<0.050	0.050	06/04/2026	ND	2.16	108	2.00	1.79	
Ethylbenzene*	<0.050	0.050	06/04/2026	ND	2.14	107	2.00	0.194	
Total Xylenes*	<0.150	0.150	06/04/2026	ND	6.51	109	6.00	0.699	
Total BTEX	<0.300	0.300	06/04/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 101 % 61.5-142

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	06/03/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/02/2026	ND	199	99.6	200	1.92	
DRO >C10-C28*	<10.0	10.0	06/02/2026	ND	213	107	200	1.64	
EXT DRO >C28-C36	<10.0	10.0	06/02/2026	ND					

Surrogate: 1-Chlorooctane 87.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 83.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Mike Snyder", is written over a horizontal line.

Mike Snyder For Celey D. Keene, Lab Director/Quality Manager



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

[illegible]

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 603768

QUESTIONS

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2613655309
Incident Name	NAPP2613655309 HOBBS WATER STATION INJECTION LINE @ FTO1500855040
Incident Type	Produced Water Release
Incident Status	Remediation Closure Report Received
Incident Facility	[FTO1500855040] HOBBS H2O STATION BATTERY

Location of Release Source

Please answer all the questions in this group.

Site Name	Hobbs Water Station Injection Line
Date Release Discovered	05/16/2026
Surface Owner	Private

Incident Details

Please answer all the questions in this group.

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Cause: Equipment Failure Flow Line - Injection Produced Water Released: 395 BBL Recovered: 240 BBL Lost: 155 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Not answered.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 603768

QUESTIONS (continued)

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	Yes
Reasons why this would be considered a submission for a notification of a major release	From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.
With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Gary Crawford Title: Operations Manager Email: randall.crawford@ewllc.com Date: 07/09/2026
--	---

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 603768

QUESTIONS (continued)

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Site Characterization	
<i>Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 26 and 50 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Between 1 and 5 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Between 1000 (ft.) and ½ (mi.)
An occupied permanent residence, school, hospital, institution, or church	Between 1000 (ft.) and ½ (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between 1000 (ft.) and ½ (mi.)
Any other fresh water well or spring	Between 500 and 1000 (ft.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Zero feet, overlying, or within area
A wetland	Between 1000 (ft.) and ½ (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Greater than 5 (mi.)
Categorize the risk of this well / site being in a karst geology	Low
A 100-year floodplain	Between 1 and 5 (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	Yes

Remediation Plan	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
Soil Contamination Sampling: (Provide the highest observable value for each, in milligrams per kilograms.)	
Chloride (EPA 300.0 or SM4500 Cl B)	80
TPH (GRO+DRO+MRO) (EPA SW-846 Method 8015M)	133
GRO+DRO (EPA SW-846 Method 8015M)	61.6
BTEX (EPA SW-846 Method 8021B or 8260B)	0
Benzene (EPA SW-846 Method 8021B or 8260B)	0
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
On what estimated date will the remediation commence	05/28/2026
On what date will (or did) the final sampling or liner inspection occur	06/01/2026
On what date will (or was) the remediation complete(d)	06/01/2026
What is the estimated surface area (in square feet) that will be reclaimed	14458
What is the estimated volume (in cubic yards) that will be reclaimed	400
What is the estimated surface area (in square feet) that will be remediated	14458
What is the estimated volume (in cubic yards) that will be remediated	408
<i>These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.</i>	
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 603768

QUESTIONS (continued)

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Remediation Plan (continued)	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:	
<i>(Select all answers below that apply.)</i>	
(Ex Situ) Excavation and off-site disposal (i.e. dig and haul, hydrovac, etc.)	Yes
Which OCD approved facility will be used for off-site disposal	fEEM0112342028 LEA LAND LANDFILL
OR which OCD approved well (API) will be used for off-site disposal	Not answered.
OR is the off-site disposal site, to be used, out-of-state	Not answered.
OR is the off-site disposal site, to be used, an NMED facility	Not answered.
(Ex Situ) Excavation and on-site remediation (i.e. On-Site Land Farms)	No
(In Situ) Soil Vapor Extraction	No
(In Situ) Chemical processing (i.e. Soil Shredding, Potassium Permanganate, etc.)	No
(In Situ) Biological processing (i.e. Microbes / Fertilizer, etc.)	No
(In Situ) Physical processing (i.e. Soil Washing, Gypsum, Disking, etc.)	No
Ground Water Abatement pursuant to 19.15.30 NMAC	No
OTHER (Non-listed remedial process)	No
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.	
I hereby agree and sign off to the above statement	Name: Gary Crawford Title: Operations Manager Email: randall.crawford@ewllc.com Date: 07/09/2026
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 5

Action 603768

QUESTIONS (continued)

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Deferral Requests Only	
Only answer the questions in this group if seeking a deferral upon approval this submission. Each of the following items must be confirmed as part of any request for deferral of remediation.	
Requesting a deferral of the remediation closure due date with the approval of this submission	No

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 603768

QUESTIONS (continued)

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Sampling Event Information	
Last sampling notification (C-141N) recorded	588793
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	06/02/2026
What was the (estimated) number of samples that were to be gathered	75
What was the sampling surface area in square feet	14000

Remediation Closure Request

Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.

Requesting a remediation closure approval with this submission	Yes
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
All areas reasonably needed for production or subsequent drilling operations have been stabilized, returned to the sites existing grade, and have a soil cover that prevents ponding of water, minimizing dust and erosion	Yes
What was the total surface area (in square feet) remediated	14458
What was the total volume (cubic yards) remediated	400
All areas not reasonably needed for production or subsequent drilling operations have been reclaimed to contain a minimum of four feet of non-waste contain earthen material with concentrations less than 600 mg/kg chlorides, 100 mg/kg TPH, 50 mg/kg BTEX, and 10 mg/kg Benzene	Yes
What was the total surface area (in square feet) reclaimed	14458
What was the total volume (in cubic yards) reclaimed	408
Summarize any additional remediation activities not included by answers (above)	None

The responsible party must attach information demonstrating they have complied with all applicable closure requirements and any conditions or directives of the OCD. This demonstration should be in the form of a comprehensive report (in .pdf format) including a scaled site map, sampling diagrams, relevant field notes, photographs of any excavation prior to backfilling, laboratory data including chain of custody documents of final sampling, and a narrative of the remedial activities. Refer to 19.15.29.12 NMAC.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. The responsible party acknowledges they must substantially restore, reclaim, and re-vegetate the impacted surface area to the conditions that existed prior to the release or their final land use in accordance with 19.15.29.13 NMAC including notification to the OCD when reclamation and re-vegetation are complete.

I hereby agree and sign off to the above statement	Name: Gary Crawford Title: Operations Manager Email: randall.crawford@ewllc.com Date: 07/09/2026
--	---

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 7

Action 603768

QUESTIONS (continued)

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Reclamation Report	
Only answer the questions in this group if all reclamation steps have been completed.	
Requesting a reclamation approval with this submission	No

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 603768

CONDITIONS

Operator: EW Operating (NM), LLC 4000 N. Frontage Rd Suite 20 Fayetteville, AR 72703	OGRID: 333313
	Action Number: 603768
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

CONDITIONS

Created By	Condition	Condition Date
nvez	None	7/30/2026