| R | U.S. Department of the Interior BUREAU OF LAND MANAGEMENT | | Sundry Print Report |
|---|--------------------------------------------------------------|------------------------------------------------------------------------|-------------------------------------------|
| | Well Name: BUENA SUERTE 29 M | Well Location: T26N / R11W / SEC 29 / SWSW / 36.453857 / 108.032394 | County or Parish/State: SAN JUAN / NM |
| | Well Number: 1 | Type of Well: OTHER | Allottee or Tribe Name: EASTERN NAVAJO |
| | Lease Number: 1149IND7971 | Unit or CA Name: | Unit or CA Number: |
| | US Well Number: 300452887800S1 | Well Status: Producing Gas Well | Operator: DJR OPERATING LLC |
| | | | |

Subsequent Report

Type of Submission: Subsequent Report

Date Sundry Submitted: 04/27/2021

Date Operation Actually Began: 04/08/2021

Type of Action: Plug and Abandonment Time Sundry Submitted: 02:45 6

Actual Procedure: The subject well was Plugged & Abandoned on 04/08/2021 per the attached detailed As Plugged Wellbore Diagram and Marker.

SR Attachments

Actual Procedure

Buena_Suerte_29M_1_PXA_Marker_20210427144512.pdf

Buena_Suerte_29M_1_EOWR___AsPlugged_WBD_20210427144512.pdf

| R | eceived by OCD: 10/18/2021 11:17:35 AM Well Name: BUENA SUERTE 29 M | Well Location: T26N / R11W / SEC 29 / SWSW / 36.453857 / 108.032394 | County or Parish/State: SAN |
|---|------------------------------------------------------------------------|------------------------------------------------------------------------|-------------------------------------------|
| | Well Number: 1 | Type of Well: OTHER | Allottee or Tribe Name: EASTERN NAVAJO |
| | Lease Number: I149IND7971 | Unit or CA Name: | Unit or CA Number: |
| | US Well Number: 300452887800S1 | Well Status: Producing Gas Well | Operator: DJR OPERATING LLC |

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

| Operator Electronic Signature: SHAW-MARIE FO | perator Elec | ronic Signatu | re: SHAW-MAR | IE FORD |
|----------------------------------------------|--------------|---------------|--------------|---------|
|----------------------------------------------|--------------|---------------|--------------|---------|

State: NM

Signed on: APR 27, 2021 02:45 PM

Name: DJR OPERATING LLC Title: Regulatory Specialist Street Address: 1 Road 3263 City: Aztec Phone: (505) 632-3476 Email address: sford@djrllc.com

Field Representative

Representative Name: Street Address: City: State: Phone: Email address:

BLM Point of Contact

BLM POC Name: WILLIAM F TAMBEKOU BLM POC Phone: 7192698500 Disposition: Accepted Signature: William Max Tambekou BLM POC Title: PETROLEUM ENGINEER BLM POC Email Address: wtambekou@blm.gov

Zip:

Disposition Date: 05/04/2021

DJR Operating, LLC Buena Suerte 29M 1 API # 30-045-28878 SWSW Sec.29, T26N, R11W San Juan County, NM



P&A End of Well Report DJR Operating, LLC Buena Suerte 29M #001 API: 30-045-28878 SWSW 29-26N-11W San Juan County, NM


Spud Date: 12/21/1992 Plugged Date: 04/08/2021

4/6/21: Set CR at 1208'. PT casing, did not test, flow out of BH. Plug 1: Fruitland perfs: Mix and pump 12 sx Class G cement through CR. Plug 2: Mix and pump 60 sx Class G cement on top of CR, reverse out at 496'. Tag at 496'. TOC 512' from CBL.

4/7/21: Perforate 4 holes at 480'. CR set at 464'. Plug 3: Kirtland: Mix and pump 12 sx Class G + 2% CaCl2 thru CR. Sting out, place 23 sx Class G + 2% CaCl2 above CR, reverse from 194'. Perforate 4 holes at 170'. Set CR at 129'. Plug 4: Pump 45 sx Class G cement through CR, Good cement returns at BH. Place 12 sx Class G cement on top of CR.

4/8/21: TOC in 4 1/2" csg at 9'. In annulus at surface. Install marker. Top off cellar and 4 1/2" casing with 17 sx Class G cement.

All cement used: Class G mixed at 15.8 ppg. 1.15 yield BLM Representative onsite to witness: Darrell Priddy

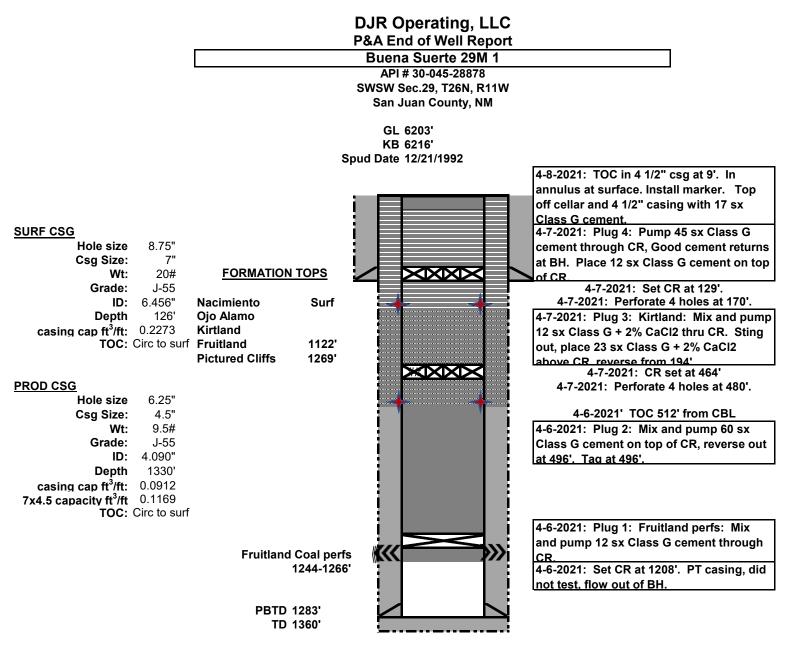

All cement used was Class G mixed at 15.8 ppg, yield 1.15 Reulatory representative, Darrell Priddy, BLM GPS Coordinates: Lat: 36.45408804528415, Lng: -108.03316377103329

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

| CONDITIONS |
|------------|
|------------|

| | 371838 |
|--------------------------------------|-----------------------------------------------|
| 1 Road 3263 Activ Aztec, NM 87410 | ction Number: 56513 |
| Actie | ction Type: [C-103] Sub. Plugging (C-103P) |

CONDITIONS

| Created By | Condition | Condition Date |
|------------|-----------|----------------|
| mkuehling | None | 11/3/2021 |

Page 6 of 6

Action 56513