

Office
 District I – (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II – (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III – (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV – (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM
 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-28931
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name W A RAMSAY NCT D
8. Well Number #005
9. OGRID Number 16696
10. Pool name or Wildcat DOLLARHIS; TUBB-DRINKARD (18830)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator OXY USA INC.	
3. Address of Operator 5 Greenway Plaza, Suite 110, Houston, TX	
4. Well Location Unit Letter K : 1650 feet from the SOUTH line and 1650 feet from the WEST line Section 28 Township 24S Range 38E NMPM LEA County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3207' GL	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input checked="" type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input checked="" type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

OXY USA INC. respectfully requests approval to TA the well. While rigged up performed a tubing leak repair workover job, we experienced some issues with tubing stuck in hole. See the attached summary of work performed and CIBP set details. Plan forward is to work up and file C103F to P&A the well.

Spud Date: 10/06/1984 Rig Release Date:

**Condition of Approval: notify
OCD Hobbs office 24 hours
prior of running MIT Test & Chart**

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Leslie T. Reeves TITLE REGULATORY MANAGER DATE 6/23/2022

Type or print name LESLIE REEVES E-mail address: LESLIE_REEVES@OXY.COM PHONE: 713-497-2492
For State Use Only

APPROVED BY: Kerry Fortner TITLE Compliance Officer A DATE 7/1/22
 Conditions of Approval

W A RAMSAY NCT D #5 (30-025-28931)

NOI_TA_WORKOVER JOB SUMMARY

6/8/22 MIRU. PULL PUMP AND RODS.

6/9/22 CONT'D POOH WITH PUMP AND RODS. NDWH AND NUBOP. ATTEMPTED TO RELEASE TAC. NO SUCCESS.

6/13/22 SECOND ATTEMPT TO RELEASE TAC AND WORK STUCK TUBING @ 5320'. RIH AND CUT TUBING @ 5275.

6/14/22 CONTINUED TO WORK FISH.

6/15/22 TAGGED TOF @ 5275'. WASHED OVER AND FISH FELL TO 5380'.


6/17/22 CONTINUED TO FISH. WAS ABLE TO RECOVERED TUBING, TAC ETC.

6/21/22 RIH WITH GAUGE RING TO 6017' AND WAS UNABLE TO GET PAST THE TOL.

6/22/22 RIH WITH CIBP AND SET IN LINER @ 6035'. DUMPED 26' CL C CMT ON TOP OF CIBP.

6/23/22 TESTED CIBP/ CSG. DID NOT HOLD. CASING DAMAGE EST DEPTHS F/ ~5315'-5370'. RDMO, PLAN FOR PA.

OXY USA Inc. - Current
W A Ramsay NCT D #5
API No. 30-025-28931

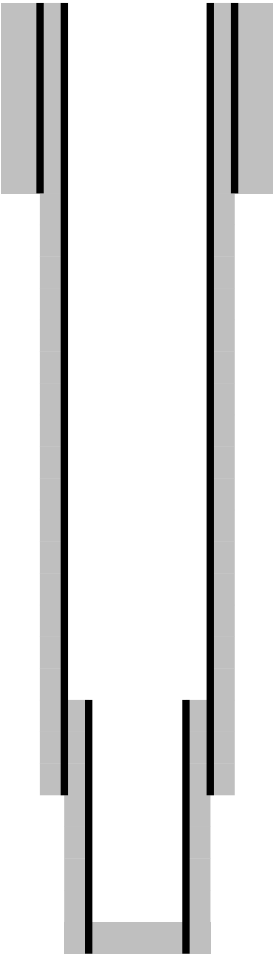

Spud 10/06/1984

12-1/4" hole
9-5/8" #36 casing @ 1245'
w/ 575sx - circ - surface

DV Tool @ 2076'


7-7/8" hole
5-1/2" #15.5 casing @ 6230'
w/ 2450sx - circ - surface

4" liner f/ 5616' - 6950'

Perfs @ 6091'-6116'
Perfs @ 6688'-6737'

OXY USA Inc. - Current
W A Ramsay NCT D #5
API No. 30-025-28931

CIBP set @ 6035' W 25' CL C CMT.

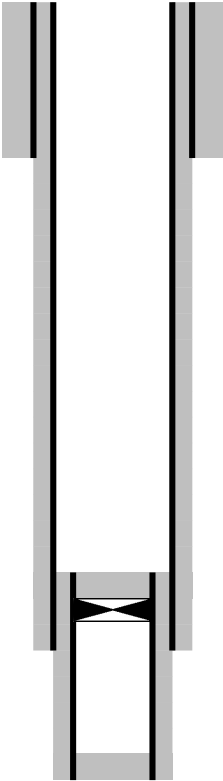

Spud 10/06/1984

12-1/4" hole
9-5/8" #36 casing @ 1245'
w/ 575sx - circ - surface

DV Tool @ 2076'

7-7/8" hole
5-1/2" #15.5 casing @ 6230'
w/ 2450sx - circ - surface

4" liner f/ 5616' - 6950'

Perfs @ 6091'-6116'
Perfs @ 6688'-6737'

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 119891

CONDITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 119891
	Action Type: [C-103] NOI Temporary Abandonment (C-103I)

CONDITIONS

Created By	Condition	Condition Date
kfortner	Run TA status MIT/BHT test	7/1/2022