Sundry Print Report

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Number: 10

Well Name: EAGLE 35 E FEDERAL Well Location: T17S / R27E / SEC 35 / County or Parish/State: EDDY /

SWNW /

V /

Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM0557370 Unit or CA Name: Unit or CA Number:

US Well Number: 300153303500S1 Well Status: Plugged and Abandoned Operator: REDWOOD

OPERATING LLC

Accepted for record - NMOCD gc 2/10/2023

Subsequent Report

Sundry ID: 2714429

Type of Submission: Subsequent Report

Type of Action: Plug and Abandonment

Date Sundry Submitted: 02/07/2023 Time Sundry Submitted: 09:47

Date Operation Actually Began: 02/02/2023

Actual Procedure: 02/02/23 MIRU plugging equipment. 02/03/23 POH w/ rods & pump. Dug out cellar, unflanged wellhead, NU BOP. Pumped brine H20 to kill well. POH w/ tbg. 02/04/23 Set 5 1/2 CIBP @ 2900'. Pump'd 15 bbls Brine H20. Spotted 25 sx class C cmt @ 2900-2653'. WOC. Tagged plug @ 2643'. Pump'd 100 Brine H20 to kill well. Set 5 1/2 CIBP @ 1847'. 02/05/23 Circ'd hole w/ MLF. Pressure tested csg, held 500 psi. Spotted 25 sx class C cmt @ 1847-1600'. ND BOP. Broke circulation. Spotted 30 sx class C cmt @ 380-60'. RU wireline. Perf'd @ 60'. RD wireline. Flanged up well. Broke circulation. Sqz'd 25 sx class C cmt @ 60' & circulated to surface. Rigged down and moved off. 02/06/23 Moved in backhoe and welder. Cut off well head & anchors. Roberta Thompson w/ BLM verified cmt @ surface via picture text message. Welded on "Above Ground Dry Hole Marker". Backfilled cellar, cut off deadmen, cleaned location, and moved off.

SR Attachments

Actual Procedure

Eagle_35_E_Fed_10___Plugged_WBD_20230207094459.pdf

Eagle_35_E_Fed_10___Subsequent_Report_20230207094459.pdf

Eagle_35_E_Fed_10___Current_WBD_20230207094459.pdf

eceived by OCD: 2/10/2023 10:04:00 AM
Well Name: EAGLE 35 E FEDERAL

Well Location: T17S / R27E / SEC 35 /

SWNW /

County or Parish/State: EDD 1/2

Well Number: 10

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM0557370

Unit or CA Name:

Unit or CA Number:

US Well Number: 300153303500S1

Well Status: Plugged and Abandoned

Operator: REDWOOD OPERATING LLC

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Signed on: FEB 07, 2023 09:47 AM **Operator Electronic Signature: DELILAH FLORES**

Name: REDWOOD OPERATING LLC

Title: Regulatory Technician 1

Street Address: 11344 LOVINGTON HWY

City: ARTESIA State: NM

Phone: (575) 748-1288

Email address: DELILAH@MEC.COM

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: JAMES A AMOS

BLM POC Phone: 5752345927

Disposition: Accepted

Signature: James A. Amos

BLM POC Title: Acting Assistant Field Manager

BLM POC Email Address: jamos@blm.gov


Disposition Date: 02/09/2023

Page 2 of 2

Redwood O	perating, LLC	Plugged	
Author:	Abby @ BCM		
Well Name	Eagle 35 E Federal	Well No.	#10
Field/Pool	Red Lake; Qn-GRBG- SA	API#:	30-15-33035
County	Eddy	Location:	Sec 35, T17S, R27E
State	New Mexico	_	2310' FNL & 215' FWL
Spud Date	9/11/2003	GL:	3573
		_	

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8	J55	24#	326	12 1/4	330	0
Prod Csg	5 1/2	J55	15.5#	3,488	7 7/8	750	60

Formation	Тор
Queen	840+/-
GRBG	1260
San Andres	1572
Glorieta	2952
Yeso	3014

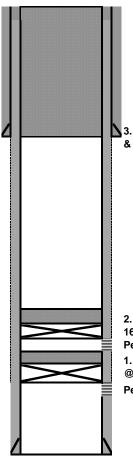

TD @

3500

8 5/8 24# CSG @ 326 Hole Size: 12 1/4

3. Spotted 30 sx class C cmt @ 380-60'. RU wireline. Perf'd @ 60'. Broke circulation. Sqz'd 25 sx class C cmt @ 60' & circulated to surface.

2. Set 5 1/2 CIBP @ 1847'. Circ'd hole w/ MLF. Pressure tested csg, held 500 psi. Spotted 25 sx class C cmt @ 1847-1600'.

Perfs @ 1897-2396

1. Set 5 1/2 CIBP @ 2900'. Pump'd 15 bbls Brine H20. Spotted 25 sx class C cmt @ 2900-2653'. WOC. Tagged plug @ 2643'. Pump'd 100 Brine H20 to kill well.

Perfs @ 2949-3286

5 1/2 15.5# CSG @ 3,488

Hole Size: 7 7/8

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 184950

CONDITIONS

Operator:	OGRID:
Redwood Operating LLC	330211
PO Box 1370	Action Number:
Artesia, NM 88210	184950
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By		Condition Date
gcordero	None	2/10/2023