

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report

Well Name: POKER LAKE UNIT Well Location: T24S / R29E / SEC 13 / County or Parish/State: EDDY /

SWNE / 32.2193548 / -103.9358558

Well Number: 276 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM05912 Unit or CA Name: POKER LAKE Unit or CA Number:

DELAWARE C NMNM71016G

US Well Number: 3001535137 Well Status: Abandoned Operator: XTO PERMIAN

OPERATING LLC

## **Subsequent Report**

**Sundry ID: 2778726** 

Type of Submission: Subsequent Report

Type of Action: Plug and Abandonment

Date Sundry Submitted: 03/08/2024 Time Sundry Submitted: 03:01

Date Operation Actually Began: 02/23/2024

Actual Procedure: XTO Permian Operating LLC has P&A'd the above mentioned well per the attached summary report

and WBD.

### **SR Attachments**

#### **Actual Procedure**

Poker\_Lake\_Unit\_276\_PA\_Summ\_Rpt\_WBD\_20240308150016.pdf

eceived by OCD: 4/30/2024 11:15:29 AM
Well Name: POKER LAKE UNIT

Well Location: T24S / R29E / SEC 13 /

SWNE / 32.2193548 / -103.9358558

County or Parish/State: EDD 1/2

Well Number: 276

Type of Well: OIL WELL

**Allottee or Tribe Name:** 

Lease Number: NMNM05912

Unit or CA Name: POKER LAKE

**DELAWARE C** 

**Unit or CA Number:** 

NMNM71016G

**US Well Number: 3001535137** 

Well Status: Abandoned

**Operator: XTO PERMIAN** OPERATING LLC

## **Operator**

crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a

Signed on: MAR 08, 2024 03:00 PM **Operator Electronic Signature: SHERRY MORROW** 

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 HOLIDAY HILL ROAD BLDG 5

City: MIDLAND State: TX

Phone: (432) 218-3671

Email address: SHERRY.MORROW@EXXONMOBIL.COM

### **Field**

**Representative Name:** 

**Street Address:** 

City:

State:

Zip:

Phone:

**Email address:** 

## **BLM Point of Contact**

**BLM POC Name: JAMES A AMOS BLM POC Title:** Acting Assistant Field Manager

**BLM POC Phone:** 5752345927 BLM POC Email Address: jamos@blm.gov

**Disposition:** Accepted Disposition Date: 03/25/2024

Signature: James A Amos

Page 2 of 2

#### Poker Lake Unit 276 API Number 3001535137 P&A Summary Report

2/23/24: Check well psi Move Equip. Spot equip SDFWE.

2/26/24: Check well psi Bd well RU Lobo HOU KW w/ 130 bbls 10# brine. MIRU Brigade 34 WO RU floor and Rod Tls.

2/27/24: Check well psi Bd & KW ND WH NU rod BOP worked to unseat pump finally unseated Ld SMPR + SB Ld (129) 7/8 steel rods (40) 3/4" steel rods install SMPL and SB on well and SD due to high winds.

2/28/24: Check well psi Bd & KW Ld SMPR + SB Cont Ld (150) 3/4" steel rods pump stuck in tbg. Decision made to strip rods backed off 18 rods ND 3K B-1 flange set hgr in WH w/ 2WCV NU 5K 7-1/16 BOP test to 2500 psig high ,& low250 psig w/ chart test Gd Rmv 2WCV and Hgr . Rlse TAC TOH w/ 7 stands to rods and secure well and SDFN.

2/29/24: Check well psi Bd & KW Switched tbg Tls for rod Tls Backed off rods string weight 4 pts Ld 11 -3/4 steet rods and 11 - 1-1/2 SB switched back to tbg Tls TOH w/ 7 stands .to top of sinker bar pull up 1 more stand and break out at connection to see if any trapped psi below stuck pump in tbg ,tbg on vacuum Ld jts w/ stuck pump cont TOH w/ tbg and BHA Total jts 2-7/8" J-55 8rd tbg 291. SDFN.

3/1/24: Check well psi Bd & KW RU Brigade WLU RIH w/ 4.62 GR & JB to 8120' w/ no tight spots POH PU 5-1/2" CIBP RIH set 2 8100' per XTO engineer Peter Staub TIH w/256 jts 2-7/8" tbg + 10 ' sub EOT @8094' spot 150 sxs class H 15.0 mix 1.06 Yld ,16.4 # Disp w/ 39.5 bbls TOH w/ 30 stands EOT @6188' did not Reverse Circ well on vacuum. SDFWE.

3/4/24: Check well psi Bd well attempt to move tbg ,tbg stuck moving 5' play pump 60 bbls down csg and 40 down tbg well on vacuum RU Brigade WLU RIH w/ 1-1/2 weight bar tag Cmt @ 6810' POH RD Brigade WL RU TWG WL RIH free point TI found stuck tbg @6132' free @ 5984 collar POH w/ free point TI RIH w/ 2.125 OD jet cutter 40 pts string weight pulled 15 pts over jet cut tbg good cut POH RD WLU. TOH w/ 85 stands 2-7/8" J-55 tbg Secure well and SDFN.

3/5/24: Check well psi TOH w/ 10 stands 2-7/8" J-55 tbg Ld 1 jt and jt that was cut RU Brigade WLU RIH w/ 4.62 GR & JB down to 5920' no problems POH PU 5-1/2" CIBP RIH set @ 5890' POH RD WLU TIH w/186 jts + 10' sub EOT @ 5887' load csg w/ 90 bbls 10# brine test production 5-1/2" 15.5# csg to 600 psi w/ surface valve open for 30 minutes Gd test spot 25 sxs class C cmt from 5887'-5640 CTOC 3.75 mix,1.32 Yld, 14.8# Disp w/ 32.5 bbls PUH Ld 30 jts EOT 4924 Reverse Circ 32 bbls secure well and SDFN.

3/6/24: Check well psi TIH tag CTOC @ 5636' w/ 178.7 jts PUH LD 18 jts tbg EOT @ 5065 spot 25 sxs class C cmt 3.75 mix 1.32 Yld 14.8# Disp w/ 23 bbls PUH 20 stands reverse Circ 24 bbls and SD WOC. TIH tag Cmt @ 4789' PUH Ld tbg to next spot @ 4267 EOT spot 128 sxs Cmt 19.2 mix,1.32 yld,14.8# ,Disp w/ 17 bbls PUH 30 stands Reverse Circ 17 bbls PUH 10 more stands and SDFN.

3/7/24: Check well psi TIH tag CTOC @ 2904" w/ 92 jts PUH LD 92 TIH w/ 19 jts and hgr set in WH and Lock pins ND 5K 7-1/16 BOPE spot 60 sxs to surface TOH Ld Hgr and tbg SD due to excessive winds SDFN.


3/8/24: Check well cmt to surface RDMO rig and Cmt Equip. XTO to cut off WH & install DHM.


4/19/24: Cut off WH and installed DHM.



# **Schematic - Vertical with Perfs**

Well Name: Poker Lake Unit 276



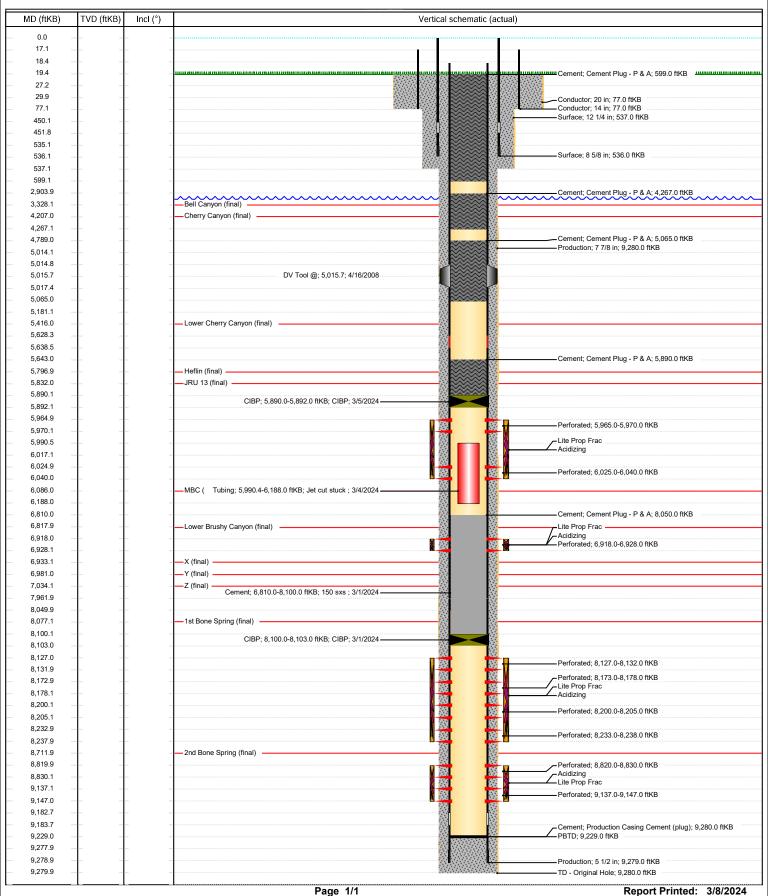

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 339095

#### **CONDITIONS**

Operator:	OGRID:
XTO ENERGY, INC	5380
6401 Holiday Hill Road Midland, TX 79707	Action Number: 339095
	Action Type: [C-103] Sub. Plugging (C-103P)

#### CONDITIONS

Created By		Condition Date
gcordero	None	4/30/2024