Received by OCD: 8/10/2021 1:09:18 PM Form C-141 State of New Mexico

Page 5

Oil Conservation Division

Incident ID	NAPP2114756542
District RP	
Facility ID	
Application ID	

Remediation Plan

Remediation Plan Checklist: Each of the following items must be included in the plan.

Detailed description of proposed remediation technique

Scaled sitemap with GPS coordinates showing delineation points

Estimated volume of material to be remediated

Closure criteria is to Table 1 specifications subject to 19.15.29.12(C)(4) NMAC

Proposed schedule for remediation (note if remediation plan timeline is more than 90 days OCD approval is required)

Deferral Requests Only: Each of the following items must be con	firmed as part of any request for deferral of remediation.
Contamination must be in areas immediately under or around prodeconstruction.	oduction equipment where remediation could cause a major facility
Extents of contamination must be fully delineated.	
Contamination does not cause an imminent risk to human health	, the environment, or groundwater.
I hereby certify that the information given above is true and complet rules and regulations all operators are required to report and/or file c which may endanger public health or the environment. The acceptan liability should their operations have failed to adequately investigate surface water, human health or the environment. In addition, OCD a responsibility for compliance with any other federal, state, or local la	ertain release notifications and perform corrective actions for releases nee of a C-141 report by the OCD does not relieve the operator of and remediate contamination that pose a threat to groundwater, neceptance of a C-141 report does not relieve the operator of
Printed Name: Larry Baker	Title: Environmental Tech SR.
Printed Name: Larry Baker Signature: Larry Baker	Date: 8/10/2021
email: larry.baker@apachecorp.com	Telephone: 432-631-6982
OCD Only	
Received by: <u>Robert Hamlet</u>	Date: <u>11/17/2021</u>
Approved X Approved with Attached Conditions of A	Approval Denied Deferral Approved
Signature: Robert Hamlet	Date: 11/17/2021

•

303 Veterans Airpark Lane Midland, TX 79705

Remediation Plan

August 10, 2021

Re: CLFCA Water Transfer Line Case nAPP2114756542

Background:

On 5/13/2021 a release occurred due to a 4 inch metal grooved transition failed due to external corrosion. The release (GPS: 32.823203, -103.946841) is located east of Loco Hills, New Mexico in unit letter F section 23 township 17S range 30E. On 8/2/2021 a soil bore was conducted 52 feet north of the release. The soil bore was advanced to a depth of 117 feet below ground surface. The bore hole was left open for 72 hours and gauged for the presence of water. The bore hole was dry to a depth of 117 feet.

On 6/30/2021 vertical delineation was conducted to depths of 8 and 12 feet. All samples collected were submitted to a commercial laboratory for analysis of chloride, TPH, and BTEX. Horizontal 5 point surface composite samples were collected not to exceed 200 square feet. All samples collected were submitted to a commercial laboratory for analysis of chloride, TPH, and BTEX. On 8/2/2021 further delineation was conducted at SP2 utilizing a soil bore rig. SP 2 was advanced to a depth of 30 feet. All samples collected were submitted to commercial laboratory for analysis of chloride. The release area has been delineated below table one standards for release greater than 100 feet to groundwater.

Remediation Plan:

Apache Corporation proposes that the release area be excavated to a depth of 4 feet below ground surface and a variance is requested to install a 20 mil reinforced liner. 5 point wall composite samples will be collected not to exceed 200 square feet. All excavated soil (100 yards) will be hauled to an OCD approval facility. The release area will backfilled with clean imported top soil and seeded in accordance with the surface owner. The remediation will be completed 90 days from OCD approval of the plan.

Enclosed: C-141, Groundwater Data, Maps, Sample Data, Laboratory Results, Noxious Weed and Revegetation Plan.

Submitted by;

Bruce Baker

Environmental Technician larry.baker@apachecorp.com Cell# 432-631-6982

Received by OCD: 8/10/2021 1:09:18 PM Form C-141 State of New Mexico

Oil Conservation Division

	Page 3 of 36
Incident ID	
District RP	
Facility ID	
Application ID	

Site Assessment/Characterization

This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

What is the shallowest depth to groundwater beneath the area affected by the release?	(ft bgs)
Did this release impact groundwater or surface water?	🗌 Yes 🛛 No
Are the lateral extents of the release within 300 feet of a continuously flowing watercourse or any other significant watercourse?	🗌 Yes 🔽 No
Are the lateral extents of the release within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)?	🗌 Yes 🛛 No
Are the lateral extents of the release within 300 feet of an occupied permanent residence, school, hospital, institution, or church?	🗌 Yes 🔽 No
Are the lateral extents of the release within 500 horizontal feet of a spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes?	🗌 Yes 🛛 No
Are the lateral extents of the release within 1000 feet of any other fresh water well or spring?	🗌 Yes 🛛 No
Are the lateral extents of the release within incorporated municipal boundaries or within a defined municipal fresh water well field?	🗌 Yes 🛛 No
Are the lateral extents of the release within 300 feet of a wetland?	🗌 Yes 🛛 No
Are the lateral extents of the release overlying a subsurface mine?	🗌 Yes 🔽 No
Are the lateral extents of the release overlying an unstable area such as karst geology?	🗌 Yes 🛛 No
Are the lateral extents of the release within a 100-year floodplain?	🗌 Yes 🔽 No
Did the release impact areas not on an exploration, development, production, or storage site?	🔽 Yes 🗌 No

Attach a comprehensive report (electronic submittals in .pdf format are preferred) demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined. Refer to 19.15.29.11 NMAC for specifics.

Characterization Report Checklist: Each of the following items must be included in the report.

- Scaled site map showing impacted area, surface features, subsurface features, delineation points, and monitoring wells. Field data
- Data table of soil contaminant concentration data
- \checkmark Depth to water determination
- Determination of water sources and significant watercourses within ½-mile of the lateral extents of the release
- Boring or excavation logs
 - Photographs including date and GIS information
- Z Topographic/Aerial maps
- Laboratory data including chain of custody

If the site characterization report does not include completed efforts at remediation of the release, the report must include a proposed remediation plan. That plan must include the estimated volume of material to be remediated, the proposed remediation technique, proposed sampling plan and methods, anticipated timelines for beginning and completing the remediation. The closure criteria for a release are contained in Table 1 of 19.15.29.12 NMAC, however, use of the table is modified by site- and release-specific parameters.

Form C-141 Page 4	99:18 PM State of New Mexico Oil Conservation Division		Incident ID District RP Facility ID Application ID	Page 4 of
regulations all operators are require public health or the environment. failed to adequately investigate and addition, OCD acceptance of a C-1 and/or regulations.	n given above is true and complete to the ed to report and/or file certain release nor The acceptance of a C-141 report by the 1 remediate contamination that pose a the 41 report does not relieve the operator o	tifications and perform c OCD does not relieve th reat to groundwater, surfa f responsibility for comp	orrective actions for rele e operator of liability sh ace water, human health liance with any other fe	eases which may endanger ould their operations have or the environment. In
Sinte Annu A	Baker			
email: larry.baker@apac	hecorp.com	Date: 8/10/2021 Telephone: 432-6	31-6982	
OCD Only				

Received by OCD: 8/10/2021 1:09:18 PM Form C-141 State of New Mexico

Oil Conservation Division

Incident ID	
District RP	
Facility ID	
Application ID	

Remediation Plan

<u>Remediation Plan Checklist</u>: Each of the following items must be included in the plan.

Detailed description of proposed remediation technique

Scaled sitemap with GPS coordinates showing delineation points


Estimated volume of material to be remediated

Closure criteria is to Table 1 specifications subject to 19.15.29.12(C)(4) NMAC

Proposed schedule for remediation (note if remediation plan timeline is more than 90 days OCD approval is required)

Deferral Requests Only: Each of the following items must be con	firmed as part of any request for deferral of remediation.
Contamination must be in areas immediately under or around prodeconstruction.	oduction equipment where remediation could cause a major facility
Extents of contamination must be fully delineated.	
Contamination does not cause an imminent risk to human health.	the environment, or groundwater.
I hereby certify that the information given above is true and complete	a to the best of my knowledge and understand that nursuant to OCD
rules and regulations all operators are required to report and/or file c which may endanger public health or the environment. The acceptar liability should their operations have failed to adequately investigate surface water, human health or the environment. In addition, OCD a responsibility for compliance with any other federal, state, or local la	ertain release notifications and perform corrective actions for releases nee of a C-141 report by the OCD does not relieve the operator of and remediate contamination that pose a threat to groundwater, cceptance of a C-141 report does not relieve the operator of two and/or regulations.
Printed Name: Larry Baker	Title: Environmental Tech SR.
Printed Name: Larry Baker Signature: Larry Baker	Date: 8/10/2021
email: larry.baker@apachecorp.com	Date: 8/10/2021 Telephone: 432-631-6982
OCD Only	
Received by:	Date:
Approved Approved with Attached Conditions of A	Approval Denied Deferral Approved
Signature:	Date:

Page 5

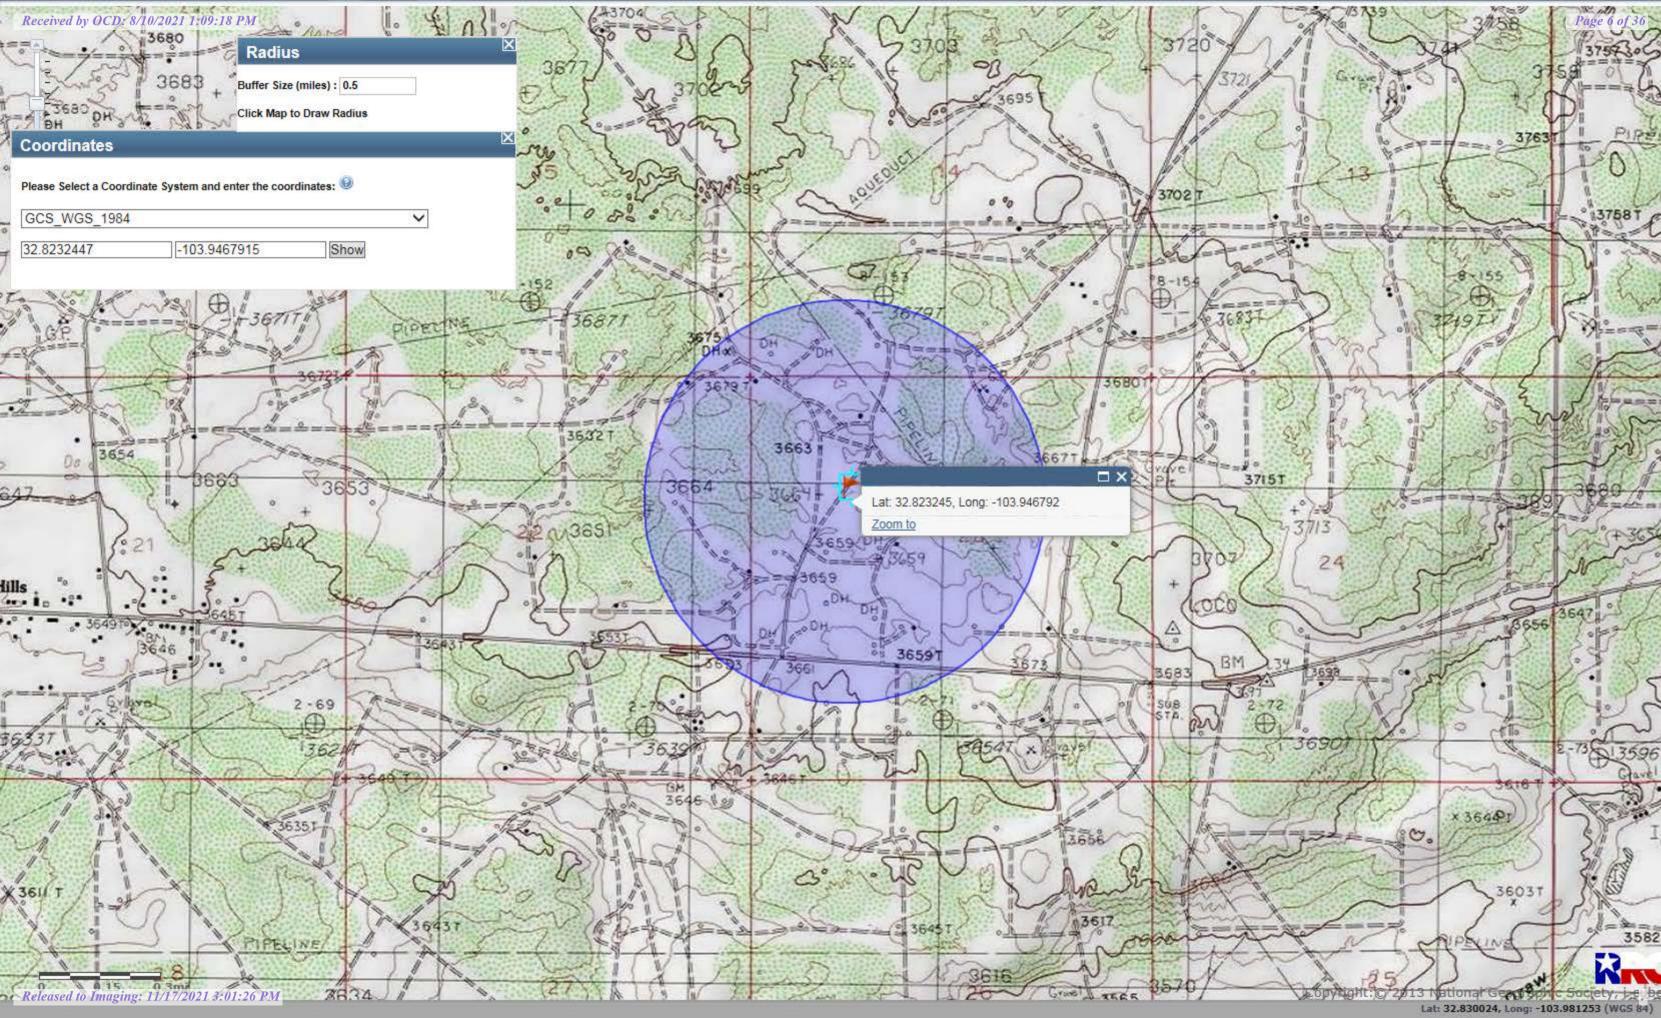


Desert Sand Water Well Services, LLC.

Soil Bore Report

Info	Customer:				Phone:	Date:
General / Well I	-	oack Dispos	al/Apach	e Corp.	575-631-9586	8/2/21
ral/	Well Name				Location:	i
Gene	CLFCA	WATER TI	RANSFEI	R LINE	32.823401, -103.946934	
	DI	EPTH				
	FROM	ТО	THICKNESS (feet)	COLOR	AND TYPE OF MATERIAL ENCOUNTERED - I BEARING CAVITIES OR FRACTURES	ICLUDE WATER
	0	7	7		TOP SOIL	
	7	20	13	*****	CALECHE	
	20	55	25		RED SAND / ROCK	
	55	60	5		RED CLAY	
	60	80	20		RED SAND WITH RED CALY STRINGE	RS
	80	117	37		RED CLAY / GRAVEL	
		A state of the sta				
		and a second sec				
	and and a second s	sizer de				
	Sec.	- See				
WELL		and the second second				
			-	DODE		
OF					OLE WAS LEFT OPEN 72 HOURS THEN C	
LOG OF	the first start			WATER, TH	HE BORE HOLE WAS DRY AFTER 72 HOURS.	BORE HOLE WAS
2					FROM THE BOTTOM OF THE HOLE TO	THE TOP WITH
				Planta de la comp	AN NATURAL FILL AND 3/8 HOLE PLUG	ON 8/6/21.
		R. A. Star		1		
	and they		23			
			T ille y	а, ²		
				14 - 14 - 14 - 14 - 14 - 14 - 14 - 14 -		
		Ale the Summer of	a an			
-						
-						
-	and a	and the second			and the second sec	Window Charles
ŀ						
ŀ						
ŀ						

1118 West Broadway Place

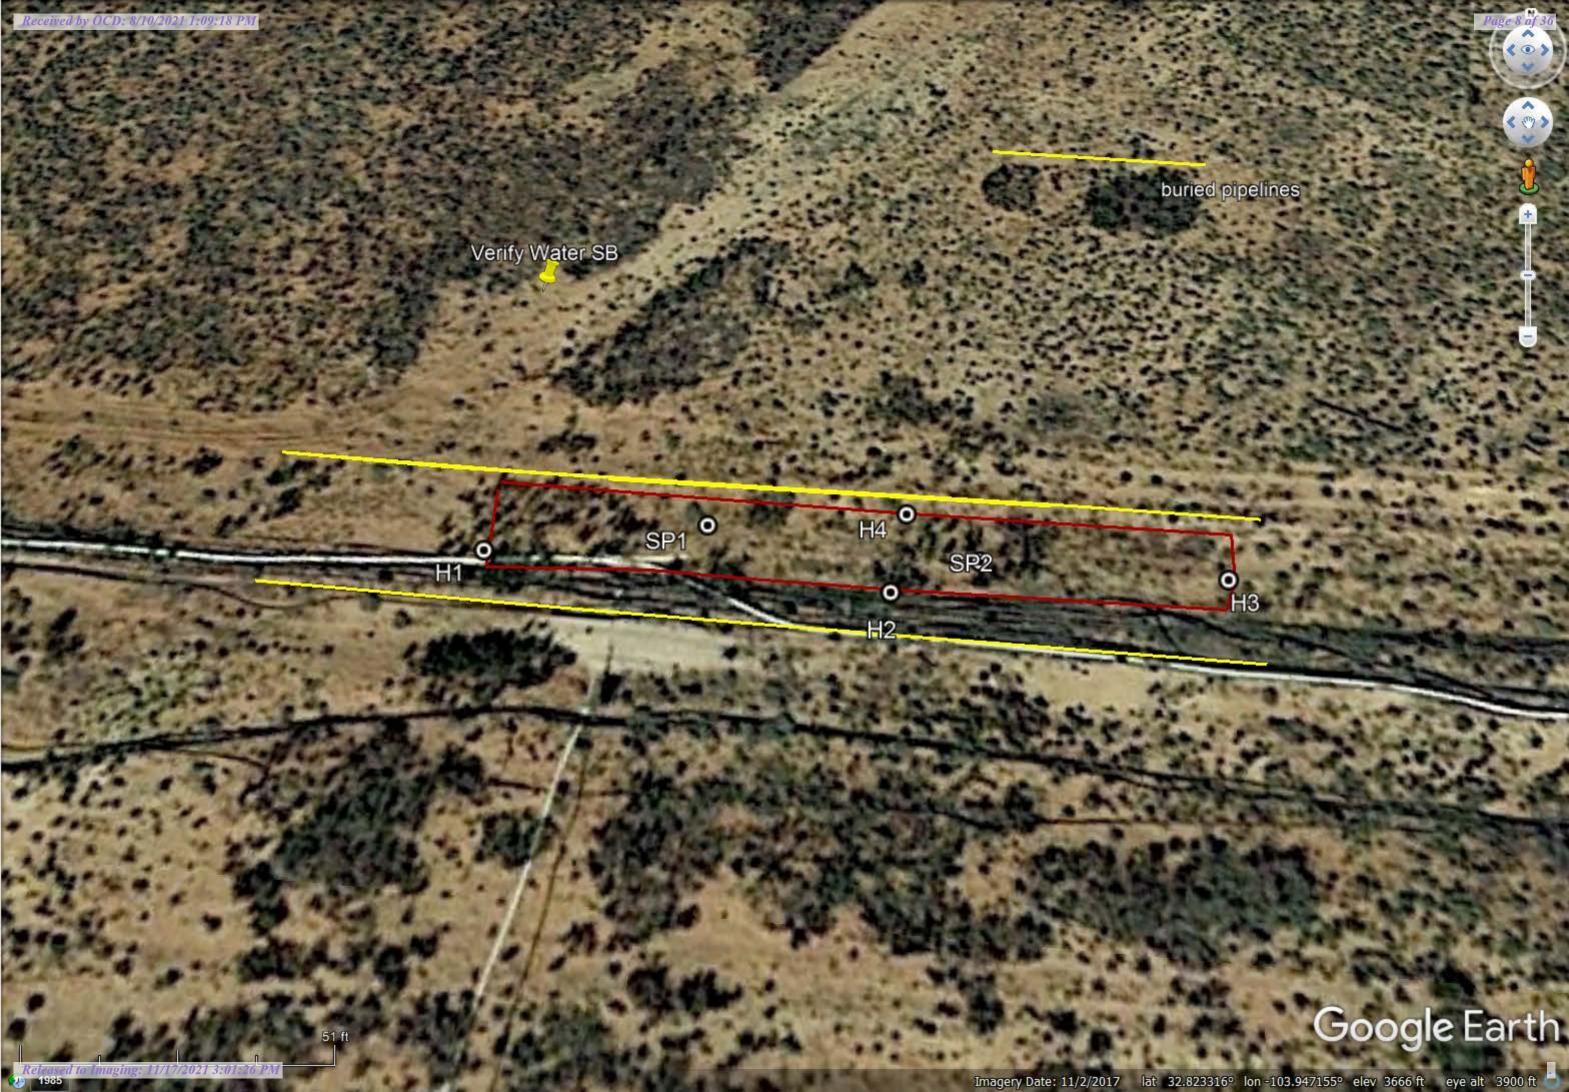

Sample Date	Sample ID	Depth	Chloride	Benzene	Toulene	Ethybenzene	Total Xylenes	Total BTEX	GRO	DRO	EXT DRO	GPS Coordinates
Delineation Sa	amples						Ayreneo	012/		1		
												32.8232447,
6/30/2021	SP 1	S	464	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	174	52.5	-103.9467915
		2'	5,200	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	
		4'	1,900	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	15.4	<10.0	
		6'	7,440	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	
		8'	5,280	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	
												32.8232351,
6/30/2021	SP 2	S	6,640	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	135	74.8	-103.9466125
		2'	5,360	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	188	94.6	
		4'	19,000	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	14.4	<10.0	
		6'	23,600	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	20.2	<10.0	
		8'	17,400	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	17.6	<10.0	
		10'	17,200	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	19.7	<10.0	
		12'	20,000	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	15	<10.0	
8/2/2021		15'	14,600									
		20'	19,000									
		25'	15,400									
		30'	9,000									
Horizontal Sar	nples_										•	•
												32.8232188,
6/30/2021	H1	S	<16.0	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	-103.9469313
												32.8232129,
6/30/2021	H2	S	<16.0	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	-103.9466679
												32.8232408,
6/30/2021	H3	S	<16.0	<0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	-103.9464526
												32.8232613,
6/30/2021	H4	S	48.0	< 0.050	<0.050	<0.050	<0.150	<0.300	<10.0	<10.0	<10.0	-103.9466621



July 07, 2021

JEFFREY BROOM APACHE CORP - HOBBS 2350 W. MARLAND BLVD. HOBBS, NM 88240

RE: CLFCA

Enclosed are the results of analyses for samples received by the laboratory on 06/30/21 16:25.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-20-13. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/ga/lab_accred_certif.html.

Cardinal Laboratories is accreditated through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Celey D. Keine

Celey D. Keene Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 1 @ SURFACE (H211703-01)

BTEX 8021B	mg/kg		Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/01/2021	ND	2.07	103	2.00	0.850	
Toluene*	<0.050	0.050	07/01/2021	ND	2.23	111	2.00	0.994	
Ethylbenzene*	<0.050	0.050	07/01/2021	ND	2.13	107	2.00	2.34	
Total Xylenes*	<0.150	0.150	07/01/2021	ND	6.35	106	6.00	1.62	
Total BTEX	<0.300	0.300	07/01/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	101	% 69.9-14	0						
Chloride, SM4500Cl-B	de, SM4500Cl-B mg/kg			Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	464	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	174	10.0	07/02/2021	ND	225	113	200	3.49	QR-03
EXT DRO >C28-C36	52.5	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane 107 % 44.3-133		3							
Surrogate: 1-Chlorooctadecane	123	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celeg D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 1 @ 2' (H211703-02)

BTEX 8021B	mg,	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifie
Benzene*	<0.050	0.050	07/01/2021	ND	2.07	103	2.00	0.850	
Toluene*	<0.050	0.050	07/01/2021	ND	2.23	111	2.00	0.994	
Ethylbenzene*	<0.050	0.050	07/01/2021	ND	2.13	107	2.00	2.34	
Total Xylenes*	<0.150	0.150	07/01/2021	ND	6.35	106	6.00	1.62	
Total BTEX	<0.300	0.300	07/01/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	102	% 69.9-14	0						
Chloride, SM4500Cl-B	mg,	′kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	5200	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg,	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	<10.0	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	<10.0	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	108	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	114 9	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and clent's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatscever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, whother based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 1 @ 4' (H211703-03)

BTEX 8021B	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/01/2021	ND	2.07	103	2.00	0.850	
Toluene*	<0.050	0.050	07/01/2021	ND	2.23	111	2.00	0.994	
Ethylbenzene*	<0.050	0.050	07/01/2021	ND	2.13	107	2.00	2.34	
Total Xylenes*	<0.150	0.150	07/01/2021	ND	6.35	106	6.00	1.62	
Total BTEX	<0.300	0.300	07/01/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	97.3	% 69.9-14	0						
Chloride, SM4500Cl-B	mg	/kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	1900	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	15.4	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	<10.0	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	108	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	118	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celeg D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 1 @ 6' (H211703-04)

BTEX 8021B	mg/	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/01/2021	ND	2.07	103	2.00	0.850	
Toluene*	<0.050	0.050	07/01/2021	ND	2.23	111	2.00	0.994	
Ethylbenzene*	<0.050	0.050	07/01/2021	ND	2.13	107	2.00	2.34	
Total Xylenes*	<0.150	0.150	07/01/2021	ND	6.35	106	6.00	1.62	
Total BTEX	<0.300	0.300	07/01/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	111 9	% 69.9-14	0						
Chloride, SM4500Cl-B	mg/	/kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	7440	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg/	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	<10.0	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	<10.0	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	109	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	117 9	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 1 @ 8' (H211703-05)

BTEX 8021B	mg/	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/01/2021	ND	2.07	103	2.00	0.850	
Toluene*	<0.050	0.050	07/01/2021	ND	2.23	111	2.00	0.994	
Ethylbenzene*	<0.050	0.050	07/01/2021	ND	2.13	107	2.00	2.34	
Total Xylenes*	<0.150	0.150	07/01/2021	ND	6.35	106	6.00	1.62	
Total BTEX	<0.300	0.300	07/01/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	107 9	% 69.9-14	0						
Chloride, SM4500Cl-B	mg/	′kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	5280	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg/	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	<10.0	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	<10.0	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	109 9	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	117 9	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and clent's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatscever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, whother based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ SURFACE (H211703-06)

BTEX 8021B	mg/	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/01/2021	ND	2.07	103	2.00	0.850	
Toluene*	<0.050	0.050	07/01/2021	ND	2.23	111	2.00	0.994	
Ethylbenzene*	<0.050	0.050	07/01/2021	ND	2.13	107	2.00	2.34	
Total Xylenes*	<0.150	0.150	07/01/2021	ND	6.35	106	6.00	1.62	
Total BTEX	<0.300	0.300	07/01/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	102 9	% 69.9-14	0						
Chloride, SM4500Cl-B	mg/	′kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	6640	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg/	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	135	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	74.8	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	106 9	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	118 9	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ 2' (H211703-07)

BTEX 8021B	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/01/2021	ND	2.07	103	2.00	0.850	
Toluene*	<0.050	0.050	07/01/2021	ND	2.23	111	2.00	0.994	
Ethylbenzene*	<0.050	0.050	07/01/2021	ND	2.13	107	2.00	2.34	
Total Xylenes*	<0.150	0.150	07/01/2021	ND	6.35	106	6.00	1.62	
Total BTEX	<0.300	0.300	07/01/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	99.8	% 69.9-14	0						
Chloride, SM4500Cl-B	mg	/kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	5360	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	188	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	94.6	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	110	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	125	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ 4' (H211703-08)

BTEX 8021B	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	98.7	% 69.9-14	0						
Chloride, SM4500Cl-B	mg	/kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	19000	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	14.4	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	<10.0	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	108	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	115	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celeg D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ 6' (H211703-09)

BTEX 8021B	mg	/kg	Analyze	ed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	99.0	% 69.9-14	0						
Chloride, SM4500Cl-B	mg	/kg	Analyze	ed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	23600	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyze	ed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	20.2	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	<10.0	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	107	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	116	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ 8' (H211703-10)

BTEX 8021B	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	99.4	% 69.9-14	0						
Chloride, SM4500Cl-B	mg	/kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	17400	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/02/2021	ND	247	123	200	7.00	
DRO >C10-C28*	17.6	10.0	07/02/2021	ND	225	113	200	3.49	
EXT DRO >C28-C36	<10.0	10.0	07/02/2021	ND					
Surrogate: 1-Chlorooctane	103	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	112	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ 10' (H211703-11)

BTEX 8021B	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	101	% 69.9-14	0						
Chloride, SM4500Cl-B	mg	/kg	Analyze	ed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	17200	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyze	ed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/06/2021	ND	233	116	200	1.16	
DRO >C10-C28*	19.7	10.0	07/06/2021	ND	227	114	200	1.89	
EXT DRO >C28-C36	<10.0	10.0	07/06/2021	ND					
Surrogate: 1-Chlorooctane	104	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	114	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ 12' (H211703-12)

BTEX 8021B	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	102	% 69.9-14	0						
Chloride, SM4500Cl-B	mg	/kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	20000	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/06/2021	ND	233	116	200	1.16	
DRO >C10-C28*	15.0	10.0	07/06/2021	ND	227	114	200	1.89	
EXT DRO >C28-C36	<10.0	10.0	07/06/2021	ND					
Surrogate: 1-Chlorooctane	107	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	116	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: H 1 (H211703-13)

BTEX 8021B	mg/	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	111 9	69.9-14	0						
Chloride, SM4500Cl-B	mg/	′kg	Analyze	d By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	<16.0	16.0	07/02/2021	ND	464	116	400	3.51	
TPH 8015M	mg/	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/06/2021	ND	233	116	200	1.16	
DRO >C10-C28*	<10.0	10.0	07/06/2021	ND	227	114	200	1.89	
EXT DRO >C28-C36	<10.0	10.0	07/06/2021	ND					
Surrogate: 1-Chlorooctane	107 9	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	115 9	38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celeg D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: H 2 (H211703-14)

BTEX 8021B	mg,	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	103 % 69.9-14		0						
Chloride, SM4500Cl-B	mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	<16.0 16.0		07/02/2021 ND		448	112	400	0.00	
TPH 8015M	mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/06/2021	ND	233	116	200	1.16	
DRO >C10-C28*	<10.0	10.0	07/06/2021	ND	227	114	200	1.89	
EXT DRO >C28-C36	<10.0	10.0	07/06/2021	ND					
Surrogate: 1-Chlorooctane	103	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	111 9	% 38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: H 3 (H211703-15)

BTEX 8021B	mg,	′kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID	103	% 69.9-14	0						
Chloride, SM4500Cl-B	mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	<16.0 16.0		07/02/2021 ND		448	112	400	0.00	
TPH 8015M	mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/06/2021	ND	233	116	200	1.16	
DRO >C10-C28*	<10.0	10.0	07/06/2021	ND	227	114	200	1.89	
EXT DRO >C28-C36	<10.0	10.0	07/06/2021	ND					
Surrogate: 1-Chlorooctane	108	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	118 9	38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	06/30/2021	Sampling Date:	06/30/2021
Reported:	07/07/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER LINE	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: H 4 (H211703-16)

BTEX 8021B	mg/kg		Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	07/02/2021	ND	2.04	102	2.00	1.06	
Toluene*	<0.050	0.050	07/02/2021	ND	2.15	108	2.00	3.56	
Ethylbenzene*	<0.050	0.050	07/02/2021	ND	2.08	104	2.00	3.14	
Total Xylenes*	<0.150	0.150	07/02/2021	ND	6.12	102	6.00	4.40	
Total BTEX	<0.300	0.300	07/02/2021	ND					
Surrogate: 4-Bromofluorobenzene (PID			0						
Chloride, SM4500Cl-B	mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	48.0 16.0		07/02/2021 ND		448	112	400	0.00	
TPH 8015M	mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	07/06/2021	ND	233	116	200	1.16	
DRO >C10-C28*	<10.0	10.0	07/06/2021	ND	227	114	200	1.89	
EXT DRO >C28-C36	<10.0	10.0	07/06/2021	ND					
Surrogate: 1-Chlorooctane	105 9	% 44.3-13	3						
Surrogate: 1-Chlorooctadecane	113 9	38.9-14	2						

Cardinal Laboratories

*=Accredited Analyte

Celeg D. Keine

Celey D. Keene, Lab Director/Quality Manager



Notes and Definitions

S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
QR-03	The RPD value for the sample duplicate or MS/MSD was outside of QC acceptance limits due to matrix interference. QC batch accepted based on LCS and/or LCSD recovery and/or RPD values.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C
	Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

Celez D. Keine

Celey D. Keene, Lab Director/Quality Manager

101 East Marland, Hobbs, NM 88240 (575) 393-2326 FAX (575) 393-2476 atc ries

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

All Results are REMARKS:	above stated roccore or drammers of the applicable of the applicable of the applicable fifts incurred by client, its subsidiaries, above stated roccore or otherwise.	1 2:04	0,0	Die acri	11.56	1150	1150	1:50	11:48	6130 1:46	DATE TIME	SAMPLING	∠ıp:
are emailed. Ple	pplicable	1111								1	CI Ext TP BTEX	7	
□ No Add'I Phone #: ase provide Email addre												ł	2 2 (14) 2
e #: Idress:									-				
							-		×				
	A.											s ^e	1

Received by OCD: 8/10/2021 1:09:18 PM

Company Name:	BILL TO		ANALYSIS REQUEST
Project Manager: JUR Brown	P.O. #:		
Address:	Company:		
City: Hobos State: NUZip: 88200	Attn:		
Fax #:	Address:		
Project #: Project Owner:	City:		
Project Name:	State: Zip:		
Project Location: USEA Water transfer Line	Phone #:		
Sampler Name: Leve (), co za Da da	Fax #:		
	PRESERV.	SAMPLING	
Lab I.D. Sample I.D. B OR (C)OMI TAINERS NDWATER EWATER	R : ASE: OOL	TPH ×	
# CON GROU		TIME CI Exct BITE	
sture G1 1	-	1.10/11	
2 SP102		1:48 1 1	
2 SPI0/2 C		50	
S SPION'		1150	
2 Sr2 Surfue		1.50	
80200			
9 50206 111		0.00	
PLEASE NOTE: Liability and Damages. Cardina's liability and client's exclusive remedy for any cliam arising whether based in contract or tort, shall be limited to the amount paid by the client for the analysis.	ract or tort, shall be limited to the amount pa	alog / / /	
service. In no event shall Cardinal be liable for incidental or consequential damages, including without immation unasses inaute at winung and uncerve or variantal within 30 days are completeno rule explorable affiliates or successors arising out of or related to the performance of servi-as hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated crossors or diservice.	aino received by cardinal within 30 days and ins, loss of use, or loss of profits incurred by aim is based upon any of the above stated r	er completion of the applicable client, its subsidiaries, scsons cr dtherwice.	14
Neilinduisied By:	11111	Verbal Result: Yes No Add'l Phone #: All Results are emailed. Please provide Email address:	Add'I Phone #: ide Email address:
Relinquished By: Date: Received By: Time:	. Lilldaffyl	REMARKS:	
Delivered By: (Circle One) Observed Temp. °C 3.7 Sample Condition Sampler - UPS - Bus - Other: Corrected Temp. °C Cool Intact	Act (Initials)	Turmaround Time: Standard N Themometer ID #113	Bacteria (only) S Cool Intact
r UNM-000 K 3.1 00/04/20 † Cardinal cannot accept verbal c	nanges. Please email cha	Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com	n.com

Page 28 of 36

101 East Marland, Hobbs, NM 88240 (575) 393-2326 FAX (575) 393-2476 0 ator IES.

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

-		the survey of the local division of the loca			_	Statement and the owner whether the	-	-	And in case of the local division in which the local division in which the local division in which the local division in the local din the local division in the local division in the local din the l	The survey of th		-	
Sampler - UPS - E	Delivered By: (Ci		Refinquished By	analyses. All calims including those for neglige service. In no event shall Cardinal be itsble for afficience or success ons arising out of or related Relinquished By				0]	14	5	11	H211703	· Lab I.D.
Bus - Other:	ircle One)		Lun	including those for negligence : shall Cardinal be libble for incid insarising out of or related to the				HY	F.F.	HI @			Sa

Company Name:	BILL TO	ANALYSIS REQUEST	
Project Manager:			
Address:	Company:		
city: Hours State: Un Zip: 28240	1		
Phone #: Fax #:	Address:		
Project #: Project Owner:	City:		
Project Name:	State: Zip:		
Project Location: CLACA war thank Lin	#		
Sampler Name: Auch Jussich 1	Fax #:		
Clerk Mussingthe dr	Fax #:		
ИР.	MATRIX PRESERV. SA		ł
# CONTAINERS GROUNDWATER WASTEWATER SOIL		EL Ext TPH BTEX	1
11 81 81 81 81 81 81 11 11 11 11 11 11 1	1 6/30	2:00	
	6/30	Size XXX Sec	
	- 430		
those for negligence and any other cau final be litable for incidental or consequ out of or related to the performance of	In vriting and received by Cardinal within 30 days at erruptions, loss of use, or loss of profits incurred by such claim is har ad upon any of the above stated	er completion of the applicable Silent, its subsidiaries, assors or otherwise.	
Dates -30 -31	ta Allabert	Verbal Result:	
Received By: Time:		REMARKS:	
Delivered By: (Circle One) Observed Temp. °C 3.7 Sample Cool Sampler - UPS - Bus - Other: Corrected Temp. °C Image: Cool Inta No Image: Cool No Image: Cool No	Sample Condition CHECKED BY: Cool Intact (Initials)	Turnaround Time: Standard A Bacteria (only) Sample Condition Rush Cool Intact Observed Temp. °C Thermometer ID #113 Yes Yes Correction Factor None Nc Nc Corrected Temp. °C	
† Cardinal cannot accept verb	al changes. Please email cha	· .	

.

Page 29 of 36



August 06, 2021

JEFFREY BROOM APACHE CORP - HOBBS 2350 W. MARLAND BLVD. HOBBS, NM 88240

RE: CLFCA

Enclosed are the results of analyses for samples received by the laboratory on 08/02/21 16:56.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-20-13. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/ga/lab_accred_certif.html.

Cardinal Laboratories is accreditated through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Celey D. Keine

Celey D. Keene Lab Director/Quality Manager



APACHE CORP - HOBBS JEFFREY BROOM 2350 W. MARLAND BLVD. HOBBS NM, 88240 Fax To: (575) 393-2432

Received:	08/02/2021	Sampling Date:	08/02/2021
Reported:	08/06/2021	Sampling Type:	Soil
Project Name:	CLFCA	Sampling Condition:	Cool & Intact
Project Number:	CLFCA WATER TRANSFER	Sample Received By:	Tamara Oldaker
Project Location:	NOT GIVEN		

Sample ID: SP 2 @ 15' (H212035-01)

Chloride, SM4500Cl-B	mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	14600	16.0	08/04/2021	ND	432	108	400	3.77	

Sample ID: SP 2 @ 20' (H212035-02)

Chloride, SM4500Cl-B	mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	19000	16.0	08/04/2021	ND	432	108	400	3.77	

Sample ID: SP 2 @ 25' (H212035-03)

Chloride, SM4500Cl-B	mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	15400	16.0	08/04/2021	ND	432	108	400	3.77	

Sample ID: SP 2 @ 30' (H212035-04)

Chloride, SM4500Cl-B	mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	9000	16.0	08/04/2021	ND	432	108	400	3.77	

Cardinal Laboratories

*=Accredited Analyte

Celeg D. Keine

Celey D. Keene, Lab Director/Quality Manager



Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C

Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

Celeg D. Keine

Celey D. Keene, Lab Director/Quality Manager

Page 33 of 36

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Page 4 of 4

Project Manager: Company Name: Project Name: Project #: City: Habos Sampler Name: Project Location: Phone #: Address: Relinquished By: service. In no event shall Cardinal be liable analyses. All claims PLEASE NOTE: Lia **Relinquished By** FOR LAB USE ONLY Sampler - UPS - Bus - Other: t's Delivered By: (Circle One) Lab I.D. 12030 including those 3 4 3 101 East Marland, Hobbs, NM 88240 SP2 000 SP2 200000000000 580 693 (575) 393-2326 FAX (575) 393-2476 Josep . Ducho TOF 0 151 Sample I.D. Boom and Wester any Corrected Temp. °C Observed Temp. °C Time: HISBOW Fax #: Project Owner: State: N.W. Zip: 882KO Time: + Cardinal cannot accept verbal changes. Please email changes to celey keene@cardinallabsnm.com hemalle shall be edy for any claim including without limitation 2.2 (G)RABOR (C)OMP 9999 Received By: Received By: # CONTAINERS GROUNDWATER unless made in writing and received by Cardinal within 30 days after business inte Cool Intact Sample Condition WASTEWATER MATRIX SOIL OIL ions, loss of use, or loss of profits incu SLUDGE State: City: P.O. #: Fax #: Attn: Address OTHER Company: Phone #: ACID/BASE: PRESERV CHECKED BY: (initials) ICE COOL BILL OTHER C Zip: 90 00 00 DATE 10 e 2 0) SAMPLING red by client, its subsi paid by the client for the 12:43 12:50 2.2 12:45 All Results are emailed. Please provide Email address: Thermometer ID #113 Correction Factor None **Turnaround Time:** REMARKS Verbal Result: completion of the applicable TIME c □ Yes Standard Rush ON D ANALYSIS K Add'l Phone #: Cool Intact Bacteria (only) Sample Condition Ves Ves REQUEST Observed Temp. °C Corrected Temp. °C

Released to Imaging: 11/17/2021 3:01:26 PM



CLFCA Water Transfer Line nAPP2114756542 Revegetation And Noxious Weed Plan

Revegetation Plan:

All the disturbed area in the pasture will be properly prepared and reseeded with BLM # 2. The disturbed area will be monitored to ensure successful revegetation is achieved. If revegetation is not successful after a couple of growing seasons the site will be reseeded.

Noxious Weed Plan:

Apache Corporation will treat noxious weeds if they become established within the area of remediation. Weed control will be maintained on the disturbed land where noxious weeds exist both prior to remediation and restoration. Apache Corporation will consult with the Authorized Officer for acceptable weed control methods.

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
APACHE CORPORATION	873
303 Veterans Airpark Ln	Action Number:
Midland, TX 79705	41044
	Action Type:
	[C-141] Release Corrective Action (C-141)

CONDITIONS

Created	Condition	Condition
By		Date
rhamlet	The Remediation Plan is Conditionally Approved. Floor samples will need to have closure samples below 20,000 mg/kg for chlorides. Excavate to 8 ft below surface, back-fill with clean	11/17/2021
	material to 4 ft below surface, install liner, and backfill with clean material to surface. Please make sure all sidewall samples are delineated to 600 mg/kg for chlorides to define the edge of	
	the release. Please collect confirmation samples, representing no more than 200 ft2.	

Page 36 of 36

CONDITIONS

Action 41044

.