

SITE INFORMATION

Closure Report
Thunderbird 14, 18 CTB
Incident ID: nAPP2414552321
Unit P Sec 1 T26S R34E
32.06748203°, -103.4190982°
Lea County, New Mexico

Produced Water Release

Point of Release: Equipment Failure inside the Secondary Containment

Release Date: 05.23.2024

Volume Released: 30 Barrels of Produced Water

Volume Recovered: 30 Barrels of Produced Water

CARMONA RESOURCES



Prepared for: Marathon Oil Corporation 990 Town and Country Blvd, Houston, Texas 77024

Prepared by: Carmona Resources, LLC 310 West Wall Street Suite 500 Midland, Texas 79701



TABLE OF CONTENTS

1.0 SITE INFORMATION AND BACKGROUND

2.0 SITE CHARACTERIZATION AND GROUNDWATER

3.0 NMAC REGULATORY CRITERIA

4.0 LINER INSPECTION ACTIVITIES

5.0 CONCLUSIONS

FIGURES

FIGURE 1 OVERVIEW FIGURE 2 TOPOGRAPHIC

FIGURE 3 SECONDARY CONTAINMENT MAP

APPENDICES

APPENDIX A PHOTOS

APPENDIX B N.O.R. AND FINAL C-141/NMOCD CORRESPONDENCE

APPENDIX C SITE CHARACTERIZATION AND GROUNDWATER



July 1, 2024

New Mexico Oil Conservation Division 1220 South St, Francis Drive Santa Fe, NM 87505

Re: Closure Report

Thunderbird 14, 18 CTB Marathon Oil Corporation Incident ID: nAPP2414552321

Site Location: Unit P, S1, T26S, R34E (Lat 32.06748203°, Long -103.4190982°)

Lea County, New Mexico

To whom it may concern:

On behalf of Marathon Oil Corporation, Carmona Resources, LLC has prepared this letter to document the Thunderbird 14, 18 CTB site activities. The site is located at 32.06748203°, -103.4190982° within Unit P, S1, T26S, R34E, in Lea County, New Mexico (Figures 1 and 2).

1.0 Site Information and Background

Based on the Notice of Release obtained from the New Mexico Oil Conservation Division (NMOCD), the incident was discovered on May 23, 2024, due to equipment failure inside the secondary containment at the water tank. The incident released approximately thirty (30) barrels of produced water, with thirty (30) barrels of produced water recovered. All fluids were contained within the lined facility. See Figure 3. The Notice of Release form is attached in Appendix B.

2.0 Site Characterization and Groundwater

The site is located within a low karst area. Based on a review of the New Mexico Office of State Engineers and USGS databases, no known water sources are within a 0.50-mile radius of the location. The nearest well is located approximately 1.57 miles East of the site in S5, T26S, R35E and was drilled in 2022. The well has a reported groundwater depth of 101' feet below the ground surface (ft bgs). A copy of the associated point of diversion is attached in Appendix C.

3.0 NMAC Regulatory Criteria

Per the NMOCD regulatory criteria established in 19.15.29.12 NMAC, the following criteria were utilized in assessing the site.

- Benzene: 10 milligrams per kilogram (mg/kg).
- Benzene, toluene, ethylbenzene, and total xylenes (BTEX): 50 mg/kg.
- TPH: 100 mg/kg (GRO + DRO + MRO).
- Chloride: 600 mg/kg.

4.0 Liner Inspection Activities

On June 10, 2024, Carmona Resources, LLC conducted liner inspection activities to assess the liner's integrity within the facility. Prior to the liner inspection, the NMOCD division office was notified via web portal on June 6, 2024, per Subsection D of 19.15.29.12 NMAC. See Appendix B. Carmona Resources, LLC personnel inspected the liner visually and found it to be intact with no integrity issues. Refer to the Photolog.



5.0 Conclusions

Based on the liner inspection throughout the facility, no further actions are required at the site. The final C-141 is attached, and Marathon formally requests the closure of the spill. If you have any questions regarding this report or need additional information, please contact us at 432-813-1992.

Sincerely,

Carmona Resources, LLC


Clinton Merritt


Sr. Project Manager


Ashton Thielke Sr. Project Manager

FIGURES

CARMONA RESOURCES

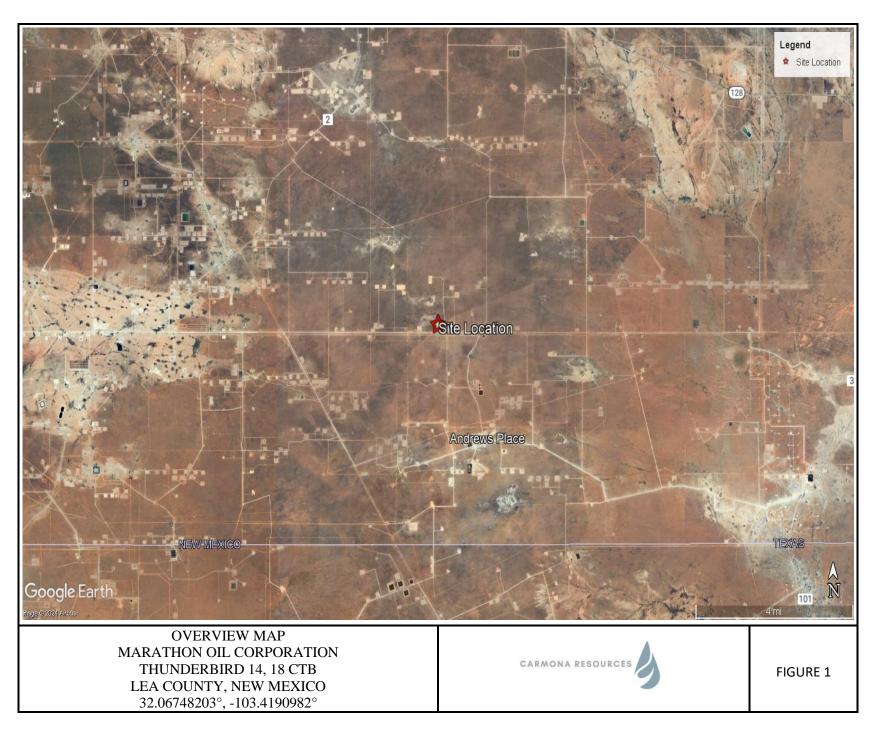

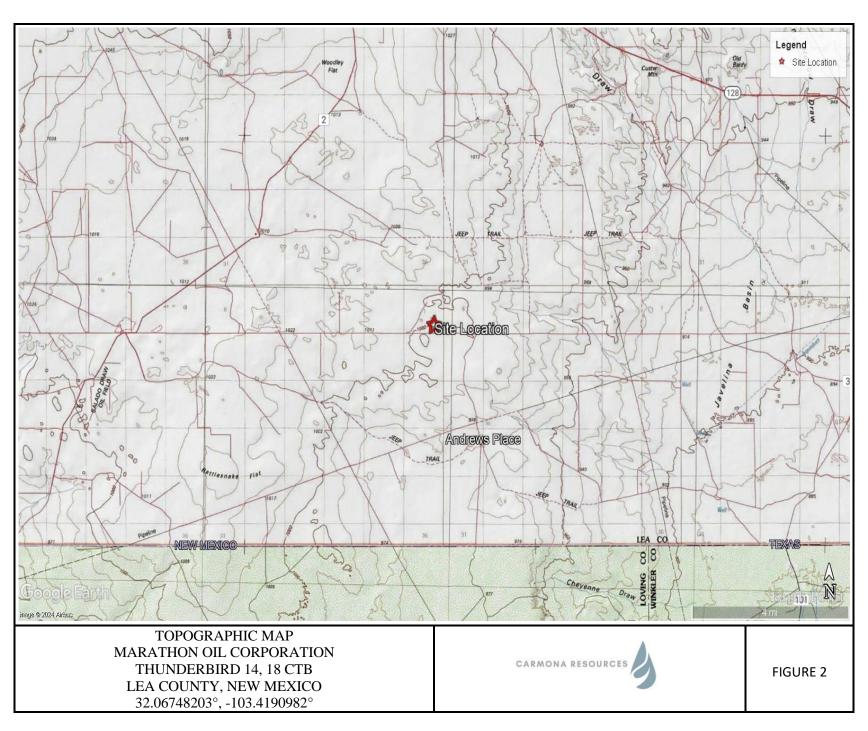

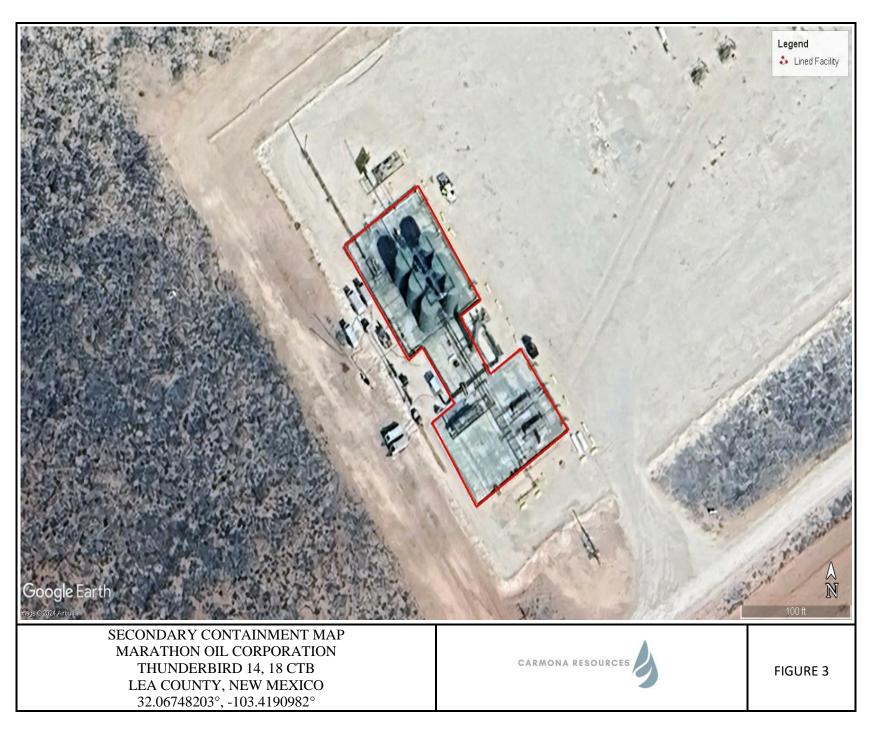

APPENDIX A

CARMONA RESOURCES

PHOTOGRAPHIC LOG

Marathon Oil Corporation


Photograph No. 1

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View South of liner inside facility berm.

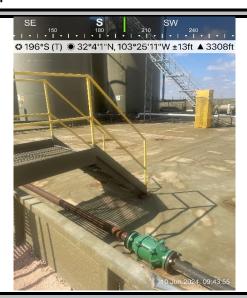


Photograph No. 2

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View South of liner inside facility berm.

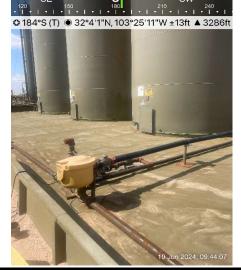

Photograph No. 3

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View Northwest of liner inside facility berm.



PHOTOGRAPHIC LOG

Marathon Oil Corporation

Photograph No. 4

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View Northwest of liner inside facility berm.



Photograph No. 5

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View South of liner inside facility berm.



Photograph No. 6

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View South of liner inside facility berm.



PHOTOGRAPHIC LOG

Marathon Oil Corporation


Photograph No. 7

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View Northwest of liner inside facility berm.

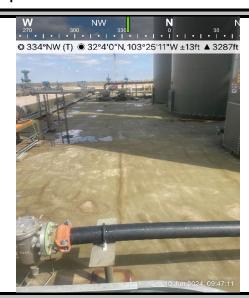

Photograph No. 8

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View South of liner inside facility berm.



Photograph No. 9

Facility: Thunderbird 14, 18 CTB

County: Lea County, NM

Description:

View Southwest of liner inside facility berm.



APPENDIX B

CARMONA RESOURCES

District I 1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

QUESTIONS

Action 347766

QUESTIONS

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	347766
	Action Type:
	[NOTIFY] Notification Of Release (NOR)

QUESTIONS

Location of Release Source		
Please answer all the questions in this group.		
Site Name	Thunderbird 14,18 CTB	
Date Release Discovered	05/23/2024	
Surface Owner	Federal	

Incident Details	
Please answer all the questions in this group.	
Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release		
Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.		
Crude Oil Released (bbls) Details	Not answered.	
Produced Water Released (bbls) Details	Cause: Equipment Failure Production Tank Produced Water Released: 30 BBL Recovered: 30 BBL Lost: 0 BBL.	
Is the concentration of chloride in the produced water >10,000 mg/l	Yes	
Condensate Released (bbls) Details	Not answered.	
Natural Gas Vented (Mcf) Details	Not answered.	
Natural Gas Flared (Mcf) Details	Not answered.	
Other Released Details	Not answered.	
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Not answered.	

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

QUESTIONS, Page 2

Action 347766

QUESTIONS ((continued)

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	347766
	Action Type:
	[NOTIFY] Notification Of Release (NOR)

QUESTIONS

Nature and Volume of Release (continued)	
No, according to supplied volumes this does not appear to be a "gas only" report.	
Yes	
From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.	

Initial Response		
The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.		
The source of the release has been stopped	True	
The impacted area has been secured to protect human health and the environment	True	
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True	
All free liquids and recoverable materials have been removed and managed appropriately	True	
If all the actions described above have not been undertaken, explain why	Not answered.	

Per Paragraph 4 of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see 19.15.29.11(A)(5)(a) NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

Action 347766

ACKNOWLEDGMENTS

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

ACKNOWLEDGMENTS

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	347766
l l	Action Type:
	[NOTIFY] Notification Of Release (NOR)

ACKNOWLEDGMENTS

V	I acknowledge that I am authorized to submit notification of a release on behalf of my operator.
V	I acknowledge that upon submitting this application, I will be creating a new incident file (assigned to my operator) to track the notification(s) and corrective action(s) for a release, pursuant to NMAC 19.15.29.
V	I acknowledge that creating a new incident file will require my operator to file subsequent submission(s) of form "C-141, Application for administrative approval of a release notification and corrective action", pursuant to NMAC 19.15.29.
	I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment.
<u> </u>	I acknowledge the fact that the acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment.
V	I acknowledge the fact that, in addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 347766

CONDITIONS

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	347766
	Action Type:
	[NOTIFY] Notification Of Release (NOR)

CONDITIONS

Created	Condition	Condition
Ву		Date
icastro	When submitting future reports regarding this release, please submit the calculations used or specific justification for the volumes reported on the initial C-141.	5/24/2024

Counties:

SIGN-IN HELP

Searches **Operator Data Hearing Fee Application**

OCD Permitting

Operator Data Action Status Action Search Results Action Status Item Details

[C-141] Initial C-141 (C-141-V-INITIAL) Application

Submission Information

Operator:

Submission ID: 353501

Districts: Hobbs

Description: MARATHON OIL PERMIAN LLC [372098]

> . Thunderbird 14.18 CTB , nAPP2414552321

[372098] MARATHON OIL PERMIAN LLC

APPROVED Status: Status Date: 06/13/2024

References (2): fAPP2228624549, nAPP2414552321

Forms

Attachments: Volume Calculation

Questions

Prerequisites

Incident ID (n#)

NAPP2414552321 THUNDERBIRD 14,18 CTB @ 0 Incident Name

Incident Type Produced Water Release Incident Status Initial C-141 Received

[fAPP2228624549] THUNDERBIRD 1 FED COM TB Incident Facility

Location of Release Source

Please answer all the questions in this group.

Site Name Thunderbird 14,18 CTB

05/23/2024 Date Release Discovered Surface Owner Federal

Incident Details

Please answer all the questions in this group.

Incident Type Produced Water Release

Did this release result in a fire or is the result of a fire No Did this release result in any injuries No Has this release reached or does it have a reasonable probability of reaching a No

watercourse

Has this release endangered or does it have a reasonable probability of endangering

public health

Has this release substantially damaged or will it substantially damage property or the

Is this release of a volume that is or may with reasonable probability be detrimental

to fresh water

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission

Crude Oil Released (bbls) Details

SIGN-IN HELP

Searches Operator Data Hearing Fee Application

Other Released Details

Are there additional details for the questions above (i.e. any answer containing

Not answered.

Not answered.

Nature and Volume of Release (continued)

Is this a gas only submission (i.e. only significant Mcf values reported)

No, acc

Was this a major release as defined by Subsection A of 19.15.29.7 NMAC

Yes

Reasons why this would be considered a submission for a notification of a major

Other, Specify, Unknown, and/or Fire, or any negative lost amounts)

release

No, according to supplied volumes this does not appear to be a "gas only" report.

From paragraph A. "Major release" determine using:

(1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.

With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

True
The impacted area has been scoured to protect human health and the environment
True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices
All free liquids and recoverable materials have been removed and managed appropriately
If all the actions described above have not been undertaken, explain why

Not answered

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission.

If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement

Name: Isaac Castro
Email: icastro@marathonoil.com
Date: 06/12/2024

Site Characterization

Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)

What method was used to determine the depth to ground water

Not answered.

Not answered.

Not answered.

What is the minimum distance, between the closest lateral extents of the release and the following surface areas:

A continuously flowing watercourse or any other significant watercourse Not answered Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) Not answered An occupied permanent residence, school, hospital, institution, or church Not answered A spring or a private domestic fresh water well used by less than five households for Not answered Any other fresh water well or spring Not answered Incorporated municipal boundaries or a defined municipal fresh water well field Not answered A wetland Not answered A subsurface mine Not answered An (non-karst) unstable area Categorize the risk of this well / site being in a karst geology Not answered A 100-year floodplain Not answered Did the release impact areas not on an exploration, development, production, or Not answered storage site

Remediation Plan

Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.

Requesting a remediation plan approval with this submission

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Nο

SIGN-IN HELP

Comments

No comments found for this submission.

Conditions

Summary: menter (9/13/2024), None

Reasons

No reasons found for this submission.

Searches Operator Data Hearing Fee Application

Hearing Fee Application

Conditions

Summary: number (9/13/2024), None

Reasons

No reasons found for this submission.

Mere Merico Energy, Miserelá and Natural Resources Department | Copyright 2012
12/20 South St. Frances Dive | Seria Fe. NM 67502 | P. (505) 478-5200 | F. (505) 478-5200 |

EMNRD Home OCD Main Page OCD Rules Help

QUESTIONS Action 351335

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

Incident Status

Incident Facility

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

	QUESTIONS
Operator: MARATHON OIL PERMIAN LLC	OGRID: 372098
990 Town & Country Blvd. Houston, TX 77024	Action Number: 351335
	Action Type: [NOTIFY] Notification Of Liner Inspection (C-141L)
QUESTIONS	
Prerequisites	
Incident ID (n#)	nAPP2414552321
Incident Name	NAPP2414552321 THUNDERBIRD 14,18 CTB @ 0
Incident Type	Produced Water Release

Location of Release Source				
Site Name	Thunderbird 14,18 CTB			
Date Release Discovered	05/23/2024			
Surface Owner	Federal			

Notification Accepted

[fAPP2228624549] THUNDERBIRD 1 FED COM TB

Liner Inspection Event Information					
Please answer all the questions in this group.					
What is the liner inspection surface area in square feet	20,361				
Have all the impacted materials been removed from the liner	Yes				
Liner inspection date pursuant to Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC	06/10/2024				
Time liner inspection will commence	08:00 AM				

Warning: Notification can not be less than two business days prior to conducting liner inspection.

Please provide any information necessary for observers to liner inspection Clinton Merritt 432-813-9044 From the intersection of CR 205 and Antony Rd, travel west on Antony Rd for 12.3 miles. Turn northeast onto unmarked lease road and travel 0.19 miles. Job site is on the immediate Please provide any information necessary for navigation to liner inspection site northwest side of the unmarked lease road.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 351335

CONDITIONS


Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	351335
	Action Type:
	[NOTIFY] Notification Of Liner Inspection (C-141L)

CONDITIONS

Created By		Condition Date
icastro	Failure to notify the OCD of liner inspections including any changes in date/time per the requirements of 19.15.29.11.A(5)(a)(ii) NMAC, may result in the inspection not being accepted.	6/7/2024

APPENDIX C

CARMONA RESOURCES

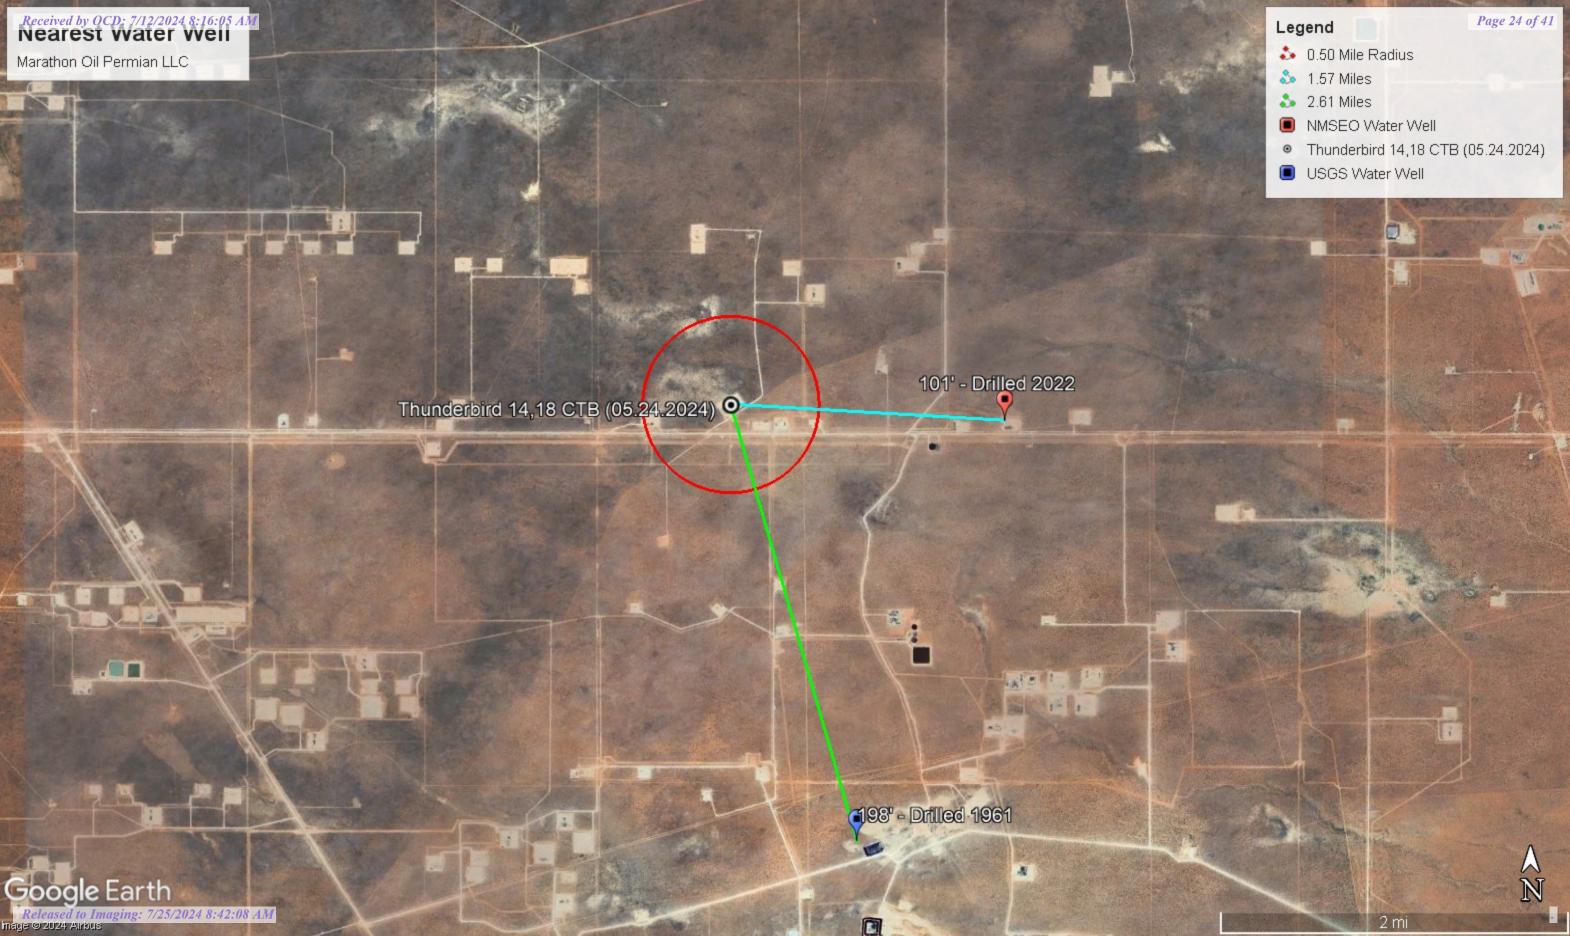





New Mexico Office of the State Engineer Water Column/Average Depth to Water

(A CLW#### in the POD suffix indicates the POD has been replaced & no longer serves a water right file.)

(R=POD has been replaced, O=orphaned, C=the file is

closed)

(quarters are 1=NW 2=NE 3=SW 4=SE)

(quarters are smallest to largest)

(NAD83 UTM in meters)

(In feet)

POD

Sub-QQQ

Code basin County 64 16 4 Sec Tws Rng

Distance

Depth Depth Water **Well Water Column**

C 04601 POD1

POD Number

3 4 3 05 26S 35E

651710 3548919

2488

Average Depth to Water:

Minimum Depth:

Maximum Depth:

Record Count: 1

UTMNAD83 Radius Search (in meters):

Radius: 5000 Easting (X): 649223 Northing (Y): 3549008

The data is furnished by the NMOSE/ISC and is accepted by the recipient with the expressed understanding that the OSE/ISC make no warranties, expressed or implied, concerning the accuracy, completeness, reliability, usability, or suitability for any particular purpose of the data.

OSE DII APR 8 2022 MG:16

ION	OSE POD NO. (WELL NO.) POD1 (TW-1) WELL TAG ID NO.							OSE FILE NO(S). C-4601					
OCAT	WELL OWNE Marathon ((S)					PHONE (OP	TIONAL)				
AND WELL LOCATION	WELL OWNE 4111 S Tid		NG ADDRESS					CITY Carlsbad			STAT	88220	ZIP
9				DEGREES	MINUTES	SECON	DS						
A	WELL	.,		32	3	58		* ACCURA	TV REQUIE	RED: ONE TENT	TH OF	A SECOND	
GENERAL	LOCATIO (FROM GP	(S)	ATITUDE ONGITUDE	103	23	33	N W	* DATUM F	-		morz	ASECOND	
EZ													
1. G	DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS – PLSS (SECTION, TOWNSHJIP, RANGE) WHERE AVAILABLE SE SE Sw Sec. 05 T26S R35E												
	LICENSE NO	١.	NAME OF LICE	NSED DRILLER					NAME	OF WELL DRI	ILLING	COMPANY	
	124	19			Jackie D. Atkins					Atkins Eng	ineeri	ng Associates, I	nc.
	DRILLING S'	TARTED	DRILLING END	ED DEPTH OF C	COMPLETED WELL (FT))	BORE HOI	LE DEPTH (FT) DEPTI	H WATER FIRS	ST ENC	COUNTERED (FT)	
	3/31/2	2022	3/31/2022	1	temporary well		±:	100.8			n	/a	
Z	COMPLETED WELL IS: ARTESIAN PRY HOLE SHALLOW (UNCONFINED)							IC WATER MPLETED		/a	DATE STATIC 1 4/6/2		
TIO	DRILLING FLUID: AIR MUD ADDITIVES – SPECIFY:												
CASING INFORMATION	DRILLING METHOD: ROTARY HAMMER CABLE TOOL OTHER - SPECIFY: H						Iollow Ster	n Auger	CHECK INSTAL	HERE LED	IF PITLESS ADAI	TER IS	
	DEPTH (feet bgl) BORE HOLE			LE CASIN	CASING MATERIAL AND/OR CASIN		CINC		ASING	CA	SING WALL	SLOT	
[G]	FROM TO				GRADE		CONNECTION			DE DIAM.	0.0000000000000000000000000000000000000	HICKNESS	SIZE
ASIN			(inches)		(include each casing string, and note sections of screen)			TYPE (add coupling diameter)		inches)		(inches)	(inches)
	0	100.8	8 ±6.5		Boring								
2. DRILLING &													
LLI													
DRI		"											
7.													
											_		
^ .						\rightarrow			+				
				-		-+					_		
	DEPTH	(feet bgl)	BORE HO	IE 1	LIST ANNULAR SE	AT. MAT	TERIAI A	ND	\dagger	AMOUNT		метно	D OF
AL.	FROM	TO	DIAM. (incl		AVEL PACK SIZE-I					(cubic feet)		PLACEM	1781000
ERL	110								-				
IAT													
R													
ULA													
ANNULAR MATERIAL													
3. A													
FOR	OSE INTER	NAL.US	E					WR	-20 WEL	L RECORD &	& LOC	G (Version 01/2	8/2022)

POD NO.

TRN NO.

WELL TAG ID NO.

PAGE 1 OF 2

26.35.05.343

FILE NO. C - 4

LOCATION

	DEPTH (f	WATER BEARING? (YES / NO)	ESTIMATED YIELD FOR WATER- BEARING ZONES (gpm)						
	0	4	4	Sand, medium/ fine grained poorly graded, Red	Y /N	ZONES (gpin)			
	4	19	15	Sand, medium/ fine grained poorly graded, Tan	Y √N				
	19	101	82	Sand, medium/ fine grained poorly graded, Reddish Brown	Y ✓ N				
					Y N				
					Y N				
ELL					Y N				
F W					Y N				
0 9					Y N				
10					Y N				
OE					Y N				
070					Y N				
4. HYDROGEOLOGIC LOG OF WELL					Y N				
DRC					Y N				
Æ					Y N				
4					Y N				
					Y N				
					Y N				
					Y N				
					Y N				
					Y N				
					Y N				
	METHOD U	SED TO ES	TIMATE YIELD	OF WATER-BEARING STRATA:	TOTAL ESTIMATED				
	PUMF	A	WELL YIELD (gpm):	0.00					
ION	WELL TEST TEST RESULTS - ATTACH A COPY OF DATA COLLECTED DURING WELL TESTING, INCLUDING DISCHARGE METHOD, START TIME, END TIME, AND A TABLE SHOWING DISCHARGE AND DRAWDOWN OVER THE TESTING PERIOD.								
TEST; RIG SUPERVISION	MISCELLA	NEOUS INF	ORMATION:						
PER									
G St					ISE 011 APR 8 2022	อนวิกา เว			
ľ; RI					44.18.10.20.20.22	of the sale sale			
LES	PRINT NAM	E(S) OF DI	RILL RIG SUPER	VISOR(S) THAT PROVIDED ONSITE SUPERVISION OF WELL CON	ISTRUCTION OTHER T	HAN LICENSEE:			
'n	Shane Eldric	lge, Carme	lo Trevino, Can	neron Pruitt					
TURE	CORRECT F	ECORD O	F THE ABOVE D	IES THAT, TO THE BEST OF HIS OR HER KNOWLEDGE AND BEL DESCRIBED HOLE AND THAT HE OR SHE WILL FILE THIS WELL I O DAYS AFTER COMPLETION OF WELL DRILLING:	IEF, THE FOREGOING RECORD WITH THE ST	IS A TRUE AND TATE ENGINEER			
6. SIGNATURE	Jack A	tkins		Jackie D. Atkins	4/7/2022				
		SIGNAT	URE OF DRILLE	R / PRINT SIGNEE NAME	DATE				

FOR OSE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 01/28/20)22)
FILE NO. C-4601- 701	POD NO.	TRN NO. 72104	
LOCATION 25.35.05.343		WELL TAG ID NO. PAGE 2 O	F 2

Mike A. Hamman, P.E. State Engineer



Roswell Office 1900 WEST SECOND STREET ROSWELL, NM 88201

STATE OF NEW MEXICO OFFICE OF THE STATE ENGINEER

Trn Nbr:

721041

File Nbr:

C 04601

Well File Nbr: C 04601 POD1

Apr. 08, 2022

MELODIE SANJARI MARATHON OIL 4111 S TIDWELL RD CARLSBAD, NM 88220

Greetings:

The above numbered permit was issued in your name on 03/10/2022.

The Well Record was received in this office on 04/08/2022, stating that it had been completed on 03/31/2022, and was a dry well. The well is to be plugged according to 19.27.4.30 NMAC.

Please note that another well can be drilled under this permit if the well is completed and the well log filed on or before 03/10/2023.

If you have any questions, please feel free to contact us.

Sincerely,

Maret Amaral (575) 622 - 6521

drywell



2904 W 2nd St. Roswell, NM 88201 voice: 575.624.2420 fax: 575.624.2421 www.atkinseng.com

08/016/2021

DII-NMOSE 1900 W 2nd Street Roswell, NM 88201

Hand Delivered to the DII Office of the State Engineer

Re: Well Record C-4601 Pod1

Grown Modelin

To whom it may concern:

Attached please find a well log & record and a plugging record, in duplicate, for a one (1) soil borings, C-4601 Pod1.

If you have any questions, please contact me at 575.499.9244 or lucas@atkinseng.com.

Sincerely,

Lucas Middleton

Enclosures:

as noted above

OSE DIT APR 8 2022 PM3:15



Click to hideNews Bulletins

- How are we doing? We want to hear from you. Take our quick survey to tell us what you think.
- Explore the NEW <u>USGS National Water Dashboard</u> interactive map to access real-time water data from over 13,500 stations nationwide.
- Full News 🔊

Groundwater levels for New Mexico

Click to hide state-specific text

Important: <u>Next Generation Monitoring Location Page</u>

Search Results -- 1 sites found

Agency code = usgs site_no list =

• 320150103235501

Minimum number of levels = 1

Table of data

Tab-separated data

Save file of selected sites to local disk for future upload

USGS 320150103235501 26S.35E.19.142

Lea County, New Mexico Latitude 32°01'53", Longitude 103°24'25" NAD27 Land-surface elevation 3,190 feet above NGVD29

This well is completed in the Other aquifers (N9999OTHER) national aquifer.

Output formats

Graph of data										
Reselect pe	leselect period									
Date	Time	? Water- level date- time accuracy	? Parameter code	Water level, feet below land surface	Water level, feet above specific vertical datum	Referenced vertical datum	? Status	? Method of measurement	? Measuring agency	? Source (measure
1961-12-2	20	D	62610		2992.00	NGVD29	1	0	USGS	
1961-12-2	20	D	62611		2993.51	NAVD88	1	0	USGS	
1961-12-2	20	D	72019	198.00			1	0	USGS	

Ex	pla	nat	ion

Section	Code	Description
Water-level date-time accuracy	D	Date is accurate to the Day
Parameter code	62610	Groundwater level above NGVD 1929, feet
Parameter code	62611	Groundwater level above NAVD 1988, feet
Parameter code	72019	Depth to water level, feet below land surface
Referenced vertical datum	NAVD88	North American Vertical Datum of 1988
Referenced vertical datum	NGVD29	National Geodetic Vertical Datum of 1929
Status	1	Static

Date	te f	Time	? Water-level date-time accuracy	? Parameter code	Water level, feet below land surface	Water level, feet above specific vertical datum	Referenced vertical datum	?
------	------	------	---	------------------------	---	---	---------------------------------	---

Questions or Comments
Automated retrievals
Help
Data Tips
Explanation of terms
Subscribe for system changes
News

Accessibility

FOIA

Privacy

Policies and Notices

<u>U.S. Department of the Interior</u> | <u>U.S. Geological Survey</u> **Title: Groundwater for New Mexico: Water Levels**

URL: https://nwis.waterdata.usgs.gov/nm/nwis/gwlevels?

Page Contact Information: <u>New Mexico Water Data Maintainer</u> Page Last Modified: 2023-09-17 16:42:33 EDT

0.28 0.24 nadww02



FEMA National Flood Hazard Layer (NFHL)




Bureau of Land Management, Texas Parks & Wildlife, Esri, HERE, Garmin, INCREMENT P, USGS, METI/NASA, EPA, USDA

FEMA National Flood Hazard Layer (NFHL)

NFHL Water Lines Flood Hazard Boundaries Limit Lines NP SFHA / Flood Zone Boundary Flowage Easement Boundary Flood Hazard Zones 1% Annual Chance Flood Hazard Regulatory Floodway Special Floodway Area of Undetermined Flood Hazard 0.2% Annual Chance xe Rd Flood Hazard Future Conditions 1% Annual Chance Flood Hazard Area with Reduced Risk Due to Levee Area with Risk Due to Levee esri FEMA flood layer 0.3mi

Maxar | Esri Community Maps Contributors, Texas Parks & Wildlife, © OpenStreetMap, Microsoft, CONANP, Esri, TomTom, Garmin, SafeGraph, GeoTechnologies, Inc, METI/NASA, USGS, EPA, NPS, US Census Bureau, USDA, USFWS

Thunderbird 14,18 CTB (05.24.2024)

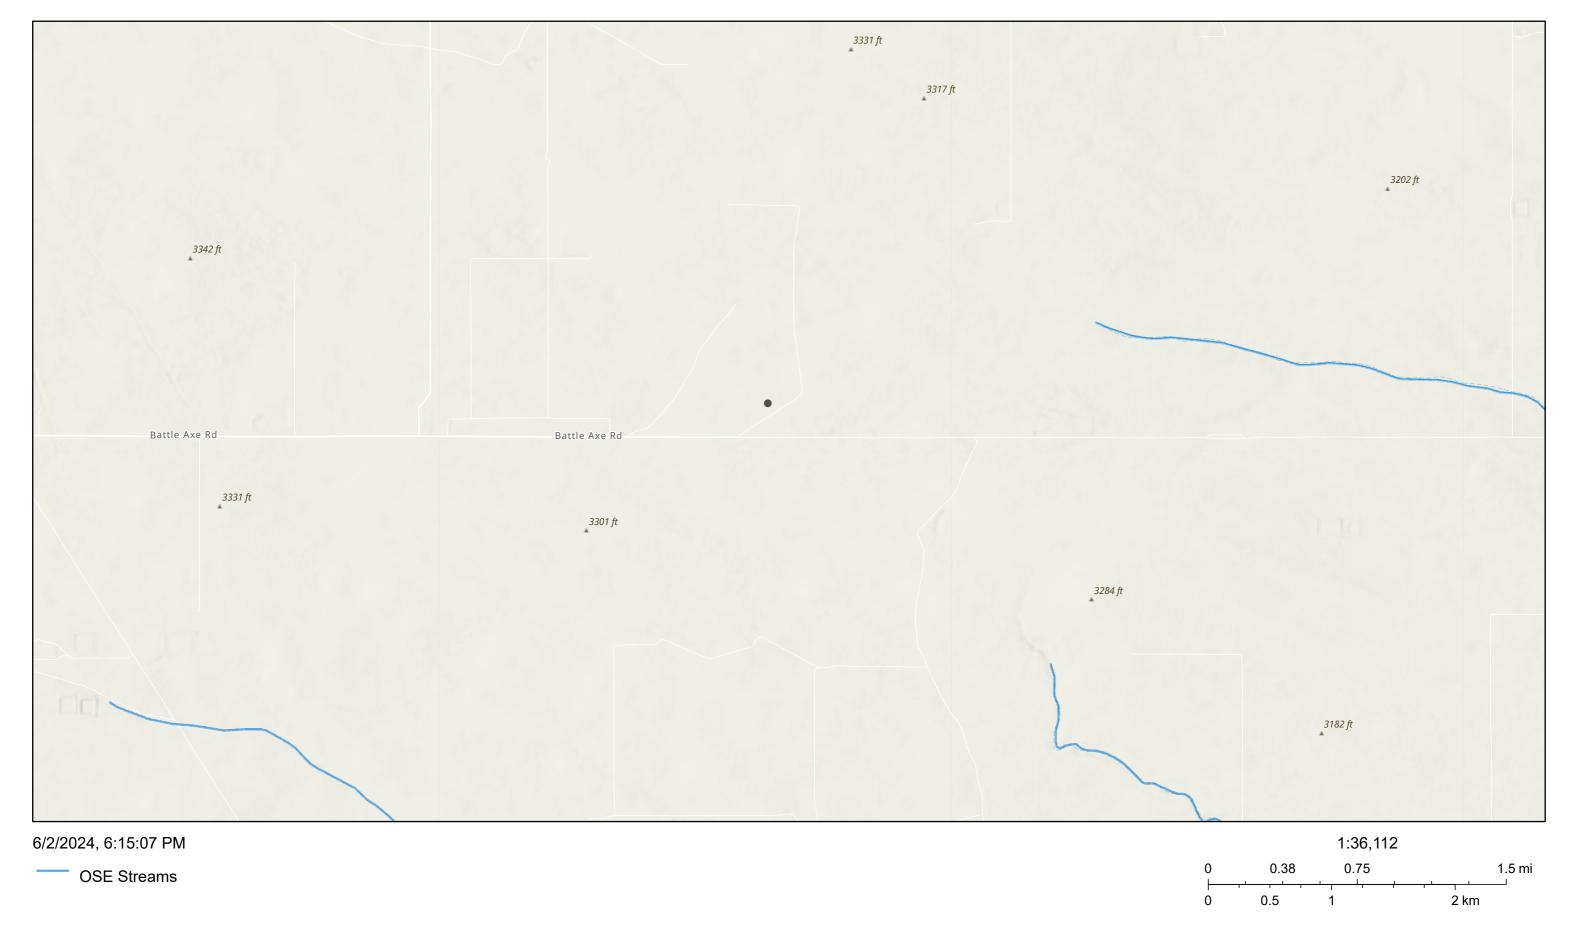

Esri, NASA, NGA, USGS, FEMA, Texas Parks & Wildlife, CONANP, Esri, TomTom, Garmin, SafeGraph, GeoTechnologies, Inc, METI/NASA, USGS, EPA, NPS, US Census Bureau, USDA, USFWS, NM OSE

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

QUESTIONS

Action 360074

QUESTIONS

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	360074
	Action Type:
	[C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2414552321
Incident Name	NAPP2414552321 THUNDERBIRD 14,18 CTB @ 0
Incident Type	Produced Water Release
Incident Status	Remediation Closure Report Received
Incident Facility	[fAPP2228624549] THUNDERBIRD 1 FED COM TB

Location of Release Source	
Please answer all the questions in this group.	
Site Name	Thunderbird 14,18 CTB
Date Release Discovered	05/23/2024
Surface Owner	Federal

Incident Details	
Please answer all the questions in this group.	
Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

rude Oil Released (bbls) Details	Not answered.
roduced Water Released (bbls) Details	Cause: Equipment Failure Production Tank Produced Water Released: 30 BBL Recovered: 30 BBL Lost: 0 BBL.
the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Spill was contained inside lined secondary containment. Liner was pressure washed an fluids recovered.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

QUESTIONS, Page 2

Action 360074

QUEST	IONS (continued)	
Operator: MARATHON OIL PERMIAN LLC 990 Town & Country Blvd. Houston, TX 77024	OGRID: 372098 Action Number: 360074 Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)	
QUESTIONS		
Nature and Volume of Release (continued)		
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.	
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	Yes	
Reasons why this would be considered a submission for a notification of a major release	From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.	
With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.	e. gas only) are to be submitted on the C-129 form.	
nitial Response		
The response The responsible party must undertake the following actions immediately unless they could create a s	safety hazard that would result in injury.	
The source of the release has been stopped	True	
The impacted area has been secured to protect human health and the environment	True	
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True	
All free liquids and recoverable materials have been removed and managed appropriately	True	
If all the actions described above have not been undertaken, explain why	Not answered.	
	i lation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of ted or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of evaluation in the follow-up C-141 submission.	
to report and/or file certain release notifications and perform corrective actions for release	knowledge and understand that pursuant to OCD rules and regulations all operators are required ases which may endanger public health or the environment. The acceptance of a C-141 report by adequately investigate and remediate contamination that pose a threat to groundwater, surface	

water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or

Name: Isaac Castro

Date: 07/12/2024

Email: icastro@marathonoil.com

local laws and/or regulations.

I hereby agree and sign off to the above statement

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

QUESTIONS, Page 3

Action 360074

QUESTIONS (continued)

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	360074
	Action Type:
	[C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Site Characterization		
Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.		
What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)	
What method was used to determine the depth to ground water	NM OSE iWaters Database Search	
Did this release impact groundwater or surface water	No	
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:		
A continuously flowing watercourse or any other significant watercourse	Between 1 and 5 (mi.)	
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Greater than 5 (mi.)	
An occupied permanent residence, school, hospital, institution, or church	Greater than 5 (mi.)	
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Greater than 5 (mi.)	
Any other fresh water well or spring	Greater than 5 (mi.)	
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)	
A wetland	Greater than 5 (mi.)	
A subsurface mine	Greater than 5 (mi.)	
An (non-karst) unstable area	Greater than 5 (mi.)	
Categorize the risk of this well / site being in a karst geology	Low	
A 100-year floodplain	Greater than 5 (mi.)	
Did the release impact areas not on an exploration, development, production, or storage site	No	

Remediation Plan		
Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.		
Requesting a remediation plan approval with this submission	Yes	
Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.		
Have the lateral and vertical extents of contamination been fully delineated	Yes	
Was this release entirely contained within a lined containment area	Yes	
Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.		
On what estimated date will the remediation commence	06/10/2024	
On what date will (or did) the final sampling or liner inspection occur	06/10/2024	
On what date will (or was) the remediation complete(d)	06/10/2024	
What is the estimated surface area (in square feet) that will be remediated	0	
What is the estimated volume (in cubic yards) that will be remediated	0	
These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.		

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to

significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

Released to Imaging: 7/25/2024 8:42:08 AM

District I

1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 **District II**

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 **District III**

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462 State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 360074

QUESTIONS (continued)

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	360074
	Action Type:
	[C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Remediation Plan (continued)	
Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.	
This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:	
(Select all answers below that apply.)	
Is (or was) there affected material present needing to be removed	Yes
Is (or was) there a power wash of the lined containment area (to be) performed	Yes
OTHER (Non-listed remedial process) No	
Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC.	

Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC which includes the anticipated timelines for beginning and completing the remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement

Name: Isaac Castro
Email: icastro@marathonoil.com
Date: 07/12/2024

The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.

District I

1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 **District II**

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 **District III**

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 **District IV**

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

QUESTIONS, Page 6

Action 360074

QUESTIONS (continued)

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	360074
	Action Type:
	[C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Liner Inspection Information		
Last liner inspection notification (C-141L) recorded	351335	
Liner inspection date pursuant to Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC	06/10/2024	
Was all the impacted materials removed from the liner	Yes	
What was the liner inspection surface area in square feet	20361	

Remediation Closure Request			
Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.			
Requesting a remediation closure approval with this submission	Yes		
Have the lateral and vertical extents of contamination been fully delineated	Yes		
Was this release entirely contained within a lined containment area	Yes		
What was the total surface area (in square feet) remediated	0		
What was the total volume (cubic yards) remediated	0		
Summarize any additional remediation activities not included by answers (above)	On June 10, 2024, Carmona Resources, LLC conducted liner inspection activities to assess the liner's integrity within the facility. Prior to the liner inspection, the NMOCD division office was notified via web portal on June 6, 2024, per Subsection D of 19.15.29.12 NMAC. See Appendix B. Carmona Resources, LLC personnel inspected the liner visually and found it to be intact with no integrity issues.		

The responsible party must attach information demonstrating they have complied with all applicable closure requirements and any conditions or directives of the OCD. This demonstration should be in the form of a comprehensive report (in .pdf format) including a scaled site map, sampling diagrams, relevant field notes, photographs of any excavation prior to backfilling, laboratory data including chain of custody documents of final sampling, and a narrative of the remedial activities. Refer to 19.15.29.12 NMAC.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. The responsible party acknowledges they must substantially restore, reclaim, and re-vegetate the impacted surface area to the conditions that existed prior to the release or their final land use in accordance with 19.15.29.13 NMAC including notification to the OCD when reclamation and re-vegetation are complete.

Name: Isaac Castro
Email: icastro@marathonoil.com
Date: 07/12/2024

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 360074

CONDITIONS

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	360074
	Action Type:
	[C-141] Remediation Closure Request C-141 (C-141-v-Closure)

CONDITIONS

Created By	$^{\prime}$	Condition Date
rhamlet	We have received your Remediation Closure Report for Incident #NAPP2414552321 THUNDERBIRD 14,18 CTB, thank you. This Remediation Closure Report is approved.	7/25/2024