


District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

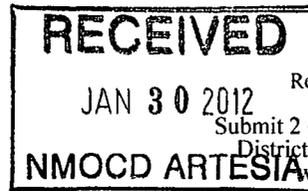

Form C-141  
Revised October 10, 2003  
Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

30-015-34877

**Release Notification and Corrective Action**

NMLB 1204534263

**OPERATOR**

Initial Report  Final Report

Name of Company BOPCO, L.P.	260737	Contact Tony Savoie
Address 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220		Telephone No. 432-556-8730
Facility Name Poker Lake Unit #261		Facility Type E&P

Surface Owner Federal	Mineral Owner Federal	Lease No. NMLC-068431
-----------------------	-----------------------	-----------------------

**LOCATION OF RELEASE**

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
J	21	24S	30E	1980	South	1880	East	Eddy

Latitude N 32.201420 Longitude W 103.883103

**NATURE OF RELEASE**

Type of Release: Produced water and crude oil	Volume of Release: 700 bbls of crude oil and 10 bbls of produced water	Volume Recovered: 600 bbls total fluid
Source of Release: Temporary Gas Purge Tank.	Date and Hour of Occurrence: 1/19/12 Approximately 8:00 p.m.	Date and Hour of Discovery: 1/19/12 12:00 a.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Emergency Phone extension #104	
By Whom? Tony Savoie	Date and Hour 1/20/12 10:26 a.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.\*

Describe Cause of Problem and Remedial Action Taken.\* A new well was brought onto the production at the PLU-261 battery, the new well went on gas surge and pushed all of the oil out of the production vessels into a temporary gas purge tank which overflowed. The well was shut in and the gas problem was corrected.

Describe Area Affected and Cleanup Action Taken.\*The area around the lined tank containment was enclosed with an earthen berm which kept all of the spilled fluid on the well pad and tank battery pad. An area measuring approximately 18,000 sq. ft. was affected by the spill. The free oil was recovered with a vacuum truck and the heavily saturated soil around the process vessels and lines was hand dug and stockpiled on-site. A sampling event is scheduled for the week of 1/30/12 to determine the vertical extent around the process equipment and under the lined containment. The Site remediation for the produced water and crude oil spill will follow the NMOCD guidelines for leaks and spills.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Tony Savoie</i>	<b>OIL CONSERVATION DIVISION</b>	
Printed Name: Tony Savoie	Approved by District Supervisor Signed By <i>Mike Bernice</i>	
Title: Waste Mgmt. & Remediation Specialist	Approval Date: FEB 14 2012	Expiration Date:
E-mail Address: TASavoie@BassPet.com	Conditions of Approval: Remediation per OCD Rules & Guidelines. <b>SUBMIT REMEDIATION PROPOSAL NOT LATER THAN:</b> <u>3/14/12</u>	Attached <input type="checkbox"/>
Date: 1/30/12 Phone: 432-556-8730		

\* Attach Additional Sheets If Necessary

*2 RP-1012*