


Release/Excavation/Sample Area
95' X 95'
(12" of impacted soils removed)

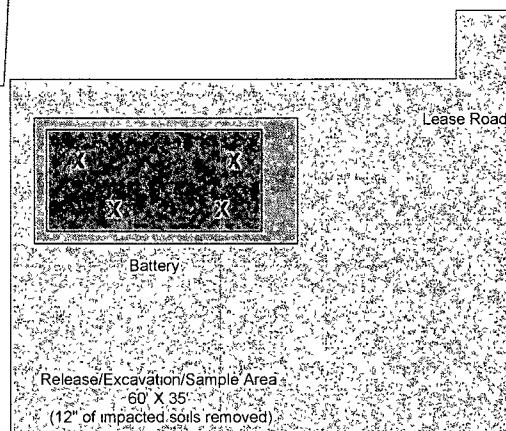

Analytical Report- 425878 & 425879	Sample Area	Sample Date	Sample Type	Depth	BTEX	GRO	DRO	TOTAL	Chlorides
Comp-01.0 B	Release Area	8/12/2011	Comp/Auger	12" (24" BSL)	ND	ND	ND	ND	6010
Comp-02.0 B	Release Area	8/12/2011	Comp/Auger	24" (36" BSL)	ND	ND	ND	ND	3440
Comp-01.0 ES	Release Area	8/12/2011	Comp/Auger	12" (24" BSL)	ND	ND	ND	ND	11500
Comp-02.0 ES	Release Area	8/12/2011	Comp/Auger	24" (36" BSL)	ND	ND	ND	ND	14800
Analytical Report- 42961.1	Sample Area	Sample Date	Sample Type	Depth	BTEX	GRO	DRO	TOTAL	Chlorides
Comp-03.0 B	Release Area	10/11/2011	Comp/Backhoe	3' (4' BSL)					96.4
Comp-04.0 B	Release Area	10/11/2011	Comp/Backhoe	4' (5' BSL)					317
Comp-05.0 B	Release Area	10/11/2011	Comp/Backhoe	5' (6' BSL)					21.9
Comp-03.0 ES	Release Area	10/11/2011	Comp/Backhoe	3' (4' BSL)					10500
Comp-04.0 ES	Release Area	10/11/2011	Comp/Backhoe	4' (5' BSL)					11700
Comp-05.0 ES	Release Area	10/11/2011	Comp/Backhoe	5' (6' BSL)					9230
Analytical Report- 431732	Sample Area	Sample Date	Sample Type	Depth	BTEX	GRO	DRO	TOTAL	Chlorides
Comp-06.0 ES	Release Area	11/16/2011	Comp/Backhoe	6' (7' BSL)					8970
Comp-07.0 ES	Release Area	11/16/2011	Comp/Backhoe	7' (8' BSL)					4610
Comp-08.0 ES	Release Area	11/16/2011	Comp/Backhoe	8' (9' BSL)					5650
Comp-09.0 ES	Release Area	11/16/2011	Comp/Backhoe	9' (10' BSL)					2320

Site Ranking is Ten (10). Depth to Ground Water 50-99' (approx. 70', per Trend Map).

All results are ppm. X - Sample Points BLS - Below Surface Level

Released: 80 B/PW; Recovered: 0 B/PW. Release Date: 6/2/2011



Humidor BMJ State Com.#1

30-015-32889

Section 23, T24S-R27E

Eddy County, NM

SAMPLE DIAGRAM(Not to Scale)

Prepared by Robert Asher
Environmental Regulatory Agent