


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

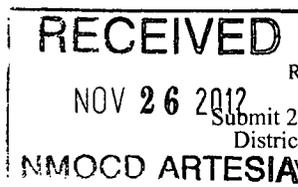

Form C-141
Revised October 10, 2003
Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Release Notification and Corrective Action

1233239870 OPERATOR Initial Report Final Report

Name of Company Yates Petroleum Corporation	OGRID Number 25575	Contact Jeremy Haass
Address 104 S. 4 TH Street	Telephone No. 575-748-1471	
Facility Name Dayton Water Line	API Number 30-015-25677	Facility Type Water Line <u>White IU #2</u>
Surface Owner State	Mineral Owner Fee	Lease No. N/A

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
P	28	18S	26E	990	South	330	East	Eddy

Latitude 32.71425 Longitude 104.37910

NATURE OF RELEASE

Type of Release Produced Water	Volume of Release 85 B/PW	Volume Recovered 80 B/PW
Source of Release Water Line	Date and Hour of Occurrence 11/20/2012 AM	Date and Hour of Discovery 11/20/2012 AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher, NMOCD II	
By Whom? Jeremy Haass, Yates Petroleum Corporation	Date and Hour 11/21/2012 AM (email)	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	
If a Watercourse was Impacted, Describe Fully.* N/A		
Describe Cause of Problem and Remedial Action Taken.* Water surfaced alongside Lakewood Rd. Pipe was isolated then dug up. Vac Truck was called and pipe was patched.		
Describe Area Affected and Cleanup Action Taken.* An approximate area of 10' X 30', alongside Lakewood Rd. Vacuum truck called to pick up remaining produced water, impacted soils to be scraped up and taken to an NMOCD approved facility. Vertical and horizontal delineation samples will be taken and analysis ran for TPH & BTEX, Chlorides will be run for documentation. If initial analytical results for TPH & BTEX are under RRAL's a Final Report, C-141 will be submitted to the OCD requesting closure. If the analytical results are above the RRAL's a work plan will be submitted. Depth to Ground Water: 50-99' (approximately 90', Section 28-T18S-R26E, per NMOSE), Wellhead Protection Area: No, Distance to Surface Water Body: >1000', SITE RANKING IS 10.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		

Signature:	OIL CONSERVATION DIVISION	
Printed Name: Jeremy Haass	Approved by District Supervisor:	Signed By:
Title: Environmental Regulatory Agent	Approval Date: <u>NOV 27 2012</u>	Expiration Date:
E-mail Address: jhaass@yatespetroleum.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: Monday, November 26, 2012 Phone: 575-748-1471	Remediation per OCD Rules & Guidelines. SUBMIT REMEDIATION PROPOSAL NOT LATER THAN: <u>Dec. 27th 2012</u>	

* Attach Additional Sheets If Necessary

2RP-1424

Bratcher, Mike, EMNRD

From: Jeremy Haass <Jhaass@yatespetroleum.com>
Sent: Wednesday, November 21, 2012 10:05 AM
To: Bratcher, Mike, EMNRD; Dade, Randy, EMNRD
Cc: Lisa Norton; Jerry Fanning; Katie Parker; Bob Asher; Amanda Trujillo; Amber Cannon; Lupe Carrasco
Subject: Release: Dayton Water Line

Yates Petroleum Corporation is reporting a release at the following location (11/20/2012).

Dayton Water Line
Section 34, T18S-R26E
Eddy County, New Mexico

Released: 85 B/PW; Recovered: 80 B/PW.

Release was from a 4" main water line that runs along Lakewood Rd. between Kincaid Ranch Rd. and Dayton Rd. Line was dug up and patched last night.

A Form C-14I Initial Report will be submitted with complete information.

Thank you.

Jeremy Haass

Environmental Regulatory Agent
Yates Petroleum Corporation
Office: (575) 748-4311
Fax: (575) 748-4131
Cell: (575) 513-9235

This message may contain confidential information and is intended for the named recipient only. If you are not the intended recipient you are notified that disclosing, copying, distributing or taking any action in reliance on the contents of this information is strictly prohibited. E-mail transmission cannot be guaranteed to be secure or error-free as information could be intercepted, corrupted, lost, destroyed, arrive late or incomplete, or contain viruses. The sender therefore does not accept liability for any errors or omissions in the contents of this message, which arise as a result of e-mail transmission. If verification is required please request a hard-copy version.
