

Bratcher, Mike, EMNRD

From: Miller, Gary [Gary.Miller@tetrattech.com]
Sent: Wednesday, October 28, 2009 3:12 PM
To: Bratcher, Mike, EMNRD
Subject: Unit Gourley fed Borehole samples
Attachments: Bore hole locations and results.pdf

Mike, please give me a call so we can review. thanks

Gary E. Miller | Office Manager and Senior Project Manager
Main: 432.682.4559 | Cell: 432.557.4681 | Fax: 432.682.3946
Gary.Miller@tetrattech.com

Tetra Tech Inc.
1910 North Big Spring | Midland, TX 79705 | www.tetrattech.com

PLEASE NOTE: This message, including any attachments, may include privileged, confidential and/or inside information. Any distribution or use of this communication by anyone other than the intended recipient is strictly prohibited and may be unlawful. If you are not the intended recipient, please notify the sender by replying to this message and then delete it from your system.

This inbound email has been scanned for malicious software and transmitted safely to you using Webroot Email Security.



TETRA TECH

CLIENT _____

DATE _____

JOB TITLE _____


JOB NUMBER _____

SUBJECT _____

BY _____

SHEET _____

of _____

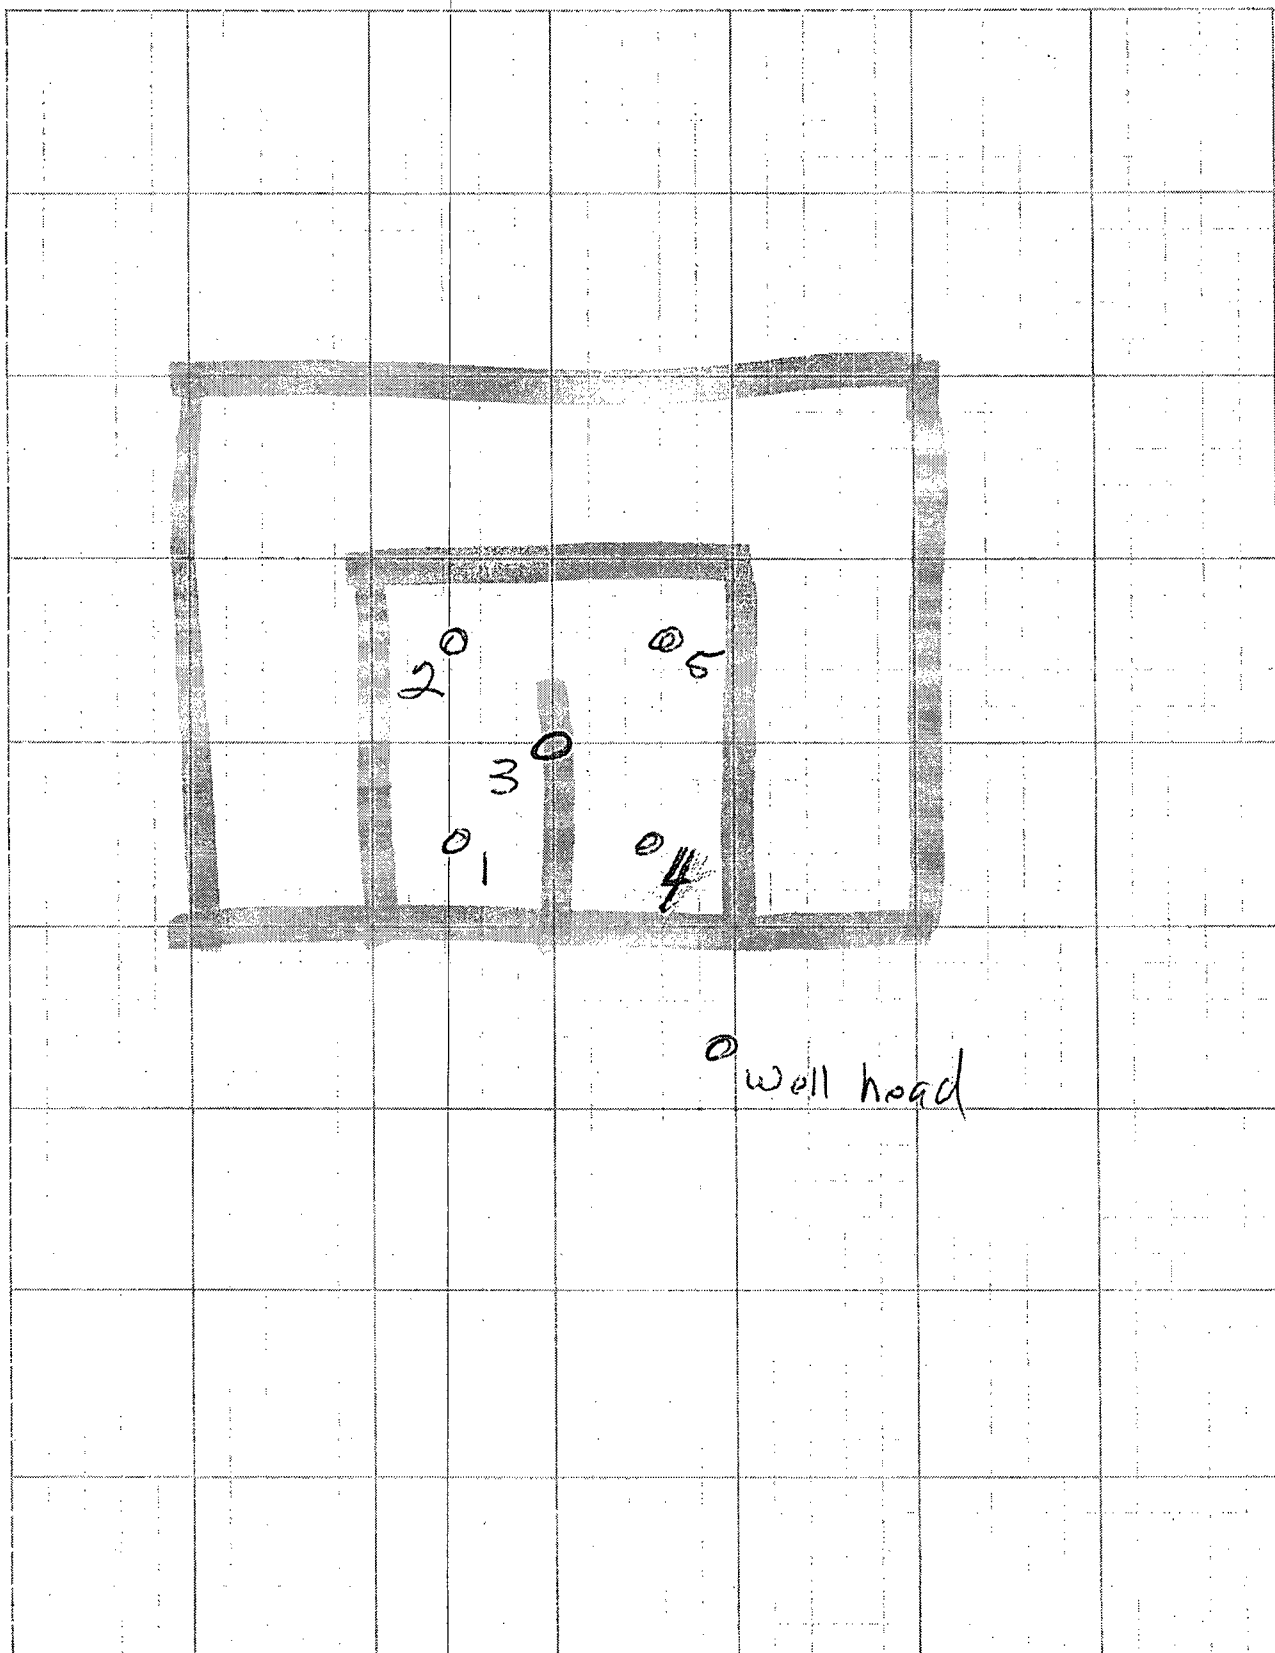

Summary Report

Jeff Kindley
Tetra Tech
1910 N. Big Spring Street
Midland, TX 79705

Report Date: October 28, 2009

Work Order: 9102801



Project Location: Eddy Co., NM
Project Name: Gourley Fed. #3
Project Number: 115-6403654

Sample	Description	Matrix	Date Taken	Time Taken	Date Received
213181	SB-1 (5')	soil	2009-10-26	00:00	2009-10-27
213182	SB-1 (10')	soil	2009-10-26	00:00	2009-10-27
213183	SB-1 (15')	soil	2009-10-26	00:00	2009-10-27
213184	SB-1 (20')	soil	2009-10-26	00:00	2009-10-27
213185	SB-1 (25')	soil	2009-10-26	00:00	2009-10-27
213186	SB-1 (30')	soil	2009-10-26	00:00	2009-10-27
213187	SB-2 (5')	soil	2009-10-26	00:00	2009-10-27
213188	SB-2 (10')	soil	2009-10-26	00:00	2009-10-27
213189	SB-2 (15')	soil	2009-10-26	00:00	2009-10-27
213190	SB-2 (20')	soil	2009-10-26	00:00	2009-10-27
213191	SB-2 (25')	soil	2009-10-26	00:00	2009-10-27
213192	SB-2 (30')	soil	2009-10-26	00:00	2009-10-27
213193	SB-3 (5')	soil	2009-10-26	00:00	2009-10-27
213194	SB-3 (10')	soil	2009-10-26	00:00	2009-10-27
213195	SB-3 (15')	soil	2009-10-26	00:00	2009-10-27
213196	SB-3 (20')	soil	2009-10-26	00:00	2009-10-27
213197	SB-3 (25')	soil	2009-10-26	00:00	2009-10-27
213198	SB-3 (30')	soil	2009-10-26	00:00	2009-10-27
213199	SB-4 (5')	soil	2009-10-27	00:00	2009-10-27
213200	SB-4 (10')	soil	2009-10-27	00:00	2009-10-27
213201	SB-4 (15')	soil	2009-10-27	00:00	2009-10-27
213202	SB-4 (20')	soil	2009-10-27	00:00	2009-10-27
213203	SB-4 (25')	soil	2009-10-27	00:00	2009-10-27
213204	SB-4 (30')	soil	2009-10-27	00:00	2009-10-27
213205	SB-5 (5')	soil	2009-10-27	00:00	2009-10-27
213206	SB-5 (10')	soil	2009-10-27	00:00	2009-10-27
213207	SB-5 (15')	soil	2009-10-27	00:00	2009-10-27
213208	SB-5 (20')	soil	2009-10-27	00:00	2009-10-27
213209	SB-5 (25')	soil	2009-10-27	00:00	2009-10-27
213210	SB-5 (30')	soil	2009-10-27	00:00	2009-10-27

TraceAnalysis, Inc. • 6701 Aberdeen Ave., Suite 9 • Lubbock, TX 79424-1515 • (806) 794-1296

This is only a summary. Please, refer to the complete report package for quality control data.

Report Date: October 28, 2009

Work Order: 9102801

Page Number: 2 of 5

Sample: 213181 - SB-1 (5')

Param	Flag	Result	Units	RL
Chloride		4570	mg/Kg	4.00

Sample: 213182 - SB-1 (10')

Param	Flag	Result	Units	RL
Chloride		2340	mg/Kg	4.00

Sample: 213183 - SB-1 (15')

Param	Flag	Result	Units	RL
Chloride		2360	mg/Kg	4.00

Sample: 213184 - SB-1 (20')

Param	Flag	Result	Units	RL
Chloride		2280	mg/Kg	4.00

Sample: 213185 - SB-1 (25')

Param	Flag	Result	Units	RL
Chloride		584	mg/Kg	4.00

Sample: 213186 - SB-1 (30')

Param	Flag	Result	Units	RL
Chloride		1450	mg/Kg	4.00

Sample: 213187 - SB-2 (5')

Param	Flag	Result	Units	RL
Chloride		5030	mg/Kg	4.00

Sample: 213188 - SB-2 (10')

Param	Flag	Result	Units	RL
Chloride		1650	mg/Kg	4.00

Report Date: October 28, 2009

Work Order: 9102801

Page Number: 3 of 5

Sample: 213189 - SB-2 (15')

Param	Flag	Result	Units	RL
Chloride		3570	mg/Kg	4.00

Sample: 213190 - SB-2 (20')

Param	Flag	Result	Units	RL
Chloride		5650	mg/Kg	4.00

Sample: 213191 - SB-2 (25')

Param	Flag	Result	Units	RL
Chloride		4570	mg/Kg	4.00

Sample: 213192 - SB-2 (30')

Param	Flag	Result	Units	RL
Chloride		8860	mg/Kg	4.00

Sample: 213193 - SB-3 (5')

Param	Flag	Result	Units	RL
Chloride		5230	mg/Kg	4.00

Sample: 213194 - SB-3 (10')

Param	Flag	Result	Units	RL
Chloride		3340	mg/Kg	4.00

Sample: 213195 - SB-3 (15')

Param	Flag	Result	Units	RL
Chloride		2530	mg/Kg	4.00

Sample: 213196 - SB-3 (20')

Param	Flag	Result	Units	RL
Chloride		2170	mg/Kg	4.00

Sample: 213197 - SB-3 (25')

Param	Flag	Result	Units	RL
Chloride		4580	mg/Kg	4.00

Sample: 213198 - SB-3 (30')

Param	Flag	Result	Units	RL
Chloride		6940	mg/Kg	4.00

Sample: 213199 - SB-4 (5')

Param	Flag	Result	Units	RL
Chloride		4020	mg/Kg	4.00

Sample: 213200 - SB-4 (10')

Param	Flag	Result	Units	RL
Chloride		5450	mg/Kg	4.00

Sample: 213201 - SB-4 (15')

Param	Flag	Result	Units	RL
Chloride		5610	mg/Kg	4.00

Sample: 213202 - SB-4 (20')

Param	Flag	Result	Units	RL
Chloride		1860	mg/Kg	4.00

Sample: 213203 - SB-4 (25')

Param	Flag	Result	Units	RL
Chloride		866	mg/Kg	4.00

Sample: 213204 - SB-4 (30')

Param	Flag	Result	Units	RL
Chloride		12800	mg/Kg	4.00

Report Date: October 28, 2009

Work Order: 9102801

Page Number: 5 of 5

Sample: 213205 - SB-5 (5')

Param	Flag	Result	Units	RL
Chloride		2180	mg/Kg	4.00

Sample: 213206 - SB-5 (10')

Param	Flag	Result	Units	RL
Chloride		1090	mg/Kg	4.00

Sample: 213207 - SB-5 (15')

Param	Flag	Result	Units	RL
Chloride		945	mg/Kg	4.00

Sample: 213208 - SB-5 (20')

Param	Flag	Result	Units	RL
Chloride		1130	mg/Kg	4.00

Sample: 213209 - SB-5 (25')

Param	Flag	Result	Units	RL
Chloride		529	mg/Kg	4.00

Sample: 213210 - SB-5 (30')

Param	Flag	Result	Units	RL
Chloride		945	mg/Kg	4.00