

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
20 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

RECEIVED
SEP 03 2013
NMOCD ARTESIA

Form C-141
Revised October 10, 2003
Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Release Notification and Corrective Action

JMW 1324847819

OPERATOR Initial Report Final Report

Name of Company	COG OPERATING LLC <i>229137</i>	Contact	Robert McNeill
Address	600 West Illinois Avenue, Midland, TX 79701	Telephone No.	432-230-0077
Facility Name	USP Fee #2	Facility Type	Well Pad

Surface Owner State	Mineral Owner	Lease No. (API#)	30-015-34438
---------------------	---------------	------------------	--------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
D	16	23S	29E					Eddy

Latitude 32.31158 Longitude 103.99516

NATURE OF RELEASE

Type of Release	Produced water	Volume of Release	20bbls	Volume Recovered	10bbls
Source of Release	3" Tee	Date and Hour of Occurrence	08-26-2013	Date and Hour of Discovery	08-26-2013 08:00am
Was Immediate Notice Given?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?			
By Whom?		Date and Hour			
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

A small hole developed on the bottom of a 3" tee on the SWD due to corrosion. Replace tee with a coated 3" coated tee.

Describe Area Affected and Cleanup Action Taken.*

Initially an estimated 20bbls were released from a corroded 3" tee. We were able to recover 10bbls of fluid with a vacuum truck. The spill area is located on the location along the front side of the lined tank battery. Tetra Tech will sample the spill site area to delineate any possible contamination from the release and we will present a work plan to the NMOCD for approval prior to any significant remediation work.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	<i>Robert Grubbs Jr.</i>	OIL CONSERVATION DIVISION	
Printed Name:	Robert Grubbs Jr.	Approved by District Supervisor:	Signed By <i>Mike Benjamin</i>
Title:	Senior Environmental Coordinator	Approval Date:	SEP 04 2013
E-mail Address:	rgrubbs@concho.com	Expiration Date:	
Date:	09-03-2013	Phone:	432-661-6601

Attach Additional Sheets If Necessary


Conditions of Approval:
Remediation per OCD Rule & Guidelines. **SUBMIT REMEDIATION PROPOSAL NO LATER THAN: October 4, 2013**

Attached

2RP-1894

Bratcher, Mike, EMNRD

From: Robert Grubbs <RGrubbs@concho.com>
Sent: Tuesday, September 03, 2013 3:03 PM
To: Bratcher, Mike, EMNRD
Cc: Robert McNeill; Tavarez, Ike; Kujawski, Marcus (Marcus.Kujawski@tetrattech.com)
Subject: C-141 Initial Report - USP Fee #2
Attachments: USP Fee #2 (Well Pad) -- Date Of Release -- 08-26-2013 Inital.pdf

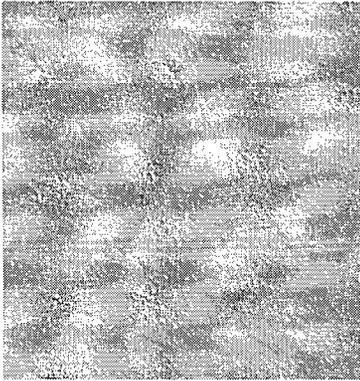

Mr. Bratcher,

Please see attached the C-141 Initial Report for a release that occurred at our USP Fee #2 (Well Pad) on 08-26-2013 in Eddy County New Mexico.

We plan to assess the spill area timely.

Thank you,

Robert Grubbs Jr.
Sr. Environmental Coordinator
432.683.7443 (main)
432.818.2369 (direct)
432.661.6601 (cell)
rgrubbs@concho.com
Mailing Address:
One Concho Center
600 W. Illinois Avenue
Midland, Texas 79701



CONFIDENTIALITY NOTICE: The information in this email may be confidential and/or privileged. If you are not the intended recipient or an authorized representative of the intended recipient, you are hereby notified that any review, dissemination or copying of this email and its attachments, if any, or the information contained herein, is prohibited. If you have received this email in error, please immediately notify the sender by return email and delete this email from your system. Thank you.