

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 S. First St., Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-141  
Revised August 8, 2011  
Submit 1 Copy to appropriate District Office in  
accordance with 19.15.29 NMAC.

**Release Notification and Corrective Action**

NAB1429339093 OPERATOR  Initial Report  Final Report

Name of Company: Enterprise Crude Oil LLC <u>155015</u>	Contact: Chris Spore
Address: PO Box 4324, Houston, TX 77210-4324	Telephone No.: 432-214-3264
Facility Name: Brown Crow Federal #1	Facility Type: Battery

Surface Owner: Federal	Mineral Owner:	API No.: 30-015-25282
------------------------	----------------	-----------------------

**LOCATION OF RELEASE**

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
A	21	17S	30E	990'	North	660'	East	Eddy, NM

Latitude 32.824598 N Longitude -103.970582 W

**NATURE OF RELEASE**

Type of Release: Crude Oil	Volume of Release: 10 bbls Oil	Volume Recovered: 7 bbls Oil
Source of Release: Tank Trailer Vent Line	Date and Hour of Occurrence: 9/24/2014 @ 8:00 am	Date and Hour of Discovery: 9/24/2014 @ 8:00 am
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Artesia NMOCD/Mike Bratcher & Heather Paterson, BLM/Jim Amos	
By Whom? Kimberly Wilson with Talon/LPE	Date and Hour: 9/24/2014 @ 2:53 pm	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.\* N/A

Describe Cause of Problem and Remedial Action Taken.\* A transport driver for Enterprise overflowed his tank causing a release of 10 barrels of crude oil on the Brown Crow Federal #1 (a Nadel and Gussman Permian location). A vac truck was immediately called to the location and recovered 7 barrels of oil. All fluids stayed on location. Talon/LPE personnel were immediately contacted for assessment and the correction of this release. Talon made an emergency One Call with NM 811 and started the same day doing emergency remediation activities.

Describe Area Affected and Cleanup Action Taken.\* The impacted area measured approximately 116-feet long by 20- feet wide on the flow path to the south. The flow path to the west measured approximately 85-feet long by 45-feet wide. The impacted areas of the release were excavated to a depth of 0.5-foot below land surface. The impacted soil was transported to Lea Land, LLC. Confirmation soil sampling was completed on 9/26/2014 and delivered to Cardinal Labs. The lab results are attached along with a site map and groundwater data for the area. The soil testing results are under the Recommended Remedial Action Levels (RRAL) after excavation activities. The excavated areas were backfilled to grade using new material transported from a local borrow pit. No further actions are required.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <u>Jon Fields</u>	<b>OIL CONSERVATION DIVISION</b>	
Printed Name: Jon Fields	Approved by Environmental Specialist: <u>[Signature]</u>	
Title: Director, Field Environmental, Operations	Approval Date: <u>10/25/14</u>	Expiration Date: <u>NA</u>
E-mail Address: JEFIELDS@eprod.com	Conditions of Approval: <u>Final</u>	Attached <input type="checkbox"/>
Date: 10/9/2014 Phone: 713-381-6684		

\* Attach Additional Sheets If Necessary

2RP-2558



ENTERPRISE PRODUCTS PARTNERS L.P.  
ENTERPRISE PRODUCTS HOLDINGS LLC  
(General Partner)

ENTERPRISE PRODUCTS OPERATING LLC

October 10, 2014

New Mexico Oil Conservation Division  
District 2 Office  
Mr. Mike Bratcher  
811 South First Street  
Artesia, New Mexico 88210

via email

BLM Farmington Field Office  
Lands Team  
Attn: Shari Ketcham  
6251 College BLVD. Ste. A  
Farmington, NM 87402

via email

**RE: Brown Crow Federal #1  
Eddy County**

Dear Sirs:


Attached is a final Release Notification/Corrective Action Report (C-141). Should have questions or need additional information, please contact our field representative, Chris Spore at 432-214-3264 or me directly at 713-381-6684.

Yours truly,

A handwritten signature in cursive script that reads 'Jon E. Fields'.

Jon E. Fields  
Director, Field Compliance

/sjn  
enclosures

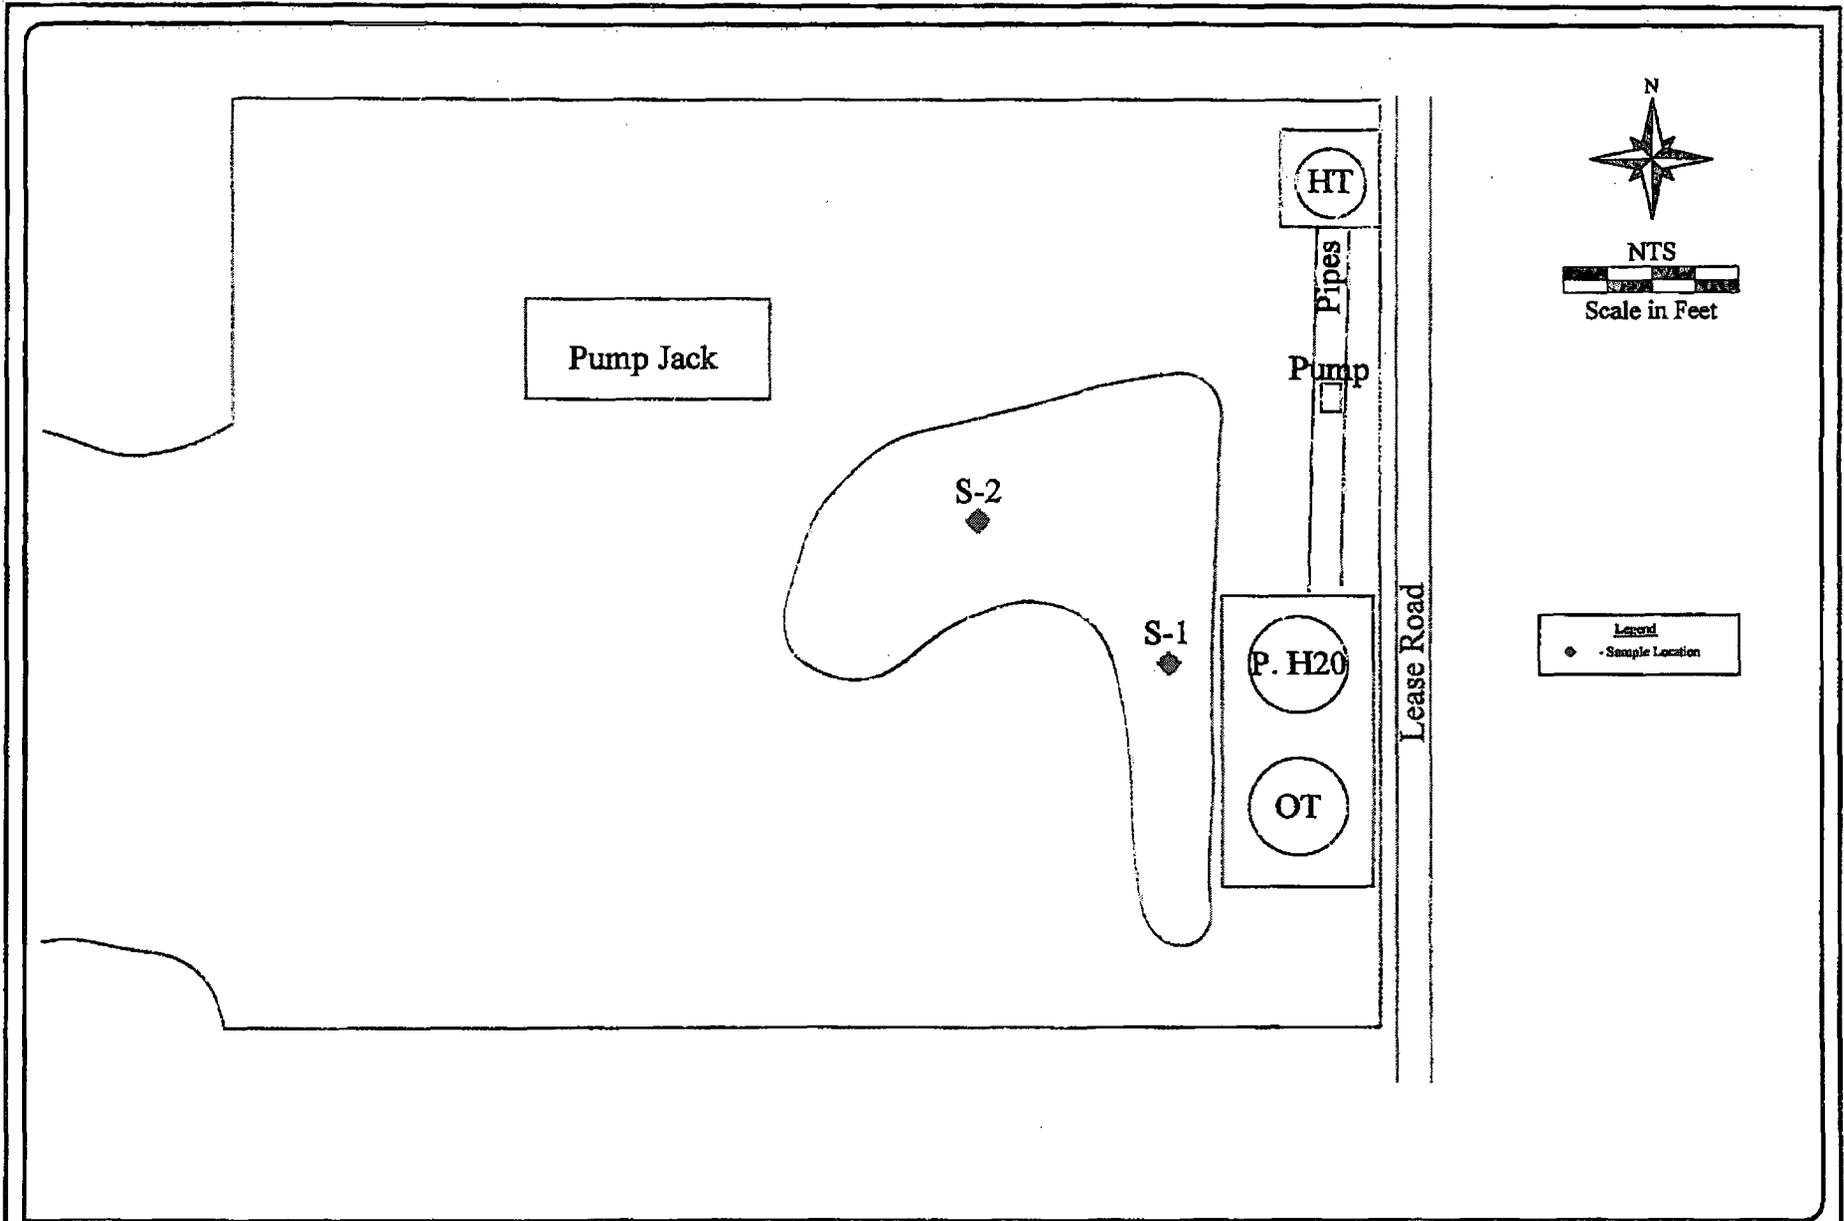

**Legend**  
 ◆ - Sample Location



Date: 10/08/2014  
 Scale: NTS  
 Drawn By: TJS

Brown Crow Fed #1  
 Enterprise Crude Oil, LLC  
 Eddy County, New Mexico  
 Figure 1 - Site Plan