

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

NM OIL CONSERVATION

ARTESIA DISTRICT

Form C-141
Revised August 8, 2011

NOV 06 2014

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

RECEIVED

Release Notification and Corrective Action

NAB14316396416

OPERATOR Initial Report Final Report

Name of Company	ConocoPhillips <i>217817</i>	Contact	Weldon Ellis (HSE Coordinator)
Address	3300 North A Street, Midland, Texas 79705	Telephone No.	432-688-6862
Facility Name	Stampede Federal WC COM 34-1H	Facility Type	Appraisal Well
Surface Owner	Mineral Owner	API No. 3001542123	

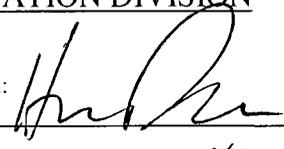
LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
4	34	26 S	31 E	250	FSL	380	FWL(SWSW)	EDDY
D	27	26 S	31 E	330	FNL	380	FWL(NWNW)	EDDY

Latitude 32° 0'2.7" N Longitude 103° 46'22.282" W

NATURE OF RELEASE

Type of Release	Slick water	Volume of Release	20 Bbls	Volume Recovered	19 Bbls
Source of Release	Burst 4" discharge hose	Date and Hour of Occurrence	11-3-2014 @5:40pm	Date and Hour of Discovery	11-3-2014 @5:40pm
Was Immediate Notice Given?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Called BLM - Left message			
By Whom?	Alan Cain (HSE Coordinator)	Date and Hour 11-5-2014 @10:00am			
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A			
If a Watercourse was Impacted, Describe Fully.* N/A					
Describe Cause of Problem and Remedial Action Taken.* While pumping a slick water stage (fresh water with friction reducing agent) the #1 pony rod clamp failed causing damage to the suction valve on the #1 frac pump allowing discharge pressure to reach the suction manifold and causing the 4" discharge hose to burst. The pump stage was immediately stopped and the failed pump and hose were isolated. Approximately 20 Bbls of "slick water" was released onto location. A vacuum truck on standby began picking up the spilled fluid immediately. Approximately 19 BBLs of "slick water" was recovered.					
Describe Area Affected and Cleanup Action Taken.* The remaining spilled fluid was covered with absorbent pads and removed prior to high wind and heavy rain covering the area.					
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.					

Signature: <i>Weldon Ellis</i>		OIL CONSERVATION DIVISION	
Printed Name: Weldon Ellis		Approved by Environmental Specialist: 	
Title: HSE Coordinator		Approval Date: <i>11/6/14</i>	Expiration Date: <i>NA</i>
E-mail Address: Weldon.ellis@contractor.cop.com		Conditions of Approval:	
Date: 11-6-2014 Phone: 432-688-6862		Remediation per O.C.D. Rules & Guidelines SUBMIT REMEDIATION PROPOSAL NO LATER THAN: <u>12/10/14</u>	
* Attach Additional Sheets If Necessary		Attached <input type="checkbox"/>	

2 RP 2592

Patterson, Heather, EMNRD

From: Hughes, Solomon <shughes@blm.gov>
Sent: Thursday, November 06, 2014 10:46 AM
To: weldon.ellis@contractor.cop.com
Cc: Patterson, Heather, EMNRD
Subject: Spill at Stampede Fed 34-01H
Attachments: Blank C-141.doc

Mr. Ellis,

The form we need for the 20-bbl slickwater fracturing fluid spill at the below-referenced location is attached. Please, make sure this form also gets to Heather Patterson of NMOCD; she is copied on this email.

Stampede Fed 34-01H
Lease: LC-068282A
API: 30-015-42123
SW/SW, Sec. 34, 26S-31E

Bests,
Sol

Sol Hughes

Environmental Protection Division
Bureau of Land Management
620 E. Greene St
Carlsbad, NM

Office: 575.234.5951
Cell: 575.499.3378