

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 S. First St., Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

**NM OIL CONSERVATION**

ARTESIA DISTRICT

Form C-141

Revised August 8, 2011

DEC 15 2014

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

RECEIVED

**Release Notification and Corrective Action**

**NAB1435036006** OPERATOR  Initial Report  Final Report

Name of Company: BOPCO, L.P. <b>2100737</b>	Contact: Tony Savoie
Address: 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220	Telephone No. 575-887-7329
Facility Name: PLU-CVX-JV-PB #008H	Facility Type: Exploration and Production

Surface Owner: Federal	Mineral Owner: Federal	API No. 30-015-42630
------------------------	------------------------	----------------------

**LOCATION OF RELEASE**

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
	32	25S	31E	2180	North	660	East	Eddy

Latitude N 32.087867 Longitude W 103.793453

**NATURE OF RELEASE**

Type of Release: Produced water	Volume of Release: 90 bbls. Produced water	Volume Recovered: approximately 10 bbls.
Source of Release: Frac tank containment	Date and Hour of Occurrence: <del>12/11/14</del> <b>12/12/14</b> time unknown	Date and Hour of Discovery: <del>12/11/14</del> <b>12/12/14</b> at 11:30 a.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? E-mail to the NMOCD and BLM <b>12/12/14</b> <i>T. Savoie</i>	
By Whom? Tony Savoie	Date and Hour: <del>12/11/14</del> <b>12/12/14</b> at 1:31 p.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	
If a Watercourse was Impacted, Describe Fully.*		
Describe Cause of Problem and Remedial Action Taken.* The produced water was spilled by contract crew improperly dismantling and cleaning the frac tank containment around the frac tank farm. All of the free standing fluid was recovered with a vacuum truck.		
Describe Area Affected and Cleanup Action Taken.* The spill impacted approximately 19,000 sq.ft. of caliche well pad. The spill are will be cleaned up once the frac tanks and equipment have been removed from the area. The spill will be cleaned up in accordance to the NMOCD and BLM remediation guidelines.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		
Signature: <i>Tony Savoie</i>	<b>OIL CONSERVATION DIVISION</b>	
Printed Name: Tony Savoie	Signed By <i>Mike Brannon</i> Approved by Environmental Specialist:	
Title: Waste Management and Remediation Specialist	Approval Date: <b>12/16/14</b>	Expiration Date:
E-mail Address: <a href="mailto:tasavoie@basspet.com">tasavoie@basspet.com</a>	Conditions of Approval: <input type="checkbox"/> Attached <input type="checkbox"/>	
Date: 12/15/14	Phone: 432-556-8730	

**Remediation per O.C.D. Rules & Guidelines**  
**SUBMIT REMEDIATION PROPOSAL NO**  
**LATER THAN: 1/16/15**

\* Attach Additional Sheets If Necessary

2RP-2661

DOPECO, L.P.

LOT

TRACTS 51


FOR SALE

11/15 11/15 11/15

2

Flat Sand

Flat 4-1 Boro to

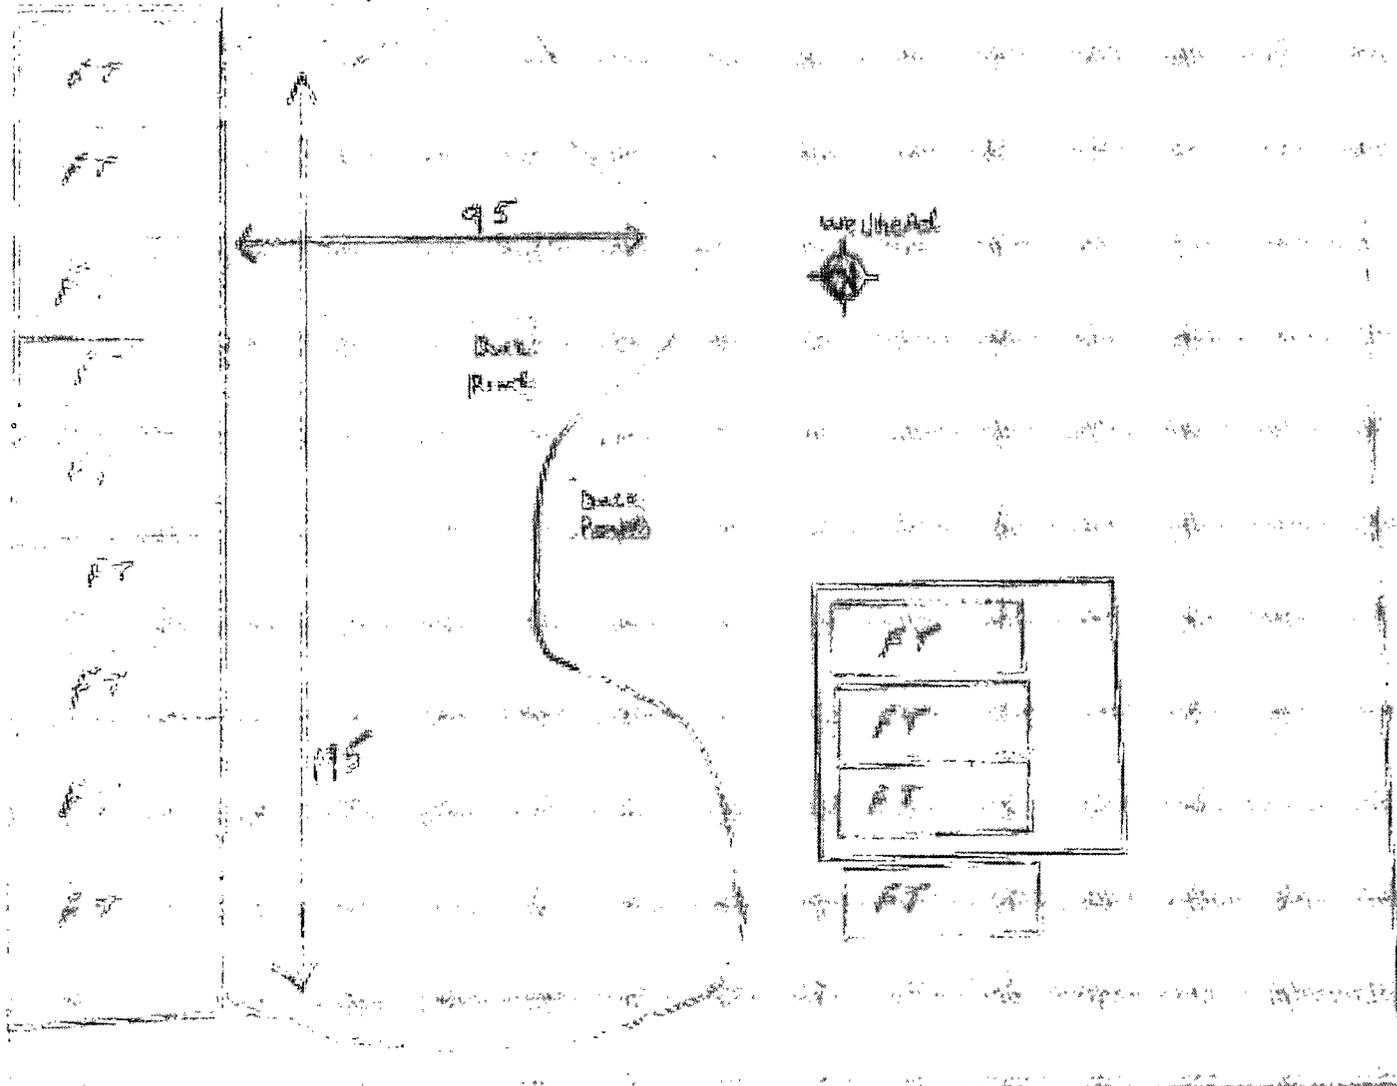

## Savoie, Tony A.

---

**From:** Savoie, Tony A.  
**Sent:** Friday, December 12, 2014 1:31 PM  
**To:** mike.bratcher@state.nm.us; 'Patterson, Heather, EMNRD'; Jim Amos (James\_Amos@blm.gov)  
**Cc:** Gawlik, Robert; Bright, Kathy; Blevins, Bradley; Ruth, Amy C.; Fuqua, D. Jace; Fletcher, Gary B  
**Subject:** Phantom Banks 008H spill  
**Attachments:** imagejpeg\_0.jpg

A lobo truck driver reported that there was quite a bit of produced water spilled on the pad, possibly more than 25 bbls. The truck driver has started recovering what he can.

Bradley Blevins is in route.

PLU-CVX-JV-PB-008H

API 30-015-42630

Section 32-25S-31E