

NM OIL CONSERVATION
ARTESIA DISTRICT

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

MAR 09 2015

Form C-141
Revised August 8, 2011

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit Copy to appropriate District Office in accordance with 19.15.29 NMAC.

RECEIVED

Release Notification and Corrective Action

NAB1506934810

OPERATOR

Initial Report Final Report

Name of Company: Mewbourne Oil Company 14744	Contact: Zack Thomas
Address: PO Box 5270 Hobbs NM 88241	Telephone No. 575-393-5905
Facility Name: Mirage 30 PM St. Com #1H Battery	Facility Type: Oil producing Well

Surface Owner: State	Mineral Owner: State	API No. 30-015-40753
----------------------	----------------------	----------------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
P	30	19S	29E	300'	South	150'	East	Eddy

Latitude 32.625402 Longitude -104.10611632

NATURE OF RELEASE

Type of Release: Oil/produced water	Volume of Release: estimated 10 bbls total fluid	Volume Recovered: 5 bbls total fluid
Source of Release: Compressor separator	Date and Hour of Occurrence 3-9-15	Date and Hour of Discovery 3-9-15 9:30 am
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher & Ian Dolby	
By Whom? Zack Thomas	Date and Hour 3-9-15 1:45 pm	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

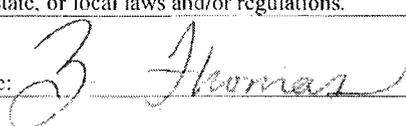
Describe Cause of Problem and Remedial Action Taken.*

Cause of the leak- Gas pressure to dumps on separation equipment was lost sending fluid to compressor separator. Compressor separator in turn vented fluid onto ground. Upon arrival pumper closed the vent line stopping the release. Vent line was then re-routed to water tanks.

Describe Area Affected and Cleanup Action Taken.*

Affected area- Fluid ran onto pad surface on North side of compressor before running off the pad an estimated 200 ft. out into the pasture. 5 bbls of total fluid was recovered from pasture via vacuum truck. Clean up action will include removing contaminated soil to NMOCD regulation standards and replacing with clean backfill then reseeded.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Zack Thomas	Approved by Environmental Specialist 	
Title: Environmental Rep.	Approval Date: 3/10/15	Expiration Date: N/A
E-mail Address: zthomas@mewbourne.com	Conditions of Approval: Remediation per O.C.D. Rules & Guidelines Attached <input type="checkbox"/>	
Date: 3-9-15 Phone: 575-602-2188	SUBMIT REMEDIATION PROPOSAL NO	

* Attach Additional Sheets If Necessary

LATER THAN: 4/10/15 2RP-2874

Bratcher, Mike, EMNRD

From: Zack Thomas <zthomas@mewbourne.com>
Sent: Monday, March 09, 2015 3:11 PM
To: Bratcher, Mike, EMNRD; idolly@slo.state.nm.us
Cc: Michael Burton; Aaron Garcia
Subject: Mirage 30 PM St. Com #1H
Attachments: C141- Mirage 30 PM St. Com #1H (3-9-15) MOC Signed Initial.pdf; IMG_0616.JPG; IMG_0618.JPG; IMG_0620.JPG



Zack Thomas
Environmental Rep.
Mewbourne Oil Company
PO Box 5270
Hobbs, NM 88241 US

Phone: (575) 393-5905 | Fax: (575) 397-6252
(575) 602-2188
Email: zthomas@mewbourne.com