

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

NM OIL CONSERVATION Form C-141
ARTESIA DISTRICT Revised August 8, 2011
Submit Copy to appropriate District Office in accordance with 19.15.29 NMAC.

JAN 07 2016

RECEIVED

Release Notification and Corrective Action

NAB 1600826804

60137

OPERATOR

Initial Report Final Report

Name of Company Devon Energy Production Company	Contact Rudy Zuniga Production Foreman
Address 6488 Seven Rivers Hwy Artesia, NM 88210	Telephone No. 575-390-5435
Facility Name Bellatrix 28 Fed 1H	Facility Type Oil Well

Surface Owner Federal	Mineral Owner Federal	API No 30-015-40331
------------------------------	------------------------------	----------------------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
A	29	19S	31E	920	North	790	East	Eddy

Latitude: N 32° 63' 61.24"

Longitude: W 103° 88' 53.74"

32.636124

103.885374

NATURE OF RELEASE

Type of Release Spill Oil	Volume of Release 1.5 bbls oil	Volume Recovered 0 bbls
Source of Release Pressure valve	Date and Hour of Occurrence 1.2.16 @ 9:30 am	Date and Hour of Discovery 1.2.16 @ 9:30 am
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Heather Patterson @OCD Dara Glass @BLM	
By Whom? Jesse Armendariz Assistant Production Foreman	Date and Hour 1.2.16 @ 12:00 pm 1.2.16 @ 12:10 pm	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse N/A	

If a Watercourse was Impacted, Describe Fully.*
N/A

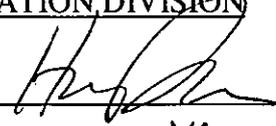
Describe Cause of Problem and Remedial Action Taken.*

Ice plug due to cold weather caused pressure valve to pressure up causing 1.5 bbls oil release. Well was shut in to prevent further release. Took apart pressure valve and got ice plug out and flushed methanol down line and put back together.

Describe Area Affected and Cleanup Action Taken.*

1.5 bbls oil was released on the South, South west side of the facility off the pad. None of the spill was recovered. The area was a 20' x 30' where it sprayed off the pad. Environmental Agency to be contacted for remediation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: Corina Moya	OIL CONSERVATION DIVISION	
Printed Name: Corina Moya	Approved by Environmental Specialist: 	
Title: Field Admin Support	Approval Date: 1/8/16	Expiration Date: N/A
E-mail Address: corina.moya@dm.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 1.7.15 Phone: 575.746.5559		

* Attach Additional Sheets If Necessary

2RP-3A18

Patterson, Heather, EMNRD

From: Moya, Corina <Corina.Moya@dvn.com>
Sent: Thursday, January 07, 2016 4:19 PM
To: Patterson, Heather, EMNRD; Tucker, Shelly
Subject: Bellatrix 28 Fed 1H 1.5 bbl oil spill 1.2.16
Attachments: Bellatrix 28 Fed 1H 1.5 bbl oil spill 1.2.16 pic 1 of 3.JPG; Bellatrix 28 Fed 1H 1.5 bbl oil spill 1.2.16 Initial C-141.doc; Bellatrix 28 Fed 1H 1.5 bbl oil spill 1.2.16 GIS Mapping.pdf; Bellatrix 28 Fed 1H 1.5 bbl oil spill 1.2.16 pic 3 of 3.JPG; Bellatrix 28 Fed 1H 1.5 bbl oil spill 1.2.16 pic 2 of 3.JPG

Good afternoon,
Please see the attached info for the Bellatrix 28 Fed 1H 1.5 bbl oil spill on 1.2.16

Thank you,

Corina Moya
Field Admin Support
Production
B Schedule

Devon Energy Corporation
PO Box 250
Artesia, NM 88211
575 746 5559



Confidentiality Warning: This message and any attachments are intended only for the use of the intended recipient(s), are confidential, and may be privileged. If you are not the intended recipient, you are hereby notified that any review, retransmission, conversion to hard copy, copying, circulation or other use of all or any portion of this message and any attachments is strictly prohibited. If you are not the intended recipient, please notify the sender immediately by return e-mail, and delete this message and any attachments from your system.