

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-141  
Revised October 10, 2003

Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

**Release Notification and Corrective Action**

**OPERATOR**

Initial Report  Final Report

Name of Company <b>ConocoPhillips Company</b>	Contact <b>Kenneth N. Andersen</b>
Address <b>4001 Penbrook, Odessa, TX 79762-5917</b>	Telephone No. <b>505.391.3158</b>
Facility Name <b>Leamex Battery # 8</b>	Facility Type <b>Oil and Gas</b>

Surface Owner <b>State of New Mexico</b>	Mineral Owner <b>State of New Mexico</b>	Lease No <b>B - 2118</b>
--	--	--------------------------


**LOCATION OF RELEASE**

Unit Letter <b>D/E</b>	Section <b>24</b>	Township <b>17S</b>	Range <b>33E</b>	Feet from the	North/South Line	Feet from the	East/West Line	County <b>Lea Co.</b>
---------------------------	----------------------	------------------------	---------------------	---------------	------------------	---------------	----------------	--------------------------

Latitude **32.825144N** Longitude **-103.623350W**

**NATURE OF RELEASE**

Type of Release <b>Crude Oil</b>	Volume of Release 20 bbl (20 oil, 0 water)	Volume Recovered (18 oil, 0 water)
Source of Release <b>No. 1 Tank thief hatch</b>	Date and Hour of Occurrence 05/08/2006 0845hrs	Date and Hour of Discovery 05/08/2006 0915hrs
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? <b>Donna Mull, NMOCD</b>	
By Whom? <b>Tommy E. Brooks</b>	Date and Hour <b>05/09/2006 0915hrs</b>	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

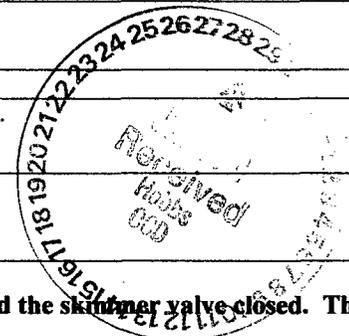

If a Watercourse was Impacted, Describe Fully.\*

Describe Cause of Problem and Remedial Action Taken.\*

Person or persons unknown had closed the valve between tank # 1 & tank # 2, and the MSO had the skimmer valve closed. The valves will be locked open.

Describe Area Affected and Cleanup Action Taken.\*

The spill site covered 21'X24' & 3'X65' of dry caliche battery pad and 13'X105' of dry caliche road. The free fluid was picked up by a vacuum truck. The site was assessed & delineated and a remediation plan was approved by NMOCD which consisted of removing & disposing 84 cu yds of contaminated soil at CRI & back filling. (Enclosures)

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Kenneth N. Andersen</i>	<b>OIL CONSERVATION DIVISION</b>	
Printed Name: <b>Kenneth N. Andersen</b>	Approved by District Supervisor:	
Title: <b>HSER Lead</b>	Approval Date:	Expiration Date:
E-mail Address: <b>ken.n.andersen@conocophillips.com</b>	Conditions of Approval:	Attached <input type="checkbox"/>
Date: <b>06/27/2006</b>	Phone: <b>505.391.3158</b>	

- Attach Additional Sheets If Necessary



# ARDINAL LABORATORIES

PHONE (325) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR  
BBC INTERNATIONAL, INC.  
ATTN: CLIFF BRUNSON  
1324 WEST MARLAND  
HOBBS, NM 88240  
FAX TO : 505-397-0397

Receiving Date: 6/8/06  
Project Owner: CONOCO PHILLIPS  
Project Number: NONE GIVEN  
Project Name: LEAMEX BATTERY #8  
Project Location: MALJAMAR N.M.  
Reporting Date: 6/13/06

Sampling Dates: 6/8/06  
Sample Type: SOIL  
Sample Condition: COOL & INTACT  
Sample Received By: NF  
Analyzed By: JC

LAB ID	SAMPLE ID	GRO	DRO	ETHYL- BENZENE	TOLUENE	TOTAL XYLENES
		C6-C12 (mg/kg)	>C12-C28 (mg/kg)			
H11201-1	SP1 @ 1'	<50.0	<50.0	<0.002	<0.002	<0.006
H11201-2	SP2 @ 1'	<50.0	160	<0.002	<0.002	<0.006
H11201-3	SP3 @ 1'	<50.0	988	<0.002	<0.002	<0.006
H11201-4	BKGND	<50.0	<50.0	<0.002	<0.002	<0.006

Extraction Date:	06/09/06	06/09/06	GRO/DRO	06/09/06	06/09/06	06/09/06	06/09/06
Analysis Date:	06/09/06	06/09/06	Total	06/09/06	06/09/06	06/09/06	06/09/06
Method Blank	<50.00	<50.00	(mg/kg)	<0.002	<0.002	<0.002	<0.006
LCS				0.091	0.093	0.096	0.283
True Value LCS				0.100	0.100	0.100	0.300
LCS % Recovery				91%	93%	96%	94%
Matrix Spike (MS)			470				
Matrix Spike Dup (MSD)			485				
True Value Matrix Spike			500				
MS % Recovery			94.1%				
MSD % Recovery			97.0%				
Matrix Spike RPD			3.1%	7.4%	1.8%	0.0%	1.4%
FLAGS:							

Methods: TPH 8015M; BTEX-MTBE SW-846 8021B, 5030B

*Burgess & Cooke*  
Chemist

*6/15/06*  
Date

*Close & backfill 6/19/06 -  
Approx 160' to ground water.*

H11201BTEXTPHSOIL[1].xls



