

District I
1625 N French Dr, Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S St Francis Dr, Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company PRIDE ENERGY COMPANY	Contact LARRY MILLER
Address PO OX 701950, TULSA, OK 74170	Telephone No. 918-524-9200
Facility Name SOUTH FOUR LAKES UNIT	Facility Type SALT WATER LINE

Surface Owner STATE OF NEW MEXICO	Mineral Owner STATE OF NEW MEXICO	Lease No. E-2064
-----------------------------------	-----------------------------------	------------------

LOCATION OF RELEASE API# 30025018330000 well #5


Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
G	2	12 S	34 E	1980	NORTH	1980	EAST	LEA

Latitude _____ Longitude _____

NATURE OF RELEASE

WTR 25'

Type of Release SALT WATER	Volume of Release 15 BBL +/-	Volume Recovered 5 BBL
Source of Release SALT WATER INJECTION LINE	Date and Hour of Occurrence 9/4/07 TIME = N/A	Date and Hour of Discovery 9/4/07 4:00 PM
Was Immediate Notice Given? <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Not Required	If YES, To Whom?	
By Whom?	Date and Hour	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse	

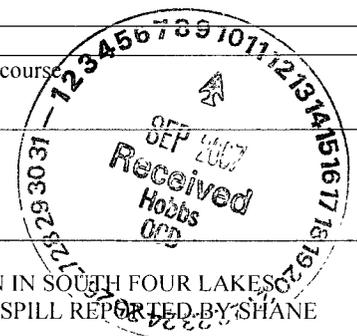

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*
VICTAULIC CONNECTION ON SWD LINE CAME LOOSE AND LEAKED SALT WATER ON LOCATION IN SOUTH FOUR LAKES BATTERY. CONNECTION WAS REPAIRED. EST. SODIUM CHLORIDE CONTENT = 100,000 PPM. SPILL REPORTED BY SHANE FERGUSON, PUMPER.

Describe Area Affected and Cleanup Action Taken.*
WATER RAN ACROSS LOCATION (APPROX. 160' X 6' AREA EFFECTED). APPROX. 5 BBLs WERE PICKED UP BY VACUUM TRUCK. CREW IS SCHEDULED TO REMOVE SATURATED SOIL AND FILL BACK IN W/ SOIL AND CALICHE BEGINNING 9/7/07

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Larry O. Miller</i>	OIL CONSERVATION DIVISION	
Printed Name: LARRY MILLER	<i>J. Johnson</i> Approved by District Supervisor: ENVIRONMENTAL ENGINEER	
Title: ENGINEER	Approval Date: 9.27.07	Expiration Date: 12.3.07
E-mail Address: larrym@pride-energy.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 9/6/07 Phone: 918-524-9200	ⓐ Horiz & Vertical Delineation To 'CLEAN + 1' ⓑ Documentation submitted w/ Final C.141 B4	

RP# 1598

* Attach Additional Sheets If Necessary