

District I
1625 N. French Dr , Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1000 S. St. Francis Dr , Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company: Targa Midstream Services L P	Contact: James Lingnau 505.394.2534, Chuck Tolsma 505.631.6026
Address: PO Box 1909 Eunice, NM 88231	Telephone No. (505) 394-2534
Facility Name: Eunice Gathering System	Facility Type Gas Processing Plant

Surface Owner: Edwin Johnson	Mineral Owner:	Lease No.
------------------------------	----------------	-----------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
	27	22S	37E					Lea

Latitude 32.36843833 N Longitude 103.15923333 W

NATURE OF RELEASE



Type of Release: Gas and Produced Liquids	Volume of Release: Gas and spray of liquid.	Volume Recovered: None
Source of Release: 20" Gas Gathering Pipeline leak	Date and Hour of Occurrence: 1PM April 23, 2007	Date and Hour of Discovery: 2PM April 23, 2007
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Pat Caperton OCD	
By Whom? Rebecca Woodell	Date and Hour 1:40 PM April 24, 2007	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken. *
A 20 inch gathering line 2 feet below the surface with 20 psig and 4.3mcf/d of flow and less than 50 ppm of H₂S developed a 1/4 inch hole and released gas and liquids that were lying in the line. Field operators immediately blocked in line. Repairs were made to the line with a clamp and plans made to replace that section of line.
1300 feet of 16 inch poly line was inserted inside the 20 inch line.

Describe Area Affected and Cleanup Action Taken.*
The area has been cleaned and tested per OCD guidelines.
180 yards of contaminated soil was removed from the site and hauled to the Targa landfarm and Sundance Landfarm (Chloride contaminated soil).
New soil obtained from the landowner will be used to backfill the site upon closure approval.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Don Embrey	Approved by District  ENVIRONMENTAL ENGINEER	
Title. Advisor	Approval Date: 11-27-07	Expiration Date: —
E-mail Address: dembrey@targaresources.com	Conditions of Approval.	Attached <input type="checkbox"/> RP# 1316
Date: 11/26/07 Phone: (432) 688-0546		

* Attach Additional Sheets If Necessary

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company: Targa Midstream Services L P	Contact: James Lingnau 505.394.2534, Chuck Tolsma 505.631.6026	
Address: PO Box 1909 Eunice, NM 88231	Telephone No. (505) 394-2534	
Facility Name: Eunice Gathering System	Facility Type Gas Processing Plant	
Surface Owner: Edwin Johnson	Mineral Owner:	Lease No.

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
	27	22S	37E					Lea

Latitude 32.36843833 N Longitude 103.15923333 W

NATURE OF RELEASE

Type of Release: Gas and Produced Liquids	Volume of Release: Gas and spray of liquid.	Volume Recovered: None
Source of Release: 20" Gas Gathering Pipeline leak	Date and Hour of Occurrence: 1PM April 23, 2007	Date and Hour of Discovery: 2PM April 23, 2007
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Pat Caperton OCD	
By Whom? Rebecca Woodell	Date and Hour: 1:40 PM April 24, 2007	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

A 20 inch gathering line 2 feet below the surface with 20 psig and 4.3mcf/d of flow and less than 50 ppm of H2S developed a leak and released gas and liquids that were lying in the line. Field operators immediately blocked in line. Repairs were made to the line with a clamp and plans made to replace that section of line.

Describe Area Affected and Cleanup Action Taken.*

Targa will replace pipe as needed. The area will be cleaned and tested per OCD guidelines.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	OIL CONSERVATION DIVISION	
Printed Name: Don Embrey	Approved by District Supervisor: <i>[Signature]</i>	
Title: Advisor <i>[Signature]</i>	Approval Date: 5.11.07	Expiration Date: 7.11.07
E-mail Address: dembrey@targaresources.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 5/07/07 Phone: (432) 688-0546	SUBMIT DELIBERATION SUMMARY	

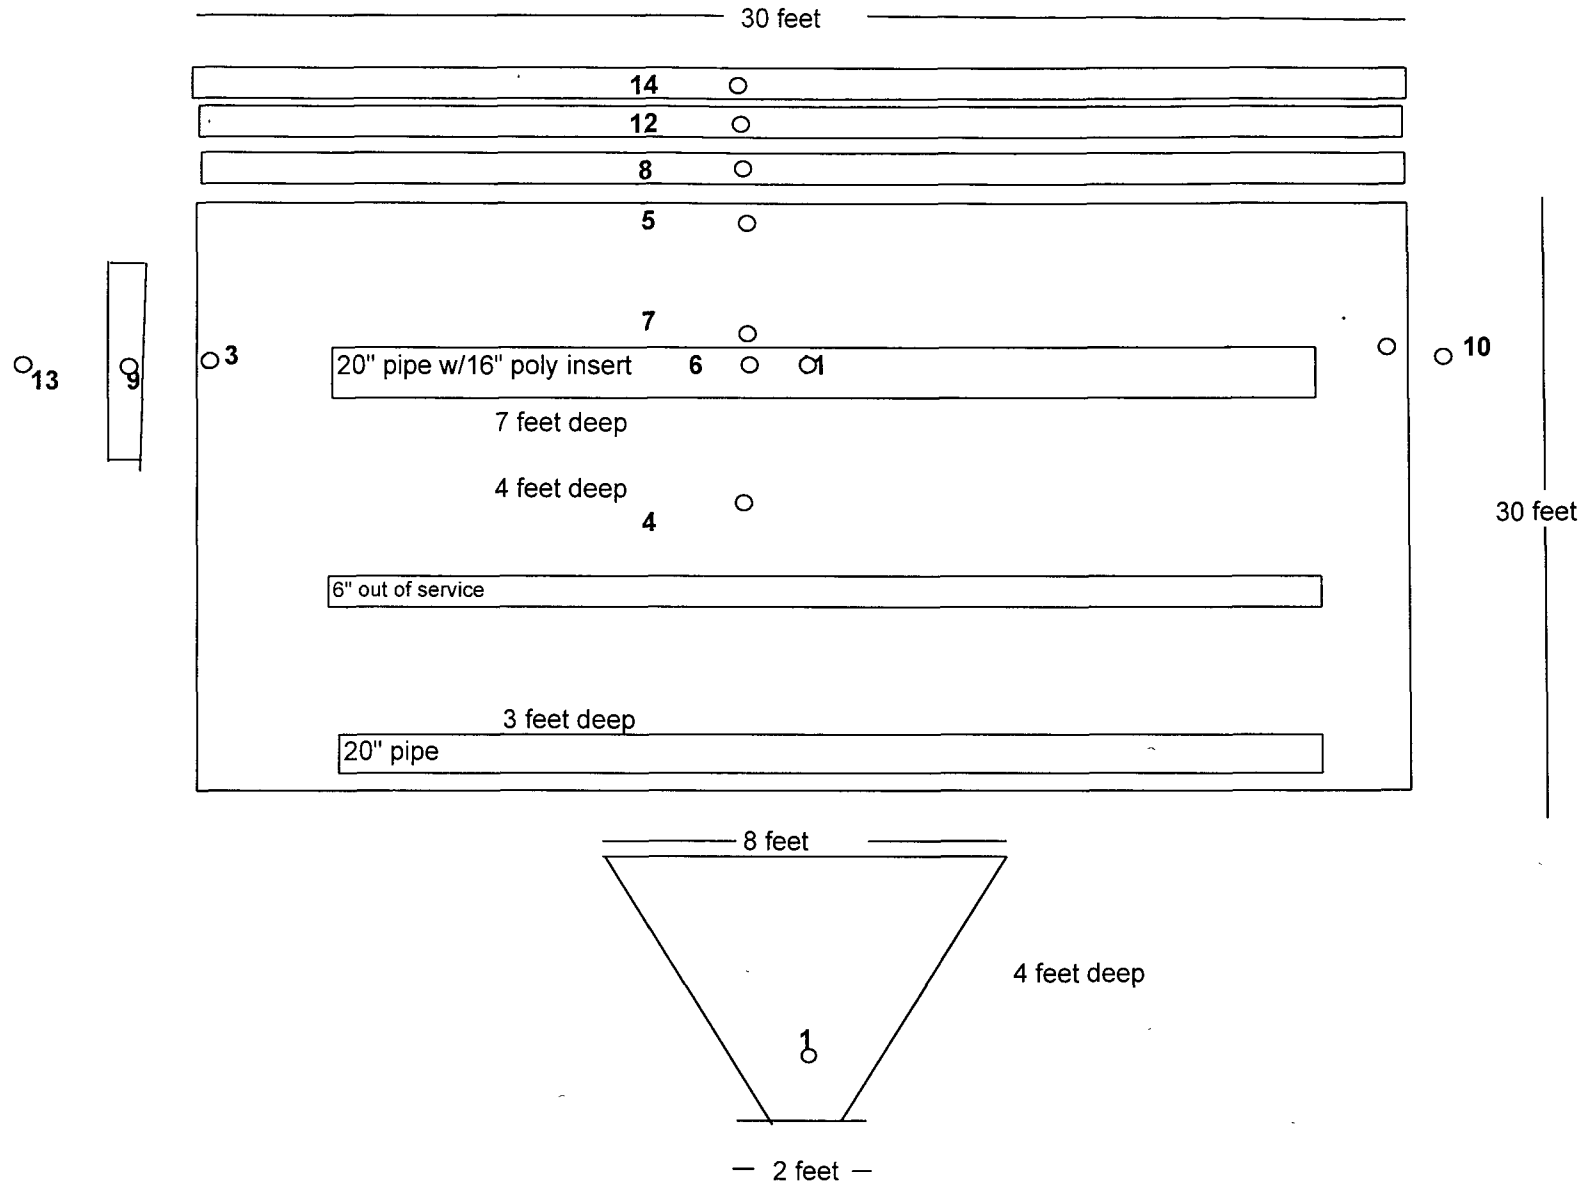
* Attach Additional Sheets If Necessary

INFO PRIOR TO BACKFILL.

incident - nPAC0713431028
application - nPAC0713431189

RPT# 316

EDWIN JOHNSON



EDWIN JOHNSON

SAMPLE DATE	SAMPLE I.D.	SOIL STATUS	TPH GRO	TPH DRO	CHLORIDE
8/30/2007	#1	In Situ	<10	16.3	<16
8/30/2007	#2(North Wall)	Excavated	<10	860	<16
8/30/2007	#3(South Wall)	Excavated	<10	86	144
8/30/2007	#4	In Situ	<10	29.3	<16
8/30/2007	#5	Excavated	<10	<10	1410
8/30/2007	#6(Bottom 6 feet)	Excavated	<10	1230	3620
8/30/2007	#7(Bottom 3 feet)	Excavated	98.6	8930	2900
9/25/2007	#8(West Wall)	Excavated	<10	<10	511
9/25/2007	#9(South Wall)	Excavated	<10	<10	1220
9/25/2007	#10(North Wall)	In Situ	<10	<10	<16
9/25/2007	#11(Bottom 9 feet)	In Situ	<10	<10	<16
11/6/2007	#12(West Wall)	Excavated			1040
11/6/2007	#13(South Wall)	In Situ			64
11/20/2007	#14(West Wall)	In Situ			<16

11/26/2007



ARDINAL LABORATORIES

PHONE (325) 873-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2328 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR

TARGA

ATTN: DON EMBREY

6 DESTA DRIVE SUITE 3300

MIDLAND, TX 79705

FAX TO: (432) 688-0552

Receiving Date: 08/30/07

Reporting Date: 09/08/07

Project Number: NOT GIVEN

Project Name: EDWIN JOHNSON

Project Location: NOT GIVEN

Sampling Date: 08/30/07

Sample Type: SOIL

Sample Condition: COOL & INTACT

Sample Received By: HM

Analyzed By: CK/KS

LAB NUMBER	SAMPLE ID	ANALYSIS DATE	GRO	DRO	CI*
			(C ₆ -C ₁₂) (mg/Kg)	(>C ₁₂ -C ₂₈) (mg/Kg)	(mg/Kg)
		09/05/07	09/05/07	08/31/07	
1	H13200-1	RO 40' E	<10.0	16.3	<16
2	H13200-2	NW 3'	<10.0	860	<16
3	H13200-3	SW 3'	<10.0	86	144
4	H13200-4	EW 2'	<10.0	29.3	<16
5	H13200-5	WW 4'	<10.0	<10.0	1410
6	H13200-6	B 6'	<10.0	1230	3620
7	H13200-7	B 3'	98.6	8930	2900
	Quality Control		445	530	500
	True Value QC		500	500	500
	% Recovery		89	106	100
	Relative Percent Difference		0.4	1.59	4.1

METHODS: TPH GRO & DRO, EPA SW-846 8015 M; Std. Methods 4500-CFB

*Analyses performed on 1:4 w/v aqueous extracts.

Chemist

Date

H13200 Targa

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client. Its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.



101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603
(505) 393-2326 FAX (505) 393-2476 (325) 673-7001 FAX (325) 673-7020

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

[illegible]

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort shall be limited to the amount paid by the client for the analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Relinquished By: <u>Don Emery</u> Date: <u>8-30-07</u> Time: <u>9:10 AM</u>		Received By: _____ Date: _____ Time: _____		Phone Result: <input type="checkbox"/> Yes <input type="checkbox"/> No Add'l Phone #: _____ Fax Result: <input type="checkbox"/> Yes <input type="checkbox"/> No Add'l Fax #: _____ REMARKS: _____	
Relinquished By: _____ Date: _____ Time: _____		Received By: <u>Steve L. M. [Signature]</u> Date: _____ Time: _____			
Delivered By: (Circle One) Sampler - UPS - Bus - Other: _____		Sample Condition: Cool: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Intact: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No		CHECKED BY: (Initials) _____	

† Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2476



ARDINAL
LABORATORIES

PHONE (815) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E MARLAND • HOBBS NM 88240

**ANALYTICAL RESULTS FOR
TARGA**

**ATTN: DON EMBREY
6 DESTA DRIVE, SUITE 3300
MIDLAND, TX 79705
FAX TO: (432) 888-0552**

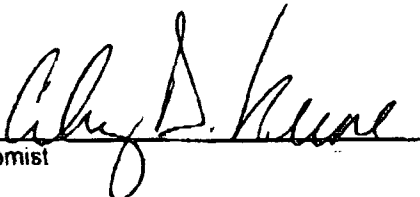
Receiving Date: 09/25/07
Reporting Date: 09/27/07
Project Number: NOT GIVEN
Project Name: EDWIN JOHNSON
Project Location: NOT GIVEN


Sampling Date: 09/25/07
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: SB
Analyzed By: BC/HM

LAB NUMBER	SAMPLE ID	GRO (C ₆ -C ₁₀) (mg/Kg)	DRO (>C ₁₀ -C ₂₈) (mg/Kg)	Cl ⁻ (mg/Kg)
		09/25/07	09/25/07	09/25/07
8	H13365-1 EJ WW 5'	<10.0	<10.0	511
9	H13365-2 EJ SW 5'	<10.0	<10.0	1220
10	H13365-3 EJ NW 5'	<10.0	<10.0	<16
11	H13365-4 EJ BOT 9'	<10.0	<10.0	<16
	Quality Control	790	728	500
	True Value QC	800	800	500
	% Recovery	99.5	91.1	100
	Relative Percent Difference	0.6	1.5	<0.1

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl⁻: Std. Methods 4500-Cl⁻B

***Analyses performed on 1:4 w.v aqueous extracts**


Chemist


Date

H13365 TARGA

PLEASE NOTE: Liability and Damages: Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

ARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603
(505) 393-2326 FAX (505) 393-2476 (325) 673-7001 FAX (325) 673-7020

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

[illegible]

† Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2476



**ANALYTICAL RESULTS FOR
TARGA
ATTN: DON EMBREY
6 DESTA DRIVE SUITE 3300
MIDLAND, TX 79705
FAX TO: (432) 688-0552**

Sampling Date: 11/08/07
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: SB
Analyzed By: HM

[illegible]

4500-C/B

W. S. M. Jones
Chemist

11-09-07
Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. Cardinal and its subsidiaries shall be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.



CARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603

(505) 393-2326 FAX (505) 393-2476 (325) 673-7001 FAX (325) 673-7020

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: TARCO		BILL TO		ANALYSIS REQUEST																					
Project Manager: Don Embrey		P.O. #:																							
Address: 6 Dextra Drive Suite 3300		Company:																							
City: MILANO State: TX Zip: 79705		Attn:																							
Phone #: 432-688-0546 Fax #: 432-688-0552		Address:																							
Project #:		City:																							
Project Name: Edwin Johnson		State: Zip:																							
Project Location:		Phone #:																							
Sampler Name: Don Embrey		Fax #:																							
FOR LAB USE ONLY		MATRIX		PRESERV.		SAMPLING																			
Lab I.D.	Sample I.D.	(GRAB OR (COMP. # CONTAINERS	GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER	ACID/BASE	ICE / COOL	OTHER	DATE	TIME												
H13652-1	WW 5'	X	1		X							11/6/07	12:30	C1											
2	SW 5'	X	1		X							11/6/07	12:30	4											

PLEASE NOTE: Liability and Damages: Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the services. Accidents including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages including without limitation, business interruptions, loss of use, or loss of profits incurred by client or its subsidiaries. Cardinal's acceptance of a retained or the performance of services hereunder by Cardinal regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Relinquished By:	Date:	Received By:	Phone Result:	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Add'l Phone #:
Don Embrey	11/6/07		Fax Result:	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Add'l Fax #:
Relinquished By:	Date:	Received By:	REMARKS:			
	1:40					
Delivered By: (Circle One)	Date:	Received By:				
Sampler UPS - Bus - Other:		Sue Barnes 11/6/07 1:40pm				
		Sample Condition	CHECKED BY:			
		Cool Intact	(Initials)			
		<input type="checkbox"/> Yes <input type="checkbox"/> No	SB			

† Cardinal cannot accept verbal changes Please fax written changes to 505-393-2476



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

TARGA

ATTN: DON EMBREY

6 DESTA DRIVE SUITE 3300

MIDLAND, TX 79705

FAX TO. (432) 688-0552

Receiving Date: 11/20/07

Reporting Date: 11/20/07

Project Number: NOT GIVEN

Project Name: EDWIN JOHNSON

Project Location NOT GIVEN

Sampling Date. 11/20/07

Sample Type: SOIL

Sample Condition: COOL & INTACT

Sample Received By: SB

Analyzed By: HM

METHOD: Standard Methods	4500-CIB
--------------------------	----------

Note: Analysis performed on a 1:4 w/v aqueous extract

Chemist

Date

PLEASE NOTE **Liability and Damages**. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. **Incidental or consequential damages**, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise



CARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603
(505) 393-2326 FAX (505) 393-2476 (325) 673-7001 FAX (325) 673-7020

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: <u>TARGA</u>				BILL TO				ANALYSIS REQUEST																																	
Project Manager: <u>Don Embrey</u>				P.O. #:																																					
Address: <u>6 Desta Drive Suite 3300</u>				Company: <u>TARGA</u>																																					
City: <u>M. OLAND</u> State: <u>TX</u> Zip: <u>79705</u>				Attn:																																					
Phone #: <u>432-688-0546</u> Fax #: <u>432-688-0552</u>				Address: <u>P.O. Box 1909</u>																																					
Project #:				City: <u>Funice</u>																																					
Project Name: <u>Edwin Johnson</u>				State: <u>NM</u> Zip: <u>88231</u>																																					
Project Location:				Phone #:																																					
Sampler Name: <u>Don Embrey</u>				Fax #:																																					
FOR LAB USE ONLY						MATRIX		PRESERV.		SAMPLING																															
Lab I.D.		Sample I.D.		G/RAB OR (C)COMP		# CONTAINERS		GROUNDWATER		WASTEWATER		SOIL		OIL		SLUDGE		OTHER		ACID/BASE		ICE / COOL		OTHER		DATE		TIME													
<u>413752-1</u>		<u>WW 5'</u>		<u>6</u>		<u>1</u>						<u>X</u>														<u>11/20/07</u>		<u>8:30 AM</u>		<u>X</u>											

PLEASE NOTE: Liability and Damages. The analysis and results are provided for informational purposes only. The client is responsible for the accuracy of the information provided. The client is responsible for the accuracy of the information provided. The client is responsible for the accuracy of the information provided.

Relinquished By: <u>Don Embrey</u>		Date: <u>11/20/07</u>		Received By:		Phone Result: <input type="checkbox"/> Yes <input type="checkbox"/> No Add'l Phone #:	
		Time: <u>9:40 AM</u>				Fax Result: <input type="checkbox"/> Yes <input type="checkbox"/> No Add'l Fax #:	
Relinquished By:		Date:		Received By:		REMARKS:	
		Time:		<u>Sue Barma 11/20/07 9:40 AM</u>			
Delivered By: (Circle One)				Sample Condition		CHECKED BY:	
<u>Sampler</u> UPS Bus Other				Cool Intact		(Initials)	
				<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No		<u>SB</u>	

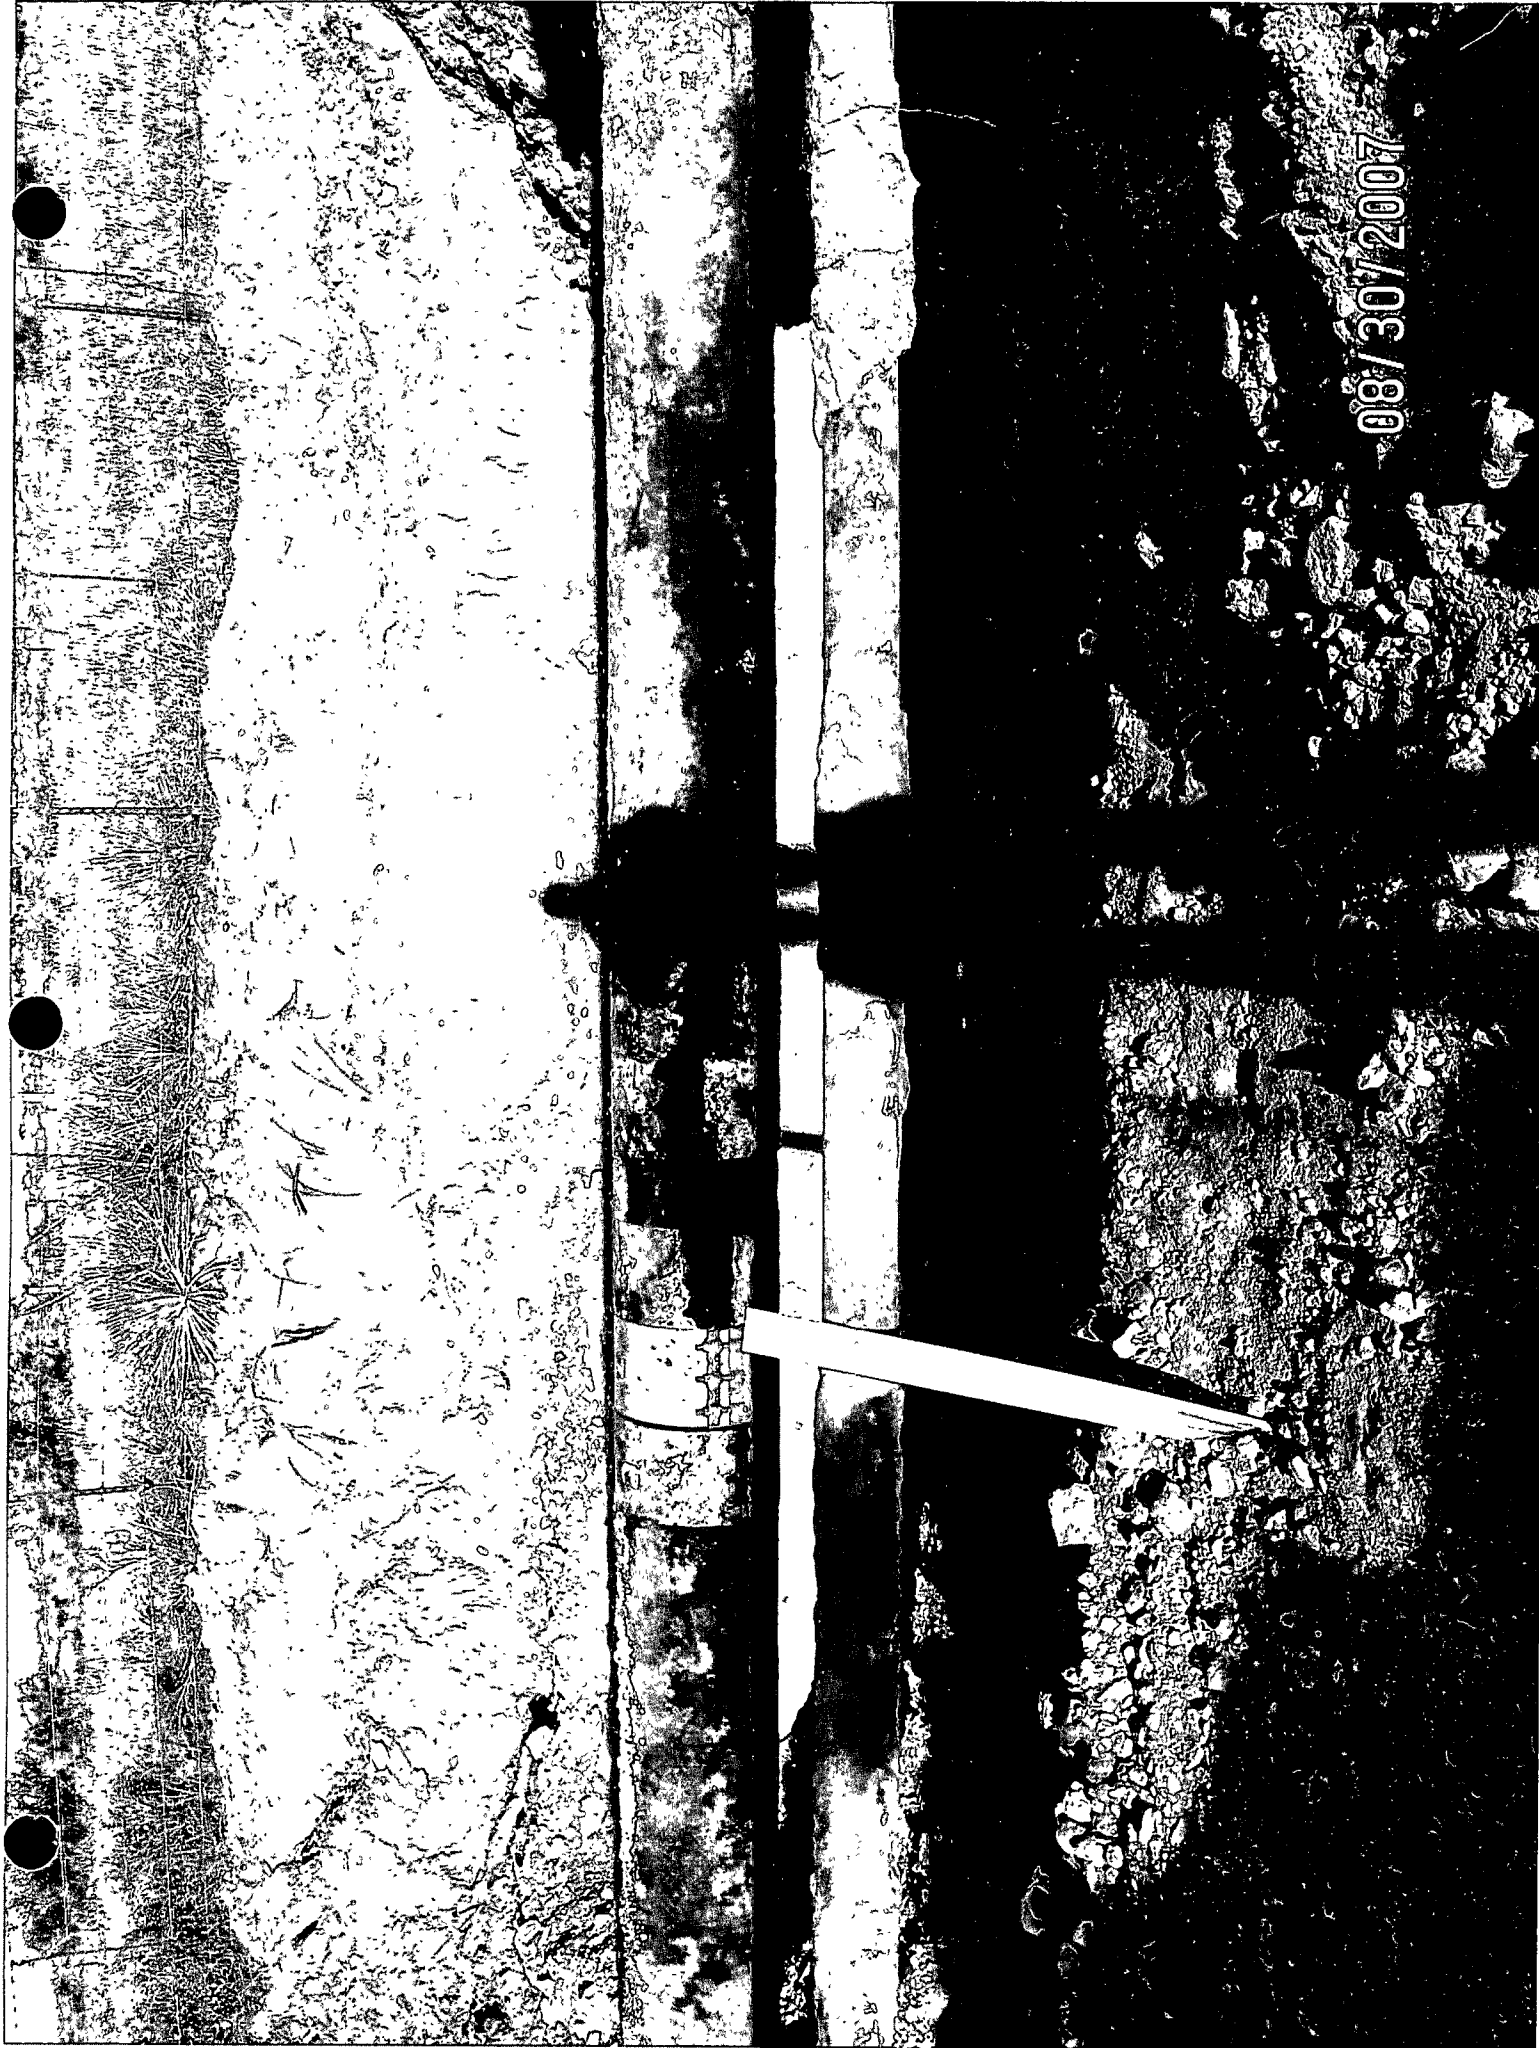
Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2476

08/30/2007



08/30/2007





08/30/2007