

District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company: Targa Midstream Services L P	Contact: James Lingnau 505.394.2534, Chuck Tolsma 505.631.6026
Address: PO Box 1909 Eunice, NM 88231	Telephone No. (505) 394-2534
Facility Name: Eunice Gathering System	Facility Type

Surface Owner: Deck Estate Turner Road	Mineral Owner:	Lease No.
--	----------------	-----------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
E	28	21S	37E					Lea

Latitude 32.28.605 N Longitude 103.10.737W

NATURE OF RELEASE

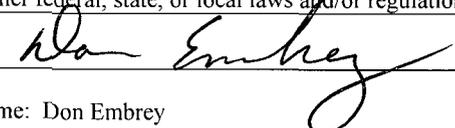
Type of Release: Gas and Produced Liquids	Volume of Release:.	Volume Recovered: None
Source of Release: 6" Pipeline Failure	Date and Hour of Occurrence: Unknown	Date and Hour of Discovery Unknown
Was Immediate Notice Given? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	
By Whom?	Date and Hour 8/19/05 8:50 AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken. *
A Four inch or Six inch gathering line had a leak and released gas and any produced liquids that were lying in the line. Line was repaired and possibly contaminated soil used for backfill.

Describe Area Affected and Cleanup Action Taken.*
Targa has excavated site and hauled approximately 60 yards of contaminated soil to an OCD approved land farm. Soil will be obtained from land owner to backfill the excavation. Samples were taken from excavation site and met OCD guidelines.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION 	
Printed Name: Don Embrey	Approved by District Superintendent ENVIRONMENTAL ENGINEER	
Title: Advisor	Approval Date: 11.4.08	Expiration Date: —
E-mail Address: dembrey@targaresources.com	Conditions of Approval: —	Attached <input type="checkbox"/> IRP 1893
Date: 11/3/2008	Phone: (432) 688-0546	

* Attach Additional Sheets If Necessary

District I
1625 N. French Dr , Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St Francis Dr , Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Form C-141
Revised October 10, 2003

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company: Targa Midstream Services L P	Contact: James Lingnau 505.394.2534, Chuck Tolsma 505.631.6026
Address: PO Box 1909 Eunice, NM 88231	Telephone No. (505) 394-2534
Facility Name: Eunice Gathering System	Facility Type
Surface Owner: Deck Estate Turner Road	Mineral Owner:
Lease No. 30-025-26444-co-00	

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
E	28	21S	37E					Lea

Latitude 32.28.605 N Longitude 103.10.737W

NATURE OF RELEASE

Type of Release: Gas and Produced Liquids	Volume of Release: Unknown	Volume Recovered: None
Source of Release: 4" or 6" Pipeline Failure	Date and Hour of Occurrence: Unknown	Date and Hour of Discovery: Unknown
Was Immediate Notice Given? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	
By Whom?	Date and Hour	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse	

If a Watercourse was Impacted, Describe Fully *



Describe Cause of Problem and Remedial Action Taken. *

A Four inch or Six inch gathering line had a leak and released gas and any produced liquids that were lying in the line. Line was repaired and possibly contaminated soil used for backfill.

Describe Area Affected and Cleanup Action Taken.*

Targa will excavate and sample the area of contamination and remove any contaminated soil. The area will be cleaned and tested per OCD Guidelines.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Don Embrey	 Approved by District Environmental Engineer	
Title: Advisor	Approval Date: 7.8.08	Expiration Date: 8.8.08
E-mail Address: dembrey@targaresources.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 4/01/08 Phone: (432) 688-0546	SUBMIT DELINEATION & WORKPLAN BY  IRP 1893	

* Attach Additional Sheets If Necessary



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
 TARGA RESOURCES
 ATTN ROGER HOLLAND
 P.O. BOX 1929
 EUNICE, NM 88231
 FAX TO: (575) 394-1514

Receiving Date: 10/23/08
 Reporting Date: 10/27/08
 Project Number: NOT GIVEN
 Project Name: TURNER RD. 6"
 Project Location: NOT GIVEN

Sampling Date: NOT GIVEN
 Sample Type: SOIL
 Sample Condition: COOL & INTACT
 Sample Received By: ML
 Analyzed By: AB/HM

LAB NUMBER	SAMPLE ID	GRO (C ₈ -C ₁₀) (mg/kg)	DRO (>C ₁₀ -C ₂₈) (mg/kg)	Cl* (mg/kg)
	ANALYSIS DATE	10/24/08	10/24/08	10/24/08
H16176-1	E-S	<10.0	<10.0	< 18
H16176-2	W-S	<10.0	<10.0	< 18
H16176-3	N-S	<10.0	<10.0	< 16
H16176-4	S-S	<10.0	479	< 16
H16176-5	BOTTOM	<10.0	<10.0	< 16
Quality Control		559	518	500
True Value QC		500	500	500
% Recovery		112	103	100
Relative Percent Difference		0.0	4.7	2.0

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl*: Std. Methods 4500-Cl*B
 *Analyses performed on 1:4 w:v aqueous extracts.

Chemist

Date

H16176 TCL TARGA

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



PHONE (575) 383-2326 • 101 E. MARLAND • HOBBS, NM 88240

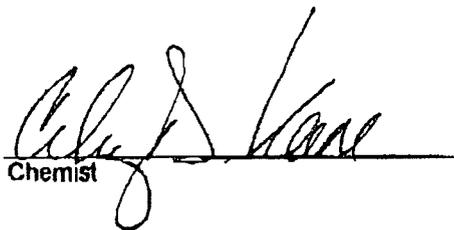
ANALYTICAL RESULTS FOR
TARGA RESOURCES
ATTN: ROGER HOLLAND
P.O. BOX 1929
EUNICE, NM 88231
FAX TO: (575) 394-1514

Receiving Date: 10/30/08
Reporting Date: 10/31/08
Project Number: NOT GIVEN
Project Name: TURNER RD. 8"
Project Location: NOT GIVEN

Sampling Date: NOT GIVEN
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: ML
Analyzed By: AB/HM

LAB NUMBER	SAMPLE ID	GRO (C ₈ -C ₁₀) (mg/kg)	DRO (C ₁₀ -C ₂₈) (mg/kg)	Cl' (mg/kg)
ANALYSIS DATE		10/30/08	10/30/08	10/30/08
H16221-1	S.S.	<10.0	<10.0	<16
Quality Control		586	523	500
True Value QC		500	500	500
% Recovery		113	105	100
Relative Percent Difference		3.4	8.1	<0.1

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl': Std. Methods 4500-Cl'B
*Analysis performed on a 1:4 w:v aqueous extract.


Chemist


Date

H16221 TCL TARGA

DISCLAIMER NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether covered in contract or not, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

DE Turner Road



03/31/2008