

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Hrazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003
Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

NSEB0835741498 OPERATOR Initial Report Final Report

Name of Company <u>Judah Oil, LLC</u> <u>245872</u>	Contact <u>James B Campanella</u>
Address <u>P.O. Box 568, Artesia, NM 88211-0568</u>	Telephone No. <u>575-746-1280</u>
Facility Name <u>Lucy Pearl State</u> <u>002</u>	Facility Type <u>Oil Storage</u>

Surface Owner <u>State</u>	Mineral Owner <u>State</u>	Lease No <u>E-4205</u>
----------------------------	----------------------------	------------------------

30 015 23337 LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
G	2	22-S	28-E	1712	North	2310	East	Eddy

Latitude _____ Longitude _____

NATURE OF RELEASE

Type of Release <u>Oil</u>	Volume of Release <u>25</u> bbls	Volume Recovered <u>40</u> bbls
Source of Release <u>Hole in stock tank</u>	Date and Hour of Occurrence <u>10:00 am</u>	Date and Hour of Discovery <u>11:00 am</u>
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? <u>Mike Bratcher w/ NMOCD Artesia Dist.</u>	
By Whom? <u>James B Campanella</u>	Date and Hour <u>11-14-2008 11:30 am</u>	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	
If a Watercourse was impacted, Describe Fully.* <u>N/A</u>		
Describe Cause of Problem and Remedial Action Taken.* <u>Hole in production tank. Called for vacume truck and transport. Transford oil from bad tank to good tank. Picked up 40 bbls of oil from ground and took to Oxy T-Bone SWD</u>		
Describe Area Affected and Cleanup Action Taken.* <u>North side of tank batt. 20'x20' ran south of batt down 10" path to low area. Low area is 25'x20'</u>		

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
	Remediation Actions to be completed and Final C-141 submitted with confirmation analyses/ documentation on or before the Expiration Date	
Printed Name: <u>James B Campanella</u>	Approved by District Supervisor: <u>J. Gunn by SB</u>	
Title: <u>Manager/President</u>	Approval Date: <u>12-22-08</u>	Expiration Date: <u>2-22-09</u>
E-mail Address: <u>judahoil@yahoo.com</u>	Conditions of Approval:	Attached <input checked="" type="checkbox"/>
Date: <u>11-15-2008</u> Phone: <u>575-746-1280</u>	<u>Attached work plan approved with strips.</u>	<u>2RP - 282</u>

Attach Additional Sheets If Necessary

December 12, 2008

New Mexico Energy and Minerals Dept.
ATTN: Sherry Bonham
1301 W Grand Ave
Artesia, NM 88210

RE: Clean up procedure on Lucy Pearl St Tank Facility, UL G, Sec 2, T-22-S, R-28-E
Eddy, County, New Mexico

Sherry,

I am submitting a Work Plan proposal for remediation on the above captioned location. This is a follow-up to my earlier submitted notification to the Artesia District Office dated November 15, 2008.

Cause of spill: Hole in production tank.

Soil type: sand and cliché

Sight Ranking: 0

Our remediation, removal, and cleanup plan is as follows:

A) Actions already preformed;

- 1) Sold oil on lease
- 2) Removed 40 bbls of oil
- 3) Removed tank battery
- 4) Removed 254 yds of contaminated soil and took to CRI Inc.
- 5) Relocated tank facility and built firewall and laid 20 mill liner
- 6) Replaced one tank and repaired the other. Reconstructed tank facility and put wells back into service.
- 7) Took soil sample from contaminated area. (Attached)

B) Further actions to be taken;

- 1) Remove contaminated soil in accordance with NMOCD guidelines and dispose of material at CRI Land-farm
- 1) Contact NMOCD Dist II office to witness all core samples which will be tested by Cardinal Labs of Hobbs NM. Samples will be taken to show vertical and horizontal delineation of contamination. (Refer to attached map)
- 3) After samples pass NMOCD guidelines, we will backfill remediated areas with fresh material and re-seed surface with BLM mixture 2.
- 4) Submit final report

If you have any questions, please do not hesitate to call.
Thank you,

James B Campanella
Manager/President
Attc/jd

P.O. Box 568
611 W Mahone, Suite D
Artesia, NM 88211-0568

Office: (505) 746-1280
Fax: (505) 746-1290
E-Mail: judahoil@yahoo.com



DEC 15 2008
OCD-ARTESIA

PHONE (575) 393-2326 • 101 E MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
JUDAH OIL LLC
ATTN: BLAISE CAMPANELLA
P.O BOX 568
ARTESIA, NM 88210
FAX TO: (575) 746-1290


Receiving Date: 11/19/08
Reporting Date: 11/25/08
Project Number: NOT GIVEN
Project Name: NOT GIVEN
Project Location: LUCY PEARL

Sampling Date: 11/19/08
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: ML
Analyzed By: ZL


LAB NUMBER	SAMPLE ID	BENZENE (mg/kg)	TOLUENE (mg/kg)	ETHYL BENZENE (mg/kg)	TOTAL XYLENES (mg/kg)
ANALYSIS DATE		11/25/08	11/25/08	11/25/08	11/25/08
H16357-1	#1	<0.050	0.834	1.51	8.45
H16357-2	#2	<0.050	3.80	3.16	17.4
H16357-3	#3	<0.050	<0.050	<0.050	<0.150
H16357-4	#4	<0.050	<0.050	<0.050	<0.150
H16357-5	#5	<0.050	<0.050	<0.050	<0.150
H16357-6	#6	<0.050	<0.050	<0.050	<0.150
H16357-7	#7	<0.050	<0.050	<0.050	<0.150
H16357-8	#8	<0.050	<0.050	0.149	1.18
Quality Control		0.060	0.049	0.055	0.151
True Value QC		0.050	0.050	0.050	0.150
% Recovery		120	98.0	110	101
Relative Percent Difference		3.4	2.1	1.2	3.0

METHOD: EPA SW-846 8260B

TEXAS NELAP CERTIFICATION T104704398-08-TX FOR BENZENE, TOLUENE, ETHYL BENZENE,
AND TOTAL XYLENES.

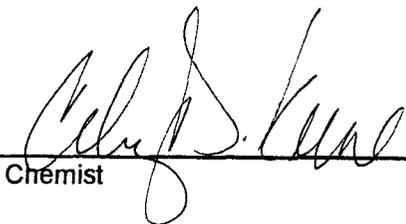

Chemist

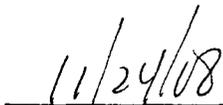

Date

PLEASE NOTE **Liability and Damages.** Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, in whole or in part, shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.



ANALYTICAL RESULTS FOR
 JUDAH OIL LLC
 ATTN: BLAISE CAMPANELLA
 P.O. BOX 568
 ARTESIA, NM 88210
 FAX TO: (575) 746-1290


Receiving Date: 11/19/08
 Reporting Date: 11/25/08
 Project Number: NOT GIVEN
 Project Name: NOT GIVEN
 Project Location: LUCY PEARL

Sampling Date: 11/19/08
 Sample Type: SOIL
 Sample Condition: COOL & INTACT
 Sample Received By: ML
 Analyzed By: AB/HM

LAB NUMBER	SAMPLE ID	GRO (C ₆ -C ₁₀) (mg/kg)	DRO (>C ₁₀ -C ₂₈) (mg/kg)	CI* (mg/kg)
ANALYSIS DATE		11/19/08	11/19/08	11/19/08
H16357-1	#1	2,650	4,760	4,160
H16357-2	#2	1,800	3,250	1,920
H16357-3	#3	<10.0	<10.0	784
H16357-4	#4	<10.0	<10.0	32
H16357-5	#5	<10.0	20.0	16
H16357-6	#6	<10.0	<10.0	<16
H16357-7	#7	96.3	379	352
H16357-8	#8	742	1,410	32
Quality Control		538	443	500
True Value QC		500	500	500
% Recovery		108	88.6	100
Relative Percent Difference		6.9	8.1	<0.1


METHODS: TPH GRO & DRO: EPA SW-846 8015 M; CI: Std. Methods 4500-CI'B

*Analyses performed on 1:4 w:v aqueous extracts.

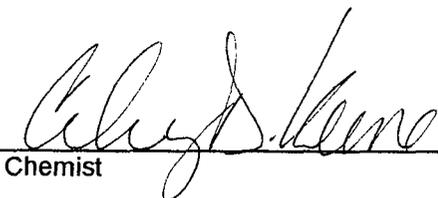
 Chemist


 Date

H16357 TCL JO

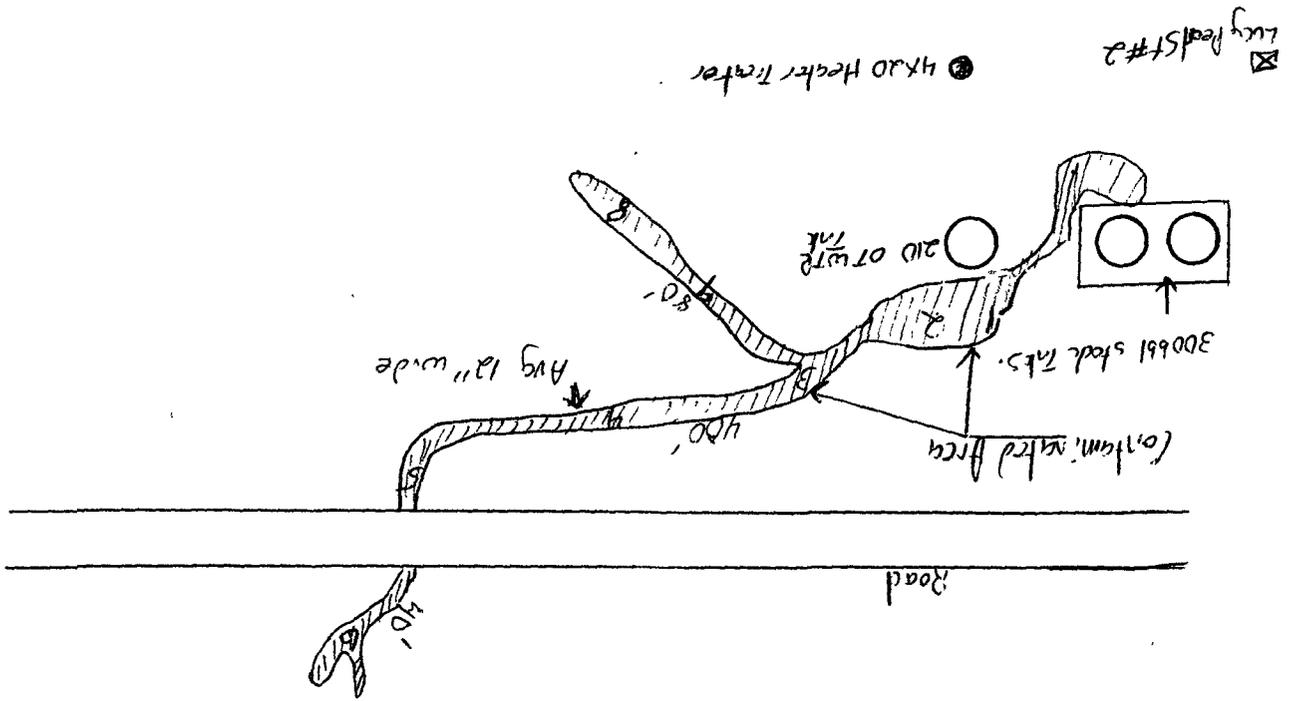

Judith O. LLC
 Lucy Reed St Tank B.H.
 U-6 Sec 2, T-22-S, R-28-E
 Eddy County NM

November 14-2008



New Mexico Energy, Minerals and Natural Resources Department

Bill Richardson
Governor

Joanna Prukop
Cabinet Secretary
Reese Fullerton
Deputy Cabinet Secretary

Mark Fesmire
Division Director
Oil Conservation Division



Judah Oil, LLC
PO Box 568
Artesia, NM 88211-0568

RE: Lucy Pearl State 2 30-015-23337
G-2-22S-28E Eddy County, New Mexico
2RP-282

Dear Operator:

The New Mexico Oil Conservation Division District 2 Office (OCD) is in receipt of a work plan proposal (plan) for remediation of a release of oil that occurred at the above referenced facility.

The plan is accepted with the following stipulations:

- Confirmation samples are to be obtained and submitted to OCD prior to backfilling.
- Notify the OCD 48 hours prior to obtaining samples where analyses are to be submitted to the OCD.
- Remediation requirements may be subject to change as site conditions warrant.
- Remediation to be completed by February 22, 2009.

Please be advised that NMOCD acceptance of this plan does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of this plan does not relieve the operator of responsibility for compliance with any other federal, state, local laws and/or regulations.

Respectfully,

Sherry Bonham
NMOCD District II

