

District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W Grand Avenue, Artesia, NM 88210  
District III  
1000 Rio Brazos Road, Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy Minerals and Natural Resources **HOBBSOCD**  
Oil Conservation Division  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-141  
Revised October 10, 2003  
Submit 2 Copies to appropriate  
District Office in accordance  
with Rule 116 on back  
side of form

JAN 28 7:11 AM

**Release Notification and Corrective Action**

**OPERATOR**

Initial Report  Final Report

Name of Company - ConocoPhillips Pipe Line Company	Contact - Kirby Shipp
Address - 4001 East 42 <sup>nd</sup> Street - Odessa, Tx. 79762	Telephone No. - 575/391-8262
Facility Name - Oxy West Injection Battery	Facility Type - Crude oil injection site

Surface Owner - State of New Mexico	Mineral Owner - State of New Mexico	Lease No. RW 28367
-------------------------------------	-------------------------------------	--------------------

**LOCATION OF RELEASE**

NEARBY WELL: N. HOBBS 4/5A UNK 421  
API #: 30-025-05504.00.00

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
H	25	18S	37E					Lea

Latitude N32° 43' .088" Longitude W103° 11' .949"

**NATURE OF RELEASE**

Type of Release - Crude oil	Volume of Release - 370 bbls. (est)	Volume Recovered - 3 bbls
Source of Release - Pump site - crack in tube thread on IMO pump	Date and Hour of Occurrence - 08/30/08 @ 5:45 PM	Date and Hour of Discovery - 08/31/08 @ 5:30 PM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? NMOCD Santa Fe Office; NMOCD District 1 (Buddy Hill)	
By Whom? Thomas Lacki, CPPL	Date and Hour: NMOCD was contacted on 3/31/08 at approximately 8:35 p.m. and 8:40 p.m. respectively.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	


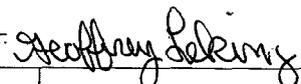
If a Watercourse was Impacted, Describe Fully.\*  
NA

WATER @ 42'

Describe Cause of Problem and Remedial Action Taken.\* A full investigation will be completed; however, based on initial observations, the release was a result of a crack in the thread seam of a 1/2 in. x 3 in. steel nipple connecting a tube to the suction side of an IMO pump. The crack, which appears to be from about the noon to eight o'clock position, resulted in a spray of crude oil from the tube. The release lasted approximately 24 hours. The pump was shutdown upon confirmation of the release and a vacuum truck was dispatched to the location collecting approximately 3 bbls of crude oil. Plastic has been placed along the ConocoPhillips right-of-way and the process of moving visually contaminated soil onto the plastic has begun.

Describe Area Affected and Cleanup Action Taken.\* The area directly impacted by the release is approximately 90ft x 100 ft in the area immediately adjacent to and south/southwest of the pump. In addition, there is an area north/northwest of the pump that was impacted by crude oil carried by the wind. Once the initial spill response activity is completed, ConocoPhillips plans to work with TetraTech to develop a sampling plan to delineate the extent of the release, and once the extent of the contamination is known, a remediation plan to address the issues. Both the sampling and remediation plans will be submitted to your office for approval prior to implementation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	<b>OIL CONSERVATION DIVISION</b>	
Printed Name: Thomas Lacki	Approved by District Supervisor: 	
Title: Environmental Coordinator	Approval Date: 02/02/09	Expiration Date: 04/03/09
E-mail Address: thomas.lacki@conocophillips.com	Conditions of Approval: DELINEATE & REMEDIATE TO CLEAN + 1. FINAL C-141 DUE 04/03/09	Attached <input type="checkbox"/> IRP-09-01-2070
Date: 9/2/08 Phone: (432) 368-1315		

\* Attach Additional Sheets If Necessary

FCRL 0903337599



**ConocoPhillips  
Pipe Line Company**

**RECEIVED**

JAN 28 2009

**HOBBSOCD**

**Thomas Lacki, CHMM**  
Environmental Coordinator  
Western Operations – Transportation  
Texas Panhandle and West Texas Districts  
**ConocoPhillips Pipe Line Company**  
4001 E. 42<sup>nd</sup> Street, Suite 105  
Odessa, TX 79762  
Phone 432.368.1315  
thomas.lacki@conocophillips.com

January 23, 2009

Certified Mail: 7007 2560 0002 4784 9830  
Return Receipt Requested

State of New Mexico  
Oil Conservation Division - District I  
Attn: Mr. Larry Johnson  
1625 N. French Dr.  
Hobbs, NM 88240

**RE: Oxy WIB  
ConocoPhillips Pipe Line Company  
C-141 Initial Notification Form**

Dear Mr. Johnson,

As requested, please find the attached copy of the C-141 for the crude oil release at the above referenced ConocoPhillips Pipe Line (CPPL) Company facility.

I appreciate your assistance with this matter and ask that you please contact me at (432) 368-1315 or at thomas.lacki@conocophillips.com with any questions, or if you require any additional information

Best regards,

A handwritten signature in black ink, appearing to read "Thomas Lacki", is written over a horizontal line.

Thomas Lacki, CHMM  
Environmental Coordinator

Enc.  
RC w/enc. Kirby Shipp; ConocoPhillips Pipe Line Company

# D D Landfarm, Inc.

Box 36  
Monument, N.M. 88265.

Date: 1-23-09

**RECEIVED**

JAN 28 2009

**HOBBSOCD**

New Mexico  
Energy Minerals and Natural Resources Dept.  
Oil Conservation Division  
1625 N. French Dr.  
Hobbs, N. M. 88240

Quarterly report ending 12-31-08 for D D Landfarm, Inc.

D D Landfarm did not receive any contaminated soil this quarter. Remediation of on site  
Soil continues.

Jimmie B. Cooper  
D D Landfarm, Inc.  
Box 36  
Monument, N. M. 88265