

District I
1625 N. French Dr , Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S St. Francis Dr , Santa Fe, NM 87505

RECEIVED
APR 17 2009
HOBBSOCD

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

X Initial Report XX Final Report

Name of Company Oxy USA WTP	Contact Dusty Wilson
Address 1017 W. Stanolind Rd	Telephone No. (575) 397-8247
Facility Name Byers B Battery	Facility Type Oil Gathering
Surface Owner Bob McCasland	Mineral Owner Oxy
Lease No.	

LOCATION OF RELEASE

BYERS B 001 API #30-025-28325-00-00

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
H	7	20s	38e					Lea

Latitude _____ Longitude _____

NATURE OF RELEASE

Type of Release Oil and Produce Water.	Volume of Release 15 bo 15 bw	Volume Recovered 10 bo 10 bw
Source of Release Tank Overflow	Date and Hour of Occurrence 3/27/09	Date and Hour of Discovery 3/27/09
Was Immediate Notice Given? X Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Jeff Leking	
By Whom? Dusty Wilson	Date and Hour 3/31/09	
Was a Watercourse Reached? <input type="checkbox"/> Yes X No	If YES, Volume Impacting the Watercourse. n/a	

If a Watercourse was Impacted, Describe Fully.*
N/A

WATER @ 40'

Describe Cause of Problem and Remedial Action Taken.*
Tank runover due to power loss overnight. Spill stayed within fire wall of battery. Battery floor is lined with plastic liner, and a vac truck was used to recover all free standing fluids. Refer to closure report for remediation actions.

Describe Area Affected and Cleanup Action Taken.*
Remediate to NMOCD Requirements.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	OIL CONSERVATION DIVISION	
Printed Name: Dusty L. Wilson	Approved by District Supervisor	
Title: HES Specialist	Approval Date: 04/17/09	Expiration Date: —
E-mail Address: dusty_wilson@oxy.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 4/14/09 Phone: (575) 397-8210		IRP-09.4.2158

- Attach Additional Sheets If Necessary

FOR L0910758610



OXY USA WTP LP

4008 N. Grimes PMB#269
Hobbs, NM 88240
575-397-8210 Office
575-397-8204

4/3/2009

NMOCD
1625 N. FRENCH DRIVE
HOBBS NM 88240

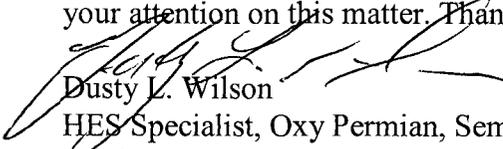
RE: FINAL REPORT/ REPORTABLE SPILL 03/27/09
Byers "B" Battery

To Whom It May Concern:

This spill occurred on 03/27/2009 and was reported to the NMOCD via telephone the next day. Oxy reported a loss of 15 bbls of Oil, and 15 bbls of Produce Water. 10 bbls of Oil and 10 bbls of Produce Water were recovered by vac truck the day of the release. The original C-141 form was ~~hand delivered~~^{mailed} with this closure report. The affected spill area was contained within the above listed well location site, and affected a 60' X 40' area, within the battery's fire wall, at the surface level. The Battery floor was covered with a 20 mil plastic liner prior to the spill, and then covered with Pea Gravel, as part of the sites construction. A visual inspection of the site showed that all of the surface fluids were recovered via vac truck at the time of the spill, and that the plastic liner was intact at the time of the spill, containing the fluids on top of the liner with no contamination below the liner. A backhoe, was used to excavate the affected Pea Gravel to a depth of 4", and removed them to an approved disposal, Sundance Services, Eunice NM. The area was backfilled with clean Pea Gravel and remediation completed. The above was approved via telephone by NMOCD, Jeff Leking, on 3/31/09 at 2:45 pm.

This letter is to inform the NMOCD that all remediation for this spill was completed to NMOCD standards, and to close this spill site. If any further information is needed please feel free to contact Dusty Wilson, HES Specialist, Oxy Permian, at (575) 441-7189.

A copy of the C-141, and site photos are being sent with this closure letter. Thank you for your attention on this matter. Thank You.


Dusty L. Wilson
HES Specialist, Oxy Permian, Seminole RMT
(575) 441-7189

