

Bratcher, Mike, EMNRD

From: Logan Anderson [la_elkeenv@yahoo.com]
Sent: Thursday, March 04, 2010 1:17 PM
To: Bratcher, Mike, EMNRD
Subject: Linn Operating - C A Russell Battery
Attachments: Plat Map and Field Analysis.pdf

Follow Up Flag: Follow up
Flag Status: Completed

Mike,

Attached is the delineation of the spill using field analysis.


Thanks,
Logan Anderson

Project Manager
Elke Environmental, Inc.
off 432-366-0043
cell 432-664-1269
fax 432-366-0884

This inbound email has been scanned for malicious software and transmitted safely to you using Webroot Email Security.

Linn Operating
C A Russell Battery
Eddy County, NM

Plat Map

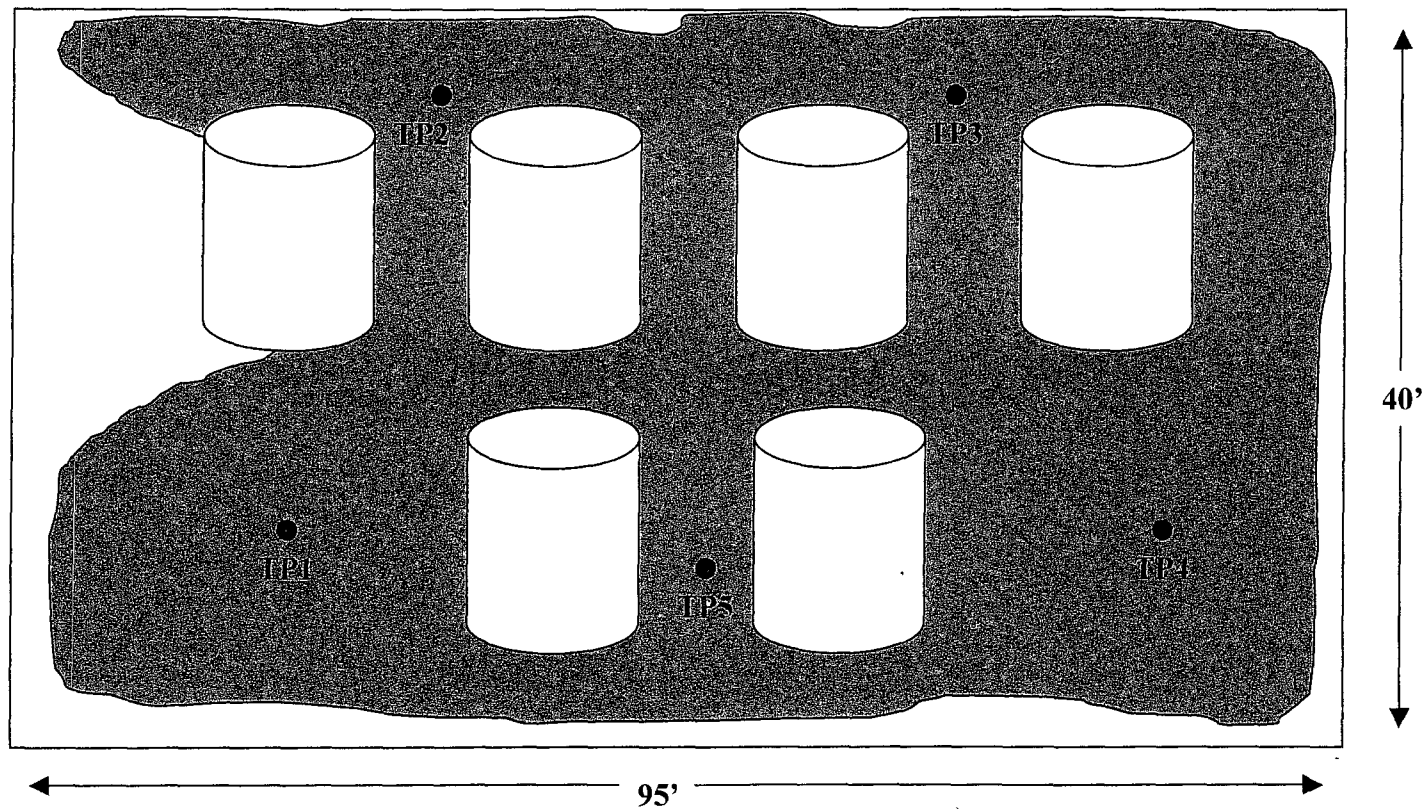

Elke Environmental, Inc.

P.O. Box 14167 Odessa, TX 79768

Field Analytical Report FormClient Linn Operating Analyst Bobby SteadhamSite C A Russell Battery

Sample ID	Date	Depth	418.1 TPH / PPM	CI / PPM	PID / PPM	GPS
TP1	2-25-10	6"	6,450	175	1,055	32° 50.291' N 103° 54.335' W
TP1	2-25-10	1' 6"	1,004	169	219	32° 50.291' N 103° 54.335' W
TP1	3-3-10	3' 6"	1,278	239	119	32° 50.291' N 103° 54.335' W
TP1	3-3-10	4' 6"	1,295	509	106	32° 50.291' N 103° 54.335' W
TP1	3-3-10	5' 6"	465	1,075	13.5	32° 50.291' N 103° 54.335' W
TP1	3-3-10	6' 6"	6	1,762	8.7	32° 50.291' N 103° 54.335' W
TP1	3-3-10	7' 6"		1,876	6.4	32° 50.291' N 103° 54.335' W
TP1	3-3-10	8' 6"		1,423	4.5	32° 50.291' N 103° 54.335' W
TP1	3-3-10	9' 6"		1,687	3.7	32° 50.291' N 103° 54.335' W
TP1	3-3-10	10' 6"		2,377	4.8	32° 50.291' N 103° 54.335' W
TP1	3-3-10	11' 6"		1,966	5.2	32° 50.291' N 103° 54.335' W
TP1	3-3-10	12' 6"		871	3.1	32° 50.291' N 103° 54.335' W
TP1	3-3-10	13' 6"	11	256	2.0	32° 50.291' N 103° 54.335' W
TP2	2-25-10	6"	15,410	184	1,635	32° 50.294' N 103° 54.335' W
TP2	2-25-10	1' 6"	400	79	717	32° 50.294' N 103° 54.335' W
TP2	3-2-10	2' 6"	167	122	95.0	32° 50.294' N 103° 54.335' W

Analyst Notes _____

Elke Environmental, Inc.

P.O. Box 14167 Odessa, TX 79768

Field Analytical Report Form**Client** Linn Operating **Analyst** Bobby Steadham**Site** C A Russell Battery

Sample ID	Date	Depth	418.1 TPH / PPM	CI / PPM	PID / PPM	GPS
TP3	2-25-10	6"	19,580	92	1,514	32° 50.296' N 103° 54.328' W
TP3	2-25-10	1' 6"	976	117	926	32° 50.296' N 103° 54.328' W
TP3	3-2-10	2' 6"	1,276	173	1,186	32° 50.296' N 103° 54.328' W
TP3	3-2-10	3' 6"	127	118	277	32° 50.296' N 103° 54.328' W
TP3	3-2-10	5'	14	114	47.9	32° 50.296' N 103° 54.328' W
TP4	2-25-10	6"	22,150	119	1,305	32° 50.294' N 103° 54.323' W
TP4	2-25-10	1' 6"	12,850	119	1,118	32° 50.294' N 103° 54.323' W
TP4	3-2-10	2' 6"	487	200	384	32° 50.294' N 103° 54.323' W
TP4	3-2-10	3' 6"	587	119	113	32° 50.294' N 103° 54.323' W
TP4	3-2-10	4' 6"	1,250	109	76.3	32° 50.294' N 103° 54.323' W
TP4	3-2-10	5' 6"	682	141	41.1	32° 50.294' N 103° 54.323' W
TP5	2-25-10	6"	22,000	176	1,341	32° 50.292' N 103° 54.331' W
TP5	2-25-10	1' 6"	1,250	129	1,304	32° 50.292' N 103° 54.331' W
TP5	3-2-10	2' 6"	1,690	247	529	32° 50.292' N 103° 54.331' W
TP5	3-2-10	3'	10,190	449	457	32° 50.292' N 103° 54.331' W

Analyst Notes _____

Elke Environmental, Inc.

P.O. Box 14167 Odessa, TX 79768

Field Analytical Report Form

Client Linn Operating **Analyst** Bobby Steadham

Site C A Russell Battery

Sample ID	Date	Depth	418.1 TPH / PPM	CI / PPM	PID / PPM	GPS
TP5	3-2-10	3' 6"	3,660	569	104	32° 50.292' N 103° 54.331' W
TP5	3-2-10	5'	32	773	41.0	32° 50.292' N 103° 54.331' W
TP5	3-2-10	5' 6"		703		32° 50.292' N 103° 54.331' W
TP5	3-3-10	6'		860		32° 50.292' N 103° 54.331' W
TP5	3-3-10	8'	16	235	54.5	32° 50.292' N 103° 54.331' W
North Wall	3-3-10	5'	27	209	11.1	32° 50.297' N 103° 54.330' W
East Wall	3-3-10	5'	16	149	10.8	32° 50.296' N 103° 54.318' W
South Wall	3-3-10	5'	31	259	7.0	32° 50.288' N 103° 54.331' W
West Wall	3-3-10	5'	369	271	29.0	32° 50.291' N 103° 54.340' W

Analyst Notes _____