

Sample ID	Sample Date	Sample Type	Depth	BTEX	GRO	DRO	TOTAL	Chlorides
Tank Bottom	7/21/2010	Composite/Backhoe	3'	112.04	943	1350	2293	39.4
Tank Bottom	7/21/2010	Composite/Backhoe	6'	367.2	5680	7980	13660	97.8
Tank Bottom	7/21/2010	Composite/Backhoe	9'	383.5	3400	4760	8160	77.4
North/East Side	7/21/2010	Composite/Backhoe	3'	50.28	456	1020	1476	46
North/East Side	7/21/2010	Composite/Backhoe	6'	0.0028	ND	ND	ND	ND
North/East Side	7/21/2010	Composite/Backhoe	9'	ND	ND	ND	ND	ND
West/South Side	7/21/2010	Composite/Backhoe	3'	ND	ND	ND	0	5.57
West/South Side	7/21/2010	Composite/Backhoe	6'	ND	ND	ND	0	ND
West/South Side	7/21/2010	Composite/Backhoe	9'	ND	ND	ND	ND	ND
Sample ID	Sample Date	Sample Type	Depth	BTEX	GRO	DRO	TOTAL	Chlorides
Tank Bottom	9/14/2010	Composite/Backhoe	10'	114.67	2120	1230	3350	
Tank Bottom	9/14/2010	Composite/Backhoe	12'	368.7	8950	4710	13660	
Tank Bottom	9/14/2010	Composite/Backhoe	14'	299.0	6910	3910	10820	
Tank Bottom	9/14/2010	Composite/Backhoe	16'	201.30	5650	3150	8800	
Tank Bottom	9/14/2010	Composite/Backhoe	18'	193.6	5170	3410	8580	
Tank Bottom	9/14/2010	Composite/Backhoe	20'	147.4	4150	2650	6800	
Sample ID	Sample Date	Sample Type	Depth	BTEX	GRO	DRO	TOTAL	Chlorides
Tank Bottom	10/20/2010	Drilled	25-26'	64.70	1010	471	1481	
Tank Bottom	10/20/2010	Drilled	30-31'	68.4	530	202	732	
Tank Bottom	10/20/2010	Drilled	34-35'	69.1	1350	516	1866	
Tank Bottom	10/20/2010	Drilled	39-40'	17.90	562	313	875	
Tank Bottom	10/20/2010	Drilled	44-45'	9.3	278	194	472	
Tank Bottom	10/20/2010	Drilled	48-50'	52.2	323	172	495	


Site Ranking is Zero (0). Depth to Ground Water >100' (approx. 168', per New Mexico State Engineer Office).

All results are ppm.




Well Head

Battery

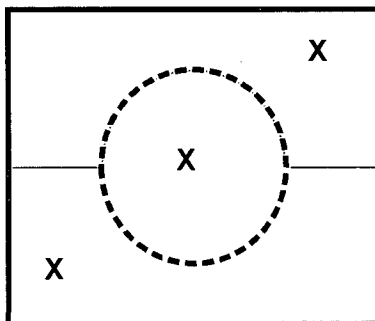

Lease Road

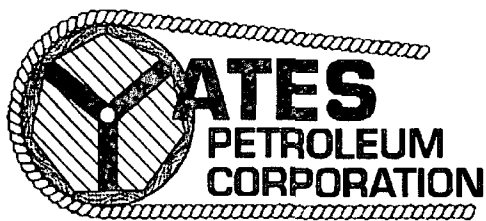

Skuzie XL Com. #1

30-015-20922

Section 11, T18S-R25E

Eddy County, NM

SAMPLE DIAGRAM (Not to Scale)

Prepared by Robert Asher
Environmental Regulatory Agent