

GW - 14

REPORTS

YEAR(S):

1990

**OVERFLOW POND POST REMEDIATION REPORT
LEA REFINERY
LOVINGTON, NEW MEXICO**

**PREPARED FOR
SOUTHERN UNION COMPANY**

OCTOBER, 1990





Geraghty & Miller, OCD Meeting on Southern Union Refinery

11/5/90 0930 hrs

Handled out closure report on cooling tower disposal, spill areas ("Overflow Pond Post Remediation Report")
EID has left them alone so far

Will present document to EID today for clean closure

Participants

Dave Boyer - OCD
Roger Anderson - OCD
Bill Olson - OCD
Eugene Dubay - Southern Union Co.
Terese Salamone - Geraghty & Miller

OVERFLOW POND POST REMEDIATION REPORT

LEA REFINERY

LOVINGTON, NEW MEXICO

Prepared For

SOUTHERN UNION COMPANY

OCTOBER, 1990

TABLE OF CONTENTS

EXECUTIVE SUMMARY	1
INTRODUCTION	2
GEOLOGY	3
FIELD PROGRAM	4
Excavation	4
Stockpiles	5
Soil Sampling	6
RESULTS	7
Phase 1	7
Phase 2	7
Phase 3	8
Phase 4	8
Soil Disposal	9
Backfilling	10
CONCLUSIONS	11

LIST OF TABLES

Table

1. Overflow Pond Confirmation Soil Analyses
2. Overflow Pond Soil Stockpile Analyses

LIST OF FIGURES

Figure

1. Location Map
2. Phase I (3-29-90)
3. Phase II (3-30-90)
4. Phase III (4-5-90)
5. Phase IV (4-12-90)
6. Soil Stockpile Locations

LIST OF APPENDICES

Appendix

- A. Photographs
- B. Laboratory Analyses, Chain of Custody
- C. Correspondence
- D. Transportation Manifests

**OVERFLOW POND POST REMEDIATION REPORT
LEA REFINERY
LOVINGTON, NEW MEXICO**

EXECUTIVE SUMMARY

The excavation and subsequent backfilling of the overflow pond area at the Lea Refinery located 4 miles south of Lovington, New Mexico is described in this document. The refinery was operated by Southern Union Company from 1974 through 1986 and was purchased by the Holly Corporation (Navajo Refining) in 1989.

In response to a February 4, 1987 letter issued by Roger C. Anderson of the New Mexico Oil Conservation Division (OCD), closure of the overflow pond was initiated in February of 1987. Free liquids were removed from the pond and clean soils were used to backfill the site. These soils were mixed with the remaining pond sludges in the backfilling process. The fiberglass pond liner was not removed.

Removal of the soil/sludge mixture and overexcavation of the backfilled overflow pond began in March of 1990. This remedial work was initiated by Southern Union Company as part of a property transfer agreement with the Holly Corporation. Removed soils were transported to the Rio Rancho Sanitary Landfill facility near Albuquerque, New Mexico with the approval of the New Mexico OCD and Environmental Improvement Division (EID). The excavation and disposal proceeded until background levels of total petroleum

hydrocarbons, as approved by the OCD, were achieved in all soil confirmation samples collected.

Approximately 4,500 cubic yards of soil were removed from the overflow pond site. Backfilling of the site was approved by the OCD and completed on April 27, 1990. Backfill materials were caliche and soils obtained from a Lea Refinery owned borrow pit near the overflow pond site. The backfilled area was returned to natural grade.

INTRODUCTION

The excavation of the sludge/soil mixture of the former overflow pond site located at the Lea Refinery on State Highway 18 south of Lovington, New Mexico (Figure 1) is documented in this report. The Lea Refinery was formerly owned and operated by the Southern Union Company of Dallas, Texas. The property was sold to the Holly Corporation, also of Dallas, Texas, in 1989. The overflow pond cleanup by Southern Union was included in the property transfer agreement. The refinery is not in operation at this time.

Geraghty & Miller, Inc. (G&M) authored a closure plan for the overflow pond for submittal to the OCD dated August 14, 1989. This plan was approved on October 13, 1989 in a letter written to Mr. Russel Buss of Southern Union by Mr. David Boyer of the OCD (Appendix C).

Southern Union Company retained G&M to provide onsite supervision of the cleanup operation and to conduct post-remedial soil sampling. Chemical Waste Management, Inc. provided the personnel and equipment for excavation. Excavated materials were transported by TAD Trucking of Hobbs, New Mexico to the Rio Rancho Sanitary Landfill near Albuquerque, New Mexico.

GEOLOGY

The Lovington area is located within the limits of a large subsurface structural feature known as the Permian Basin. Oil and gas exploration has revealed a complex subsurface geology which involves rocks from Precambrian to Permian in age. This structure is overlain by gently southeasterly dipping Triassic redbeds separated from the older rocks by an erosional unconformity.

Above the Triassic redbeds are the Pliocene age sediments of the Ogallala formation. These sediments form the Llano Estacado surface and were deposited by easterly flowing, braided, streams following the Laramide revolution and the raising of the Rocky Mountains to the west.

The upper portion of the Ogallala contains a dense caliche cap up to 15 feet thick at the refinery site. This caliche is composed of calcium carbonate deposited in the soil through

a leaching and redeposition process common in the southwestern United States. It is variable in hardness and texture and can be locally fractured.

Poorly cemented sand and silt underlie the caliche. This material is found to a depth of at least 90 feet beneath the Lea Refinery. The excavation at the overflow pond was completed in this sand at a depth of approximately 35 feet below ground level.

FIELD PROGRAM

Excavation

A trackhoe was used to remove the soils and sludge mixture remaining from the 1987 overflow pond closure. A front-end loader moved the excavated material from the edge of the pit to the stockpiling area (see Appendix A photos).

Soil boring data obtained during the field investigation conducted prior to the August 14, 1989 closure plan suggested that minimal soil contamination would be found beneath the pond's fiberglass liner. Excavation revealed that the fiberglass liner was a simple saucer-shaped layer about 8 feet below ground level in the center of the pond varying in depth to about 2 feet below the surface at the margins. The liner was approximately 1/8-inch in thickness and cracked in many places. Damage to the liner may have occurred during the 1987 closure activities in which sludges were mechanically mixed with backfill soils by construction equipment. Excavation also discovered the presence of a concrete sump and

drain system below the liner. Soil contamination from sump and liner leakage required more extensive excavation than originally planned.

The overflow pond excavation was opened in four separate phases so that analytical data could be used in conjunction with observed soil staining and odor to re-evaluate the required depth and width of the excavation. Each phase was followed by soil sampling. When the results of this sampling indicated soil values above the predetermined background level of 28 parts per million total petroleum hydrocarbons (as approved by the OCD in the closure plan), additional excavation in the area of each contaminated sample was initiated. The excavation and sampling process continued until all samples were at or below background levels.

Figures 2 through 5 are sketches of the excavation phases. Sample points represented on the figures are approximate and do not represent surveyed locations. Photographs of the overflow pond excavation may be found in Appendix A.

Stockpiles

Excavated soil was stockpiled on 6-mil thick plastic sheeting to the east side of the excavation. Most soil stockpiles averaged approximately 200 cubic yards of soil. Figure 6 shows the location of the stockpiles with respect to the excavation and Appendix A contains photos.

Soil Sampling

All soil samples were collected by G&M personnel using clean steel trowels. Excavation soil samples were collected from a depth of about 6 inches in the sidewalls and bottom of the pit (Figures 2 through 5). Stockpile soil samples were collected for each stockpile, approximately 200 yards per sample (Figure 6). These stockpile samples were collected by digging into the pile to a depth of about 1 foot at 5 or 6 randomly spaced locations and combining the samples in one sample container. A total of 28 excavation samples and 19 stockpile samples were collected.

Samples were placed in glass jars with teflon lined caps, labeled, sealed and placed on ice for preservation. Samples were shipped to Southwestern Laboratories in Dallas, Texas via overnight mail for analysis. Quality control and chain of custody procedures were employed. Soil samples were analyzed for benzene, toluene, ethylbenzene, and xylenes (BTEX) by Environmental Protection Agency (EPA) Method 8020 and for total petroleum hydrocarbons (TPH) by EPA Method 418.1.

RESULTS

Phase 1

Excavation of the overflow pond was initiated on March 13, 1990. This first phase involved the removal of the soil/sludge mixture overlying the original fiberglass liner. The remnants of a concrete sump and associated drain line were also removed. About 2,200 cubic yards of soil were excavated in Phase 1.

Six samples, numbered S-OPC1 through S-OPC6, (see Table 1 and Figure 2) were collected on March 29, 1990 and were analyzed for TPH and total BTEX. The results of this sampling indicated that additional excavation was necessary in the area below the former sump drain line, the south pit wall and the northern pit wall. TPH values as high as 19,100 milligrams per kilogram (mg/kg) remained in place at this time.

Phase 2

The second phase of the excavation (see Figure 3) began on March 30, 1990. Some 1,200 additional yards of soil were removed from the area to the northeast of the sump. This area of stained soil was discovered during the removal of soil from around soil sample S-OPC6 and followed at depth to the east and south.

Samples S-OPC7 through S-OPC13 were taken at this time. Results of these analyses (Table 1) indicated that TPH values up to 3,740 mg/kg remained in the northern portion of the deepest part of the pit.

Phase 3

The third phase (see Figure 4) was initiated on April 3, 1990. About 600 yards of additional soil were removed from the pit bottom. Soil samples S-OPC14 through S-OPC21 were taken at this time. Results of this set of samples (Table 1) showed that TPH values in the deepest section of the northern part of the pit had increased with depth at sample locations S-OPC16 and S-OPC17. In addition, the deepened ramp area to the west contained unacceptable levels of hydrocarbons. More excavation was planned.

Phase 4

The fourth and final phase (see Figure 5) of the excavation of the former overflow pond began on April 11, 1990 primarily in the northern half of the pit. Because of the increasing depth of the excavation, the operational limitations of the trackhoe required that a ramp be constructed into the lower levels of the affected area. The final excavation reached a total depth of approximately 35 feet below grade.

The final soil samples taken were S-OPC22 through S-OPC28. These soil sample results (Table 1) were much improved as compared to prior sample results. The target background level of 28 mg/kg was reached in all but two samples, both of which contained only 31 mg/kg TPH. These results are within laboratory error limits of the 28 mg/kg target and are essentially the same number. No further excavation was warranted.

Laboratory sheets for all excavation samples may be found as Appendix B.

Soil Disposal

Soil stockpile analyses for each excavation phase were submitted to the Rio Rancho Sanitary Landfill, operated by Waste Management of North America, near Albuquerque, New Mexico for approval of disposal at this facility. Rio Rancho is a New Mexico Class A municipal landfill. Approval for soil disposal was arranged by Chemical Waste Management, Inc.

TPH values for the stockpile composite samples ranged from 315 to 13,040 mg/kg and averaged slightly over 6,000 mg/kg. Total BTEX levels ranged from 0.06 to 44.9 mg/kg and averaged 6.4 mg/kg. A summary of soil stockpile analyses may be found as Table 2 and laboratory sheets as Appendix B.

TAD Trucking of Hobbs, New Mexico transported all soils to Rio Rancho. Eighteen-wheel end-dumps were utilized, averaging 20 cubic yards of soil per load. Trucks were weighed at onsite scales to ensure compliance with New Mexico highway load limits and to provide weights for volume estimations for the preparation of non-hazardous manifests. Manifests were provided by Chemical Management and signed by a representative of Southern Union. Copies of the manifests are presented as Appendix D.

Correspondence related to OCD and EID approval of overflow pond soil disposal at the Rio Rancho facility may be found as Appendix C.

Backfilling

A formal request for permission to backfill the overflow pond excavation was submitted to Mr. David Boyer of the New Mexico Oil Conservation Division on April 18, 1990. Verbal permission for pit closure was received from Mr. David Boyer in a telephone call on April 20th, followed by written approval on April 23rd.

The backfilling work was initiated on April 23rd and finished on the 27th. Caliche and soil from a borrow pit located approximately 1,000 feet west of the refinery facility were used as backfill. The borrow pit is owned by the Holly Corporation. The borrow pit was sampled prior to the submission of the August, 1989 overflow pond closure plan. Analytical results showed that this material did not contain any soil contaminants and was suitable for

use as backfill. The chemical analyses for the borrow pit were presented to the OCD as part of the closure plan and were approved by the OCD in an October 13, 1989 letter. Appendix C contains all correspondence relating to backfilling of the overflow pond excavation.

CONCLUSIONS

The cleanup of the overflow pond at the Lea Refinery required approximately one month for completion, during March and April, 1990. A clean closure to background levels approved by the Oil Conservation Division of the Energy, Minerals and Natural Resources Department of the State of New Mexico was achieved.

A total of 4,500 yards of soil were removed to a maximum depth of 35 feet. Downward migration of hydrocarbons within the Ogallala Formation was probably along fracture pathways in the near surface caliche and then spread in the high permeability of the underlying sand.

All soils excavated from the former overflow pond were transported offsite by truck to the Rio Rancho Class A Municipal Landfill near Albuquerque, New Mexico for disposal.

Approval to backfill the excavated area was verbally granted by the New Mexico Oil Conservation Division and was confirmed by written correspondence dated April 23, 1990.

Backfilling was completed to natural grade, using soil and caliche from an approved borrow pit on April 27, 1990.

Respectfully submitted,

GERAGHTY & MILLER, INC.



David Kvasnicka
Geologist



Allan Schmidt
Principal Scientist/Project Manager



Anchor E. Holm, P.E.
Associate

TABLES

TABLE 1
LEA REFINERY
OVERFLOW POND CONFIRMATION
SOIL ANALYSES IN MG/KG

PHASE	DATE	SAMPLE	TPH	TOTAL BTEX
1	3-29-90	S-OPC 1	4,774	<0.02
1	3-29-90	S-OPC 2	<25	0.09
1	3-29-90	S-OPC 3	885	103
1	3-29-90	S-OPC 4	<25	<0.02
1	3-29-90	S-OPC 5	<25	<0.02
1	3-29-90	S-OPC 6	19,100	340
2	3-30-90	S-OPC 7	30	<0.02
2	3-30-90	S-OPC 8	<25	<0.02
2	3-30-90	S-OPC 9	600	0.94
2	3-30-90	S-OPC 10	3,740	16.70
2	3-30-90	S-OPC 11	<25	<0.02
2	3-30-90	S-OPC 12	30	<0.02
2	3-30-90	S-OPC 13	1,330	4.37
3	4-05-90	S-OPC 14	53	<0.02
3	4-05-90	S-OPC 15	<25	<0.02
3	4-05-90	S-OPC 16	7,760	22.90
3	4-05-90	S-OPC 17	4,450	44.20
3	4-05-90	S-OPC 18	40	6.29
3	4-05-90	S-OPC 19	40	0.06
3	4-05-90	S-OPC 20	3,870	0.06
3	4-05-90	S-OPC 21	<25	<0.02
4	4-12-90	S-OPC 22	<25	<0.02
4	4-12-90	S-OPC 23	31	<0.02
4	4-12-90	S-OPC 24	31	<0.02
4	4-12-90	S-OPC 25	<25	<0.02
4	4-12-90	S-OPC 26	<25	<0.02
4	4-12-90	S-OPC 27	<25	0.04
4	4-12-90	S-OPC 28	<25	<0.02

07/27/90

TABLE 2
LEA REFINERY
OVERFLOW POND SOIL STOCKPILE
ANALYSES IN MG/KG

SAMPLE	DATE	BENZENE	TOLUENE	EB	XYLENES	BTEX	TPH
S-OPS 1	3-16-90	0.02	0.19	0.76	1.20	2.17	5,130
S-OPS 2B	3-20-90	1.35	10.9	12.0	20.6	44.9	7,350
S-OPS 3	3-16-90	0.08	1.03	2.76	3.55	7.42	7,200
S-OPS 4	3-16-90	0.12	1.18	1.58	2.42	5.30	11,530
S-OPS 5	3-16-90	0.08	0.52	0.97	1.34	2.91	13,040
S-OPS 6	3-16-90	0.36	2.12	2.66	3.68	8.82	10,800
S-OPS 7	3-16-90	0.36	2.12	2.66	3.68	8.82	7,800
S-OPS 8	3-22-90	0.02	0.18	1.82	3.42	5.44	9,800
S-OPS 9	3-22-90	<0.2	<0.2	0.07	0.33	0.40	8,200
S-OPS 10	3-22-90	<0.02	<0.02	0.41	0.57	1.00	6,735
S-OPS 11	3-22-90	0.28	0.25	2.02	4.87	7.42	4,300
S-OPS 12	3-29-90	<0.02	<0.02	0.02	0.07	0.09	1,620
S-OPS 13	3-29-90	<0.02	<0.02	<0.02	0.06	0.06	754
S-OPS 14	3-29-90	7.79	5.32	5.79	4.19	23.1	4,465
S-OPS 15	3-30-90	0.03	0.09	0.10	0.69	0.91	3,740
S-OPS 16	4-12-90	0.06	0.06	0.28	0.48	0.87	3,868
S-OPS 17	4-12-90	<0.02	<0.02	0.03	0.11	0.14	6,747
S-OPS 18	4-12-90	0.04	0.09	0.09	0.54	0.76	315
S-OPS 19	4-12-90	0.03	0.03	0.19	0.90	1.15	1,830

08/09/90

FIGURES

DRAFTER:

MGR:


COMPILER:

CAD FILE: NON-CAD

FILE NO.:

PROJECT NO.:

DATE:

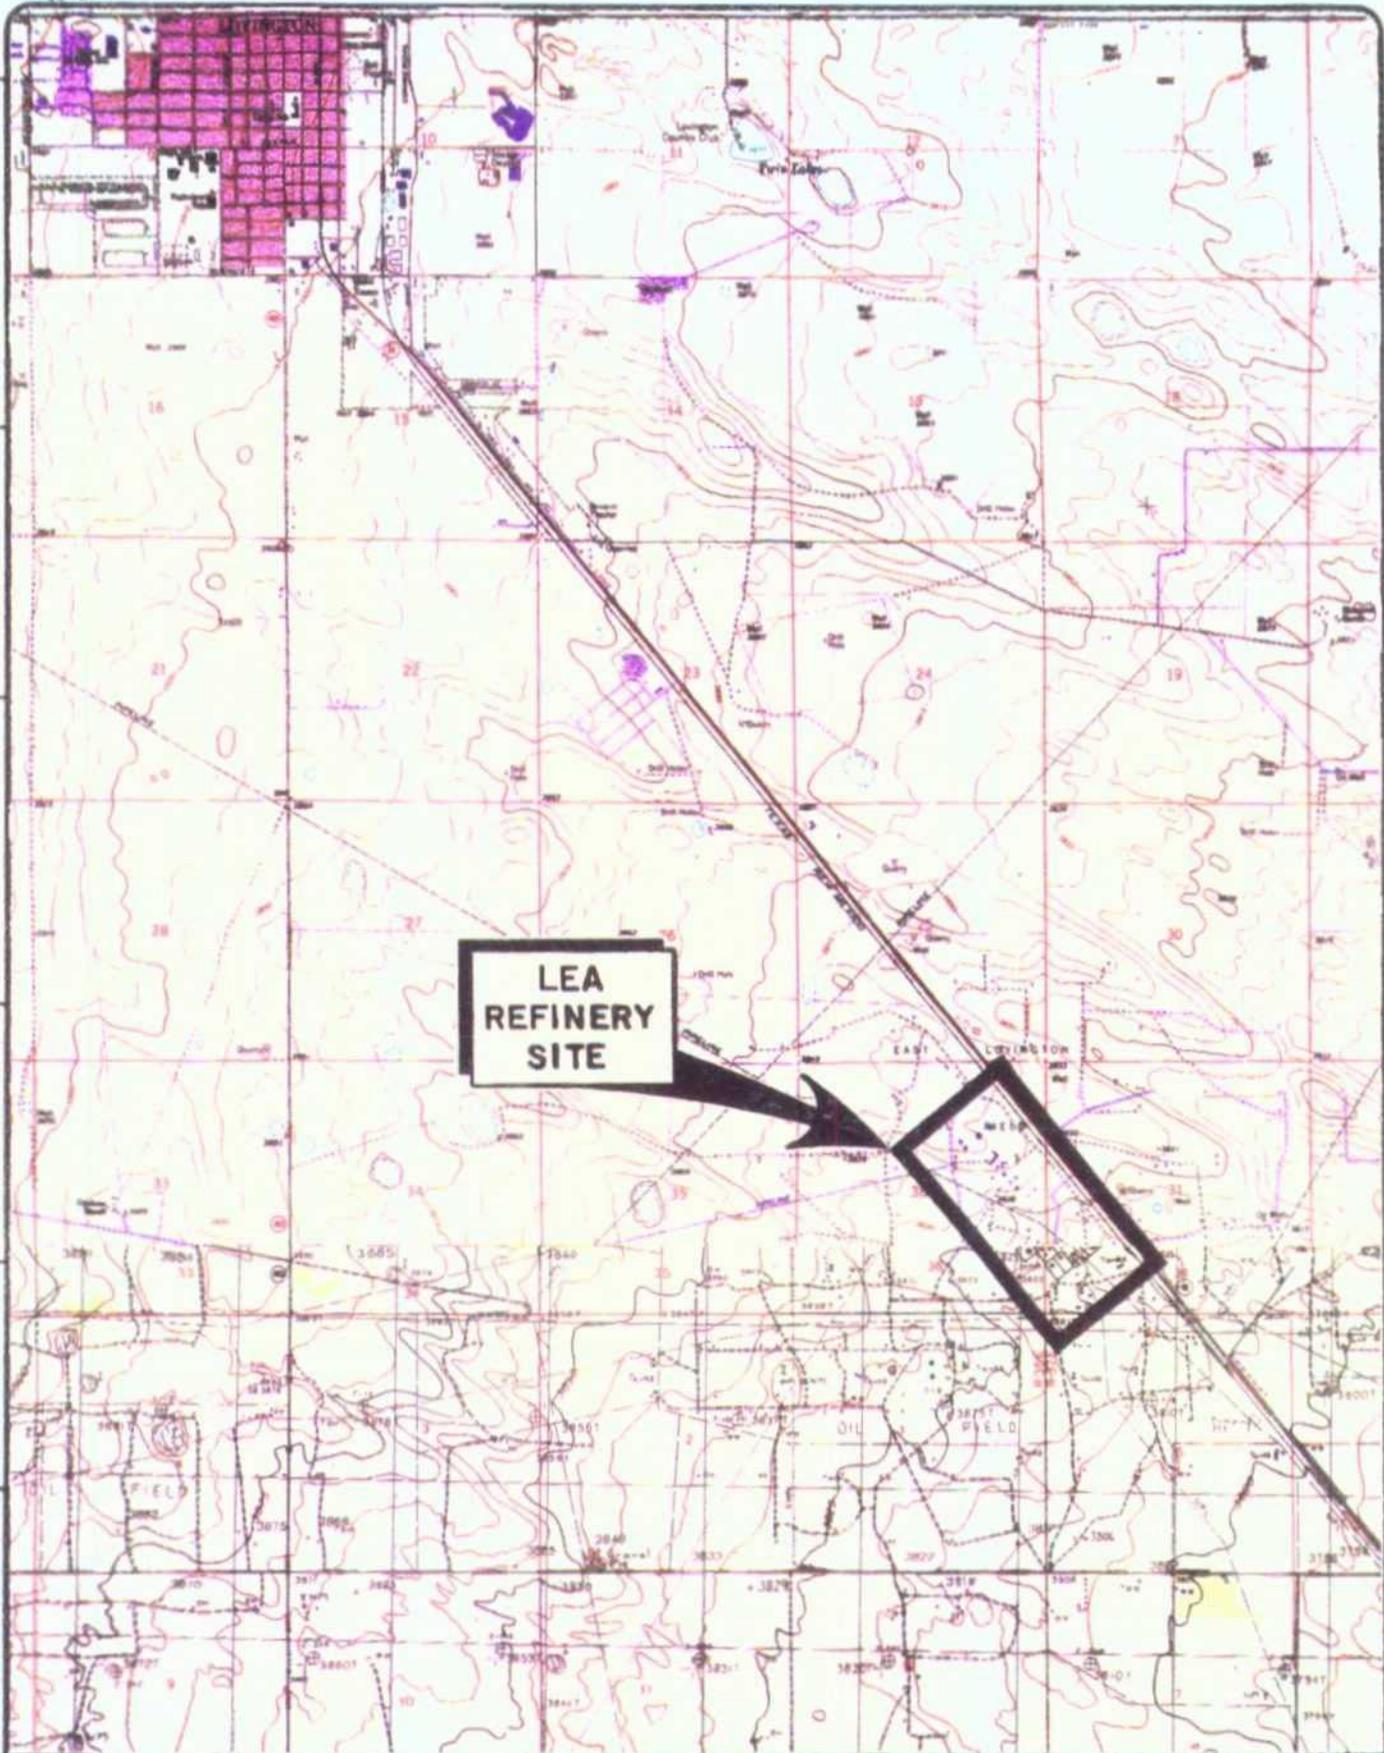

SCALE
0 4000'



**GERAGHTY
& MILLER, INC.**
Environmental Services

**LEA REFINERY SITE
LOCATION MAP**

FIGURE

1

DRAFTER: T. CHILDERS

MGR.: A. SCHMIDT


COMPILED: D. KVASNICKA

CAD FILE: NON-CAD

FILE NO.:

PRCT. NO.: CC052.01

DATE: 6-1-90

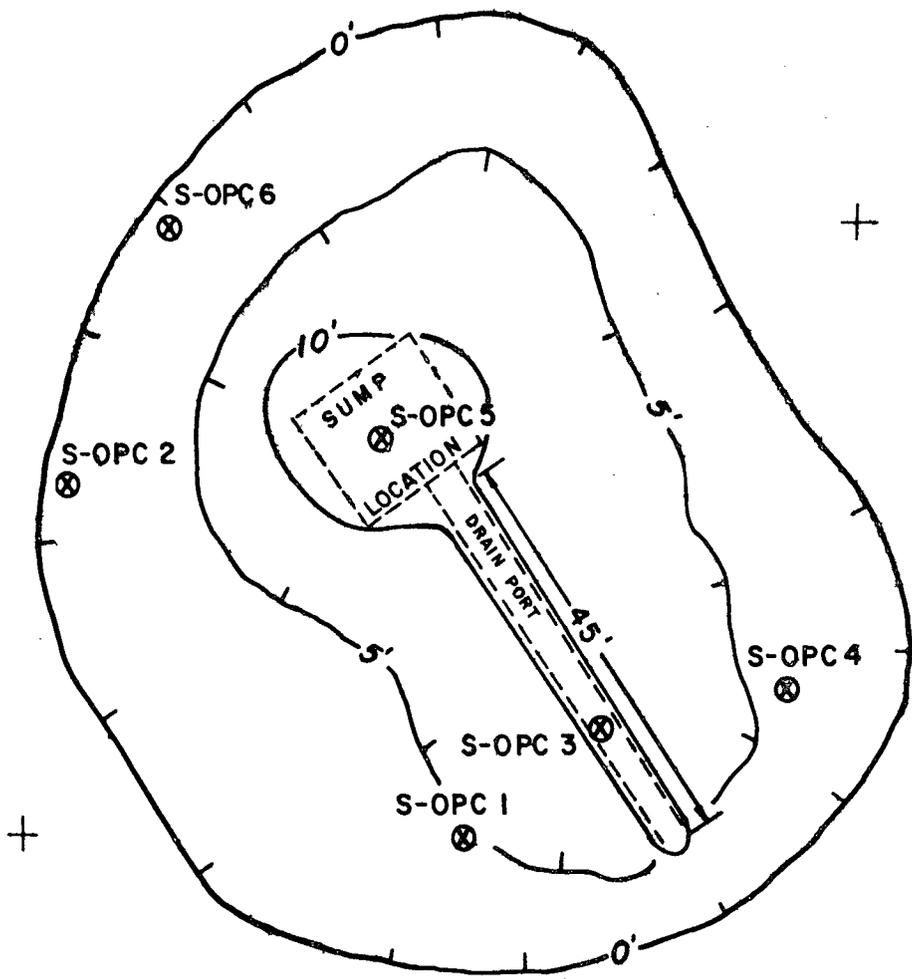


NOTE: FIGURE PORTRAYS STATUS OF EXCAVATION FOLLOWING INITIAL REMOVAL OF FIBERGLASS LINER AND SUMP SYSTEM.

LEGEND

- ⊗ SAMPLE LOCATION (FLOOR)
- 20' DEPTH BELOW SURFACE (GROUND LEVEL)

SAMPLE	MG/KG TPH	BTEX
* S-OPC 1	4774	<0.02
S-OPC 2	<25	0.09
* S-OPC 3	885	103
S-OPC 4	<25	<0.02
S-OPC 5	<25	<0.02
* S-OPC 6	19,100	340

* RESULTS EXCEEDED CLOSURE TARGET LEVELS.



**LEA REFINERY OVERFLOW POND EXCAVATION
PHASE I (3-29-90)**

SOUTHERN UNION COMPANY LEA COUNTY, NEW MEXICO

FIGURE
2



DRAFTER: T. CHILDERS

MOR: A. SCHMIDT


COMPILED: D. KVASNICKA

CAD FILE: NON-CAD

FILE NO.:

PRACT. NO.: CC052.01

DATE: 8-1-90

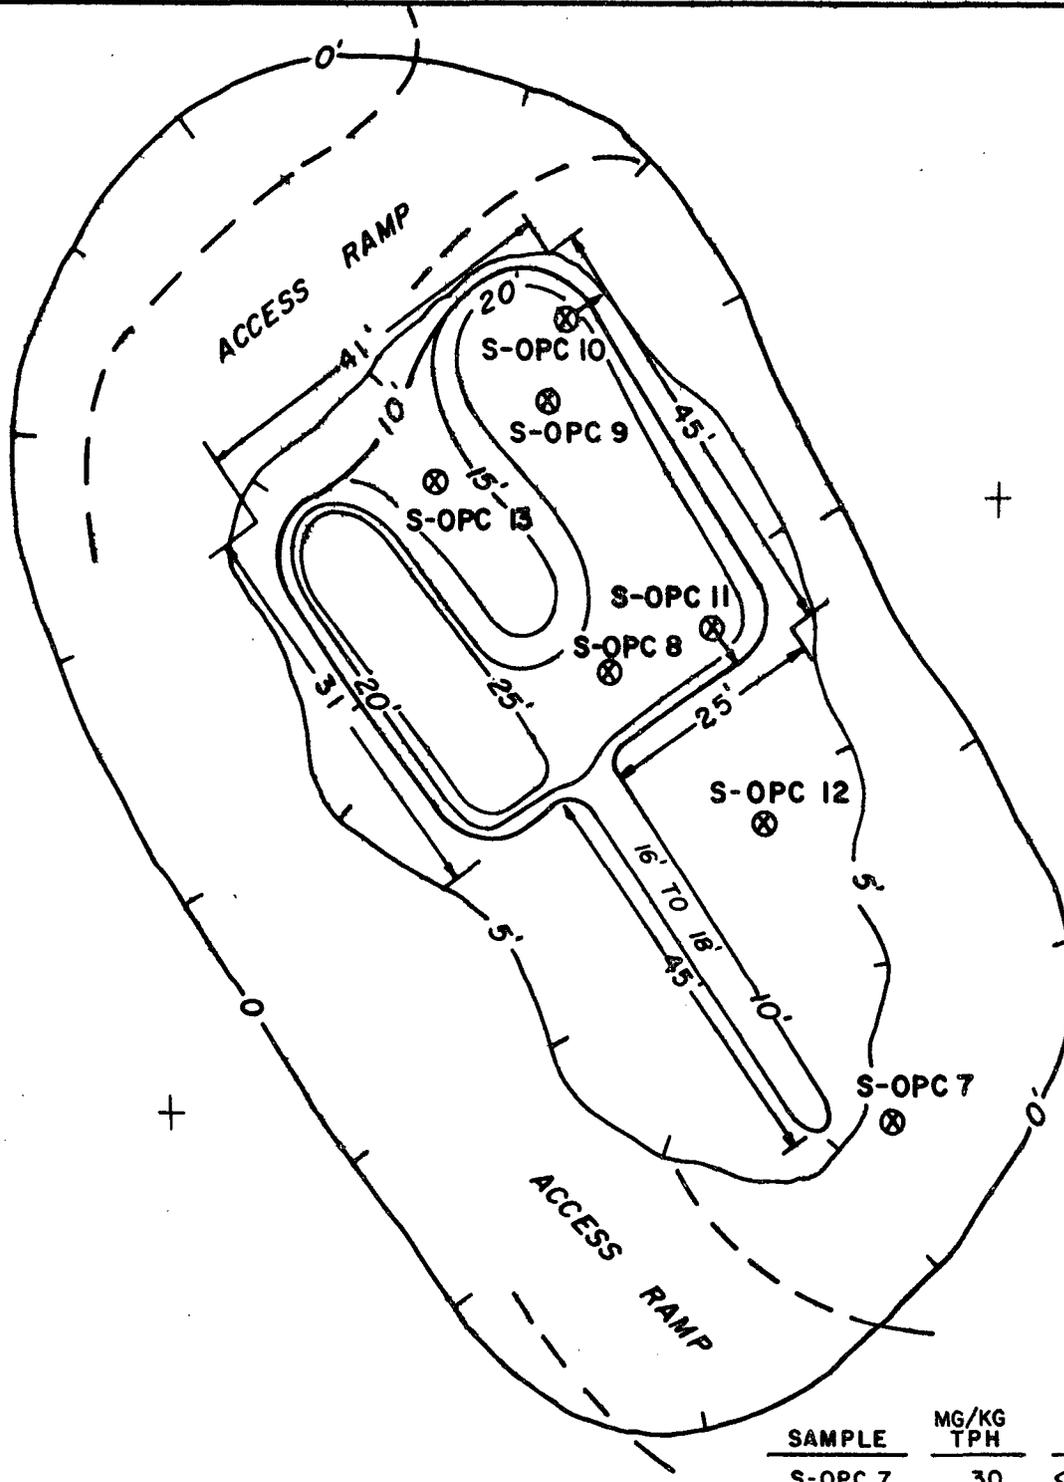


LEGEND

- ⊗ SAMPLE LOCATION (FLOOR)
- ⊙ SAMPLE LOCATION (WALL)
- 20' DEPTH BELOW SURFACE (GROUND LEVEL)

* RESULTS EXCEEDED CLOSURE TARGET LEVELS

SAMPLE	MG/KG TPH	BTEX
S-OPC 7	30	<0.02
S-OPC 8	<25	<0.02
* S-OPC 9	600	0.94
* S-OPC 10	3740	16.70
S-OPC 11	<25	<0.02
S-OPC 12	30	<0.02
* S-OPC 13	1330	4.37



**LEA REFINERY OVERFLOW POND EXCAVATION
PHASE II (3-30-90)**

SOUTHERN UNION COMPANY LEA COUNTY, NEW MEXICO

FIGURE

3



DRAFTER: T. CHILDERS

COMPILED: A. SCHMIDT


COMPILED: D. KVASNICKA

CAD FILE: NON-CAD

FILE NO.:

PROJECT NO.: CC052.01

DATE: 8-1-90

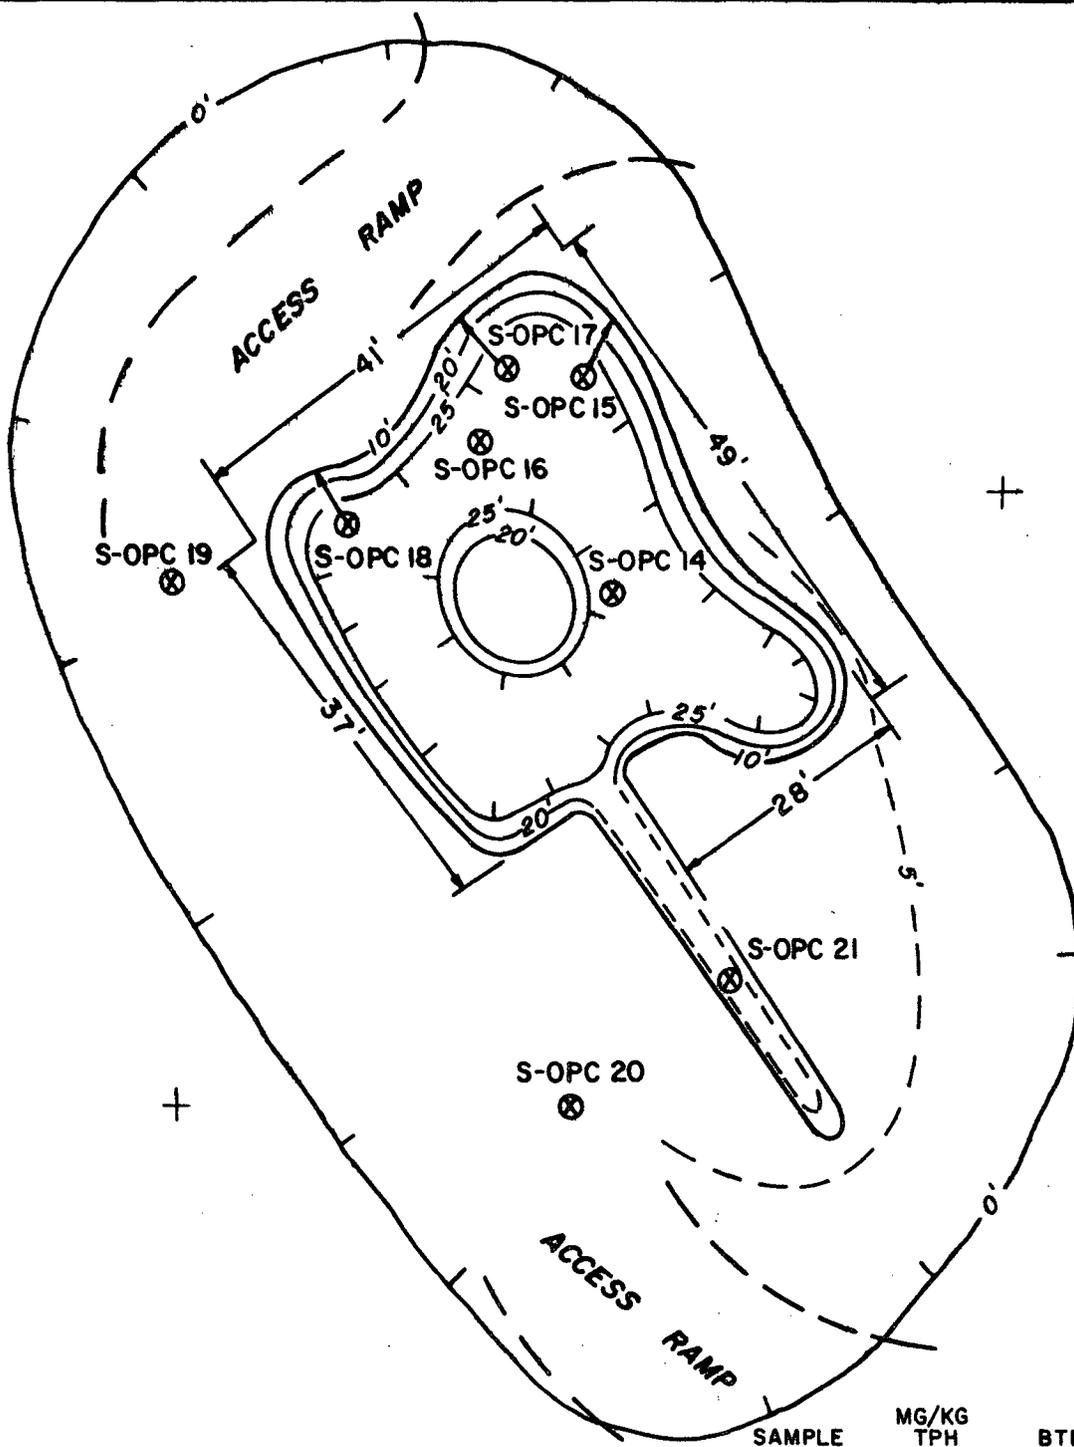

LEGEND

- ⊗ SAMPLE LOCATION (FLOOR)
- ⊗ SAMPLE LOCATION (WALL)
- 20' DEPTH BELOW SURFACE (GROUND LEVEL)

* RESULTS EXCEEDED CLOSURE TARGET LEVELS

SAMPLE	MG/KG TPH	BTEX
* S-OPC 14	53	< 0.02
S-OPC 15	< 25	< 0.02
* S-OPC 16	7760	22.90
* S-OPC 17	4450	44.20
* S-OPC 18	40	6.29
* S-OPC 19	40	0.06
* S-OPC 20	3870	0.06
S-OPC 21	< 25	< 0.02



**LEA REFINERY OVERFLOW POND EXCAVATION
PHASE III (4-5-90)**

SOUTHERN UNION COMPANY


LEA COUNTY, NEW MEXICO

FIGURE

4



DATE: 8-1-90 | PRJCT. NO.: CC052.01 | FILE NO.: | CAD FILE: NON-CAD | COMPILER: D. KVASNICKA | MGR.: A. SCHMIDT | DRAFTER: T. CHILDERS

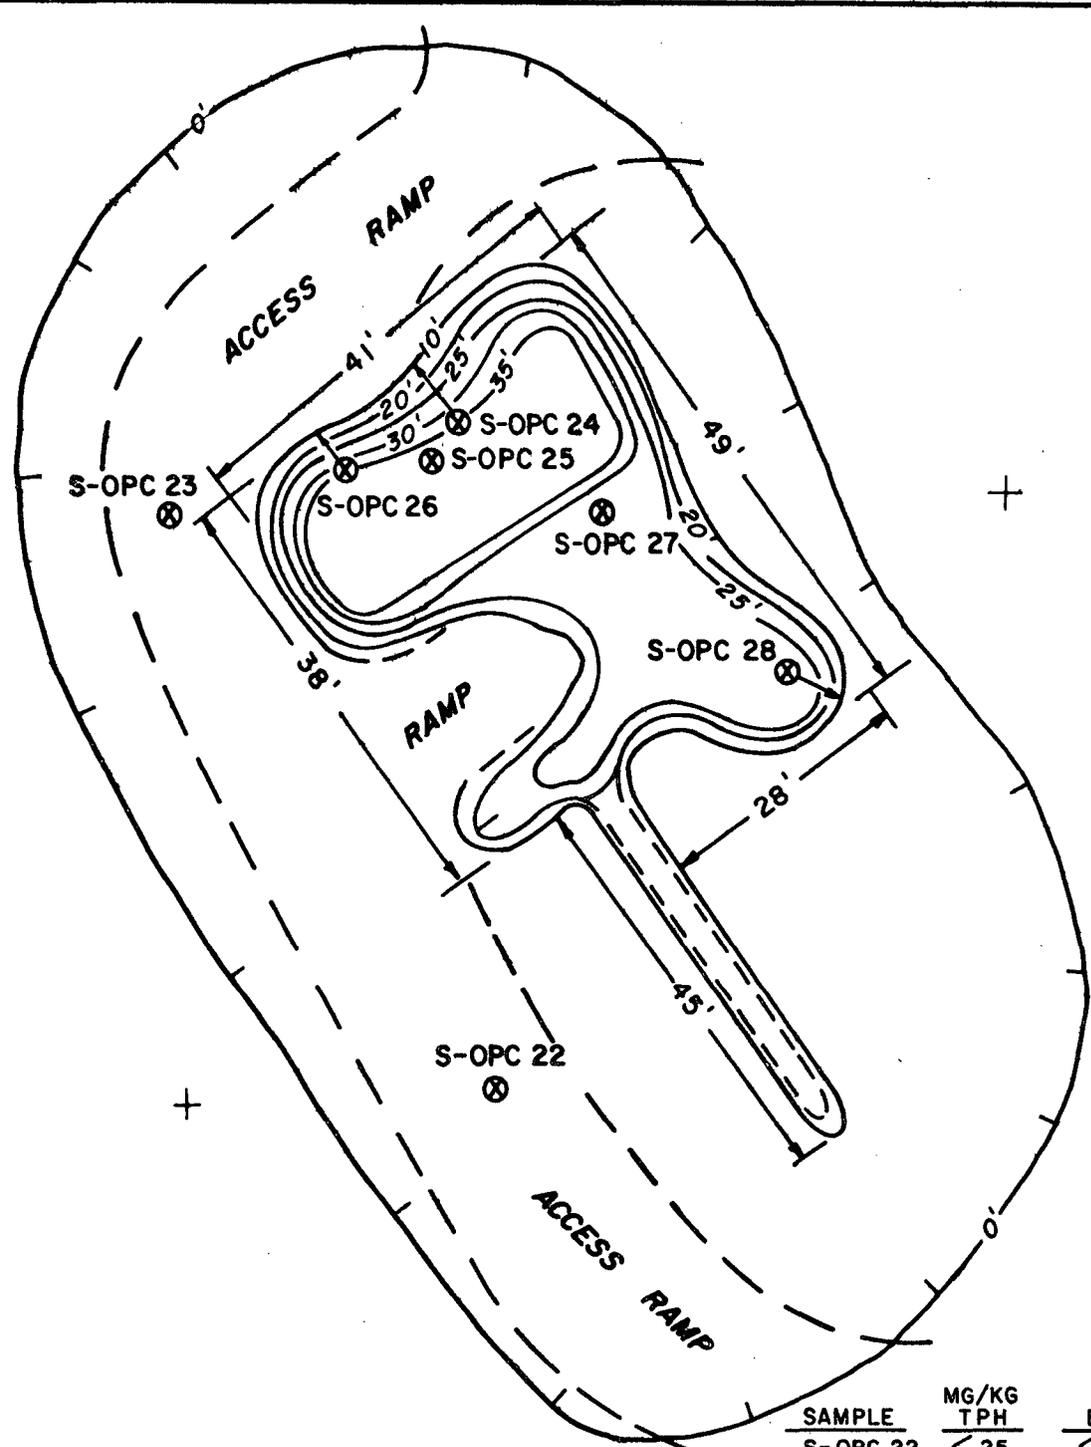

LEGEND

- ⊗ SAMPLE LOCATION (FLOOR)
- ⊙ SAMPLE LOCATION (WALL)
- ~20' DEPTH BELOW SURFACE (GROUND LEVEL)

SAMPLE	MG/KG TPH	BTEX
S-OPC 22	< 25	< 0.02
S-OPC 23	31	0.02
S-OPC 24	31	0.02
S-OPC 25	< 25	0.02
S-OPC 26	< 25	0.02
S-OPC 27	< 25	0.04
S-OPC 28	< 25	< 0.02

S-OPC 24 ~ 8' BELOW S-OPC 17
 S-OPC 26 ~ 8' BELOW S-OPC 18

GERAGHTY & MILLER, INC.
 Environmental Services

LEA REFINERY OVERFLOW POND EXCAVATION
PHASE IV (4-12-90)

SOUTHERN UNION COMPANY LEA COUNTY, NEW MEXICO

FIGURE
5



DRAFTER: T.CHILDERS

INGR.: A. SCHMIDT


COMPILER: D.K.VASNICKA

CAD FILE: NON-CAD

FILE NO.:

PRJCT. NO.: CC052.01

DATE: 8-1-90

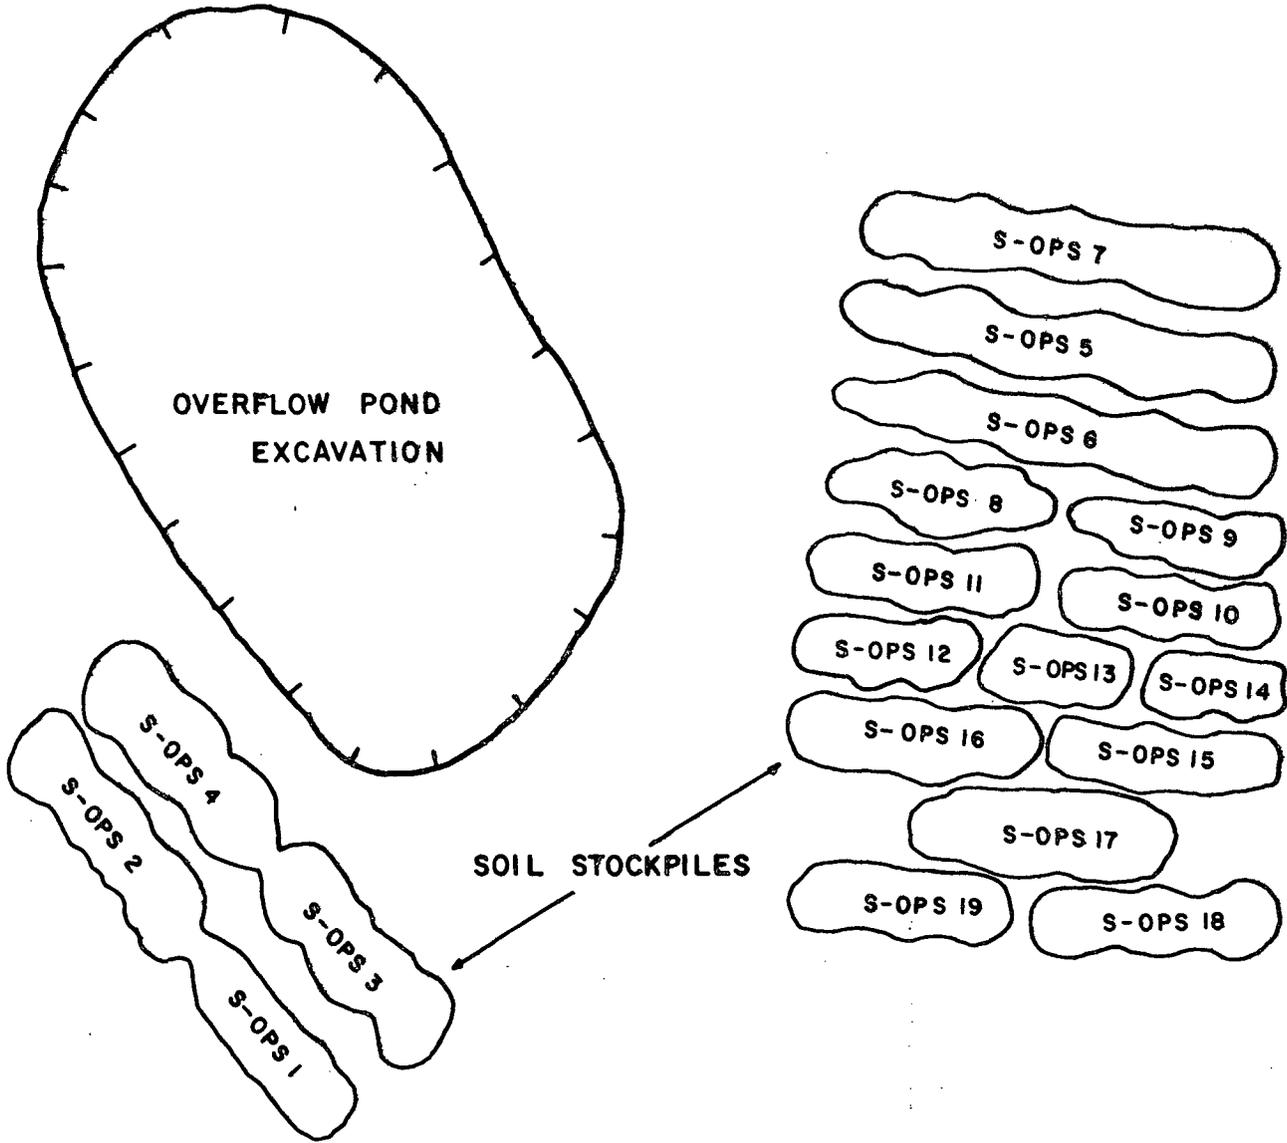

GERAGHTY & MILLER, INC.
Environmental Services

LEA REFINERY OVERFLOW POND EXCAVATION
SOIL STOCKPILE LOCATIONS

SOUTHERN UNION COMPANY


LEA COUNTY, NEW MEXICO

FIGURE

6

**APPENDIX A
PHOTOGRAPHS**

INITIATION OF
REMEDIAL WORK

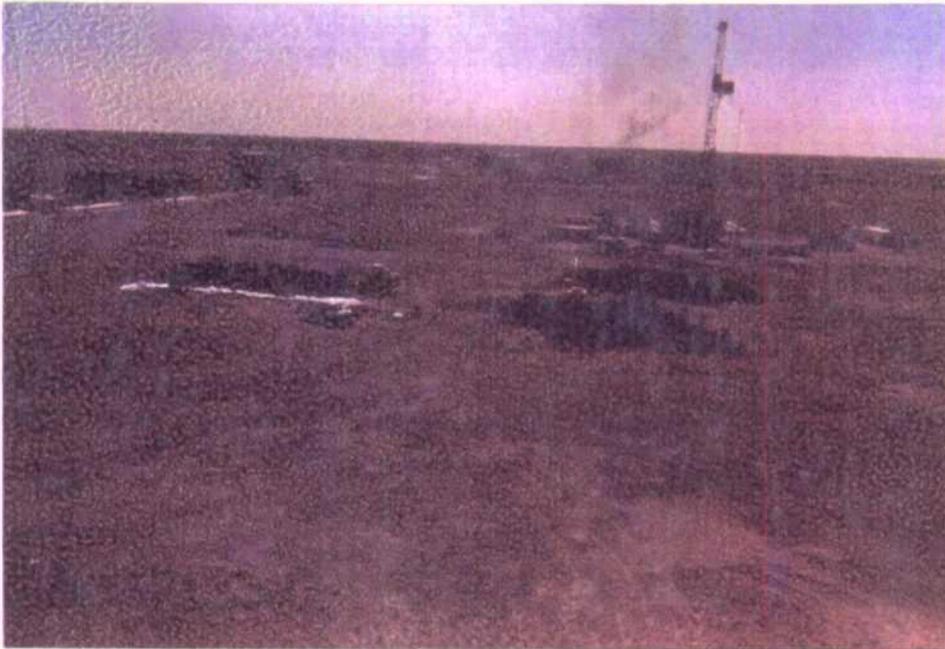

PHASE 1

PHASE 2



PHASE 3



PHASE 4

TRANSPORTING SOIL
TO RIO RANCHO



APPENDIX B

**APPENDIX B
LABORATORY ANALYSES,
CHAIN OF CUSTODY**



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

March 19, 1990

File No. _____

MAY 14 RECD

Report of: Analysis of Soil
Reported to: Geraghty & Miller
Attn: Steve Tischer
1030 Andrews Highway, Ste. 120
Midland, Texas 79701

Date received: 3/17/90

Identification: 0258 02 Lea Refinery

	<u>S-OPS1</u>	<u>S-OPS3</u>
Benzene, mg/kg	0.02	0.08
Toluene, mg/kg	0.19	1.03
Phenyl Benzene, mg/kg	0.76	2.76
Xylene, mg/kg	1.20	3.55
Total Petroleum Hydrocarbons, mg/kg	5,130	7200

Methods: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: RZ

Distribution of report:

1C: Geraghty & Miller

1C: Chemical Waste Management

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Per: Bob Garrett, Manager

Environmental and Analytical Services

Lab. No. D-9003137

S

:sf

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

March 27, 1990 File No. _____

Report of: ANALYSIS OF SOIL

Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, Tx. 79701

MAR 29 RECD

Date received: 3/23/90

Identification: Southern Union Refinery, Project #0258 02

PARAMETERS

SAMPLE RESULTS AND ID

Detection
Limit

	<u>S-OPS2B</u>	<u>S-OPS8</u>	<u>S-OPS9</u>	<u>S-OPS10</u>	<u>S-OPS11</u>	
Benzene, mg/kg	1.35	0.02	<0.2	<0.02	0.28	
Toluene, mg/kg	10.9	0.18	<0.2	0.02	0.25	
Ethyl Benzene, mg/kg	12.0	1.82	0.07	0.41	2.02	
Xylene, mg/kg	20.6	3.42	0.33	0.57	4.87	
Total BTEX, mg/kg	44.9	5.44	0.40	1.00	7.42	
Total Petroleum Hydrocarbons, mg/kg	7350	9800	8200	6735	4300	25

Method: EPA SW846 #5030 & 8020
EPA 600/4-79 #418.1

Analyst: MD, RZ

Distribution of report:

1C: Geraghty & Miller Company

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Bob Garrett

Per: Bob Garrett, Manager
Environmental and Analytical Services

Lab. No. D-9003185

:kz *[Signature]*

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 2, 1990

File No. _____

Report of: Analysis of Soils

Reported to: Geraghty & Miller Company
Attention: Allan Schmidt
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 3/30/90

Identification: Project #CC052.01, Southern Union

PARAMETER	SAMPLE ID AND RESULTS					DETECTION
	S-OPS-12	S-OPS-13	S-OPS-14	S-OPC-1	S-OPC-2	LIMITS
Benzene, mg/kg	<0.02	<0.02	7.79	<0.02	<0.02	0.02
Toluene, mg/kg	<0.02	<0.02	5.32	<0.02	<0.02	0.02
Ethyl Benzene, mg/kg	0.02	<0.02	5.79	<0.02	<0.02	0.02
Xylene, mg/kg	0.07	0.06	4.19	<0.02	0.09	0.02
Total BTEX, mg/kg	0.09	0.06	23.1	<0.02	0.09	
Total Petroleum Hydrocarbons, mg/kg	1620	754	4465	4774	<25	25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD

Distribution of report:

1C: Geraghty & Miller

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Per: Bob Garrett, Manager

Lab. No.

D-9003248

Page 2 of 2

:gc Environmental and Analytical Services

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 2, 1990

File No. _____

APR 5 RECD

Report of: Analysis of Soils

Reported to: Geraghty & Miller Company
Attention: Allan Schmidt
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 3/30/90

Identification: Project #CC052.01, Southern Union

PARAMETER	SAMPLE ID AND RESULTS				DETECTION LIMITS
	S-OPC-3	S-OPC-4	SOPC-5	S-OPC-6	
Benzene, mg/kg	6.81	<0.02	<0.02	8.59	0.02
Toluene, mg/kg	14.6	<0.02	<0.02	30.8	0.02
Ethyl Benzene, mg/kg	8.50	<0.02	<0.02	119	0.02
Xylene, mg/kg	73.2	<0.02	<0.02	182	0.02
Total BTEX, mg/kg	103	<0.02	<0.02	340	
Total Petroleum Hydrocarbon, mg/kg	885	<25	<25	19,100	25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD

Lab. No.

D-9003248 Page 1 of 2

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 4, 1990

File No. _____

Report of: Analysis of Soils

Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 3/30/90

Identification: Project #CC052.01, Southern Union

PARAMETER	SAMPLE ID AND RESULTS				DETECTION LIMIT
	S-OPC-7	S-OPC-8	S-OPC-9	S-OPC-10	
Benzene, mg/kg	<0.02	<0.02	0.10	0.12	0.02
Toluene, mg/kg	<0.02	<0.02	0.05	0.88	0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	0.12	2.77	0.02
Xylene, mg/kg	<0.02	<0.02	0.67	12.9	0.02
Total BTEX, mg/kg	<0.02	<0.02	0.94	16.7	
Total Petroleum Hydrocarbons, mg/kg	30	<25	600	3740	25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD

Distribution of report:

1C: Geraghty & Miller

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Per: *Bob Garrett*

Lab. No.

D-9003256

Page 2 of 2

Bob Garrett, Manager

Environmental and Analytical Services
Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days.
Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 4, 1990

File No. _____

Report of: Analysis of Soils

APR 9 RECD

Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 3/31/90

Identification: Project #CC052.01, Southern Union

<u>PARAMETER</u>	<u>SAMPLE ID AND RESULTS</u>				<u>DETECTION LIMITS</u>
	<u>S-OPC-11</u>	<u>S-OPC-12</u>	<u>SOPC-13</u>	<u>S-OPS-15</u>	
Benzene, mg/kg	<0.02	<0.02	0.22	0.03	0.02
Toluene, mg/kg	<0.02	<0.02	0.13	0.09	0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	0.39	0.10	0.02
Xylene, mg/kg	<0.02	<0.02	3.63	0.69	0.02
Total BTEX, mg/kg	<0.02	<0.02	4.37	0.91	
Total Petroleum Hydrocarbon, mg/kg	<25	30	1330	3740	25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD

Lab. No.

D-9003256 Page 1 of 2

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 13, 1990 File No. _____

Report of: Analysis of Soil
Reported to: Geraghty & Miller
Attn: Steve Fischer
1030 Andrews Hwy. #120
Midland, Texas 79701

Date received: 4/6/90

Identification: Lea Refinery

	<u>S-0PC-14</u>	<u>S-0PC-15</u>	<u>S-0PC-16</u>	<u>S-0PC-17</u>	<u>Detection Limit</u>
Benzene, mg/kg	<0.02	<0.02	<0.5*	3.16*	0.02
Toluene, mg/kg	<0.02	<0.02	<0.5	3.57	0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	8.61	5.53	0.02
Xylene, mg/kg	<0.02	<0.02	14.3	31.9	0.02
Total BTEX, mg/kg	<0.02	<0.02	22.9	44.2	
Total Petroleum Hydrocarbons, mg/kg	53	<25	7760	4450	25

*Higher detection limit due to dilution of samples.

Method: SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD, RZ

Distribution of report:
1C: Geraghty & Miller

Respectfully submitted,
SOUTHWESTERN LABORATORIES, INC.

Per: *Bob Garrett*
Bob Garrett, Manager
Environmental and Analytical Services

Lab. No. D-9004050

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 13, 1990 File No. _____

Report of: Analysis of Soil
Reported to: Geraghty & Miller
Attn: Steve Fischer
1030 Andrews Hwy. #120
Midland, Texas 79701

Date received: 4/6/90

Identification: Lea Refinery

	<u>S-OPC-18</u>	<u>S-OPC-19</u>	<u>S-OPC-20</u>	<u>S-OPC-21</u>	<u>Detection Limit</u>
Benzene, mg/kg	1.35	<0.02	<0.02	<0.02	0.02
Toluene, mg/kg	2.50	<0.02	<0.02	<0.02	0.02
Ethyl Benzene, mg/kg	0.32	0.03	<0.02	<0.02	0.02
Xylene, mg/kg	2.12	0.03	0.06	<0.02	0.02
Total BTEX, mg/kg	6.29	0.06	0.06	<0.02	
Total Petroleum Hydrocarbons, mg/kg	40	40	3870	<25	25

Method: SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD, RZ

Distribution of report:
1C: Geraghty & Miller

Respectfully submitted,
SOUTHWESTERN LABORATORIES, INC.

Per: *Bob Garrett*
Bob Garrett, Manager
Environmental and Analytical Services

Lab. No. D-9004050

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 17, 1990

File No. _____

APR 20 RECD

Report of: Analysis of Soils

Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 4/16/90

Identification: Project #CC052.01, Lea Refinery

PARAMETER

SAMPLE ID AND RESULTS

	<u>S-OPC-22</u>	<u>S-OPC-23</u>	<u>S-OPC-24</u>	<u>S-OPC-25</u>	<u>S-OPC-26</u>	<u>S-OPC-27</u>
Benzene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	<0.02
Toluene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	<0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	<0.02
Xylene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	0.04
Total BTEX, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	0.04
Total Petroleum Hydrocarbon, mg/kg	<25	31	31	<25	<25	<25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD, RZ

LP

Lab. No.

D-9004120

Page 1 of 2

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 17, 1990

File No. _____

Report of: Analysis of Soils
Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 4/16/90

Identification: Project #CC052.01, Lea Refinery

<u>PARAMETER</u>	<u>SAMPLE ID AND RESULTS</u>					<u>Detection Limits</u>
	<u>S-OPC-28</u>	<u>S-OPS-16</u>	<u>S-OPS-17</u>	<u>S-OPS-18</u>	<u>S-OPS-19</u>	
Benzene, mg/kg	<0.02	0.06	<0.02	0.04	0.03	0.02
Toluene, mg/kg	<0.02	0.06	<0.02	0.09	0.03	0.02
Ethyl Benzene, mg/kg	<0.02	0.28	0.03	0.09	0.19	0.02
Xylene, mg/kg	<0.02	0.47	0.11	0.54	0.90	0.02
Total BTEX, mg/kg	<0.02	0.87	0.14	0.76	1.15	
Total Petroleum Hydrocarbons, mg/kg	<25	3868	6747	315	1830	25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD, RZ

Distribution of report:
1C: Geraghty & Miller

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Linda Webb Gray for

Per: Bob Garrett, Manager

:gc Environmental and Analytical Services

Lab. No.

D-9004120

Page 2 of 2

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.

CHAIN-OF-CUSTODY RECORD

Project Number CC052,01

Project Location Southland Union

Laboratory Southwest - Dallas

Sampler(s) Allen Schmidt

SAMPLE IDENTITY BTM X H TPH
Date Sampled

SAMPLE IDENTITY	Date Sampled	SAMPLE BOTTLE / CONTAINER DESCRIPTION	TOTAL
S-OPS-12	3-29-90	1 jar	1
S-OPS-13	3-24-90	"	1
S-OPS-14	3-24-90	"	1
S-OPC-1	3-29-90	"	1
S-OPC-2	3-29-90	"	1
S-OPC-3	3-29-90	"	1
S-OPC-4	3-24-90	"	1
S-OPC-5	3-24-90	"	1
S-OPC-6	3-24-90	"	1
S-OPS-15	3-24-90	"	1
S-OPS-16	3-24-90	"	1
S-OPS-17	3-24-90	"	1
S-OPS-18	3-24-90	"	1
S-OPS-19	3-24-90	"	1
S-OPS-20	3-24-90	"	1
S-OPS-21	3-24-90	"	1
S-OPS-22	3-24-90	"	1
S-OPS-23	3-24-90	"	1
S-OPS-24	3-24-90	"	1
S-OPS-25	3-24-90	"	1
S-OPS-26	3-24-90	"	1
S-OPS-27	3-24-90	"	1
S-OPS-28	3-24-90	"	1
S-OPS-29	3-24-90	"	1
S-OPS-30	3-24-90	"	1
S-OPS-31	3-24-90	"	1
S-OPS-32	3-24-90	"	1
S-OPS-33	3-24-90	"	1
S-OPS-34	3-24-90	"	1
S-OPS-35	3-24-90	"	1
S-OPS-36	3-24-90	"	1
S-OPS-37	3-24-90	"	1
S-OPS-38	3-24-90	"	1
S-OPS-39	3-24-90	"	1
S-OPS-40	3-24-90	"	1
S-OPS-41	3-24-90	"	1
S-OPS-42	3-24-90	"	1
S-OPS-43	3-24-90	"	1
S-OPS-44	3-24-90	"	1
S-OPS-45	3-24-90	"	1
S-OPS-46	3-24-90	"	1
S-OPS-47	3-24-90	"	1
S-OPS-48	3-24-90	"	1
S-OPS-49	3-24-90	"	1
S-OPS-50	3-24-90	"	1
S-OPS-51	3-24-90	"	1
S-OPS-52	3-24-90	"	1
S-OPS-53	3-24-90	"	1
S-OPS-54	3-24-90	"	1
S-OPS-55	3-24-90	"	1
S-OPS-56	3-24-90	"	1
S-OPS-57	3-24-90	"	1
S-OPS-58	3-24-90	"	1
S-OPS-59	3-24-90	"	1
S-OPS-60	3-24-90	"	1
S-OPS-61	3-24-90	"	1
S-OPS-62	3-24-90	"	1
S-OPS-63	3-24-90	"	1
S-OPS-64	3-24-90	"	1
S-OPS-65	3-24-90	"	1
S-OPS-66	3-24-90	"	1
S-OPS-67	3-24-90	"	1
S-OPS-68	3-24-90	"	1
S-OPS-69	3-24-90	"	1
S-OPS-70	3-24-90	"	1
S-OPS-71	3-24-90	"	1
S-OPS-72	3-24-90	"	1
S-OPS-73	3-24-90	"	1
S-OPS-74	3-24-90	"	1
S-OPS-75	3-24-90	"	1
S-OPS-76	3-24-90	"	1
S-OPS-77	3-24-90	"	1
S-OPS-78	3-24-90	"	1
S-OPS-79	3-24-90	"	1
S-OPS-80	3-24-90	"	1
S-OPS-81	3-24-90	"	1
S-OPS-82	3-24-90	"	1
S-OPS-83	3-24-90	"	1
S-OPS-84	3-24-90	"	1
S-OPS-85	3-24-90	"	1
S-OPS-86	3-24-90	"	1
S-OPS-87	3-24-90	"	1
S-OPS-88	3-24-90	"	1
S-OPS-89	3-24-90	"	1
S-OPS-90	3-24-90	"	1
S-OPS-91	3-24-90	"	1
S-OPS-92	3-24-90	"	1
S-OPS-93	3-24-90	"	1
S-OPS-94	3-24-90	"	1
S-OPS-95	3-24-90	"	1
S-OPS-96	3-24-90	"	1
S-OPS-97	3-24-90	"	1
S-OPS-98	3-24-90	"	1
S-OPS-99	3-24-90	"	1
S-OPS-100	3-24-90	"	1
Total No. of Bottles/Containers			9

Relinquished by: Allen Schmidt Organization: Geragity & Miller Date: 3-29-90 Time: 4:00 Seal Intact? Yes No N/A

Received by: _____ Organization: _____ Date: / / Time: _____ Seal Intact? Yes No N/A

Relinquished by: _____ Organization: _____ Date: / / Time: _____ Seal Intact? Yes No N/A

Received by: _____ Organization: _____ Date: / / Time: _____ Seal Intact? Yes No N/A

Special Instructions/Remarks: Need quick turn around. Results by April 2, 1990 (initial)

FAX initial results to: Dave Kovasnicka 505-396-6704 (and Allen Schmidt)

FAX 915-699-1478. Send Finals to Geragity & Miller, 1030 Andrews Hwy, Midland, TX 79701

Delivery Method: In Person Common Carrier Lab Courier Other Federal Express SPECIFY

APPENDIX C

**APPENDIX C
CORRESPONDENCE**

OCT 17 '89 10:32

FROM S U G

PAGE 05



STATE OF NEW MEXICO
ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT
OIL CONSERVATION DIVISION

GARREY CARRUTHERS
GOVERNOR

October 13, 1989

POST OFFICE BOX 2088
STATE LAND OFFICE BUILDING
SANTA FE, NEW MEXICO 87504
(505) 827-5000

CERTIFIED MAIL
RETURN RECEIPT NO. P-106-675-127

Mr. Russel A. Buss
Project Manager
SOUTHERN UNION COMPANY
P. O. Box 2000
Groves, Texas 77619

RE: Closure Plan for the Southern Union Company, Lea Refinery
Overflow Pond.

Dear Mr. Buss:

The Oil Conservation Division (OCD) has reviewed the closure plan document dated August 14, 1989, prepared by Reed and Associates, Inc. of Midland, Texas and concur with the proposed remediation action.

Since under a new state law, OCD has jurisdiction over solid waste disposal from refineries and other and gas production and processing facilities, you will be required to provide us prior to disposal with specific information as to the disposition of the material including when cleanup will occur, who will perform it and who will receive the material for disposal. Although E.P. toxicity tests show chromium at less than 0.010 mg/l, five samples show total metal chrome above 5.0 ug/g. Therefore, this material should go to a facility capable of receiving such waste through as non-hazardous waste.

If you have any questions, please contact me at (505) 827-5812.

Sincerely,

A handwritten signature in cursive script, appearing to read "David G. Boyer".

David G. Boyer, Hydrogeologist
Environmental Bureau Chief

DGB/sl

cc: OCD Hobbs Office


 New Mexico Health and Environment Department

GARREY CARRUTHERS
Governor

DENNIS BOYO
Secretary

MICHAEL J. BURKHART
Deputy Secretary

RICHARD MITZELPELT
Director

March 2, 1990

Ms. Thresea Salamome
Geraghty & Miller, Inc
111 Congress Avenue, Suite 830
Austin, Texas 78701

Dear Ms. Salamome:


This is to confirm our conversations and correspondence regarding the removal and disposal of contaminated soils from Southern Union Refinery south of Lovington, New Mexico. Conversations indicated that the landfill of preference was Waste Management of New Mexico at Rio Rancho.

The submitted test results were discussed with Boyd Hamilton of the Hazardous Waste Bureau for determination of classification. It was concluded that the soils from around the cooling tower and from Areas 1 and 2 can be disposed of at the above mentioned landfill with the following provisions.

1. Soils from the cooling tower area have continuous testing during removal to assure that the chrome levels stay below the 5 milligrams per liter.
2. The Special Waste Bureau is notified prior to removal of soils from any of the three areas.
3. Notification of when the soils are to be disposed of at the landfill. The soils must be manifested according to Section 405 of the New Mexico Solid Waste Management Regulations (SWMR-2).

Please note that approval from the Special Waste Bureau for disposal at the Rio Rancho landfill does not guarantee that the landfill will accept the soils. If you have any questions please contact me at (505) 827-2780

Sincerely yours,



Phillip L. Westen
Environmental Scientist



STATE OF NEW MEXICO
ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT
OIL CONSERVATION DIVISION

GARREY CARRUTHERS
GOVERNOR

POST OFFICE BOX 2008
STATE LAND OFFICE BUILDING
SANTA FE, NEW MEXICO 87504
(505) 827-5800

March 6, 1990

CERTIFIED MAIL NO. P 612 458 034
RETURN RECEIPT REQUESTED

Mr. Russel A. Buss
Project Manager
Southern Union Gas
P.O. Box 2000
Graves, TX 77619-2000

RE: *Closure Plan for Southern Union Refinery,
Lovington, Contaminated Soil Removal*

Dear Mr. Buss:

The Oil Conservation Division has received a copy of the March 2, 1990 letter from Mr. Phillip Westen of the Environmental Improvement Division Special Waste Bureau to Ms. Theresa Salamone of Geraghty and Miller, Austin, approving disposal of non-hazardous contaminated soils at an EID regulated landfill at Rio Rancho. Based on that approval, OCD has no objections to the disposal location agreed to by New Mexico EID and Southern Union Refinery. We do, however, request that copies of the transfer manifests and results of any soil testing be provided to this office.

If you have any questions, please contact me at (505) 827-5812.

Sincerely,

David G. Boyer
Hydrogeologist/Environmental Bureau Chief

DGB/ag

cc: Jerry Sexton - Oil Conservation Division Hobbs
Phillip L. Westen - EID Special Waste Bureau - Santa Fe
Boyd Hamilton - Hazardous Waste Bureau, Santa Fe
William Terry - EID Waste Management of NM, Rio Rancho

April 18, 1990

Mr. David Boyer
Oil Conservation Department
State Card Office Building
P. O. Box 2088; Room 206
Santa Fe, NM 87504

Re: Lea Refinery
Lovington, NM

Dear Mr. Boyer:

Attached are sketch maps of sample locations and preliminary analytical sheets for the confirmation sampling at the Lea Refinery overflow pond excavation as discussed in our telephone conversation of 4/17/90. Three sets of samples were taken on 3/30, 4/5 and 4/12/90 (28 total). As you can see by the sketches, large amounts of additional soil were removed after the first and second sampling. The results of the third sampling are at or near background levels. Over 3,000 cubic yards of material have been excavated at the overflow pond. Confirmation sample numbers are designated by a "S-OPC" prefix. The soil stockpile samples are "S-OPS".

I have also attached analytical results for the backfill to be used at the overflow pond (from closure plan of 8/89). We would like to be able to begin backfill operations as soon as possible if we can arrange for an onsite inspection and verbal approval by your office. Please let me know by telephone if you have any questions.

Very truly yours,

GERAGHTY & MILLER, INC.
dba Reed & Associates

Allan T. Schmidt

Allan T. Schmidt
Senior Geologist

ATS/sne

attachment(s)

cc: Russel Buss, Southern Union Gas Company
V. Steve Reed, Geraghty & Miller, Corpus
Teresa Salamone, Geraghty & Miller, Austin


GERAGHTY
& MILLER, INC.
Environmental Services

4-13-90

Client So. Union Refining Co.

Title Lea Refinery - Overflow Pond Excavation 3-30-90

- ⊗ Sample Location (Floor)
- ⊗ Sample Location (Wall)
- 30 TPH Value
- <0.02 BTEX Value

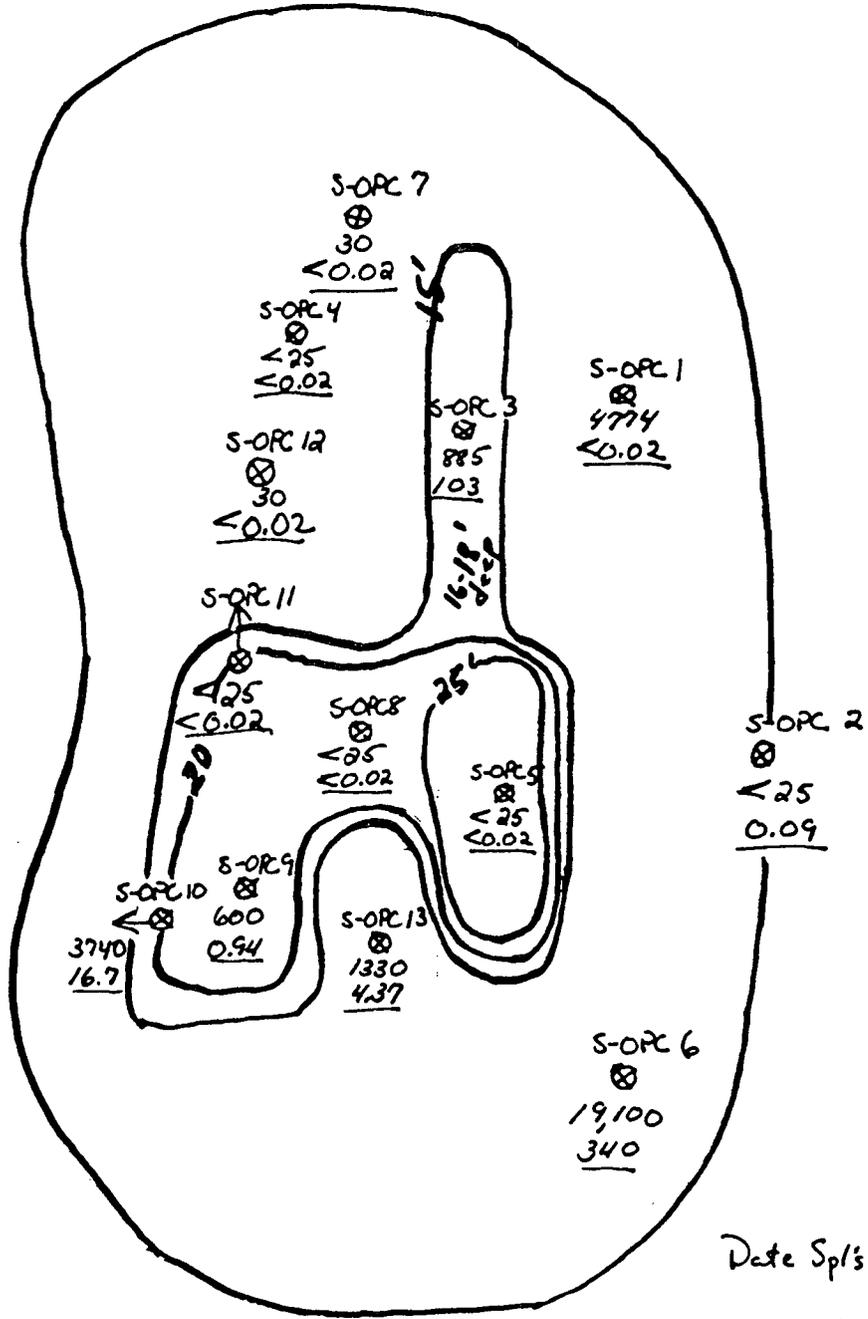

Date Spl's Taken :

S-ORC 1 thru S-ORC 6 3-29-90
S-ORC 7 thru S-ORC 13 3-30-90

GERAGHTY
& MILLER, INC.
Environmental Services


4-13-90

Client So. Union Refining Co.

Title Lea Refinery - Overflow Pond Excavation as of 4-5-90 File

25 TPH Value
4.02 BTEX Value

Circumference: 393'

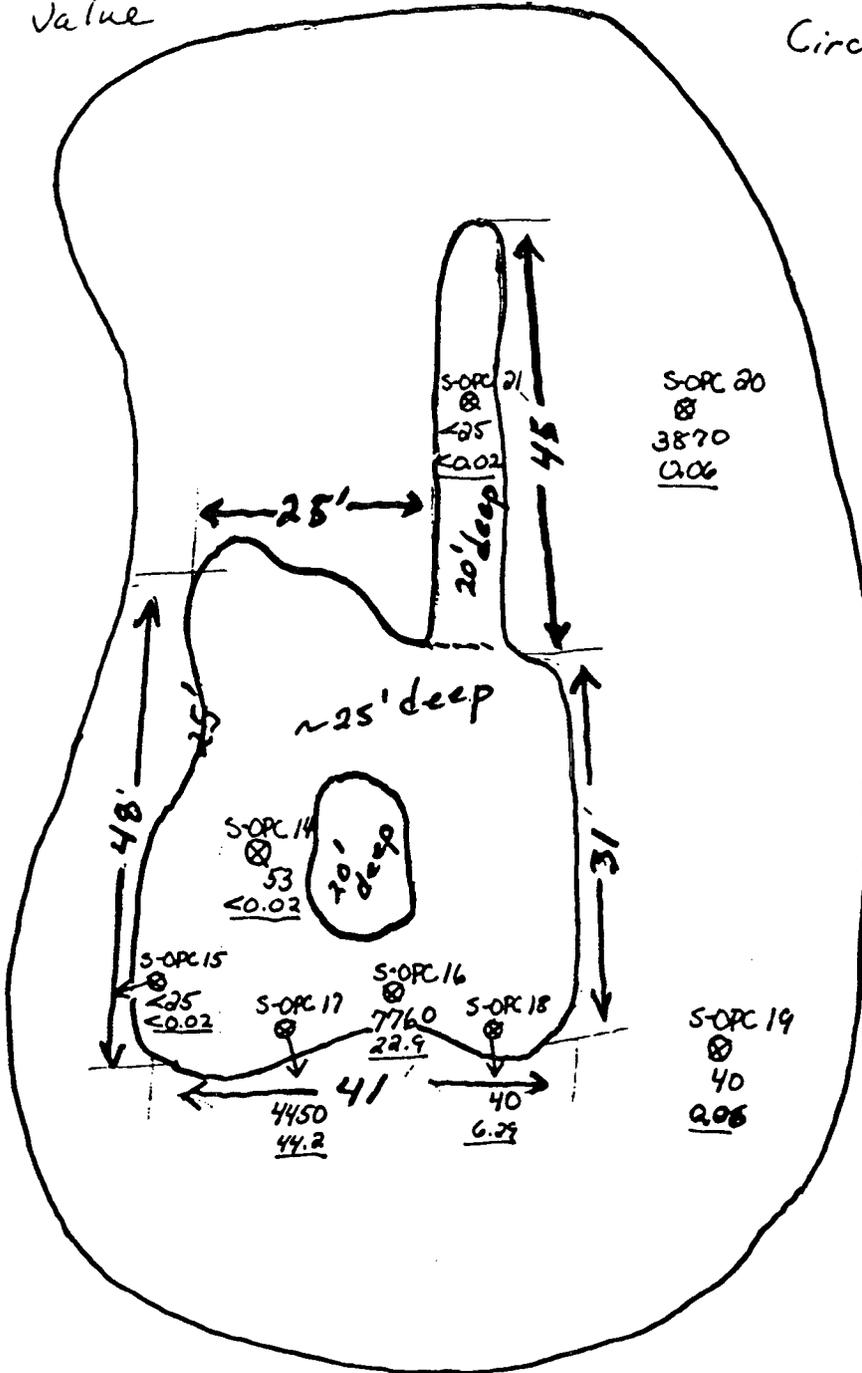

GERAGHTY
& MILLER, INC.
Environmental Services

Date 4-13-90


Client So. Union Refining Co.

Title Lea Refinery - Overflow Pond Excavation as of 4-12-90

25 TPH
L.05 BTEX
Wall of excavation

Circumference: 393'

⊗ Sample location (floor)
⊕ " " (wall)

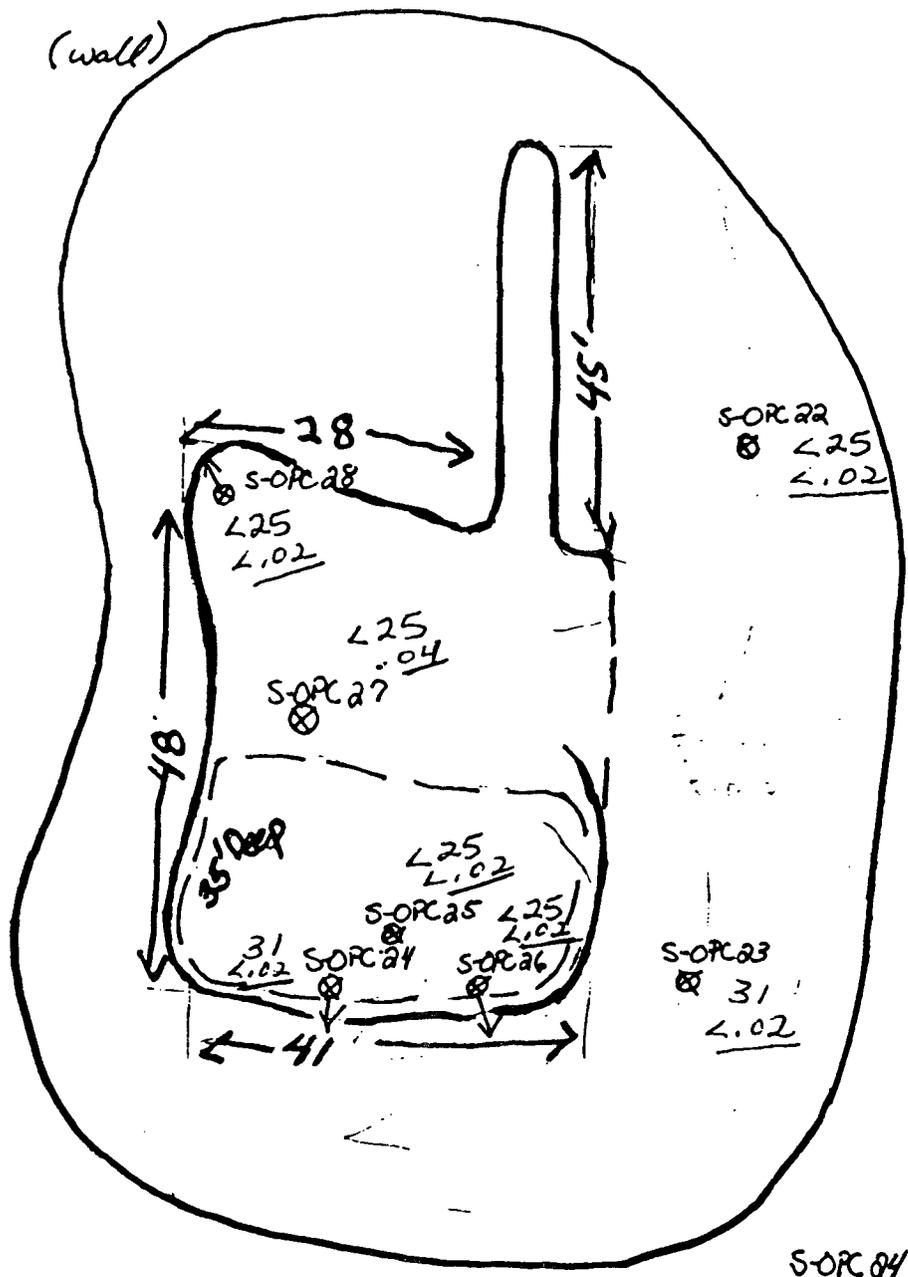

S-OPC 24 ~ 8' below S-OPC 17
S-OPC 26 ~ 8' below S-OPC 18



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P O Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 2, 1990

File No. _____

Report of: Analysis of Soils
Reported to: Geraghty & Miller Company
Attention: Allan Schmidt
1030 Andrews Highway, Suite 120
Midland, TX 79701
Date received: 3/30/90
Identification: Project #CC052.01, Southern Union

PARAMETER	SAMPLE ID AND RESULTS					DETECTION LIMITS
	S-OPS-12	S-OPS-13	S-OPS-14	S-OPC-1	S-OPC-2	
Benzene, mg/kg	<0.02	<0.02	7.79	<0.02	<0.02	0.02
Toluene, mg/kg	<0.02	<0.02	5.32	<0.02	<0.02	0.02
Ethyl Benzene, mg/kg	0.02	<0.02	5.79	<0.02	<0.02	0.02
Xylene, mg/kg	0.07	0.06	4.19	<0.02	0.09	0.02
Total BTEX, mg/kg	0.09	0.06	23.1	<0.02	0.09	
Total Petroleum Hydrocarbons, mg/kg	1620	754	4465	4774	<25	25

Stock pile

confirmation

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD

Distribution of report:

1C: Geraghty & Miller

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Bob Garrett

Per: Bob Garrett, Manager

Lab. No.

D-9003248

Page 2 of 2

:gc Environmental and Analytical Service

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SWL NORTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 2, 1990

File No. _____

APR 5 RECD

Report of: Analysis of Soils

Reported to: Geraghty & Miller Company
Attention: Allan Schmidt
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 3/30/90

Identification: Project #CC052.01, Southern Union

PARAMETER	SAMPLE ID AND RESULTS				DETECTION LIMITS
	S-OPC-3	S-OPC-4	SOPC-5	S-OPC-6	
Benzene, mg/kg	6.81	<0.02	<0.02	8.59	0.02
Toluene, mg/kg	14.6	<0.02	<0.02	30.8	0.02
Ethyl Benzene, mg/kg	8.50	<0.02	<0.02	119	0.02
Xylene, mg/kg	73.2	<0.02	<0.02	182	0.02
Total BTEX, mg/kg	103	<0.02	<0.02	340	
Total Petroleum Hydrocarbon, mg/kg	885	<25	<25	19,100	25

confirmation

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P. O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 4, 1990

File No. _____

Report of: Analysis of Soils
Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, TX 79701
Date received: 3/30/90
Identification: Project #CC052.01, Southern Union

PARAMETER	CONFIRMATION SAMPLE ID AND RESULTS				DETECTION LIMIT
	S-OPC-7	S-OPC-8	S-OPC-9	S-OPC-10	
Benzene, mg/kg	<0.02	<0.02	0.10	0.12	0.02
Toluene, mg/kg	<0.02	<0.02	0.05	0.88	0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	0.12	2.77	0.02
Xylene, mg/kg	<0.02	<0.02	0.67	12.9	0.02
Total BTEX, mg/kg	<0.02	<0.02	0.94	16.7	
Total Petroleum Hydrocarbons, mg/kg	30	<25	600	3740	25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD

Distribution of report:

1C: Geraghty & Miller

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Per: *Bob Garrett*

Bob Garrett, Manager

Lab. No.

D-9003256

Page 2 of 2

Environmental and Analytical Service

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 4, 1990

File No. _____

Report of: Analysis of Soils
Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, TX 79701

APR 9 RECD

Date received: 3/31/90

Identification: Project #CC052.01, Southern Union

PARAMETER

SAMPLE ID AND RESULTS

Stockpile

DETECTION LIMITS

	<i>Confirmation</i>				
	<u>S-OPC-11</u>	<u>S-OPC-12</u>	<u>SOPC-13</u>	<u>S-OPS-15</u>	
Benzene, mg/kg	<0.02	<0.02	0.22	0.03	0.02
Toluene, mg/kg	<0.02	<0.02	0.13	0.09	0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	0.39	0.10	0.02
Xylene, mg/kg	<0.02	<0.02	3.63	0.69	0.02
Total BTEX, mg/kg	<0.02	<0.02	4.37	0.91	
Total Petroleum Hydrocarbon, mg/kg	<25	30	1330	3740	25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD

Lab. No.

D-9003256

Page 1 of 2

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 13, 1990 File No. _____

Report of: Analysis of Soil
Reported to: Geraghty & Miller
Attn: Steve Fischer
1030 Andrews Hwy. #120
Midland, Texas 79701

Date received: 4/6/90

Identification: Lea Refinery

all confirmation

	<u>S-0PC-14</u>	<u>S-0PC-15</u>	<u>S-0PC-16</u>	<u>S-0PC-17</u>	<u>Detection Limit</u>
Benzene, mg/kg	<0.02	<0.02	<0.5*	3.16*	0.02
Toluene, mg/kg	<0.02	<0.02	<0.5	3.57	0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	8.61	5.53	0.02
Xylene, mg/kg	<0.02	<0.02	14.3	31.9	0.02
Total BTEX, mg/kg	<0.02	<0.02	22.9	44.2	
Total Petroleum Hydrocarbons, mg/kg	53	<25	7760	4450	25

*Higher detection limit due to dilution of samples.

Method: SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD, RZ

Distribution of report:
1C: Geraghty & Miller

Respectfully submitted,
SOUTHWESTERN LABORATORIES, INC.

Bob Garrett
Per: Bob Garrett, Manager
Environmental and Analytical
Services

Lab. No. *MD* D-9004050

isf
Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 13, 1990 File No. _____

Report of: Analysis of Soil
Reported to: Geraghty & Miller
Attn: Steve Fischer
1030 Andrews Hwy. #120
Midland, Texas 79701

Date received: 4/6/90

Identification: Lea Refinery

revers-

All confirmation

	<u>S-OPC-18</u>	<u>S-OPC-19</u>	<u>S-OPC-20</u>	<u>S-OPC-21</u>	<u>Detection Limit</u>
Benzene, mg/kg	1.35	<0.02	<0.02	<0.02	0.02
Toluene, mg/kg	2.50	<0.02	<0.02	<0.02	0.02
Ethyl Benzene, mg/kg	0.32	0.03	<0.02	<0.02	0.02
Xylene, mg/kg	2.12	0.03	0.06	<0.02	0.02
Total BTEX, mg/kg	6.29	0.06	0.06	<0.02	
Total Petroleum Hydrocarbons, mg/kg	40	40	3870	<25	25

Method: SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD, RZ

Distribution of report:
1C: Geraghty & Miller

Respectfully submitted,
SOUTHWESTERN LABORATORIES, INC.

Bob Garrett
Per: Bob Garrett, Manager
Environmental and Analytical Services

Lab. No. D-9004050

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
P.O. Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/831 2700

April 17, 1990

File No. _____

Report of: Analysis of Soils

Reported to: Geraghty & Miller Company
Attention: Steve Tisher
1030 Andrews Highway, Suite 120
Midland, TX 79701

Date received: 4/16/90

Identification: Project #CC052.01, Lea Refinery

Confirmation

PARAMETER

SAMPLE ID AND RESULTS

	<u>S-OPC-22</u>	<u>S-OPC-23</u>	<u>S-OPC-24</u>	<u>S-OPC-25</u>	<u>S-OPC-26</u>	<u>S-OPC-27</u>
Benzene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	<0.02
Toluene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	<0.02
Ethyl Benzene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	<0.02
Xylene, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	0.04
Total BTEX, mg/kg	<0.02	<0.02	<0.02	<0.02	<0.02	0.04
Total Petroleum Hydrocarbon, mg/kg	<25	31	31	<25	<25	<25

Method: EPA SW846 #5030 & #8020,
EPA 600/4-79 #418.1

Analyst: MD, RZ

LP

D-9004120

Page 1 of 2

Lab. No.

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our letters and reports apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products



SOUTHWESTERN LABORATORIES, INC.

Construction materials testing, analytical chemistry and geotechnical engineering
 P O Box 224227 • 2575 Lone Star Drive • Dallas, Texas 75222 • 214/631-2700

April 17, 1990

File No. _____

Report of: Analysis of Soils

Reported to: Geraghty & Miller Company
 Attention: Steve Tisher
 1030 Andrews Highway, Suite 120
 Midland, TX 79701

Date received: 4/16/90

Identification: Project #CC052.01, Lea Refinery

Confirmation

Stockpile

PARAMETER	SAMPLE ID AND RESULTS					Detection Limits
	S-OPC-28	S-OPS-16	S-OPS-17	S-OPS-18	S-OPS-19	
Benzene, mg/kg	<0.02	0.06	<0.02	0.04	0.03	0.02
Toluene, mg/kg	<0.02	0.06	<0.02	0.09	0.03	0.02
Ethyl Benzene, mg/kg	<0.02	0.28	0.03	0.09	0.19	0.02
Xylene, mg/kg	<0.02	0.47	0.11	0.54	0.90	0.02
Total BTEX, mg/kg	<0.02	0.87	0.14	0.76	1.15	
Total Petroleum Hydrocarbons, mg/kg	<25	3868	6747	315	1830	25

Method: EPA SW846 #5030 & #8020,
 EPA 600/4-79 #418.1

Analyst: MD, RZ

Distribution of report:

1C: Geraghty & Miller

Respectfully submitted,

SOUTHWESTERN LABORATORIES, INC.

Linda Webb Gray for

Per: Bob Garrett, Manager

Environmental and Analytical Serv:

Lab. No.

D-9004120

Page 2 of 2

Samples are discarded 30 days after reports are mailed unless prior arrangements are made in writing. A storage fee will apply on samples held over 30 days. Our letters and reports are for the exclusive use of the client to whom they are addressed. The use of our name must receive our prior written approval. Our results apply to the sample tested and/or inspected, and are not necessarily indicative of the qualities of apparently identical or similar products.

CORE SAMPLES
TOTAL METALS
REPORTED AS UG/CM(DRY)

SAMPLE FT MOIST CD CU ZN PB BE SB NI CR AG AS SE TL HG

Metals

BC-1	8.3	<0.5	10.3	28.4	6.9	<0.5	1.4	10.6	10.8	<0.5	2.2	<0.5	<0.5	<0.5	<0.25
BC-2	5.49	<0.5	9.3	17.4	6.3	<0.5	1.0	14.5	6.3	<0.5	2.1	<0.5	<0.5	<0.25	
BC-3	6.9	<0.5	7.2	13.3	5.1	<0.5	1.2	14.6	5.1	<0.5	2.8	<0.5	<0.5	<0.25	
BC-4	13.7	<0.5	11.7	55.8	8.5	1.7	1.0	23.7	25.6	<0.5	2.4	<0.5	<0.5	<0.25	
BC-1	9.11	<0.5	3.7	5.8	<1.5	<0.5	1.0	13.6	2.5	<0.5	2.1	<0.5	<0.5	<0.25	
BC-2	9.34	<0.5	3.3	3.5	<1.5	<0.5	2.4	11.1	1.9	<0.5	3.2	<0.5	<0.5	<0.25	
CP-1	7-7.5	3.23	<0.5	9.3	14.5	2.5	<1.0	4.2	5.1	<0.5	0.9	<0.5	<0.5	<0.25	
CP-1	9.5-10	11.5	<0.5	29.3	25.9	<1.5	2.8	11.0	1.8	<0.5	1.6	<0.5	<0.5	<0.25	
CP-1	12-12.5	10.9	<0.5	24.4	25.8	<1.5	2.1	10.3	1.7	<0.5	1.5	<0.5	<0.5	<0.25	
CP-1(CM)	12-12.5	10.5	<0.5	14.6	32.1	<1.5	<1.0	11.6	1.9	<0.5	1.3	<0.5	<0.5	<0.25	
CP-1	14.5-15	9.2	<0.5	23.5	2.0	<0.5	2.7	9.8	1.3	<0.5	0.7	<0.5	<0.5	<0.25	
CP-1	17-17.5	6.51	<0.5	32.0	2.3	<0.5	<1.0	6.0	1.9	<0.5	0.8	<0.5	<0.5	<0.25	
CP-1	19.5-20	4.08	<0.5	4.8	16.1	3.0	1.5	5.6	2.9	<0.5	0.9	<0.5	<0.5	<0.25	
CP-1	24.5-25	3.72	<0.5	4.6	13.1	2.3	1.5	2.7	2.5	<0.5	1.0	<0.5	<0.5	<0.25	
CP-1	26-29.5	6.07	<0.5	13.9	15.8	2.6	<1.0	6.8	1.1	<0.5	0.9	<0.5	<0.5	<0.25	
CP-1	32.5-36	6.03	<0.5	6.4	12.0	2.6	<1.0	4.0	1.9	<0.5	1.0	<0.5	<0.5	<0.25	
CP-1	35.5-40	5.81	<0.5	6.2	11.9	2.1	<1.0	4.0	1.8	<0.5	1.0	<0.5	<0.5	<0.25	
CP-1	44.5-45	4.27	<0.5	4.1	6.1	<1.5	<1.0	2.6	2.2	<0.5	0.9	<0.5	<0.5	<0.25	
CP-1	49.5-50	5.16	<0.5	5.8	10.8	<1.5	<1.0	3.7	2.8	<0.5	0.5	<0.5	<0.5	<0.25	
CP-2A	3-3.5	13.9	<0.5	18.0	44.8	5.5	1.9	10.2	10.0	<0.5	1.7	<0.5	<0.5	<0.25	
CP-3	5-5.5	22.6	<0.5	16.8	62.9	9.0	2.0	18.3	46.6	<0.5	2.2	<0.5	<0.5	<0.25	
CP-3(CM)	5-5.5	21.9	<0.5	22.5	68.4	9.7	4.1	17.0	68.4	<0.5	2.0	<0.5	<0.5	<0.25	
CP-5	5-5.5	15.6	<0.5	9.0	41.9	7.4	1.4	15.3	18.4	<0.5	1.7	<0.5	<0.5	<0.25	

7

From overflow pond closure plan 8/89

Backfill

HUNTER/EST REPORT: TRPH IN SOILS

CLIENT: WESTERN TECHNOLOGIES

QA/QC SPIKE RECOVERIES

ANALYST: STEVE CLARK
 REPORT DATE: 06-21-89
 ANALYSIS DATE: 06-21-89
 EXTRACT DATE: 06-20-89

SPI: 96.92
 SPM1: 88.39
 SPM2: 102.87

SAMPLE NAME (FG)	(#)	WT. (KG)	EXTRACT VOL. (L)	PERCENT MOISTURE	IR ABSORBANCE	DILUTION FACTOR	SAMPLE CONC. (MG/KG)	REPORTED SAMPLE CONC. (MG/KG-DRY)
TBLK	9	0.0100	0.1	0.01	0.0009	1	10.0	10.0
SPI	9	0.0100	0.1	0.01	0.0282	1	431.6	431.6
SPM1+BL-1	9	0.0110	0.1	9.10	0.0270	1	413.1	413.1
SPM2+BL-1	9	0.0103	0.1	9.10	0.0293	1	479.1	479.1
CP-1	7-7.5	0.0097	0.1	3.22	0.0246	50	20025.9	20025.9
CP-1	9.5-10	0.0096	0.1	11.40	0.0011	1	15.4	15.4
CP-1	12-12.5	0.0103	0.1	10.90	0.0069	1	111.9	111.9
CP-1	14.5-15	0.0104	0.1	9.20	0.0004	1	2.4	2.4
CP-1	17-17.5	0.0098	0.1	6.50	0.0003	1	0.8	<1.65
CP-1	19.5-20	0.0093	0.1	4.07	0.0029	1	45.9	45.9
CP-1	24.5-25	0.0101	0.1	3.71	0.0006	1	5.5	5.5
CP-1	29-29.5	0.0100	0.1	6.06	0.0015	1	20.5	20.5
CP-1	35.5-36	0.0100	0.1	6.02	0.0011	1	14.0	14.0
CP-1	39.5-40	0.0103	0.1	5.81	0.0011	1	13.5	13.5
CP-1	44.5-45	0.0099	0.1	4.27	0.0008	1	8.9	8.9
CP-1	49.5-50	0.0101	0.1	5.15	0.0007	1	7.2	7.2
CP-2A	3-3.5	0.0107	0.1	13.90	0.0266	50	22082.4	22082.4
CP-3	5-5.5	0.0104	0.1	22.60	0.0260	50	24697.6	24697.6
CP-5	5-5.5	0.0102	0.1	15.60	0.0170	15	4506.5	4506.5
BC	1	0.0107	0.1	8.29	0.0005	1	3.9	3.9
BC	2	0.0101	0.1	5.59	0.0020	1	28.3	28.3
BC	3	0.0100	0.1	6.90	0.0013	1	17.4	17.4
BC	4	0.0101	0.1	13.70	0.0006	1	6.2	6.2
BL	1	0.0105	0.1	9.10	0.0002	1	-0.8	<1.65
BL	2	0.0109	0.1	9.34	0.0002	1	-0.8	<1.65

From overflow pond closure plan 8/89

Backfill
 ←
 TRPH



1030 Andrews Highway, Suite 120
Midland, Texas 79701
(915) 699-1381
FAX: (915) 699-1978

4-20-90

VIA FACSIMILE

Mr. David Boyer
Oil Conservation Department
State Land Office Building
P.O. Box 2088; Room 206
Santa Fe, NM 87504

Re: Lea Refinery
Lovington, NM

Dear Mr. Boyer:

Thank you for your very prompt review of the overflow pond confirmation samples. Your verbal approval in our telephone conversation of this afternoon concerning the backfilling of the excavation is appreciated. The excavation contractor is tentatively scheduled to begin the backfilling process on Saturday, April 21. We will continue to keep you informed of operations at the site.

Very truly yours,

Allan T. Schmidt

cc: Larry Younglass
Steve Reed
Russel Buss
Teresa Salamone



STATE OF NEW MEXICO
ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT
OIL CONSERVATION DIVISION

GARREY CARRUTHERS
GOVERNOR

POST OFFICE BOX 2088
STATE LAND OFFICE BUILDING
SANTA FE, NEW MEXICO 87504
(505) 827-5800

April 23, 1990

CERTIFIED MAIL
RETURN RECEIPT NO. P-918-402-146

Mr. Allan T. Schmidt
Geraghty & Miller
Environmental Services
1030 Andrews Highway
Suite 120
Midland, Texas 79701

RE: Lea Refinery Overflow Pond Excavation

Dear Mr. Schmidt:

The Oil Conservation Division (OCD) has reviewed your letter of April 18, 1990 that provided analytical results of the soil samples obtained from the overflow pond. Based on the information provided in that letter, and the onsite inspection April 20th by our OCD Hobbs Geologist, Paul Kautz, your request of April 18th to cease further soil excavation and begin clean soil backfill operations is approved. This approval letter will also confirm the verbal approval given to you April 20th by telephone.

If you have any questions, please contact me by telephone at (505) 827-5812.

Sincerely,

David G. Boyer, Hydrogeologist
Environmental Bureau Chief

DGB/si

cc: NMOCD Hobbs District Office
Russel Buss, Southern Union Gas Company
V. Steve Reed, Geraghty & Miller, Corpus Christi
Teresa Salamone, Geraghty & Miller, Austin

APPENDIX D

APPENDIX D
TRANSPORTATION MANIFESTS

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
P.O. BOX 980
Address: HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED Quantity: 21 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE 49,960 net = 21 cy

Reportable Quantity: NONE

Additional Description: PROFILE # WMA 0258

REP. SAMPLE = S-OP-3

Container(s): TRAILER No: 1 Type ENDDUMP

Special Handling Instructions: CONTAINS HYDROCARBON CONTAMINATION

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-23-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: LELAND ALLEN Truck No.: 27-87AD Tag No./State: AP86650CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 3-23-90
Driver Signature Shipment Date

[Signature] 3-23-90
Driver Signature Shipment Date

Received at: 710 RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]
Date: 3-23-90

Print: KENTUCK

EAST BRIDGE BETWEEN 375.800 AND 375.90
NORTH GRADE BETWEEN 1557.75 AND 1557.100

ELEV 5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
Phone: _____

Job Name: SOUTHERN UNION GAS
P.O. BOX 980
Address: HOBBS, NM
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 21 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMA 02758

REP. SAMPLE = S-OP-3

Container(s): TRAILER No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-23-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: _____ Truck No.: 28-73AD Tag No./State: BP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Bob Claver 3-23-90
Driver Signature Shipment Date

Bob Claver 3-23-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 3-23-90

EAST GRID BETWEEN 375,800 AND 375,900
NORTH GRID BETWEEN 1557,25 AND 1557,100

ELEV. 5591.18

NO: OP-3

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
Phone: (409) 962-8989

Job Name: SOUTHERN UNION GAS
P.O. BOX 980
Address: HOBBS, NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 2719 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMA 02758

REP. SAMPLE = SOP-3

Container(s): TRAILER No: 1 Type END PUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAN TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1304 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 3-26-90
Driver Signature Shipment Date

John Penick 3-26-90
Driver Signature Shipment Date

Received at: POI Rancho ~~Landfill~~ SANITARY FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heald
Date: 3-26-90

Print: Ken Heald

EAST GRID BETWEEN 375,800 AND 375,700
NORTH GRID BETWEEN 1557,25 AND 1557,100

EKEN, 5591.13

NO: OP-4

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
P.O. BOX 950
Address: HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 21 19 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMA ~~02588~~ 02758

REP. SAMPLE = SOP3

Container(s): TRAILER No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 203-7910 Tag No./State: PR 19267, N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil W. Stephens 3-26-90
Driver Signature Shipment Date

Virgil W. Stephens 3-26-90
Driver Signature Shipment Date

Received at: ROI RAVENHAW SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK Print: KEN HECK

Date: 3-26-90

EAST GRID BETWEEN 375.80 AND 375.700 EW. 5591.B
NORTH GRID BETWEEN 1557.25 AND 1557.100

NO: OPS

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
9884
Phone: (409) 962-8884

Job Name: SOUTHERN UNION GAS
P.O. BOX 280
Address: HOORS, NM
Phone: (505) 326-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 219 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMAA 02758

REP. SAMPLE = S-OP-3

Container(s): TRAILER No: 1 Type: TWO DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAA TRUCKING

Address: 506 N. SHIP HOBBS, N.M Phone: 505-393-1010

Driver: Robert MACIAS Truck No.: 44-86AD Tag No./State: BP 40858 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature]
Driver Signature Shipment Date 3-26-90

[Signature]
Driver Signature Shipment Date 3-26-90

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: KEN HECK

Date: 3-26-90

EAST GRID BETWEEN 375,800 AND 375,900
AND GRID BETWEEN 155,125 AND 155,100 Elev: 5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: PO. BOX 2000 GRAVE'S, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: PO. BOX 980 HOBBS, NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 2419 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMAA 02758

REP. SAMPLE = S-OP-3

Container(s): TRAILER No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AD Tag No./State: BP40857CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett
Driver Signature 3-26-90
Shipment Date

Fred Syfrett
Driver Signature 3-26-90
Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/26/90

EAST GRID BETWEEN 375.00 AND 375.700
NORTH GRID BETWEEN 1557.05 AND 1557.100
E.U. 5591.13

NO: OP-7

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
P.O. BOX 980
Address: HOBBS, NM
Phone: (505) 386-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 219 Units: cy

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMA 02758

REP. SAMPLE = SOP 3

Container(s): TRAILER No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: SAM KISER Truck No.: 24-81AD Tag No./State: BP 60542 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Sam Kiser 3-26-90
Driver Signature Shipment Date

Sam Kiser 3/26/90
Driver Signature Shipment Date

Received at: R.O. RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: KEN HECK

Date: 3/26/90

EAST GRID BETWEEN 375,000 AVE 375,700
WORTH GRID BETWEEN 1557,25 AVE 1557,100

Elev. 5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 100
Address: GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
P.O. BOX 98
Address: HOBBS, N.M.
Phone: (605) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: cy

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMA 02758

REP. SAMPLE - SOP3

Container(s): TRAILER No: 1 Type ENDDUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: DENNIS RAINES Truck No.: 35-82AD Tag No./State: AD 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 3-26-90
Driver Signature Shipment Date

Dennis Raines 3-26-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 3/26/90

EAST GRID BETWEEN 375,800 AND 375,700
NORTH GRID BETWEEN 1557,25 AND 1557,100 ELEV. 5591.13

2743

NO: OP-9

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
P.O. BOX 980
Address: HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 21 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMA 02758

REP. SAMPLE = SOP-3

Container(s): TRAILER No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDRO CARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Leland ALLEN Truck No.: 27-87AA Tag No./State: AP 86650CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 3-26-90
Driver Signature Shipment Date

[Signature] 3-26-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]
Date: 3-26-90

Print: Kou Heck

EAST GRID BETWEEN 375, 800 AND 375, 700
NORTH GRID BETWEEN 155, 05 AND 155, 100

SLU. 5591.13

NO: OP-10

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
P.O. BOX 2000
Address: GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
P.O. BOX 980
Address: HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 2#19 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: PROFILE # WMAA 02758

REF. SAMPLE = SOP-3

Container(s): TRAILER No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10; or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AA Tag No./State: AP 86648 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 3-26-90
Driver Signature Shipment Date

Scott Woznick 3/26/90
Driver Signature Shipment Date

Received at: PO BOX 100 SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 3/26/90

EAST 62nd BETWEEN 375.000 AND 375.700
1557.100 E.N. 5591.13

NO: CP-11

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRACES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 2119 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOP-3

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-EDR Tag No./State: BP 40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers
Driver Signature Shipment Date 3-26-90

David Meyers
Driver Signature Shipment Date 3/26/90

Received at: ROI RANCH SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heick Print: Ken Heick

Date: 3/26/90

EAST GRID BETWEEN 375.800 AND 375.700
WEST GRID RA. THISEN 155725 AND 1557100 EN. 5591.13

NO: CP-12

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
622025 TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 279 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOP-3

Container(s): Trailer No: 1 Type endump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: WAYNE RITTER Truck No.: 21-74AD Tag No./State: AD 86645CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Wayne Ritter 3-26-90
Driver Signature Shipment Date

Wayne Ritter 3/26/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/26/90

EAST GRID BETWEEN 375.80 AND 375.700
NORTH GRID BETWEEN 1557.25 AND 1557.100

Elev 5591.13

NO: OP-13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: 682445 TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 386-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: # 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOP-3

Container(s): Trailer No: 1 Type: enddump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N. M Phone: 505-393-1016

Driver: GUS GARCIA Truck No.: 19-80AA Tag No./State: AP 86643CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 3-26-90
Driver Signature Shipment Date

Gus Garcia 3/26/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 3/26/90

EAST GRID BETWEEN 375.800 AND 375.700
NORTH GRID BETWEEN 15507.25 AND 1557.100
EDU. 5591.13

NO: OP-14

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOP-3

Container(s): trailer No: 1 Type enddump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAA TRUCKING

Address: 506 N. SHIP Hobbs, N.M. Phone: 505-393-1010

Driver: DALE CLOVER Truck No.: 28-73AA Tag No./State: BP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William R Brown 3-26-90
Driver Signature Shipment Date

William R Brown 3-26-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEU HECK
Date: 3/26/90

Print: KEU HECK

EAST GRID BETWEEN 375.800 AND 375.700 ELEV. 5591.13
NORTH GRID BETWEEN 1557.25 AND 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP-15

Generator: Southern Union Gas
Address: PO. Box 2000
622425 TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: PO. Box 480
Hobbs NM
Phone: (505) 386-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. sample = SOP-34

Container(s): TRAILER No: 1 Type Enddump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-26-90
Shipment Date

Transporter: TAM TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1016

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 3-26-90
Driver Signature Shipment Date

[Signature] 3-26-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: KEN HECK

Date: 3/26/90

EAST GRID BETWEEN 375,800 AND 375,800 ELEV 5591.13
NORTH GRID BETWEEN 155,125 AND 155,100

NO: OP-16

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile WMA 02758

Rep. Sample = S-OP-4

Container(s): + Trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Gus Garcia Truck No.: 19-80M Tag No./State: AP-86643CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 3-27-90
Driver Signature Shipment Date

Gus Garcia 3/27/90
Driver Signature Shipment Date

Received at: Roi Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 3/27/90

Print: KEN HECK

EAST GRID BETWEEN 375.800 AND 375.700
NORTH GRID BETWEEN 1557.25 AND 1557.100
ELEV 5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union 625
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8885

Job Name: Southern Union 625
PO. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = S-OP-7

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon.

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266, N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 3-27-90
Driver Signature Shipment Date

John Penick 3-27-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 3/27/90

EAST GRID BETWEEN 375,800 AND 375,700
NORTH GRID BETWEEN 1557,25 AND 1557,100 ELEV. 5596.13

NO: 09-18

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE* WMA 02258

Rep. Sample = S-09-4

Container(s): TRAILER No: 1 Type: enddump

Special Handling Instructions: contains hydrocarbon 26/1/01

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Virgil Stephens Truck No.: 203-79AD Tag No./State: _____

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 3-27-90
Driver Signature Shipment Date

Virgil Stephens 3-27-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 3/27/90

Print: KEN HECK

EAST GRID BETWEEN 375 800 AND 375.700 ELEV. 5591.13
NORTH GRID BETWEEN 155725 AND 1557100

NO: OP-19

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union L25
Address: PO. Box 2000
Graves TX
Phone: (409) 962-8888

Job Name: Southern Union L25
Address: PO. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OP-4

Container(s): TRAILER No: 1 Type end dump.

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 43-77AD Tag No./State: BP 40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 3-27-90
Driver Signature Shipment Date

Fred Syrett 3-27-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 3/27/90

EAST GRID BETWEEN 375,800 AND 375,700 → 5591.3
NORTH GRID BETWEEN 155,25 AND 155,100 ELEVATION

#2744

NO: OP-20

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-009

Container(s): trailer 103-77P No: 1 Type end dump

Special Handling Instructions: containing hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Kussel Buss
Generator Authorized Agent

Kussel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: Leland Allen Truck No.: 27-87AD Tag No./State: AP 86650 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Leland Allen 3-27-90
Driver Signature Shipment Date

Leland Allen 3-27-90
Driver Signature Shipment Date

Received at: Rio Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK
Date: 3/27/90

Print: KEN HECK

EAST GRID BETWEEN 375,800 AND 375,700
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV. 5591.15

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: PO. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # 41MA 02758

Rep. Sample = 5-OP-4

Container(s): Trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: WAYNE RITTER Truck No.: 21-74AA Tag No./State: AP 86645CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Wayne Ritter 3-27-90
Driver Signature Shipment Date

Wayne Ritter 3/27/90
Driver Signature Shipment Date

Received at: RIO Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy Ewing

Date: 3-27-90

East grid Between 375 800 And 375.700 Elev. 5571.3
North Grid Between 1557.025 and 1557,100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8838

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PRO file # WMA 02758

Rep. Sample = S-OP-0001

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: _____

Driver: DAVID MEYERS Truck No.: 42-ENG Tag No./State: BP40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers 3-27-90
Driver Signature Shipment Date

DAVID MEYERS 3/27/90
Driver Signature Shipment Date

Received at: ROI RANCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 3/27/90

EAST GRID BETWEEN 375,800 AND 375,700 ELEV 5591.13
100TH GRID BETWEEN 1557.25 AND 1557.100

NO: 0P23

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = 502

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: John Schuster Truck No.: 24-81AD Tag No./State: BP 60542 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature]
Driver Signature 3-27-90
Shipment Date

[Signature]
Driver Signature 3-27-90
Shipment Date

Received at: _____

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: ROY FURRY

Date: 3 27 90

EAST Grid BETWEEN 375,800 AND 375,700 ELEV 5591.3
NORTH Grid BETWEEN 155725 AND 1557100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PRO file # WMA 02558 V5

Rep. Sample = S-OP-1

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1016

Driver: CHARLENE HARDCASTLE Truck No.: 44-86AA Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Charlene Hardcastle 3-27-90
Driver Signature Shipment Date

Charlene Hardcastle 3-27-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/27/90

EAST GRID BETWEEN 375.800 AND 375.700 ELEV. 5591.13
NORTH GRID BETWEEN 1557.25 AND 1557.100

NO: 0225

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union 625
Address: P.O. Box 2000
68245 TX
Phone: (409) 962-3338

Job Name: Southern Union 625
Address: P.O. Box 990
Hobbs NM
Phone: (505) 396-5321

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = 5-0A-1

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, NM Phone: 505-393-1016

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Harry Johnston
Driver Signature 3-27-90
Shipment Date

Harry Johnston
Driver Signature 3-27-90
Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]
Date: 3 29 90

Print: ROY EWIN

EAST grid BETWEEN 375,800 375,700 ELEV. 5591.13
North grid BETWEEN 1557.25 AND 1557.100

NO: 0P26

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8458

Job Name: Southern Union Gas
PO. Box 450
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOAP-1

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Bill Brown Truck No.: 28-73AN Tag No./State: BP85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William Brown 3-27-90
Driver Signature Shipment Date

William Brown 3-27-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Ewing

Print: Roy Ewing

Date: 3 27 90

EAST grid BETWEEN 375,800 AND 320,700
NORTH grid BETWEEN 1552.25 AND 1552.100

E/W
5591-13

2533

NO: 0927

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union L2S
PO. Box 2000
Address: 68205 TX
Phone: (409) 962-8888

Job Name: Southern Union L2S
PO. Box 490
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = SOP-1

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, NM. Phone: 505-393-1010

Driver: Bob Scott Truck No.: 25-84AA Tag No./State: AP86648 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 3-27-90
Driver Signature Shipment Date

Robert Scott 3/27/90
Driver Signature Shipment Date

Received at: Rio Rancho ~~Landfill~~ Santa Ana Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: Ken Heck
Date: 3/27/90

Print: Ken Heck

EAST GRID BETWEEN 375.700 AND 375.700
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV. 5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02750

Rep. Sample = SOP-1

Container(s): TRAILER No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-27-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AA Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 3-27-90
Driver Signature Shipment Date

Dennis Raines 3-27-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 3/27/90

Print: Ken Heck

EAST Grid BETWEEN 375,800 AND 375,700 ELEV 559.13
NORTH Grid BETWEEN 1557.25 AND 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 900
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OP-7

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 3-28-90
Driver Signature Shipment Date

John Penick 3-28-90
Driver Signature Shipment Date

Received at: Rio Rancho ~~Landfill~~ SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 3/28/90

EAST GRID BETWEEN 375,800 AND 375,900
NORTH GRID BETWEEN 1551,25 AND 1551,100

EKU, 5591, 13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 480
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = 5-OP-7

Container(s): TRAILER No: 1 Type: landfill

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AA Tag No./State: AP 86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 3-28-90
Driver Signature Shipment Date

Gus Garcia 3/28/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 3/28/90

Print: Ken Heck

EAST GRID BETWEEN 375.800 AND 375.900 E/W 5591.13
NORTH GRID BETWEEN 1557.25 AND 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 369-5321

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep. Sampling = S-OP-7

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Bass
Generator Authorized Agent

Russel Bass
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AA Tag No./State: RP40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 3-28-90
Driver Signature Shipment Date

Fred Syfrett 3-28-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Jen Heck
Date: 3/28/90

Print: JEN HECK

EAST GRID BETWEEN 375,800 AND 375,900
NORTH GRID BETWEEN 1557.25 AND 1557, 100 ELEV. 5501.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO. Box 2000
GRAVES TX
Phone: (409) 962-888

Job Name: Southern Union Gas
Address: PO. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = 5-00-7

Container(s): trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-ED8 Tag No./State: BP40856CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers
Driver Signature

3-28-90
Shipment Date

David Meyers
Driver Signature

3/28/90
Shipment Date

Received at: RIO RANCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/28/90

EAST Grid BETWEEN 375,800 AND 375,900
NORTH Grid BETWEEN 155725 AND 1557100 ELEV 5591.13

TP#2534

NO: AP-33

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758 V-5

Rep. Sample = 5-0P-7

Container(s): TRAILER No: 1 Type END DUMP

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel BUSS
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP 86648 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 3-28-90
Driver Signature Shipment Date

Scott Woznick 3/28/90
Driver Signature Shipment Date

Received at: RIO AVENUE SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: [Signature]

Date: 3/28/90

EAST GRID BETWEEN 375,800 AND 375,900
NORTH GRID BETWEEN 1557.25 AND 1557.100 EFW5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO. Box 2000
GRAND TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: PO. Box 480
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OP-7

Container(s): Trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: WAYNE RITTER Truck No.: 21-74AA Tag No./State: AP 86645 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Wayne Ritter 3-28-90
Driver Signature Shipment Date

Wayne Ritter 3/28/90
Driver/Signature Shipment Date

Received at: Roi Ranch Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/28/90

EAST GRID BETWEEN 375,800 AND 375,900
NORTH GRID BETWEEN 1557,25 AND 1557,100 ELEVATION 5591.13

2745

NO: 0235

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO. box 2000
GRAVES TX
Phone: (409) 962-8488

Job Name: Southern Union Gas
Address: PO. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # 2745
WMA 02758

Rep. Sample = 5-00-7

Container(s): trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: LELAND ALLEN Truck No.: 27-87AD Tag No./State: AP 86650CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 3-28-90
Driver Signature Shipment Date

[Signature] 3-28-90
Driver Signature Shipment Date

Received at: R/O Kaneto SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/28/90

EAST GRID BETWEEN 375,800 AND 375,900 ELEV. 5591.13
NORTH GRID BETWEEN 1557.25 AND 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = 5-OP-2

Container(s): TRAILER No: 1 Type: landfill

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Allen Hicks Truck No.: 44-86AD Tag No./State: BP 40258 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 3-28-90
Driver Signature Shipment Date

Allen Hicks 3/28/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 3/28/90

Print: Ken Heck

EAST GRID BETWEEN 375.800 AND 375.900
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV. 5591.13

NO: 02-37

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 980
Address: Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-00-7

Container(s): trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AD Tag No./State: AP86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 3-28-90
Driver Signature Shipment Date

Dennis Raines 3-28-90
Driver Signature Shipment Date

Received at: El Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 3/28/90

EAST GRID BETWEEN 375.800 AND 375.900
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV 5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union 6-25
PO Box 2000
Address: GRAVES TX
Phone: (409) 962-833

Job Name: Southern Union 6-25
PO Box 980
Address: Hobbs NM
Phone: (505) 396-5321

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = 5-09-7

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1016

Driver: Bill Brown Truck No.: 28-73AD Tag No./State: BP85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William R Brown 3-28-90
Driver Signature Shipment Date

William R Brown 3-28-90
Driver Signature Shipment Date

Received at: Rio Rancho SAINTELY Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Ewing

Print: Roy Ewing

Date: 3-28-90

EAST grid Between 375.800 And 375.900 Elev
North grid Between 1557.25 And 1557.100 55413

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO. Box 2000
Graves TX
Phone: (409) 962-8388

Job Name: Southern Union 6-33
Address: PO. Box 980
Hubbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = S-002

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-28-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hubbs, N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 3-28-90
Driver Signature Shipment Date

[Signature] 3-28-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross

Date: 3/28/90

East Grid Between 375.800 And 375.900
North Grid Between 1557.25 And 1557.100 Elev
5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
Address: PO Box 2000 Address: PO Box 980
GRAVES TX Address: Herb's UM
Phone: (409) 962-8885 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contame Soil Quantity: _____ Units: CY
DOT Hazard Class: None
Identification Number: N/A
Reportable Quantity: N/A
Additional Description: Profile # WMA 0225B
Rep. Sample = S-087
Container(s): Trailer No: 1 Type end dump
Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 3-29-80
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Phone: 505-393-1010

Driver: VIRAL STEPHENS Truck No.: 204-1204 Tag No./State: PR19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Viral Stephens 3-29-90 Viral Stephens 3-29-90
Driver Signature Shipment Date Driver Signature Shipment Date

Received at: RIO RANCHO SANTA ANITA LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: KEN HECK Print: KEN HECK
Date: 3/29/90

EAST GRID BETWEEN 375.800 AND 375.900
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV. 5591.13

NO: OP-91

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PP. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: PP. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample 5-025-2

Container(s): Trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Kussel Buss
Generator Authorized Agent

Kussel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AD Tag No./State: AP86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 3-29-90
Driver Signature Shipment Date

Gus Garcia 3/29/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 3/29/90

Print: KEN HECK

EAST GRID BETWEEN 375.800 AND 375.900 EKV 5591.13
NORTH GRID BETWEEN 1557.25 AND 1557.100

#24

NO: OP-42

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE #1 WMA 02758

Rep. Sample = S-025-7

Container(s): TRAILER No: _____ Type: end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

RUSSEL BUSS
Generator Authorized Agent

Russel Buss
Signature

3-29-96
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Bob Scott Truck No.: 24-81AD Tag No./State: BP60542CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 3-29-90
Driver Signature Shipment Date

Robert Scott 3-29-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Den Heek

Print: Den Heek

Date: 3/29/90

EAST GRID BETWEEN 375.800 AND 375.900
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV 5591.13

NO: OP-43

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAZUS TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = 5-ops-7

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Idanis A Johnston Jr. 3-29-90
Driver Signature Shipment Date

Idanis A Johnston Jr. 3-29-90
Driver Signature Shipment Date

Received at: P.O. RANCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heck
Date: 3/29/90

Print: Kent Heck

EAST GRID BETWEEN 375,800 AND 375,910 SECU. 1591.13
NORTH GRID BETWEEN 1557.25 AND 1557.100

1 27 3 8

NO: OP 14

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. box 2000
Address: GRAVES TX
Phone: (1409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 386-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = 5-OPS-5

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: Allen Hicks Truck No.: 44-86AA Tag No./State: PH46858 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 3-29-90
Driver Signature Shipment Date

Allen Hicks 3-29-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 3/29/90

EAST GRID BETWEEN 375.800 AND 375.900
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV 571.13

NO: OP 95

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVAS TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Sol. Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-5

Container(s): trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: WAYNE RITTER Truck No.: 21-74AD Tag No./State: AP 26645CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Wayne Ritter 3-29-90
Driver Signature Shipment Date

Wayne Ritter 3/29/90
Driver Signature Shipment Date

Received at: Pai Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: Ken Heck

Date: 3/29/90

EAST GRID BETWEEN 375.00 AND 375.900
1 WITH GRID BETWEEN 1557.25 AND 1557.100

E1E15591.13

24, 3, 8

11K20

NO: OP46

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: BRUCE TX
Phone: (409) 962-8858

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-5

Container(s): Trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent
Russel Buss Signature
3-29-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipa Hobbs, N.M. Phone: 505-393-1010

Driver: Bill Brown Truck No.: 28-73AD Tag No./State: BP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William Brown Driver Signature
3-29-90 Shipment Date
Rob Miller Driver Signature
3-29-90 Shipment Date

Received at: Red Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: Ken Heald

Date: 3/29/90

EAST END BETWEEN 375.800 AND 375.900 ELEV. 5591.13
NORTH END BETWEEN 1557.25 AND 1557.100

28, 2, 8,

NO: OP 47

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRANVILLE TX
Phone: 14091 962-8888

Job Name: Southern Union Gas
P.O. Box 490
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = 5-OPS-5

Container(s): TRAILER No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AD Tag No./State: AP86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 3-29-90
Driver Signature Shipment Date

Dennis Raines 3-29-90
Driver Signature Shipment Date

Received at: Pal Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/29/90

EAST GRID BETWEEN 375,800 AND 375,900 - 5EV.
WEST GRID BETWEEN 1557.25 AND 1557.100 5591.13

28, 2.5, 8

NO: 0P98

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-5

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs, N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AD Tag No./State: BP40857CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 3-29-90
Driver Signature Shipment Date

Fred Syfrett 3-29-90
Driver Signature Shipment Date

Received at: for KANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3/29/90

EAST GRID BETWEEN 375.800 AND 375.900
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV. 5591.13

27 2.5.8,

#25

TP #2535

NO: OP 49

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO. Box 980
Address: Hobbs NM
Phone: (505) 396-5521

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CF

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-5

Container(s): TRAILER No: 1 Type ENDDUM P

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-8410 Tag No./State: AP 81648CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 3-29-90
Driver Signature Shipment Date

Scott Woznick 3/29/90
Driver Signature Shipment Date

Received at: Rio HAVENO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 3/29/90

EAST GRID BETWEEN 375.800 AND 375.900 E EU 5591.13
NORTH GRID BETWEEN 1557.25 AND 1557.100

29 8 3
1# 2746

NO: OP-50

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
P.O. Box 2000 P.O. Box 930
Address: GRAVES TX Address: Hobbs NM
Phone: (409) 962-8888 Phone: (505) 396-5527

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: _____ Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = 5-ops-5

Container(s): Trailer No: 1 Type: End dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel BUSS
Generator Authorized Agent

Russel Buas
Signature

3-29-90
Shipment Date

Transporter: JAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: Leland Allen Truck No.: 27-87AD Tag No./State: AP86650 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 3-29-90
Driver Signature Shipment Date

[Signature] 3-29-90
Driver Signature Shipment Date

Received at: Rio Ranches Savanna, LF.

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy Eung

Date: 3-29-90

East Grid Between 375,800 and 37700
North Grid Between 1557,25 and 1557,100

27 6-2.5

NO: OP-51

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 930
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-5

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-29-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-ED8 Tag No./State: BP 40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers
DAVID MEYERS 3-29-90
Driver Signature Shipment Date

David Meyers 3/29/90
Driver Signature Shipment Date

Received at: FOR RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK
Date: 3/29/90

Print: KEN HECK

EAST GRID BETWEEN 375.800 AND 375.900
NORTH GRID BETWEEN

EJEU5591.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP-52

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAND TX
Phone: (409) 962-8898

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Cond. Am. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: 11A

Reportable Quantity: 11A

Additional Description: Profile # WMTA 02758

Rep. Sample = S-OPS-5

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 3-30-90
Driver Signature Shipment Date

John Penick 3-30-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: BOY FERRIS

Date: 3-30-90

EAST 41st BETWEEN - 375,800 AND 375,900
NORTH 91st BETWEEN 1557,25 AND 1559,100 ELEV. 5541.15

NO: 0P53

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: LR2445 TX
Phone: (409) 962-8884

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

R.O. Sample = S-OPS-5

Container(s): Trailer No: 1 Type endump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AD Tag No./State: AP 86643 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 3-30-90
Driver Signature Shipment Date

Gus Garcia 3/30/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heel Print: Ken Heel

Date: 3-30-90

EAST GRID BETWEEN 375,650 AND 375,800 ELEVATION 13
NORTH GRID BETWEEN 1557,25 AND 1557,100

4339

NO: OP 59

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-9448

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: _____ Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = 5-OPS-5

Container(s): Trailer No: 1 Type: enddump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Duss
Generator Authorized Agent

Russel Duss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 43-77AP Tag No./State: RP 40857 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 3-30-90
Driver Signature Shipment Date

Fred Syrett 3-30-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 3-30-90

Print: Ken Heck

EAST 6TH BETWEEN 375.60 AND 375.80 ELEV 19.13
NINTH 27th BETWEEN 159.25 AND 159.100

NO: 0955

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 480
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: _____ Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-5

Container(s): Trailer No: 1 Type endump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 3-30-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-ED8 Tag No./State: RP40856CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

DAVID MEYERS Driver Signature 3-30-90 Shipment Date DAVID MEYERS Driver Signature 3/30/90 Shipment Date

Received at: RIO RANCHO SANTA FE LF.

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Print: Roy

Date: 3-30-90

For grid 1557.25 and 1557.00
North grid 1557.25 and 1557.00

NO: 0P56

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: TRAVERS TX
Phone: 14091 962-8888

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-5

Container(s): + trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss 3-30-90
Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: _____

Driver: Dennis Raines Truck No.: 35-82AD Tag No./State: AP 8654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 3-30-90
Driver Signature Shipment Date

Dennis Raines 3-30-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: [Signature]

Date: 3-30-90

EAST SIDE BETWEEN 375,600 AND 375,800
NOTHING BETWEEN 375,800 AND 155,7100
ELEV. 5579.13

2747

NO: 00-57

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
BRUCE TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile WMA 02758

Rep Sample = SOP5-5

Container(s): 1 Trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Leland Allen Truck No.: 27-87AD Tag No./State: AP 86650CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Leland Allen 3-30-90
Driver Signature Shipment Date

[Signature] 3-30-90
Driver Signature Shipment Date

Received at: Rio Archo Antimony Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3-30-90

EAST GRID BETWEEN 375,600 AND 375,800
NORTH GRID BETWEEN 155,125 AND 155,1100
Elev 579.13

NO: 0259

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Sullivan Thru Gas
Address: P.O. Box 2000
GRAND TX
Phone: (409) 962-8899

Job Name: Sullivan Thru Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = 50PS-05

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 W. SHAD Hobbs, NM Phone: 505-393-1010

Driver: WAYNE Ritter Truck No.: 21-74AD Tag No./State: AP 86645 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Wayne Ritter 3-30-90
Driver Signature Shipment Date

Wayne Ritter 3/30/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 3-30-90

EAST 6TH BETWEEN 375.650 AND 375.800
16TH AND BETWEEN 1557.25 AND 1557.100 ELEV 5579.13

IP #2535

NO: OP-59

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: FRUZZ TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02258

Rep Sample = 5095-6

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP Hobbs, N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP 86648CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 3-30-90
Driver Signature Shipment Date

Scott Woznick 3/30/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Hall

Signed: Ken Hall

Date: 3/30/90

EAST GRID BETWEEN 375.670 AND 375.800
NORTH GRID BETWEEN 1557.05 AND 1557.10 EX 1557.13

24

NO: 02-60

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRANDES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-6

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: ALLEN HICKS - Truck No.: 24-81AD Tag No./State: BP 46858CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 3-30-90
Driver Signature Shipment Date

Allen Hicks 3/30/90
Driver Signature Shipment Date

Received at: RIO KANABO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]
Date: 3-30-90

Signed: [Signature]

EAST SIDE BETWEEN 3756 AND 375800
WITH 6712 BETWEEN 155725 AND 1557100

NO: 09-61

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8844

Job Name: Southern Union Gas
P.O. Box 480
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMTA 02758

Rep Sample = SOPS-6

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 3-30-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AA Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Adams A Johnson Driver Signature 3-30-90 Shipment Date Harry A Johnston Driver Signature 3-30-90 Shipment Date

Received at: Rio Rancho SANTA FE

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: ROY FERRY

Date: 3-30-90

EAST END BETWEEN 375,650 AND 75,800
NORTH END BETWEEN 157,05 AND 1557,00
5791

NO: 00-62

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 462-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = 5025-6

Container(s): 1 Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Kiessel Buss
Generator Authorized Agent

Kiessel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBES, N.M.

Phone: 505-393-1010

Driver: Robert Scott

Truck No.: 44-86AD Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 3-30-90
Driver Signature Shipment Date

Robert Scott 3/30/90
Driver Signature Shipment Date

Received at: KID KANEHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Helt

Print: Ken Helt

Date: 3-30-90

EAST GRID BETWEEN 375650 AND 375800 E/11, 557, 13
WITH (1) ROTATION 1557, 100 AND 1557, 100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-8884

Job Name: Southern Union Gas
PO. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROCH # WMA 02758

R-p Sample = 505-6

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Kussel Buss
Generator Authorized Agent

Kussel Buss
Signature

3-30-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: BILL BROWN Truck No.: 28-73AD Tag No./State: RP85316CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William Brown 3-30-90
Driver Signature Shipment Date

William Brown 3-30-90
Driver Signature Shipment Date

Received at: KID RANCH SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Date: 3-30-90

EAST GRID BETWEEN 1541.5 AND 375.800
NORTH GRID BETWEEN 1541.25 AND 1557.100 ELEV 599.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000
I-Raven TX

Address: Hobbs NM

Phone: (409) 962-4434

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OP-S 2B

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 202-1202 Tag No./State: PR 19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-2-90
Driver Signature Shipment Date

Virgil Stephens 4-2-90
Driver Signature Shipment Date

Received at: Rio Rancho SAINTA FE

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: ROY EWING

Date: 4-2-90

EAST grid BETWEEN 375,450 AND 375,800
NORTH grid - BETWEEN 1557,25 / 1557,100 ETC 5579.13

NO: OP-65

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-5554

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 396-5521

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 17 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS 2B

Container(s): TRAILER No: 1 Type enddump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss 4-2-90
Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AD Tag No./State: AP 86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-2-90
Driver Signature Shipment Date

Gus Garcia 4/2/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4/2/90

EAST GRID BETWEEN 375,650' AVE 375,800
NORTH GRID BETWEEN 1557, 25 AVE 1557, 100 21' ELEV 5559, B

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRADUATE NM
Phone: (409) 962-4488

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = SOPS 28

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 43-77AD Tag No./State: 8P40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 4-2-90
Driver Signature Shipment Date

Fred Syrett 4-2-90
Driver Signature Shipment Date

Received at: Rio Rancho SANTA ANITA WASTE

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-2-90

Print: Ken Heck

EAST GRID BETWEEN 375.650 AND 375.800
NORTH GRID BETWEEN 1557.25 AND 1557.100
EFU. 55%

NO: OP-67

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 2000
Address: GRAVES TX
Phone: (409) 962-5858

Job Name: Southern Union Gas
PO. Box 480
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = 50PS2B

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AA Tag No./State: AP86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-2-90
Driver Signature Shipment Date

Dennis Raines 4-2-90
Driver Signature Shipment Date

Received at: Rio Rancho SAINAIY LF

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy Ewing

Date: 4-2-90

EAST grid between 375, 650 / 375, 800 ELEV
15th grid between 1557, 25 / 1557, 100 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000 Graves TX 77619

Address: P.O. Box 980 Hobbs N.M 8824

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 21 Units: CY

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: Pro file # WMA 02758

Rep sample = SOPS 2A

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIAP Hobbs, N.M

Phone: 505-393-1010

Driver: John Penick

Truck No.: 204-1204

Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 4-2-90
Driver Signature Shipment Date

John Penick 4-2-90
Driver Signature Shipment Date

Received at: El Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: [Signature]

Date: 4/2/90

EAST GRID BETWEEN 375.650 AND 375.800
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV. 5579.13

NO: OP-69

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
Address: P.O. Box 2000 Graves TX 77619 Address: P.O. Box 980 Hobbs NM, 88240
Phone: (409) 962-8888 Phone: (505) 776-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY
DOT Hazard Class: NONE
Identification Number: NONE
Reportable Quantity: NONE
Additional Description: Profile # WMA 02758
Rep. Sample = SOPS 2B
Container(s): trailer No: 1 Type: end dump
Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-2-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING
Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010
Driver: Robert Scott Truck No.: 44-86AD Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below. I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-2-90 Robert Scott 4-2-90
Driver Signature Shipment Date Driver Signature Shipment Date

Received at: Rio Rancho SANTA FE

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Ewing Print: Roy Ewing
Date: 4-2-90

East grid Between 375, 450 / 375, 800
North grid Between 1557, 25 / 1557, 100 Elev 5571.1

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: Po Box 2000 Graves TX 77619

Address: Po Box 980 Hobbs NM 88240

Phone: (409) 962 8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 0275B

Rep Sample = SOPS 2B

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAA TRUCKING

Address: 506 N Shipp Hobbs, N. M Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP 40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers 4-2-90
Driver Signature Shipment Date

David Meyers 4/2/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-2-90

type 4941
East grid between 375.650 / 375.800
North grid between 1557.25 / 1557.100 Elev 5571.13

2748

NO: OP-71

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Groves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS 2B

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Leland ALLEN Truck No.: 27-87AD Tag No./State: AP 86650CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 4-2-90
Driver Signature Shipment Date

[Signature] 4-2-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross

Date: 4-2-90

East Grid Between 375.650 and 375.800
North grid Between 1557.25 and 1557.100
Elev 5571.13

TP 2537

NO: OP-72

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000 Graves TX 77619

Address: P.O. Box 980 Hobbs N.M 88240

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile #WMA 02758

Rep Sample = SOPS 2B

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP86648 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-2-90
Driver Signature Shipment Date

Scott Woznick 4/2/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross

Date: 4-2-90

East grid Between 375,450 And 375,800

North grid Between 1557,25 And 1557,100

Elev 5571,13

NO: OP-73

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves Tr 77419
Phone: (409) 962-5888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS2B

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 W. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: HARRY Johnston Truck No.: 26-85AD Tag No./State: AP86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Harry Johnston 4-2-90
Driver Signature Shipment Date

Harry Johnston 4-2-90
Driver Signature Shipment Date

Received at: RIO RANCHO SAINTRY Land Fill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy Ewing

Date: 4-2-90

EAST grid between 375,650 and 375,800
North grid between 1557,25 and 1557,100 E/10 5571.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep sample - SOPS 28

Container(s): trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: DALE CLOVER Truck No.: 28-73AA Tag No./State: BP 85316CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dale Clover 4-2-90
Driver Signature Shipment Date

Dale Clover 4-2-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-2-90

EAST 911d BETWEEN 375,650 / 375,800

North 911d BETWEEN 1557,25 / 1557,100

E/CO 5571.13

24

NO: 0225

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # - WMA 02258

Rep Sample = SOPS 28

Container(s): trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp. Hobbs, N.M. Phone: 505-393-1010

Driver: Allen Hicks Truck No.: 24-81AD Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-2-90
Driver Signature Shipment Date

Allen Hicks 4-2-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary LF

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy Eving

Date: 4-2-90

EAST grid Between 375,650 / 375,800 Elev 5571.13
North grid Between 1557.25 / 155,100

NO: 02-76

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graevs Tx 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS 2B

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-2-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: Joe Dolan Truck No.: 21-74AD Tag No./State: AP86645 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Joe Dolan 4-2-90
Driver Signature Shipment Date

X
Driver Signature Shipment Date

Received at: RIO RANCHO SANTA FE

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: ROY - ELLIOTT

Date: 4-2-90

East grid Between 325,650 / 375,800
North grid Between 1557,25 / 1557,100 Elev 5571.73

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX 77619
Phone: (409) 962-9888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample - OP3-2B

Container(s): trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAA TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: John Denick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Denick 4-3-90
Driver Signature Shipment Date

John Denick 4-3-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: Ken Heck
Date: 4-3-90

Print: Ken Heck

EAST GRID BETWEEN 375.650 AND 375.80
NORTH GRID BETWEEN 1557.25 AND 1557.10 ELEV 579.13

NO: OP-78

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: PO Box 2000
Graves TX 77619

Address: PO Box 980
Hobbs NM 88240

Phone: 409-962-8888

Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: profile # WMA 02758

Rep. Sample = OPS-60

Container(s): trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs, N.M. Phone: 505-393-1010

Driver: Gus Garcia Truck No.: 19-80AP Tag No./State: AP-86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-3-90
Driver Signature Shipment Date

Gus Garcia 4/3/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heek Print: Ken Heek
Date: 4-3-90

EAST GRID BETWEEN 375,60 AND 375,800
NORTH GRID BETWEEN 1557,25 AND 1557,100 2100
557,13

NO: OP-79

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO Box 2000 Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
Address: PO Box 980 Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = OPS-60

Container(s): trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 43-77AD Tag No./State: BP-40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 4-3-90
Driver Signature Shipment Date

Fred Syrett 4-3-90
Driver Signature Shipment Date

Received at: Red Ranch Santa Fe

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: ROY EWING

Date: 4-3-90

EAST grid Between 375,650 / 375,800
NORTH and BETWEEN 1557,25 / 1557,100 Elev

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8588

Job Name: Southern Union Gas
PO Box 990
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = OPS-6

Container(s): Trailer No: 1 Type: END Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 4-3-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AD Tag No./State: AP 86654 Ct.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines Driver Signature 4-3-90 Shipment Date Dennis Raines Driver Signature 4-3-90 Shipment Date

Received at: Rio Rancho SANTA FE

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: ROY Ewing

Date: 4/13/90

EAST grid Between 375,650 / 375,800
North grid Between 1557.25 / 1557.100 Flow--> 10

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP-81
TR 2538

Generator: Southern Union Gas
PO Box 2000
Address: Graves tx 77619
Phone: (409) 692-8888

Job Name: Southern Union Gas
PO Box 080
Address: Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: cu

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = OPS-6

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss 4-3-90
Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP-86648CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-3-90
Driver Signature Shipment Date

Scott Woznick 4/3/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK Print: KEN HECK

Date: 4-3-90

EAST GRID BETWEEN 375.650 AND 375.800
NORTH GRID BETWEEN 1557.25 AND 1557.100 ELEV 5579.13

NO: OP-02

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: Southern Union Gas
PO Box 2000
Address: Groves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = OPS-6

Container(s): Trailer No: 1 Type end Pump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP 40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers 4-3-90
Driver Signature Shipment Date

David Meyers 4-3-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: KEN HECK

Date: 4-3-90

EAST GRID BETWEEN 375,650 AND 375,800
NORTH GRID BETWEEN 1557,25 AND 1557,100 SKW.
5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Smarrs Tx 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 950
Address: HOBBS NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = OPS-6

Container(s): drum No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AA Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Harry Johnston 4-3-90
Driver Signature Shipment Date

Harry Johnston 4-3-90
Driver Signature Shipment Date

Received at: RIO RANCHO - SAINTELY LF.

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]
Date: 4-3-90

Print: ROY EDWIN

EAST 9th BETWEEN 375,650 / 375,800
NORTH 9th BETWEEN 1557,25 / 1557,100 ELEV 5579.13

29 2.5, 8,

NO: OP-89

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Greene TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 280
Address: Hobbs NM 88240
Phone: 505 346-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Pro file # WMA 02758

Rep. Sample = OPS-6

Container(s): trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N. M. Phone: 505-393-1010

Driver: Robert Scott Truck No.: 44-86AD Tag No./State: BP 46858CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-3-90
Driver Signature Shipment Date

Robert Scott 4-3-90
Driver Signature Shipment Date

Received at: RIO Rancho SALTAY LF

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy F. [Signature]

Date: _____

EAST grid Between 375.650 / 375.800 ELEV
North grid Between 1557.25 / 1557.100 5579.13

NO: OP-85

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 490
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: CY
DOT Hazard Class: None
Identification Number: None
Reportable Quantity: None
Additional Description: Profile # WMA 02758
Rep. Sample = OPS-6
Container(s): Trailer No: 1 Type end Dump
Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING
Address: 506 N Shipp Hobbs, NM Phone: 505-393-1010
Driver: Foy Smith Truck No.: 202-1202 Tag No./State: PR 19368 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-3-90
Driver Signature Shipment Date

Foy Smith 4-3-90
Driver Signature Shipment Date

Received at: Rio Rancho SANTIAGO LF.

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Ewing

Print: Roy Ewing

Date: 4/3/90

EAST 911d Between 375,650 / 375,800
North 911d Between 1557,25 / 1557,100 ELEV 557913

2144

NO: OP-86

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 0075B

Rep. Sample = OPS-6

Container(s): loaded No: 1 Type: 200 Gallon Drum

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent
Russel Buss Signature
4-3-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Leland Allen Truck No.: 2779AD Tag No./State: AP 86650 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

[Signature] Driver Signature
4-3-90 Shipment Date

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] Driver Signature
4-3-90 Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-3-90

East Grid Between 375.650 / 375.800
North Grid Between 1557.25 / 1557.100 Elev 5579.13

28

NO: OP-88

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves tx 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs Nm 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam soil Quantity: 19 Units: CY

DOT Hazard Class: none

Identification Number: none

Reportable Quantity: None

Additional Description: profile # WMA 08758

Rep Sample = OPS-6

Container(s): trailer No: _____ Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP86645 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-3-90
Driver Signature Shipment Date

Jody Mitchell 4-3-90
Driver Signature Shipment Date

Received at: Rio Rancho SAINTELY LF

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: ROY EUNY

Date: 4/3/90

EAST grid Between 375,650 / 375,800 Elev
North grid Between 1557,25 / 1557,100 5579.13

21

NO: 02-89

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 280
Address: HeBDS NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 0275B

Rep. Sample = OPS-6

Container(s): trailer No: 1 Type: end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-3-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Joe Dolan Truck No.: 28-73AD Tag No./State: RP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Joe Dolan 4-3-90
Driver Signature Shipment Date

Joe Dolan 4-3-90
Driver Signature Shipment Date

Received at: Rio Rancho SANTIAGO 2F

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: ROY EWING

Date: 4-3-90

EAST 911d Between 375,650 / 375,800
and Between 1557,25 / 1557,100 EPCO
557912

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = OPS-6

Container(s): trailer No: 1 Type land dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John V. Penick 4-4-90
Driver Signature Shipment Date

John V. Penick 4-4-90
Driver Signature Shipment Date

Received at: R.D. RAYNO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: JEN Heck
Date: 4-4-90

Print: JEN HECK

EAST GRID BETWEEN 375.650 AND 375.800
NORTH GRID BETWEEN 357.25 AND 357.100
ELEV. 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Marathon TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 280 NM
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 19 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-6

Container(s): Trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AD Tag No./State: AP-86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

GUS Garcia 4-4-90
Driver Signature Shipment Date

GUS Garcia 4/4/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: KENT HECK

6760 BETWEEN 375.650 AND 375.800
NO. 1 6726 BETWEEN 1557.25 AND 1557.100 EVEN 1557.15

25

NO: 00-92

TYPE 2539

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Vaion Gas
PO Box 2000
Address: Groves TX 77619
Phone: 409-962-8888

Job Name: Southern Vaion Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5820

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam Soil Quantity: 19 Units: cy

DOT Hazard Class: none

Identification Number: none

Reportable Quantity: None

Additional Description: Partic # WMA 02758
S-OPS B

Rep. Sample = WMA 02758

Container(s): trailer No: _____ Type end Pump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP 8648CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4/4-90
Driver Signature Shipment Date

Scott Woznick 4/4/90
Driver Signature Shipment Date

Received at: RIO KANABO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK
Date: 4-4-90

Print: KEN HECK

EAST GRID BETWEEN 375650/375800 ELEV 559.13
NORTH GRID BETWEEN 1557.25/1557.100

43 -

NO: 0P 93

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5820

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = 50PS-9

Container(s): Trailer No: 1 Type and Dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AD Tag No./State: BP 40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 4-4-90
Driver Signature Shipment Date

Fred Syfrett 4-4-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary LF.

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ray Ewing

Print: Ray Ewing

Date: 4/4/90

EAST grid between 375,650 / 375,800
North grid between 1557,25 / 1557,100 Elev 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: Cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-~~9~~9

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, NM. Phone: 505-393-1010

Driver: Down's RAINES Truck No.: 35-82AD Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Rains 4-4-90
Driver Signature Shipment Date

Dennis Rains 4-4-90
Driver Signature Shipment Date

Received at: Rio Rancho SANITARY Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4/4/90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 EKV. 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5820

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-9

Container(s): Trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1202 Tag No./State: PR 19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-4-90
Driver Signature Shipment Date

Foy Smith 4-4-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross

Date: 4/4/90

East Grid Between 375.650 / 375.800
North Grid Between 1557.25 / 1557.100 Elev 5579.1

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 72619
Phone: 409 962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5824

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam. soil Quantity: 18 Units: cy

DOT Hazard Class: none

Identification Number: none

Reportable Quantity: none

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-9

Container(s): trailer No: 1 Type end pump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: VIRGIL Stephens Truck No.: 203-79AD Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-4-90
Driver Signature Shipment Date

Virgil Stephens 4-4-90
Driver Signature Shipment Date

Received at: RIO ARANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-4-90

Print: Ken Heck

EAST Grid BETWEEN 375.600 AND 375.800
NORTH Grid BETWEEN 1557.25 AND 1557.100 Elev 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Clarks TX 77619
Phone: 505 962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 409-396-5824

QUANTITY AND DESCRIPTION

Proper Shipping Name: center soil Quantity: 19 Units: cy

DOT Hazard Class: none

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = 505-9

Container(s): trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP 40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

DAVID MEYERS 4-4-90
Driver Signature Shipment Date

DAVID MEYERS 4/4/90
Driver Signature Shipment Date

Received at: PIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted, and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 4-4-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 STATION 557.13

NO: OP-98

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
70 Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
170 Box 980
Address: HOBBS NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS 9

Container(s): Trailer No: 1 Type end Pump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: ALLEN HICKS Truck No.: 24-81AD Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-4-90
Driver Signature Shipment Date

Allen Hicks 4-4-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK
Date: 4-4-90

Print: KEN HECK

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 ELEV 8579.13

NO: OP-99

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 280
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = 505-9

Container(s): trailer No: 1 Type: 20d Dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M Phone: 505-393-1010

Driver: Joe Nolan Truck No.: 28-73AD Tag No./State: BP 85316 CA. ~~86455 CA~~

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Joe Nolan 4-4-90
Driver Signature Shipment Date

Joe Nolan 4-4-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HEEL

Print: KEN HEEL

Date: 4-4-90

EAST GRID BETWEEN 375,600/375,800.
NORTH GRID BETWEEN 1557,25/1557,100 ELEV 5579.13

2750

NO: OP-100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 505 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam soil Quantity: 18 Units: cy

DOT Hazard Class: none

Identification Number: none

Reportable Quantity: none

Additional Description: Profile # WMA 0275B

Rep. Sample = SOPS-9

Container(s): trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs N.M. Phone: 505-393-1010

Driver: Leland Allen Truck No.: 27-87AD Tag No./State: AP 86650CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 4-4-90
Driver Signature Shipment Date

[Signature] 4-4-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-4-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 ELEV. 5579.13

24

NO: 02-101

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 28
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam soil Quantity: 20 Units: cy

DOT Hazard Class: none

Identification Number: none

Reportable Quantity: none

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-9

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: HARRY Johnston Truck No.: 26-85AD Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Johnston 4-4-90
Driver Signature Shipment Date

John Johnston 4-4-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-4-90

Print: Ken Heck

EAST Grid BETWEEN 375.650 / 375.800
North Grid BETWEEN 1557.25 / 1557.100 ELEV. 5519.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 3000
Address: Graves tx 77619
Phone: 409-962-8558

Job Name: Southern Union Gas
PO Box 290
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample - SOPS-9

Container(s): Trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP 86645CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell
Driver Signature

4-4-90
Shipment Date

Jody Mitchell
Driver Signature

4-4-90
Shipment Date

Received at: Red Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-4-90

EAST 6th BETWEEN 375650 / 375800
NORTH 6th BETWEEN 1557.25 / 1557.100 ELEVATION .13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
10 Box 2000
Address: Graves tx 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
10 Box 2450
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 19 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS-9

Container(s): trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-4-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Robert Scott Truck No.: 44-86AD Tag No./State: BP 40858 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-4-90
Driver Signature Shipment Date

Robert Scott 4-4-90
Driver Signature Shipment Date

Received at: Roi Rancho Sanitary Land Fill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-4-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 ELEV. 5579.13

204

NO: OP-104

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Groves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 0275B

Rep. Sample = SOPS-89

Container(s): Trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP Hobbs N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 4-5-90
Driver Signature Shipment Date

John Penick 4-5-90
Driver Signature Shipment Date

Received at: Rio Rancho SANTA FE

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Ewing
Date: 4-5-90

Print: Roy Ewing

east grid between 375,650 / 375,800 Elk
North grid between 1557,25 / 1557,100 -5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 7000
Address: Graves TX 77619
Phone: 5409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-346-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile = WMA 02758

Rep. Sample = SOPS-9

Container(s): trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Gus Garcia Truck No.: 19-80AA Tag No./State: AP 86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-5-90
Driver Signature Shipment Date

Gus Garcia 4/5/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-5-90

Print: Ken Heck

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 ELEV. 5579.

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
10 Box 2000
Address: Gravis TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
10 Box 2000
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # = WMA 02758

Rep. Sample = 505-9

Container(s): trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AD Tag No./State: BP-40857 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 4-5-90
Driver Signature Shipment Date

Fred Syfrett 4-5-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct;

Signed: Ken Heck
Date: 4-5-90

Print: KEN HECK

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 ELEV 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO Box 2000
Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: PO Box 980
Hobbs NM 88240
Phone: 505 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-10

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 262-1202 Tag No./State: PR19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-5-90
Driver Signature Shipment Date

Foy Smith 4-5-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-5-90

EAST GRID BETWEEN 375650 / 375800
NORTH GRID BETWEEN 1557.25 / 1557.100 ELEV. 5579.13

NO: OP-108

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
POITSOY 980
Address: HOBBS NM 88240
Phone: 505 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 19 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS 10

Container(s): trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: VIRGIL Stephens Truck No.: 203-7940 Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-5-90
Driver Signature Shipment Date

Virgil Stephens 4-5-90
Driver Signature Shipment Date

Received at: Rd 1 Rancho SANTIAGO LAND #11

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-5-90

EAST GRID BETWEEN 375650 / 375,800
WORTH 7 1/2 R. TUNNELL 1557.25 / 1557,100 ELEV 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO Box 2000
Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
Address: PO Box 980
Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-10

Container(s): trailer No: 1 Type: end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Harry Johnston 4-5-90
Driver Signature Shipment Date

Harry Johnston 4-5-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-5-90

Print: KEN HECK

EAST CURB BETWEEN 375.650 / 375.800
NO. 1 CURB BETWEEN 1557.25 / 1557.100 EKV 85719.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

SOPS-10 = rep. sample

Container(s): trailer No: 1 Type end Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP 40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

DAVID MEYERS
Driver Signature

4-5-90
Shipment Date

DAVID MEYERS
Driver Signature

4/5/90
Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-5-90

EAST GRID BETWEEN 375,650 / 375,800
NORTH GRID BETWEEN 1557,25 / 1557,100 KEN 5579.13

NO: 0P-111

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep sample = SOPS-10

Container(s): 1 trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law; is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: Robert Scott Truck No.: 44-86AD Tag No./State: BP 40858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-5-90
Driver Signature Shipment Date

Robert Scott 4-5-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4/5/90

East David Between 375.650 / 375.800

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 2000
Address: Graves TX 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 950
Address: Hobbs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: NONE

Reportable Quantity: None

Additional Description: Profile = WMA 02758

Rep Sample - SOPS 10

Container(s): trailer No: 1 Type end Pump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M.

Phone: 505-393-1010

Driver: Dennis Raines

Truck No.: 35-82AD

Tag No./State: AP86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-5-90
Driver Signature Shipment Date

Dennis Raines 4-5-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 4-5-90

EAST CURB BETWEEN 375.650 / 375.800
NORTH CURB BETWEEN 1557.25 / 1557.100 ELEV. 559.13

NO: OP-113

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box
Address: Graves # 77619
Phone: 409-962-8888

Job Name: Southern Union Gas
PO Box 480
Address: HoBBs NM 88240
Phone: 505-396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam soil Quantity: 20 Units: cy

DOT Hazard Class: NONE

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: Profile # WMA 02758

Rep Sample = SOPS 10

Container(s): trailer No: 1 Type: end Pump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP86645CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-5-90
Driver Signature Shipment Date

Jody Mitchell 4-5-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANTA ANA LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heek Print: Ken Heek

Date: 4-5-90

EAST GRID BETWEEN 375,650 / 375,900
NORTH GRID BETWEEN 155N.25 / 155N.100 2nd
CT 79.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2600 Groves TX 77619

Address: P.O. Box 980 Hobbs NM 88240

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS-10

Container(s): trailer No: 1 Type CY

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M.

Phone: 505-393-1010

Driver: Allen Hicks

Truck No.: 24-81AD

Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-5-90
Driver Signature Shipment Date

Allen Hicks 4-5-90
Driver Signature Shipment Date

Received at: Rio Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-5-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1551.25/1551.100 ELEV. 5519.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP 115
2540

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000
Graves TX 77619

Address: P.O. Box 980
Hobbs NM 88240

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WIMA 02758

Rep. Sample = SOPS-10

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, NM Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP 86648 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-5-90
Driver Signature Shipment Date

Scott Woznick 4/5/90
Driver Signature Shipment Date

Received at: Rio Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Bull

Print: Ken Bull

Date: 4-5-90

EAST GRID BETWEEN 375.650 / 375.800
NORTH GRID BETWEEN 1557.25 / 1557.100 Elev. 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
Graves TX 77619
Phone: (909) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Habbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CP

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Perfic # WMA 02758

Rep. Sample = 505-10

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-5-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Habbs, N.M. Phone: 505-393-1010

Driver: DALE CLOVER Truck No.: 28-73AD Tag No./State: BP-85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dale Clover 4-5-90
Driver Signature Shipment Date

Dale Clover 4-5-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-5-90

EAST GRID BETWEEN 375,650 / 375,800
NORTH GRID BETWEEN 1557,25 / 1557,100 CHK. 537A.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
Greaves TX 71619
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-8

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M.

Phone: 505-393-1010

Driver: John Penick

Truck No.: 204-1204

Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John V. Penick 4-6-90
Driver Signature Shipment Date

John V. Penick 4-6-90
Driver Signature Shipment Date

Received at: El Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HEED Print: KEN HEED

Date: 4-6-90

EAST GRID BETWEEN 375.650 / 375.800
NORTH GRID BETWEEN 1557.25 / 1557.100 ELEV 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 200
States TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-8

Container(s): 1 Trailer No: 1 Type end dump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 263-79AD Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-6-90
Driver Signature Shipment Date

Virgil Stephens 4-6-90
Driver Signature Shipment Date

Received at: Rio Rancho SANITARY Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-6-90

Print: Ken Heck

EAST GRID BETWEEN 375,650/375,800
NORTH GRID BETWEEN 1557,25/1557,100 ELEV 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000 Graves TX. 7749

Address: P.O. Box 980 Hobbs N.M. 88240

Phone: (409) 962-8888

Phone: (505) 356-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS-8

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs, N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1802 Tag No./State: PR 19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-6-90
Driver Signature Shipment Date

Foy Smith 4-6-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-6-90

EAST GRID BETWEEN 375.650 / 375.100
NORTH GRID BETWEEN 1557.25 / 1557.100 EPW. 5579.15

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas
P.O. Box 980

Address: P.O. Box 2000 Graves TX 77619

Address: Hobbs NM 88240

Phone: (409) 962-8888

Phone: (505) 376-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS 10

Container(s): trailer No: 1 Type: end dump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 43-77AA Tag No./State: BP 40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 4-6-90
Driver Signature Shipment Date

Fred Syrett 4-6-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-6-90

Print: KEN HECK

EAST GRID BETWEEN 375.650/375.800 ELEV. 5579.13
NORTH GRID BETWEEN 1557.25/1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: DP-121
2541

Generator: Southern Union Gas
Address: P.O. Box 2000 Graves Tx 77619
Phone: (409) 562-5888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: cy

DOT Hazard Class: none

Identification Number: none

Reportable Quantity: none

Additional Description: Profile # WMA 02758

Rep Sample = SOPS10

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: _____

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs, N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP-86648CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-6-90
Driver Signature Shipment Date

Scott Woznick 4/6/90
Driver Signature Shipment Date

Received at: RIO RANCHO Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 4-6-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100 ELEV. 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000 Graves TX 77619

Address: P.O. Box 980 Hobbs N.M. 88240

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 21 Units: CY

DOT Hazard Class: none

Identification Number: none

Reportable Quantity: none

Additional Description: Profile # WMA 02758

Rep sample = SOPS-10

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Duss
Generator Authorized Agent

Russel Duss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: Robert Scott Truck No.: 44-86AD Tag No./State: BP 40858CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-6-90
Driver Signature Shipment Date

Robert Scott 4-6-90
Driver Signature Shipment Date

Received at: Rei Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: Ken Heck

Date: 4-6-90

EAST GRID BETWEEN 375,650/375,800
NORTH GRID BETWEEN 1557,25/1557,100 ELEV. 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000 Graves TX 77619

Address: P.O. Box 980 Hobbs N.M. 88240

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = 5-OPS-11

Container(s): trailer No: 1 Type End Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP-40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers 4-6-90
Driver Signature Shipment Date

David Meyers 4/6/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heel

Print: KENHEEL

Date: 4-6-90

EAST GRID BETWEEN 375.650/375.800
NOTIFY GRID BETWEEN 1559.25/1559.100 ELEV 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000 Graves TX 77619

Address: P.O. Box 980 Hobbs N.M. 88240

Phone: (409) 962-5888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. sample = 5-0PS-11

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP 86645CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-6-90
Driver Signature Shipment Date

Jody Mitchell 4-6-90
Driver Signature Shipment Date

Received at: KPI RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct

Signed: Ken Heck

Print: Ken Heck

Date: 4-6-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 155A.25/155A.100 ELEV. 5579.15

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000 Graves TX 77619

Address: P.O. Box 980 Hobbs NM 88249

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep sample = S-025-11

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, NM Phone: 505-393-1010

Driver: Bill Brown Truck No.: 28-73AD Tag No./State: BP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William R Brown 4-6-90
Driver Signature Shipment Date

William R Brown 4-6-90
Driver Signature Shipment Date

Received at: Rio Rancho Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: KEN HECK

Date: 4-6-90

EAST SIDE BETWEEN 375.650 / 375.800 ELEV. 5579.13
NORTH SIDE BETWEEN 375.155 / 375.180

NO: OP-126

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000, Grants TX 77619

Address: P.O. Box 950 Hobbs NM 88240

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: NONE

Reportable Quantity: NONE

Additional Description: Profile # WMA 02758

Rep Sample = 5-OPS-11

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: HARRY Johnston Truck No.: 26-85AD Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Darry Johnston 4-6-90
Driver Signature Shipment Date

Darry Johnston 4-6-90
Driver Signature Shipment Date

Received at: Rio Rancho San Tom Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heel Print: KEN HEEL

Date: 4-6-90

EAST GRID BETWEEN 375.650 / 375.810
NORTH GRID BETWEEN 1527.117 / 1527.117 Elev. 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
²⁰⁰⁰
Address: P.O. Box Graves Tx 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS 11

Container(s): trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Allen Hicks Truck No.: 24-81AA Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-6-90
Driver Signature Shipment Date

Allen Hicks 4-6-90
Driver Signature Shipment Date

Received at: _____

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-6-90

SASTARD BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100
ELEV. 5559.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Cantam soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 027.58

Rep sample = S OPS-11

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss 4-6-90
Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1000

Driver: Joe Dolan Truck No.: 19-80AD Tag No./State: AP 86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Joe Dolan 4-6-90
Driver Signature Shipment Date

Joe Dolan
Driver Signature Shipment Date

Received at: Rio Arriba Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-6-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.05/1557.100 ELEV. 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Grauss Tx 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS-11

Container(s): Trailer No: 1 Type and dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-6-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs, N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AD Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-6-90
Driver Signature Shipment Date

Dennis Raines 4-6-90
Driver Signature Shipment Date

Received at: RA: RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 4-6-90

EAST GRID BETWEEN 375.650 / 375.800 ELEV. 5579.13
North Grid BETWEEN 1557.25 / 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = SOPS-11

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAA TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 203-7911 Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-9-90
Driver Signature Shipment Date

Virgil Stephens 4-9-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-9-90

Print: Ken Heck

EAST SIDE BETWEEN 375.650/375.800
NORTH SIDE BETWEEN 1557.25/1557.100 ELEV. 5579.13

NO: 0132

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAND TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contaminated Soil Quantity: 21 Units: CP

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = 5-OPS-11

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contain hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1202 Tag No./State: PR19268 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-9-90
Driver Signature Shipment Date

Foy Smith 4-9-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: [Signature]

Date: 4-9-90

SECTION BETWEEN 3751657 / 3751820
ELEV

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 3000
Address: Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = S-025-11

Container(s): trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: A-80AD Tag No./State: AP 86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-9-90
Driver Signature Shipment Date

Gus Garcia 4/9/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: KENT HEER

te: 4-9-90
ST. 6110 BETWEEN 375.650/375.800
ELEV. 5519.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-11

Container(s): Trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-9-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AD Tag No./State: BP-40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 4-9-90 Fred Syfrett 4-9-90
Driver Signature Shipment Date Driver Signature Shipment Date

Received at: Rio Rancho SANITARY LAB

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: [Signature] Print: KEN HECK

Date: 4-9-90

EAST GRID BETWEEN 375.650 / 375.800
NORTH GRID BETWEEN 1557.25 / 1557.100 ELEV 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO. Box 2000
GRIZZIES TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: ~~Reportable~~ None

Additional Description: ~~Reportable~~ = Profile # WMA 02758

Rep Sample = S-OPS-11

Container(s): Trailer No: 1 Type End dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent
Russel Buss Signature
4-9-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Robert Scott Truck No.: 44-86AD Tag No./State: BP 40858 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott Driver Signature
4-9-90 Shipment Date
Robert Scott Driver Signature
4/9/90 Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK Print: KEN HECK
Date: 4-9-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.05/1557.100 219V 5519.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX 77619
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M. 88240
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: None

Reportable Quantity: None

Additional Description: Profile # WMA 02758

Rep Sample = S-005-15

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP-86649 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 4-9-90
Driver Signature Shipment Date

[Signature] 4-9-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: [Signature]

Date: 4-9-90

EAST CURB BETWEEN 375.650 / 375.800
NOTHING BETWEEN 1557.25 / 1557.100 STEN. 5579.13

NO: 02-137

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
62203 TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hebbs LA
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Cantam. Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: NA

Reportable Quantity: NA

Additional Description: Profile # 411A 02758

Rep. Sample = 5-025-15

Container(s): Trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hebbs N.M. Phone: 505-393-1010

Driver: Allen Hicks Truck No.: 24-81AD Tag No./State: BP 46858 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-9-90
Driver Signature Shipment Date

Allen M. Hicks 4-9-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 4-9-90

EAST END BETWEEN 375.60/375.800 9/15/5519.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRANDES TR
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-005-15

Container(s): Trailer No: 1 Type: endump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, NM. Phone: _____

Driver: DAVID MEYERS Truck No.: 42-78AA Tag No./State: BP-40856 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

DAVID MEYERS 4-9-90
Driver Signature Shipment Date

DAVID MEYERS 4-9-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 4-9-90

EAST GRID BETWEEN 375.650/375.800
115016 BETWEEN 115011 AND 115011.110 ELEV 115011.12

NO: OP-140

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRANDES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 480
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = S005-K

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAN TRUCKING

Address: 506 N. Shipp Hobbs, N.M Phone: 505-393-1010

Driver: Bill Brown Truck No.: 28-73AD Tag No./State: BP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William R Brown 4-9-90
Driver Signature Shipment Date

William R Brown 4-9-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heek

Print: Kent Heek

Date: 4-9-90

EAST GRID BETWEEN 375.650/375.800 9.11.5519 B

NO: OP-191

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 990
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CF

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-15

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AD Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-9-90
Driver Signature Shipment Date

Dennis Raines 4-9-90
Driver Signature Shipment Date

Received at: RID RAINING SANITARY LABS

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-9-90

FAST COPY BETWEEN 275.650 / 375.100 92/CC1913

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5721

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = 5-ops-15

Container(s): trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP-86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-9-90
Driver Signature Shipment Date

Jody Mitchell 4-9-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heek Print: Kent Heek

Date: 4-9-90

EAST CORNER BETWEEN 3751 650 / 3751 800
9 APR 1990

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 462-5888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 394-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-005-15

Container(s): Trailer No: 1 Type: enddump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-9-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 1926 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 4-10-90
Driver Signature Shipment Date

John Penick 4-10-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-10-90

Print: Ken Heck
EKU 5579.13

EAST GRID BETWEEN 375.650/375.800 -
NORTH GRID BETWEEN 1557.25/1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-15

Container(s): TRAILER No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, NM Phone: 505-393-1010

Driver: Gus Garcia Truck No.: 19-80AA Tag No./State: AP 86643 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-10-90
Driver Signature Shipment Date

Gus Garcia 4/10/90
Driver Signature Shipment Date

Received at: Rio Rancho SANTA ANA LANDfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 4-10-90

EFW. 5579.13

EAST END BETWEEN 3751050/3751800
INITIAL GR: b BETWEEN 1557025/1557100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: PO. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: PO. Box 990
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 18 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = S-OPS-15

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Robert Scott Truck No.: 44-86AD Tag No./State: BP-40858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-10-90
Driver Signature Shipment Date

Robert Scott 4-10-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-10-90

Print: Ken Heck
EVEN. 5579.13

EAST GRID BETWEEN 3751650 / 3751800
NORTH GRID BETWEEN 1557125 / 1557100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO Box 200
Address: GRAVES TX
Phone: (409) 962-5888

Job Name: Southern Union Gas
PO Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = SPPS-5

Container(s): TRAILER No: 1 Type: land dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1002 Tag No./State: PR19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-10-90
Driver Signature Shipment Date

Foy Smith 4-10-90
Driver Signature Shipment Date

Received at: Red Hawk Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 6-10-90

ELV. 5579.13

EAST COILED BETWEEN 375-650/375-800
11000 TH CANON NE JINNS AT 155 N. 25 / 155 N. 100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
PO. Box 200
Address: FRANKS TX
Phone: 14091 962-8888

Job Name: Southern Union Gas
PO. Box 980
Address: Hobbs NM
Phone: 15051 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 1 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = S-OPS-15

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-10-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 203-791A Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-10-90 Virgil Stephens 4-10-90
Driver Signature Shipment Date Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: KEN HECK

Date: 4/10/90 EJEN 557913

EAST GRIB BETWEEN 375.650/375.800

NOTED (C) BETWEEN 1557.25/1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAND TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 346-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = SOPS-15

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AD Tag No./State: BP 40857 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 4-10-90
Driver Signature Shipment Date

Fred Syfrett 4-10-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Hark

Print: Ken Hark

Date: 4-10-90

2/EU-5579.13

EAST GRID BETWEEN 375.650/375.800
North Grid BETWEEN 155A-25/155A-100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000
GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: cy

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-15

Container(s): Trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs, N.M. Phone: 505-393-1010

Driver: Allen Hicks Truck No.: 24-81AD Tag No./State: BP 46858 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-10-90
Driver Signature Shipment Date

Allen Hicks 4-10-90
Driver Signature Shipment Date

Received at: RIO BONCHO ANTIPOY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEV FELL
Date: 4-10-90

Print: KEV FELL
ELIEN 5579, B

EAST SIDE BETWEEN 375.650/375.800
NORTH SIDE BETWEEN 1557.05/1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: 00-150
2543

Generator: Southern Union Gas Job Name: Southern Union Gas
P.O. Box 2000 P.O. Box 990
Address: GRAND TX Address: Hobbs NM
Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep. Sample = S-OPS-15

Container(s): TRAILER No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AA Tag No./State: AP-86648CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-10-90
Driver Signature Shipment Date

Scott Woznick 4/10/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-10-90

2/EK 5579.13

EAST CURB BETWEEN 375.650 / 375.800

North (curb) BETWEEN 1557.25 / 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union 625
Address: P.O. Box 2000
GRAVUS TX
Phone: (409) 962-8484

Job Name: Southern Union 625
Address: Pa Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 0275B

Rep Sample = 5-OPS-14

Container(s): trailer No: 1 Type landump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP40856 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

DAVID
Driver Signature 4-10-90
Shipment Date

DAVID
Driver Signature 4/10/90
Shipment Date

Received at: POI RAVEN SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-10-90

Print: Ken Heck
ETU. 5579.13

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1559.25/1559.100

#21

NO: OP-152

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union 625
Address: P.O. Box 2000
GRANDES TX
Phone: (409) 962-8888

Job Name: Southern Union 625
Address: P.O. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 21 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = SOPS-14

Container(s): trailer No: 1 Type: end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss 4-10-90
Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74A0 Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-10-90
Driver/Signature Shipment Date

Jody Mitchell 4-11-90
Driver/Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-11-90

East Grid between 375.650/375.800
North Grid between 1557.25/1557.100 Elev 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: Po. Box 2000
68405 TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: Po. Box 980
Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 12758

Repe. Sample = S-OPS-A

Container(s): Trailer No: 1 Type: end dump

Special Handling Instructions: contain hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AA Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-10-90
Driver Signature Shipment Date

Dennis Raines 4-10-90
Driver Signature Shipment Date

Received at: RIO HANVEDO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-10-90

Print: Ken Heck
ELER 5579.13

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100

NO: OP-154

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-14

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: HARRY Johnston Truck No.: 26-85AA Tag No./State: AP 86649

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Harry Johnston 4-10-90
Driver Signature Shipment Date

Harry Johnston 4-10-90
Driver Signature Shipment Date

Received at: RIO PALMO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-10-90

ELEV 5579.13

EAST GRID BETWEEN 375.650/375.800

NO: OP-155

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: GRAVY TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
P.O. Box 480
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS 14

Container(s): Trailer No: 1 Type enddump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-10-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M Phone: 505-393-1010

Driver: BILL BROWN Truck No.: 28-73AA Tag No./State: BP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William R Brown 4-10-90
Driver Signature Shipment Date

William R Brown 4-10-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-10-90

EVEN 5579.13

SAST GROUP BETWEEN 375#650/375#800

NO: OP-156

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
P.O. Box 2000
Address: Graves TX
Phone: (409) 962-9888

Job Name: Southern Union Gas
P.O. Box 980
Address: Hobbs NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample = S-OPS-1A

Container(s): Trailer No: 1 Type end dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4/11/90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 4-11-90
Driver Signature Shipment Date

John Penick 4-11-90
Driver Signature Shipment Date

Received at: Rt 1400 SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: JEN Heck

Print: JEN HECK

Date: 4-11-90

EKEN 5579.13

EAST SIDE BETWEEN 375.650/375.800
11-11-90

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
 Address: P.O. Box 2000, GRAVES, TX. Address: P.O. Box 980, Hobbs, N.M.
 Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY
 DOT Hazard Class: NONE
 Identification Number: N/A
 Reportable Quantity: N/A
 Additional Description: PROFILE # WMA 02758

REP. SAMPLE = S-OPS-14

Container(s): TRAILER No.: 1 Type: END DUMP.

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

RUSSEL BUSS Russel Burr 4-11-90
 Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AD Tag No./State: AP 86643 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-11-90 Gus Garcia 4/11/90
 Driver Signature Shipment Date Driver Signature Delivery Date

Received at: ROL RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-2-90

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 155N.25/155N.100
 WASTE GENERATOR CARABZ TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT
5579.B

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: DP-158

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES TX,
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980 Hobbs, N.M.,
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE = S-OPS-14

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-11-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 43-77AD Tag No./State: BP 40857CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 4-11-90
Driver Signature Shipment Date

Fred Syrett 4-11-90
Driver Signature Delivery Date

Received at: RIO FAUCO SANITARY LANDFILL

I hereby certify that the above named material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heck Print: Kent Heck

Date: 4-11-90 EW 5579.13

WAST ORED BETWEEN 375.65/375.800
NORTH END BETWEEN 1557.25/1557.100
WHITE GENERATOR CANOPY TRANSPORTER BINTZ LANDFILL GOLD GOVERNMENT

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000 GUNES TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980 HOBBS N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PICKUP # WMA 02758

REP. SAMPLE = S-OPS-14

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-11-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1202 Tag No./State: PR19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-11-90
Driver Signature Shipment Date

Foy Smith 4-11-90
Driver Signature Delivery Date

Received at: RO RANCHO SANTANA LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-11-90 2KEN-5529.13

EAST SIDE BETWEEN 3751.650/3751.800
NORTH SIDE BETWEEN 1557.25/1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP-160

(160)

Generator: Southern Union GWS
Address: P.O. Box 2000 Grants, TX
Phone: (409) 962-8888

Job Name: Southern Union GWS
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFICE # WMA 02758

REP. SAMPLE 1 = 5-OPS-14

Container(s): TRAILER No.: 1 Type: SUD Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-11-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 203-79AA Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-11-90 Virgil Stephens 4-11-90
Driver Signature Shipment Date Driver Signature Delivery Date

Received at: RID KANEN SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: JEN HECK

Date: 4-11-90 ELEV 5529.13

EAST END BETWEEN 375,650 / 375,800

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP-161

TP # 0544

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000 GUNES, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980 HOBBS, NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROVIDE # WMA 02758

REP. SAMPLE # = S-OPS-13

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

KUSSEL BUSS Generator Authorized Agent
Arnosel Buss Signature
4-11-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AD Tag No./State: AP 86648CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick Driver Signature
4-11-90 Shipment Date

Scott Woznick Driver Signature
4/11/90 Delivery Date

Received at: RD KAVOCHO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK Print: KEN HECK

Date: 4-11-90
EAST COULD BE TOWEN 375/600 / 375 / 800 ELEV. 5500
5579.13

NO: OP-162

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVET, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980 HORRIS, NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFICE # WMA 02758

REP. SAMPLE: = S-OPS-13

Container(s): TRAILER No.: _____ Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Guss
Generator Authorized Agent

Russel Guss
Signature

4-11-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AQ Tag No./State: RP40856 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers
Driver Signature

4-11-90
Shipment Date

David Meyers
Driver Signature

4/11/90
Delivery Date

Received at: PO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-11-90

EAST GRID BETWEEN 375.650/375.800 E/EN 5519.13

NO: OP-163

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS Job Name: SOUTHERN UNION GAS
 Address: P.O. Box 2000 GRAYES, TX Address: P.O. Box 980 HOBBS N.M.
 Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: NA

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE: S-OPS-13

Container(s): TRAILER No.: _____ Type: END DUMP

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-11-90
 Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP HOBBS N.M. Phone: 505-393-1010

Driver: ALLEN HICKS Truck No.: 24-81AA Tag No./State: BP 46858CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-11-90 Allen Hicks 4-11-90
 Driver Signature Shipment Date Driver Signature Delivery Date

Received at: POI RANCHO SANT ANTONIO

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: [Signature]

Date: 4-11-90 GEN. 5579.13

EAST SIDE BETWEEN 375.65 / 375.000
NORTH SIDE BETWEEN 1557.25 / 1557.180
 WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS Job Name: SOUTHERN UNION GAS
 Address: P.O. BOX 2000, GAINES, TX. Address: P.O. BOX 980, HOBBS N.M.
 Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOL Quantity: 20 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 0275B

REG. SAMPLE = SOPS-13

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-11-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: DENNIS RAINES Truck No.: 35-82AD Tag No./State: AP 86654CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-11-90
Driver Signature Shipment Date

Dennis Raines 4-11-90
Driver Signature Delivery Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-11-90 ELEV. 55 M.B

EAST SIDE BETWEEN 375.600 / 375.800
 (NOTE) GROUND BETWEEN 1557.25 / 1557.100
 WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS Job Name: SOUTHERN UNION GAS
 Address: P.O. BOX 2000 GUNES TX. Address: P.O. BOX 980, HOBBS, N.M.
 Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIC Quantity: 20 Units: cy
 DOT Hazard Class: NONE
 Identification Number: N/A
 Reportable Quantity: N/A
 Additional Description: PROFICE # WMA 02758
REP. SAMPLE = SOPS-13
 Container(s): TRAILER No.: 1 Type: END Dump
 Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-11-90
 Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING
 Address: 506 N. SHIPA Hobbs Phone: 505-393-1010
 Driver: BILL BROWN Truck No.: 28-73AD Tag No./State: BP85316CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William Brown 4-11-90 William Brown 4-11-90
 Driver Signature Shipment Date Driver Signature Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross
 Date: 4-11-90

East Grid between 357.651 / 375.800 Elev 5579.13
 North Grid between 1557.25 / 1557.100

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
 Address: P.O. Box 2000 Graves, Tx Address: P.O. Box 980 Hobbs N.M.
 Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED Soil Quantity: 20 Units: Cy.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE = S-OP-5 13

Container(s): TRAILER No.: 1 Type: END Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-11-90
Shipment Date

Transporter: JAN TRUCKING

Address: 506 N. SHIPPA Hobbs N.M. Phone: 505-393-1010

Driver: HARRY Johnston Truck No.: 26-85AA Tag No./State: AP-86649 CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Harry Johnston 4-11-90
Driver Signature Shipment Date

Harry Johnston 4-11-90
Driver Signature Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: ERNIE ROSS

Date: 4-11-90

East Grid between 357.651/375.800 Elev 5579.13
North Grid between 1557.25/1557.100

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: Southern Union Gas Job Name: Southern Union Gas
Address: P.O. Box 2000, Gaines, TX Address: P.O. Box 980 Hobbs N.M.
Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY
DOT Hazard Class: NONE
Identification Number: N/A
Reportable Quantity: N/A
Additional Description: PROFILE# WMA 02758

REP SAMPLE = S-025-13
Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-11-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING
Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010
Driver: Robert Scott Truck No.: 44-86AD Tag No./State: RP 40858 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-11-90
Driver Signature Shipment Date

Robert Scott 4-11-90
Driver Signature Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-11-90
East Grid between 375.650/375.800 Elev 5579.1
North Grid between 1557.25/1557.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 BEAVER, TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs, NM
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE: S-OPS 13

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

KUSSEL BUSS Kussel Buss 4-12-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs, N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 4-12-90
Driver Signature Shipment Date

John Penick 4-12-90
Driver Signature Delivery Date

Received at: Api Koncho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-12-90

EAST GRID BETWEEN 375.650 / 375.800

WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT
NOTED GRID BETWEEN 1557.25 / 1557.100

NO: OP-169

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. BOX 2000, GRAVES, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. BOX 980 HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE: 5-OPS 13

Container(s): TRAILER No.: 1 Type: END DUMP.

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-12-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP Hobbs N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AA Tag No./State: AP 86643CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-12-90 Gus Garcia 4/12/90
Driver Signature Shipment Date Driver Signature Delivery Date

Received at: Poi Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-12-90

EAST END BETWEEN 375.650/375.800 ELEV 5519.13
NORTH END BETWEEN 1557.25/1557.100

NO: 0P170

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. BOX 2000 GRAVES, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. BOX 980 HOBBS, NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: cy
DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE: 5-OPS-13

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

KUSSEL BUSS Kussel Buss 4-12-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: GUS GARCIA Fred Syrett Truck No.: ~~9884~~ 43-77AD Tag No./State: ~~AR 43-42 CA~~ BP-408576

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 4-12-90
Driver Signature Shipment Date

Fred Syrett 4-12-90
Driver Signature Delivery Date

Received at: Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-12-90

Print: KEN HECK
EJEU 5579.13

EAST SIDE BETWEEN 375.650/375.800
NORTH SIDE BETWEEN 1557.25/1557.100

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 GRAVES TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED Soil Quantity: 19 Units: CU.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE = 5-OPS-13

Container(s): TRAILER No.: 1 Type: END DUMP.

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-12-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1202 Tag No./State: PR 19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-12-90
Driver Signature Shipment Date

Foy Smith 4-12-90
Driver Signature Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-12-90 Dev 5579.13

East Grid Between 375.650 / 375.800
North Grid Between 1555.25 / 1557.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: Southern Union Gas
Address: P.O. Box 2000, GRAVES, TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE: 5-OPS-12

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-12-90
Shipment Date

Transporter: JAA TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 203-79AD Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-12-90
Driver Signature Shipment Date

Virgil Stephens 4-12-90
Driver Signature Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross
Elev 5579.13

Date: 4-12-90

East Grid Between 375.650 / 375.800
North Grid Between 1557.25 / 1557.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NO: OP-173

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. BOX 2000 GRAVES TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. BOX 980 HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 18 Units: CU

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE: S-OPS-12

Container(s): TRUCKER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-12-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: ALLEN HICKS Truck No.: 24-81AD Tag No./State: BP 46858

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-12-90
Driver Signature Shipment Date

Allen Hicks 4-12-90
Driver Signature Delivery Date

Received at: San Ramon Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-12-90 ELEV 5579.13

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 GRAVES TX.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: cy.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE# WMA 02758

Rep. Sample: S-OPS-12

Container(s): TRAILER No.: 1 Type: END Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-12-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs, N.M. Phone: 505-393-7010

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP86649 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Danny Johnson
Driver Signature 4-12-90
Shipment Date

Danny Johnson
Driver Signature 4-12-90
Delivery Date

Received at: Mr. Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 4-12-90

ELEV. 5579.13

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: Southern Union Gas
Address: P.O. Box 2000 GRABBS, TX.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REF. SAMPLE: 5-OPS-12

Container(s): TRAILER No.: 1 Type: END Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-12-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AA Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell
Driver Signature 4-12-90
Shipment Date

Jody Mitchell
Driver Signature 4-12-90
Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross
Elev 5579.13

Date: 4-12-90

East Grid between 375.650 / 375.800
North Grid between 1557.25 / 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP-176
T# 2545

Generator: Southern Union Gas Job Name: Southern Union Gas
Address: P.O. Box 2000, GRAVES, TX. Address: P.O. Box 980 Hobbs, N.M.
Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE# WMA 02758

REP. SAMPLE: WMA 02758 5-OPS-12

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 4-12-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AA Tag No./State: AP 86648CA.

I hereby certify that the above named material was picked up at the generator site listed above.

Scott Woznick Driver Signature 4-12-90 Shipment Date

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick Driver Signature 4/12/90 Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-12-90 Elev 5529.13

East Grid between 375.650 / 375.800

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000 GRAVES TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980 HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: _____ Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 0275B

REP SAMPLE: 5-OPS-12

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss _____ Russel Buss _____ 4-12-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: Bill Brown Truck No.: 28-73AD Tag No./State: BP 85316 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

William R Brown _____ 4-12-90 _____ William R Brown _____ 4-12-90
Driver Signature Shipment Date Driver Signature Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross _____ Print: Ernie Ross _____

Date: 4-12-90 _____ Elevation 5579.13

East Grid between 375,650 / 375,800
North Grid between 15557.25 / 1557.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

421

NO: OP 178

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, Gaines TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980 HUBBARD, N.M.
Phone: (505) 396-5521

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02750

REP SAMPLE: 5-0P5-12

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBON

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-12-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP Phone: 505-393-1010

Driver: Robert Scott Truck No.: 44-86AA Tag No./State: BP40858 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-12-90
Driver Signature Shipment Date

Robert Scott 4-12-90
Driver Signature Delivery Date

Received at: Roi Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heak
Date: 4-12-90

Print: Ken Heak
EEU-5579.13

EAST GRID BETWEEN 375.650/375.800
NORTH GRID BETWEEN 1557.25/1557.100

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: Southern Union Gas
Address: P.O. Box 2000 GRAVES, TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs, NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: ~~CONTAMINATED~~ CONTAMINATED SOIL Quantity: 20 Units: cy.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE# WMA 12758
REP SAMPLE. 5-ORS-12.

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 4-12-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS, N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP 40856 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

David Meyers Driver Signature 4-12-90 Shipment Date

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers Driver Signature 4/12/90 Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross Print: Ernie Ross

Date: 4-12-90 Elev 5579.13

East end between 375.650 / 375.800
1557 75 1557 00

NO: DP180

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
 Address: P.O. Box 2000 GRAVES, TX Address: P.O. Box 980 HOSAS, N.M.
 Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: cf

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02750

REP. SAMPLE:

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-12-90
 Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs, N.M. Phone: 505-393-1010

Driver: Dennis Raines Truck No.: 35-82AD Tag No./State: AP 86654CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-12-90
 Driver Signature Shipment Date

Dennis Raines 4-12-90
 Driver Signature Delivery Date

Received at: POI Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-12-90 ELEV 5579.13

EAST GRID BETWEEN 375.650 / 375.800

NORTH GRID BETWEEN 1550.25 / 1550.100

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 GRAVES, TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 21 Units: CY.

DOT Hazard Class: NONE.

Identification Number: N/A.

Reportable Quantity: N/A.

Additional Description: PROFILE # RMA 0275B

REP SAMPLE: 5-OPS-12

Container(s): TRAILER No.: 1 Type: END Dump

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-16-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AA Tag No./State: AP-86649 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 4-16-90
Driver Signature Shipment Date

[Signature] 4-16-90
Driver Signature Delivery Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Den Heek

Date: 4-16-90

ETD 5519.13

EAST SIDE BETWEEN 375.500/375.600
NORTH SIDE BETWEEN 1557.25/1557.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
 Address: P.O. Box 2000 Graves, TX Address: P.O. Box 980 Hobbs N.M.
 Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 22 Units: cy
 DOT Hazard Class: NONE
 Identification Number: N/A
 Reportable Quantity: N/A
 Additional Description: PROFILE # WMA 0278
REP. SAMPLE: 5-OPS-12
 Container(s): TRAILER No.: 1 Type: END DUMP
 Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-16-90
 Generator Authorized Agent Signature Shipment Date

Transporter: TAN TRUCKING
 Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010
 Driver: Bill Brown Truck No.: 28-73AD Tag No./State: AP85316CA

I hereby certify that the above named material was picked up at the generator site listed above.

William Brown 4-16-90
 Driver Signature Shipment Date

I hereby certify that the above named material was delivered without incident to the destination listed below.

William Brown 4/16/90
 Driver Signature Delivery Date

Received at: R.O. Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: KEN HECK

Date: 4-16-90 2KEN-5579.13

EAST GRID BETWEEN 375.570/375.650
 NORTH GRID BETWEEN 1557.75/1557.100

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 18 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep. Sample - S-OPS-16

Container(s): TRAILER 1 No.: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-18-90
~~4-18-90~~
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: DAVID MEYERS Truck No.: 42-78AD Tag No./State: BP 40856 CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

DAVID
Driver Signature

4-18-90
Shipment Date

DAVID
Driver Signature

4/18/90
Delivery Date

Received at: PINO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 4-18-90 E14W 5579.13

EAST SIDE BETWEEN 375.500/375.650
DON'T GO BETWEEN 155N.25/155N.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NO: OP-187

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN Union GAS
Address: P.O. Box 2000, GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN Union GAS.
Address: P.O. Box 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep. Sample - S-OPS-16

Container(s): TRAILER No.: 1 Type: END Dump

Special Handling Instructions: CONTAINS HYDROCARBON

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-18-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PR 19266 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick 4-18-90
Driver Signature Shipment Date

John Penick 4-18-90
Driver Signature Delivery Date

Received at: PO FANUO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-18-90

Print: Ken Heck
E/EV. 5579.13

EAST SIDE BETWEEN 375.500/375.650
NORTH " " 1557.25/1557.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NO: OP-185

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep. Sample - SOPS-16

Container(s): TRAILER 1 No.: 1 Type: END Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent
Russel Buss Signature
4-18-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: GUS GARCIA Truck No.: 19-80AD Tag No./State: AP86643CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia Driver Signature
4-18-90 Shipment Date

Gus Garcia Driver Signature
4/18/90 Delivery Date

Received at: RIO HANCO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: KEN HECK

Date: 4-18-90 EVEN 5579.13

EAST SIDE BETWEEN 375-500 / 375-650
NORTH " " 1557-25 / 1557-100
WHITE GENERATOR CANARY TRANSPORTED ONLY LANDFILL GOLD GOVERNMENT

NO: OP-186

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, Graves, Tx.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: NOT CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Prox # WMA - 02758

Rep Sample - S-OPS-16

Container(s): TRAILER 1 No.: 1 Type: END Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-18-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPPA Hobbs N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1202 Tag No./State: PR19268 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-18-90
Driver Signature Shipment Date

Foy Smith 4-18-90
Driver Signature Delivery Date

Received at: RIO RANCHO SANTA FE LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct

Signed: JEN HECK

Print: JEN HECK

Date: 4-18-90

ELVE 5579.13

EAST GRID BETWEEN 375.570/375.650
1557.25 / 1557.100

NO: CP187

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 Graves, Tx.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs, NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample - S-OAS-16

Container(s): TRAILER 1 No.: 1 Type: End Dump

Special Handling Instructions: Contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 4-18-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP Hobbs N.M. Phone: 505-393-1010

Driver: VIRGIL STEPHENS Truck No.: 203-79AD Tag No./State: PR 19267 N.M.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens Driver Signature 4-18-90 Shipment Date

Virgil Stephens Driver Signature 4-18-90 Delivery Date

Received at: RIO GRANDE SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heel Print: Kent Heel

Date: 4-18-90 Elev: 5599.13

EAST BRIDGE BETWEEN 375.500/375.650
NORTH " " 1557.25/1557.100

NO: OR188

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, HOBBS N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATE SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02288

Rep. Sample - S-OPS-16

Container(s): TRUCKER 1 No.: 1 Type: End Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-18-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-77AD Tag No./State: RP-40857CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 4-18-90
Driver Signature Shipment Date

Fred Syfrett 4-18-90
Driver Signature Delivery Date

Received at: RIO RANCHO SANITARY LAB #11

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kel Heck

Print: Kel Heck

Date: 4-18-90 EKV. 5579.13

EAST END BETWEEN 375.500/375.650
NOTED " " " 1557-25/1557-100

NO: 02-189

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, GRAVES, TX.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep Sample: S-OPS-16

Container(s): TRAILER 1 No.: 1 Type: END Dumps

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-18-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: ALLEN HICKS Truck No.: 24-81AD Tag No./State: BP 46858 CA

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-18-90
Driver Signature Shipment Date

Allen Hicks 4-18-90
Driver Signature Delivery Date

Received at: RIO RANCHO SANTA TRAM LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Den Heck

Print: DEN HECK

Date: 4-18-90

ELEV 5579.13

EAST GRID BETWEEN 375.500 / 375.650
NORTH GRID BETWEEN 1557.25 / 1557.100
WHITE - GENERATOR CANARY - TRANSPORTER PINK - LANDFILL GOLD - GOVERNMENT

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP-190
Tp # 2549

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES, Tx.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROJICE # WMA 02758

Rep. Sample - S-OPS - 1A

Container(s): TRAILER 1 No.: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-18-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAA TRUCKING

Address: 506 N. SHIPPA Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-84AA Tag No./State: AP8648 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-18-90 Scott Woznick 4/18/90
Driver Signature Shipment Date Driver Signature Delivery Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Hark Print: Ken Hark

Date: 4-18-90 ELEV 5579.13

EAST MID BETWEEN 375-500/375650
NORTH " " 1557.25/1557.100

NO: OP-191

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. BOX 2000 GRAVES, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. BOX 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFICE # WMA 02758

Rep. Sample - S-OPS-16

Container(s): TRAILER 1 No.: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

RUSSEL BUSS Generator Authorized Agent Russel Buss Signature 4-18-90 Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP HOBBS N.M. Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP 86654 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell Driver Signature 4-18-90 Shipment Date Jody Mitchell Driver Signature Delivery Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heel Print: Ken Heel

Date: 4-18-90 EK15579.13

EAST GR12 BETWEEN 375.500/375.650
157th " " 157th.25-1157th.160

NO: 09192

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep Sample: S-OPS-16

Container(s): TRAILER 1 No.: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-18-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: Dennis Cosby Truck No.: 34-55A Tag No./State: 3211 UT.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Cosby 4-18-90
Driver Signature Shipment Date

Dennis Cosby 4-18-90
Driver Signature Delivery Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above named material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Hill

Print: Ken Hill

Date: 4-18-90

EEV 5579.13

EAST END BETWEEN 375.00/375.650
NORTH " " 1557.25/1557.100

NO: 02193

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. BOX 2000 GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE = S-OPS-16

Container(s): TRAILER 1 No.: 1 Type: END PUMP

Special Handling Instructions: Contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-18-90
~~4-18-90~~
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHAW Hobbs N.M. Phone: 505-393-1010

Driver: Robert Hawkins Truck No.: 43-83AD Tag No./State: 014814 UT.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Hawkins 4-18-90
Driver Signature Shipment Date

Robert Hawkins 4-18-90
Driver Signature Delivery Date

Received at: P.O. Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-18-90
EAST GRID BETWEEN 375-500/375-650
1MATA " " 557-25/557-100

ETED-5579.13

NO: 02-194
~~02-168~~

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. BOX 2000, GRAVES TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. BOX 980 HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE : S-OPS-17

Container(s): TRAILER No.: 1 Type: END DUMP

Special Handling Instructions: contains hydrocarbon

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

RUSSEL BUSS Russel Buss 4-18-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIPP Hobbs N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-85AD Tag No./State: AP 86649 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

[Signature] 4-18-90 [Signature] 4-18-90
Driver Signature Shipment Date Driver Signature Delivery Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above named material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: [Signature]

Date: 4-18-90 EVEN 5579.13

EAST END BETWEEN 375.500 / 375.650
LENGTH 11 1557.25 / 1557.100

OP-195
NO: ~~666~~

NONHAZARDOUS SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, Graves, Tx.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs, Tx. M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: cy.

DOT Hazard Class: NONE

Identification Number: NA

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample: ~~XXXXXX~~ S-025-17

Container(s): TRAILER - 1 No.: 1 Type: END Dump.

Special Handling Instructions: CONTAINS ZINC CHROMATE

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

18
4-18-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N SHIP HOBBS N.M. Phone: 505-393-1010

Driver: ~~Phil Brown~~ Rob Scott Truck No.: ~~39-7543~~ 44-8640 Tag No./State: ~~BP-8536~~ BP 40858 CA.

I hereby certify that the above named material was picked up at the generator site listed above.

Robert Scott
Driver Signature
4-18-90
Shipment Date

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott
Driver Signature
4/18/90
Delivery Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above named material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-18-90

Print: Ken Heck
ETED. 5579.13

EAST 6TH BETWEEN 375.500/375.650
NORTH " " 1557.25/1557.100

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES TX
Phone: (409) 962-8888

Job Name: SOUTHERN Union Gas
Address: P.O. Box 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep Sample: ~~SECT 27~~ S-OPS-18

Container(s): TRAILER -1 No.: _____ Type: END DUMP.

Special Handling Instructions: CONTAINS ~~2000~~ ~~CHLORINATED~~ HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD TRUCKING

Address: 506 N. SHIP HOBBS N.M. Phone: 505-393-1010

Driver: ~~HARRY J. JOHNSON~~ Dennis Raines Truck No.: ~~26-0540~~ 35-8240 Tag No./State: ~~AA6649CA~~ AP866542A

I hereby certify that the above named material was picked up at the generator site listed above.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Raines 4-19-90
Driver Signature Shipment Date

Dennis Raines 4-19-90
Driver Signature Delivery Date

Received at: RIO HANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Den Heck
4-19-90
Date:

Print: Den Heck
EV05557.13

amb BETWEEN 375.570/375.650
11 1557.25/1557.100

NO: 0197

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas
Address: P.O. Box 2000 Graves TX.
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 17 Units: CY
DOT Hazard Class: None
Identification Number: N/A
Reportable Quantity: N/A
Additional Description: Profile # WMA 02758
Rep. sample: SOPS-18
Container(s): trailer 1 No: 1 Type End Dump
Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-19-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD Trucking
Address: 504 N. Shipp Hobbs N.M. Phone: 505-393-1010
Driver: Gus Garcia Truck No.: 19-8000 Tag No./State: AP 26643 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-19-90 Gus Garcia 4-19-90
Driver Signature Shipment Date Driver Signature Shipment Date

Received at: DR. ANILLO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck
Date: 4-19-90 EVEN 5557.13

EAST curb BETWEEN 375,500/ 375,650
ALONG " " " " " "

NO: OP198

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX

Address: P.O. Box 980 Hobbs N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 17 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample: S-OPS-18

Container(s): Trailer 1 No: 1 Type END Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: _____

Driver: Virgil Stephens Truck No.: 203-7111 Tag No./State: PR 1967 NM

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Virgil Stephens 4-19-90
Driver Signature Shipment Date

Virgil Stephens 4-19-90
Driver Signature Shipment Date

Received at: RID RAN UNO SANITARY LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: [Signature]

Date: 4-19-90

Σ 180.5579.13

EAST GRID BETWEEN 375.500/375.650

NORTH GRID BETWEEN 1557.25/1557.100

NO: OP199

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas
Address: P.O. Box 2000 Graves TX
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 980 Hobbs NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam. soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample: S-OPS-18

Container(s): trailer 1 No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 43-77AD Tag No./State: BP 4A8857CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 4-19-90
Driver Signature Shipment Date

Fred Syrett 4-19-90
Driver Signature Shipment Date

Received at: RIO PAVO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: KEN HECK

Date: 4-19-90

EEN 5579.13

EAST ORIG BETWEEN 375.50 / 375.650
110011 " " 1557-25 / 1557.187

NO: OP200

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas
Address: P.O. Box 2000 Graves TX
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. sample: S-OPS-18

Container(s): trailer 1 No: 1 Type EAD DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss 4-19-90
Signature Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.Mex Phone: 505-393-1010

Driver: ALAN HECK Truck No.: 24-81AD Tag No./State: BP46858CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-19-90
Driver Signature Shipment Date

Allen Hicks 4-19-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: Ken Heck

Date: 4-19-90 EVEN 5579-13

EAST 6MID BETWEEN 375.500/375.650
WEST 6MID BETWEEN 155A.25/155A.100

NO: OP201

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX.

Address: P.O. Box 980 Hobbs NM

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam soil Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep sample: S-OPS-18

Container(s): trailer 1 No: 1 Type End dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 501 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: David Meyers Truck No.: 49-7840 Tag No./State: BP40856 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

DAV [Signature] 4-19-90
Driver Signature Shipment Date

DAV [Signature] 4/19/90
Driver Signature Shipment Date

Received at: Pio Rancho SANTA ANA LAND FILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: KEN HEDC

Date: 4-19-90 21EU.5557.13

SAST 6216 BETWEEN 375.500/375.650

NO: 0702

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX

Address: P.O. Box 980 Hobbs N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 19 Units: CF

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA02758

Rep. sample: S-OPS-18

Container(s): trailer 1 No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs NM Phone: 505-797-1010

Driver: Jody Mitchell Truck No.: 21-7440 Tag No./State: AP 8654CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-19-90
Driver/Signature Shipment Date

Jody Mitchell 4-19-90
Driver/Signature Shipment Date

Received at: Rio Rancho SANITARY Land Fill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: KEN HECK

Date: 4-19-90

ELEV 555' N, 13

EAST GRID BETWEEN 375.500/375.650

NO: OP203
TP 2550

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas Job Name: Southern Union Gas
Address: P.O. Box 2000, Graves, K. Address: P.O. Box 980, Hobbs, N.M.
Phone: (409) 962-8888 Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

REP. SAMPLE: 5-OPS-18

Container(s): TRAILER 1 No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-19-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-8740 Tag No./State: 486648 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-19-90 Scott Woznick 4/19/90
Driver Signature Shipment Date Driver Signature Shipment Date

Received at: POI. RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-19-90 ELEV 5557.13

EAST 6726 BETWEEN 375,500 / 375,650
NORTH " " 1557.25 / 1557.100

NO: CP 204

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, GRAVES, TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 780 HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE: S-OPS-18

Container(s): TRAILER 1 No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Dennis Cosby Truck No.: 34-55A Tag No./State: 3211 UT

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Cosby 4-19-90
Driver Signature Shipment Date

Dennis Cosby 4-19-90
Driver Signature Shipment Date

Received at: RIO RONCO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: Kent Heck
Date: 4-19-90 2120 5557.13

EAST GRID BETWEEN 375.500/375.650
NORTH " " 1557.25/1557.100

NO: OP 205

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES, TX.
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, HOBBS, NM.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE: 5-OPS-18

Container(s): TRAILER 1 No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAN Trucking

Address: 506 N Shipp Hobbs N. Mex Phone: 505-393-1010

Driver: Robert Howkins Truck No.: 43-8740 Tag No./State: 014814 UT

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Howkins 4-19-90
Driver Signature Shipment Date

Robert Howkins 4-19-90
Driver Signature Shipment Date

Received at: RIO Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck Print: Ken Heck

Date: 4-19-90 ELEV 8557.13

EAST grid BETWEEN 375.500/375.650
North " " 1557.25/1557.100

NO: OP 206

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, Graves, TX.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 780, Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WM 8 02758

REV SAMPLE: S-OPS-18

Container(s): TRAILER 1 No: 1 Type END DUMP.

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Bob Scott Truck No.: 44-84AD Tag No./State: BP 40858CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-19-90
Driver Signature Shipment Date

Robert Scott 4-19-90
Driver Signature Shipment Date

Received at: BIO RAVENS SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 4-19-90

E/EU 5557.13

EAST GRID BETWEEN 375.500/375.650

NO: OP207

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000, GRAVES, TX.

Address: P.O. Box 980, Hobbs, N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED Soil Quantity: 19 Units: cf

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

Rep. Sample: S-OPS-16

Container(s): TRAILER 1 No: 1 Type: End Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Foy Smith Truck No.: 202-1202 Tag No./State: PR-19268 NM

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Foy Smith 4-19-90
Driver Signature Shipment Date

Foy Smith 4-19-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-19-90

EKO. 555713

EAST GRID BETWEEN 375.500 & 375.650
WMA " " 1557.25 / 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, Graves, TN
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED Soil Quantity: 18 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE: S-OPS-16

Container(s): TRAILER 1 No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 4-19-90 Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-7010

Driver: John Penick Truck No.: 204-1204 Tag No./State: PA 19266 NM

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

John Penick Driver Signature 4-19-90 Shipment Date

John Penick Driver Signature 4-19-90 Shipment Date

Received at: RIO HANCO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heck Print: KENT HECK
Date: 4-19-90 EDEN 5557, 13

EAST GRID BETWEEN 375.500/375.650
NORTH GRID BETWEEN 1557.25/1557.100

NO: CP209

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. Box 2000, GRAVES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. Box 980, HOBBS N.M.
Phone: (505) 398-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CU

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFICE # WMA 02758

Rep. Sample: S-OPS-16

Container(s): TRAILER 1 No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDRO CARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-19-90
Shipment Date

Transporter: TAD Trucking

Address: 504 N Shipp Hobbs N.M. Phone: 505-393-1010

Driver: HARRY JOHNSTON Truck No.: 26-8590 Tag No./State: AP 86649 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

HARRY JOHNSTON 4-19-90
Driver Signature Shipment Date

HARRY JOHNSTON 4-19-90
Driver Signature Shipment Date

Received at: RIO KANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-19-90

EMD 5579.13

EAST SIDE BETWEEN 375.500/375.650
NORTH SIDE BETWEEN 155A.25/155A.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, Gaines, FL
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED Soil Quantity: 19 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE: 5-OPS-17

Container(s): TRAILER 1 No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-20-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N Shipp Hobbs N.M. Phone: 505-393-1810

Driver: Allen Hicks Truck No.: 24-8140 Tag No./State: RP4685ECA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Allen Hicks 4-20-90
Driver Signature Shipment Date

Allen Hicks 4-20-90
Driver Signature Shipment Date

Received at: R.D RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck

Print: Ken Heck

Date: 4-20-90

ELEV 5579.13

EAST Grid BETWEEN 375.500/375.650

NORTH Grid BETWEEN 1557.25/1557.100

NO: OP211

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: Southern Union Gas
Address: P.O. Box 2000 Grants, N.M.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Grants, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED Soil Quantity: 18 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample # S-OPS-17

Container(s): TRAILER No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent Russel Buss Signature 4-20-90 Shipment Date

Transporter: TAD Trucking

Address: 506 N Shipp Halls N. Mex Phone: 505-393-1010

Driver: Bob Scott Truck No.: 44-8640 Tag No./State: BP 40 855 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott Driver Signature 4-20-90 Shipment Date

Robert Scott Driver Signature 4-20-90 Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK
Date: 4-20-90

Print: KEN HECK
212V 5579.13

EAST END BETWEEN 375.500 / 375.650
NORTH END BETWEEN 1557.25 / 1557.700

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 GRAVE, TX
Phone: (409) 922-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

REP SAMPLE : S-OPS-17

Container(s): TRAILER (1) No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss 4-20-90
Signature Shipment Date

Transporter: JAD Trucking

Address: 506 North Shipp Hobbs N.M. Phone: 505-393-1010

Driver: ~~Scott~~ Dennis Rains Truck No.: ~~12-3000~~ 35-8220 Tag No./State: ~~AP 86654 CA~~ AP 86654 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Rains 4-20-90
Driver Signature Shipment Date

Dennis Rains 4-20-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LF

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Eving

Print: Roy Eving

Date: 4-20-90

East grid Between 375,500 / 375,650 ELUC
North grid Between 1557,25 / 1557,100 5579.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 Survey, TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CF

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP. SAMPLE: S-OPS-17

Container(s): TRAILER 1 No: 1 Type E10 Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-20-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N Shipp Hobbs N.M. Phone: 505-397-1010

Driver: Jody Mitchell Truck No.: 21-7440 Tag No./State: AP 866 54 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-20-90
Driver Signature Shipment Date

Jody Mitchell 4-20-90
Driver Signature Shipment Date

Received at: Pro Ranch. LS

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy Ewing

Date: 4-20-90

EAST grid Between 375,500 / 375,650
North grid Between 1552,20 / 1557,100

E100 5528.13

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 Graves, TX,
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 18 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE: S-OPS-17

Container(s): TRAILER (1) No: (1) Type End Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-20-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N Shipp Hobbs N.Mex Phone: 505-393-1010

Driver: Dennis Cosby Truck No.: 34-55A Tag No./State: 3211 UT

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Cosby 4-20-90
Driver Signature Shipment Date

Dennis M Cosby 4-20-90
Driver Signature Shipment Date

Received at: RC Rancho SANTIAGO LP

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy

Print: Roy Ewing

Date: 4 20 90

EAST grid BETWEEN 375,500 / 375,650 ELEV 5578.63
NORTH grid BETWEEN 1557.25 / 1557,100

NO: OP 215

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000 Graves Tx.
Phone: (809) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE : 5-OPS-17

Container(s): TRAILER 1 No: 1 Type END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Russel Buss 4-20-90
Generator Authorized Agent Signature Shipment Date

Transporter: TAD Trucking

Address: 506 North Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Robert Hawkins Truck No.: 43-83AD Tag No./State: BP 40858 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Hawkins 4-20-90 Robert Hawkins 4-20-90
Driver Signature Shipment Date Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Hill Print: Ken Hill
Date: 4-20-90 EXEN 5557.13

EAST 6th BETWEEN 375.00/375.650
NORTH 6th BETWEEN 1557.25/1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

NO: OP 216
4254

Generator: Southern Union Gas
Address: P.O. Box 2000 Graves, Tx.
Phone: (409) 962-8898

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contaminated Soil Quantity: 19 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Proble # WMA 02758

Rec Sample: S-OPS-17

Container(s): TRAILER 1 No: 1 Type Exp Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-20-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 42-78AD Tag No./State: BP4085-6CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-20-90
Driver Signature Shipment Date

Scott Woznick 4/20/90
Driver Signature Shipment Date

Received at: Rio Rancho 2F.

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Roy Ewing

Print: Roy Ewing

Date: 4-20-90

EAST grid Between 375,500 / 375,650 ELEV 5519.13
North grid Between 1557,25 / 1557,100

NO: OP217

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX

Address: P.O. Box 980 Hobbs N.M

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample - S-OPS-17

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Dennis Cosby Truck No.: 34-58HD Tag No./State: 3211 UT

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Cosby 4-23-90
Driver Signature Shipment Date

Dennis Cosby 4-23-90
Driver Signature Shipment Date

Received at: 506 RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Hill

Print: Ken Hill

Date: 4-23-90

ELEV 5579.13

EAST SIDE BETWEEN 375.500 / 375.650

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas
Address: P.O. Box 2000 Graves TX
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 780 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam-soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep sample - S-OPS-17

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Phone: 505-393-1010

Driver: Robert Hawkins Truck No.: 43-83AD Tag No./State: 014814 UT

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Hawkins 4-23-90
Driver Signature Shipment Date

Robert Hawkins 4-23-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature] Print: [Signature]

Date: 4-23-90 EVN 5579.13

EAST ONE BETWEEN 375.500 / 375.650
NOTHING BETWEEN 1557.25 / 1557.400

NO: OP-219

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas
Address: Rd. Box 2000 Graves TX
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 980 Hobbs N.M
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 18 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample - S-OPS-17

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M Phone: 505-393-1010

Driver: Gus Garcia Truck No.: 19-80AD Tag No./State: A1 86643 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-23-90
Driver Signature Shipment Date

Gus Garcia 4/23/90
Driver Signature Shipment Date

Received at: R.O. RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]
Date: 4-23-90

Print: KENTUCK
ELEN. 5579, 13

T. GALL BETWEEN 375.570 / 375.650

N. GALL BETWEEN 1557.25 / 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas
Address: P.O. Box 2000 Graves TX
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 18 Units: CP

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA02758

Rep sample SORS-17

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: Contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 306 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Harry Johnston Truck No.: 26-85AD Tag No./State: AP 86649CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Harry Johnston
Driver Signature 4-23-90
Shipment Date

Harry Johnston
Driver Signature 4-23-90
Shipment Date

Received at: Kio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Heck
Date: 4-23-90

Print: KEN HECK
EJEN 5509.13

EAST GRID BETWEEN 375.500 / 375.650
NOTCH GRID BETWEEN 1557.25 / 1557.100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX

Address: P.O. Box 980 Hobbs N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam. soil Quantity: 20 Units: CF

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample : S-OPS-17

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Fred Syrett Truck No.: 4377AD Tag No./State: BP 40 857 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syrett 4-23-90
Driver Signature Shipment Date

Fred Syrett 4-23-90
Driver Signature Shipment Date

Received at: RIO RANCHO SAN JUAN LANDfill

I hereby certify that the above name material has been accepted and to the best of my knowledge the above is true and correct.

Signed: Ken Hall

Print: Ken Hall

Date: 4-23-90

EPEN 557913

EAST END BETWEEN 375.500 / 375.600
NORTH END BETWEEN 1557.00 / 1557.100

NO: OP-223
TP# 6557

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas
Address: P.O. Box 2000 Graves TX
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 980 Hobbs N.M
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: contam. soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA-02758

Rep. Sample: S-OPS-17

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Scott Woznick Truck No.: 25-8410 Tag No./State: AP 86648CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Scott Woznick 4-23-90
Driver Signature Shipment Date

Scott Woznick 4/23/90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LF

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: ROY FUJII

Date: _____ ELEV 5579.13

East grid Between 375,500 / 375,650
North grid Between 1557,25 / 1557,100

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves, TX

Address: P.O. Box 980 Hobbs N.M

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample - S-OPS-19

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: David Mayers Truck No.: 42-78AD Tag No./State: BP 40856 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Mayers 4-23-90
Driver Signature Shipment Date

David Mayers 4/23/90
Driver Signature Shipment Date

Received at: Rio Rancho Sawmill LF

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: Roy Ewing

Date: 4-23-90

EAST grid Between 375,500 / 375,650 ELEV 5579.13
NORTH grid Between 1557,25 / 1557,100

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, Grants, N.M.
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contaminated Soil Quantity: 20 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample = S-OPS-19

Container(s): trailer (1) No: 1 Type End Dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss Generator Authorized Agent
Russel Buss Signature
4-23-90 Shipment Date

Transporter: TAD Trucking

Address: 566 N. Shipp Hobbs N.M. Phone: 505-393-1000

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP86654CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell Driver Signature
4-23-90 Shipment Date

Jody Mitchell Driver Signature
4-23-90 Shipment Date

Received at: Rio Grande Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heck Print: KENT HECK

Date: 4-23-90 ELEN 5579.13

EAST END BETWEEN 375.570 / 375.650
NORTH END BETWEEN 1557.25 / 1557.100.

NO: OP226

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas

Job Name: Southern Union Gas

Address: P.O. Box 2000, Graus, TX

Address: P.O. Box 980 Hobbs, N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 19 Units: CY

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA 02758

REP SAMPLE: SCOPS-19

Container(s): TRAILER 1 No: 1 Type: END RAMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Bob Scott Truck No.: 44-8610 Tag No./State: BP4858CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Scott 4-23-90
Driver Signature Shipment Date

Robert Scott 4/23/90
Driver Signature Shipment Date

Received at: RIO Rancho SAINTELY LF.

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]

Print: ROY ELLIOTT

Date: 4-23-90

EAST Grid Between 375, 500 / 375, 650 ELEV 5577.13
NORTH Grid Between 1557, 25 / 1557, 100

NO: OP-227

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: SOUTHERN UNION GAS
Address: P.O. BOX 2000 GRANES, TX
Phone: (409) 962-8888

Job Name: SOUTHERN UNION GAS
Address: P.O. BOX 980, HOBBS, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: CONTAMINATED SOIL Quantity: 20 Units: cy

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: PROFILE # WMA-02758

Rep Sample: S-OPS-19

Container(s): TRAILER (1) No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-23-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-398-1010

Driver: Dennis Adams Truck No.: 35-8240 Tag No./State: AP 86654 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Adams 4-23-90
Driver Signature Shipment Date

Dennis Adams 4-23-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Den Kelly
Date: 4-23-90

Print: KENTECIC
ETEN 5579.13

EAST GRID BETWEEN 375.500/375.650
NORTH GRID BETWEEN 155725/15570180

NO: 07-228

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX

Address: P.O. Box 980 Hobbs N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep Sample: S-ORS-19

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-24-90
Shipment Date

Transporter: TAN Trucking

Address: 506 N Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Dennis Cosby Truck No.: 34-55A Tag No./State: 3211 UT

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Cosby 4-24-90
Driver Signature Shipment Date

Dennis Cosby 4-24-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross

Date: 4-24-90

Elev 1579.13

East Grid Between 375.500 / 375.650

NO: OP-229

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX

Address: P.O. Box 980 Hobbs N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 20 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA-02758

Rep sample - S-OPS-19

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: Contains Hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-24-90
Shipment Date

Transporter: TAD Trucking

Address: 506 W Shipp Hobbs N. Mex Phone: 505-393-1010

Driver: Robert Hawkins Truck No.: 43-8300 Tag No./State: 014814 UT

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Robert Hawkins 4-24-90
Driver Signature Shipment Date

Robert Hawkins 4-24-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material, has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross

Date: 4-24-90

Elev 1579.13

EAST Grid between 375.500 / 375.650
North Grid between 1557.25 / 1557.100

OP230

NO: ~~OP227~~

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: Southern Union Gas
Address: P.O. Box 2000, Graves, TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980, Hobbs, N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contaminated Soil Quantity: 20 Units: cy.

DOT Hazard Class: NONE

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep. Sample: 5-OPS-19

Container(s): TRAILER 1 No: 1 Type: END DUMP

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-24-90
Shipment Date

Transporter: TAD Trucking

Address: 506 W. Shipp Hobbs Phone: 505-393-1010

Driver: Jody Mitchell Truck No.: 21-74AD Tag No./State: AP 86654CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Jody Mitchell 4-24-90
Driver Signature Shipment Date

Jody Mitchell 4-24-90
Driver Signature Shipment Date

Received at: RIO Rancho SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ken Hook

Print: Ken Hook

Date: 4-24-90

EKEN 5579.13

EAST ROAD BETWEEN 375.570 / 375.650

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas
Address: P.O. Box 2000 Graves, TX
Phone: (409) 962-8888

Job Name: So. Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 386-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 18 Units: CY

DOT Hazard Class: none

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA-02758

Rep. sample - J-OPS-19

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-24-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Gus Garcia Truck No.: 19-80AD Tag No./State: AP86643CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Gus Garcia 4-24-90
Driver Signature Shipment Date

Gus Garcia 4/24/90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: [Signature]
Date: 4-24-90

Print: Ken Heek
ELEV 5579.13

EAST GRID BETWEEN 375.500/375.650
WORTH GRID BETWEEN 1557.25/1557.100

NO: OP-232

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas
Address: P.O. Box 2000 Graves TX
Phone: (409) 962-8888

Job Name: Southern Union Gas
Address: P.O. Box 980 Hobbs N.M.
Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep sample - S-OPS-19

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: Contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-24-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-1010

Driver: Dennis Daines Truck No.: 35-8240 Tag No./State: AP 86654CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Dennis Daines 4-24-90
Driver Signature Shipment Date

Dennis Daines 4-24-90
Driver Signature Shipment Date

Received at: RIO RANCHO SANITARY LANDFILL

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: KEN HECK

Print: KEN HECK

Date: 4-21-90

2/21/90 5579.13

FACTS AND RETURN 375.500/375.650

NO: OP-233

NONHAZARDOUS
SPECIAL WASTE MANIFEST

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves TX

Address: P.O. Box 980 Hobbs N.M

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam. Soil Quantity: 19 Units: CY

DOT Hazard Class: None

Identification Number: N/A

Reportable Quantity: N/A

Additional Description: Profile # WMA 02758

Rep sample - S-OPS-19

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: Contains hydrocarbons

I hereby certify that the above named material does not contain free liquid as defined by 40 CFR Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CFR 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Russel Buss
Generator Authorized Agent

Russel Buss
Signature

4-24-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N Shipp Hobbs N. Mex Phone: 505-393-1010

Driver: Fred Syfrett Truck No.: 43-7700 Tag No./State: BP 40857CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

Fred Syfrett 4-24-90
Driver Signature Shipment Date

Fred Syfrett 4-24-90
Driver Signature Shipment Date

Received at: Rio Rancho Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Ernie Ross

Print: Ernie Ross

Date: 4-24-90

East Grid Between 375.500 / 375.600
North Grid between 1557.25 / 1557.100

Elev 1579.13

NO: OP234

**NONHAZARDOUS
SPECIAL WASTE MANIFEST**

Generator: So. Union Gas

Job Name: So. Union Gas

Address: P.O. Box 2000 Graves Tx.

Address: P.O. Box 980 Hobbs N.M.

Phone: (409) 962-8888

Phone: (505) 396-5821

QUANTITY AND DESCRIPTION

Proper Shipping Name: Contam Soil Quantity: 20 Units:

DOT Hazard Class: NON

Identification Number: N/A

Reportable Quantity: NA

Additional Description: Profile: WMA 02758

Rep - sample - S-OPS-19

Container(s): trailer No: 1 Type end dump

Special Handling Instructions: CONTAINS HYDROCARBONS

I hereby certify that the above named material does not contain free liquid as defined by 40 CRF Part 260.10 or any applicable state law, is not a hazardous waste as defined by 40 CRF 261 or any applicable state law has been properly described, classified and packaged, and is in proper condition for transportation according to applicable regulations.

Brussel Buss
Generator Authorized Agent

Russel Buss
Signature

4-24-90
Shipment Date

Transporter: TAD Trucking

Address: 506 N. Shipp Hobbs N.M. Phone: 505-393-7010

Driver: David Meyers Truck No.: 49-7840 Tag No./State: BP 40856 CA

I hereby certify that the above named material was picked up at the generator site listed below.

I hereby certify that the above named material was delivered without incident to the destination listed below.

David Meyers 4-24-90
Driver Signature Shipment Date

David Meyers 4/24/90
Driver Signature Shipment Date

Received at: Pio Ranch Sanitary Landfill

I hereby certify that the above name material has been accepted and to the best of my knowledge, the above is true and correct.

Signed: Kent Heck

Print: Kent Heck

Date: 4-24-90

5579.13

EAST BOUND BETWEEN 375.500 / 375.650

NORTH BOUND BETWEEN 1557.25 / 1557.100