

1R - 280

REPORTS

DATE:

3/2000

Chevron USA


**Dynegy – Monument Site
Monitor Well Report
Lea County, New Mexico**

March 31, 2000

RECEIVED

MAY 24 2000

ENVIRONMENTAL BUREAU
OIL CONSERVATION DIVISION

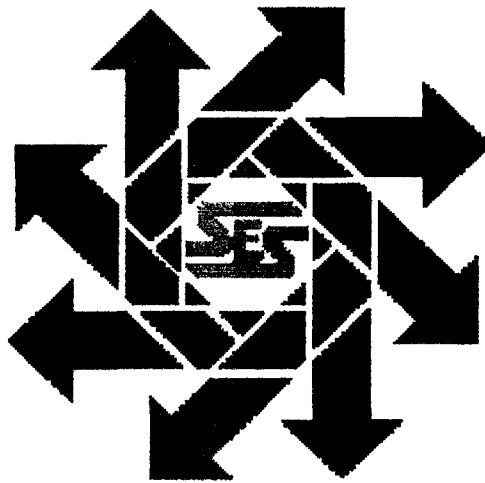

*Safety & Environmental Solutions, Inc.
703 E. Clinton Suite 103
Hobbs, New Mexico 88240
(505) 397-0510*

TABLE OF CONTENTS

I. Background.....	2
II. Work Performed	2
III. Analytical Results.....	3
IV. Maps and Figures	3

I. Background

The subject property is located in Lea County approximately 5 miles southwest of Monument, New Mexico. Mr. James Cooper currently owns the surface rights of the property and the mineral rights are under lease to Chevron. The property has been the site of condensate/liquid product leaks from a pipeline previously operated by Warren Petroleum as well as an abandoned burn pit.

Safety & Environmental Solutions, Inc. (SESI) performed sampling and data collection on the six (6) ground water monitor wells at the site (See Vicinity Map). The casing size in all wells is 4".

II. Work Performed

SESI environmental technician Sergio Contreras, Jr. arrived at the site on March 25, 2000.

Ground water samples were taken from each well after hand bailer was used to develop the wells. Three to five casing volumes of water were removed from each well until pH and temperature of the water were stabilized. The development water was stored in a 400-gallon drum under the custody of Safety & Environmental Solutions, Inc. for disposal upon completion of analytical testing. The samples were obtained and placed in appropriate containers, preserved and transported under chain of custody to Cardinal Laboratories of Hobbs, New Mexico for analysis. (See Analytical Data)

In addition to the sampling, SESI also measured the depth to the top of the water table and the total depth of each well. The depth to the top of ground water was measured using a Solinst water level indicator. The total depth of each well was measured in order to compute the proper casing volumes. A summary of this data follows:

ID	Date	Top of Casing Elevation	Depth to Water	Groundwater Potentiometric Elevation	Total Well Depth	Free Product Thickness
MW – 1	3/25/00	3565.24'	37.20'	3528.04'	49.00'	0.00
MW – 2	3/25/00	3564.21'	36.32'	3527.89'	45.75'	0.00
MW – 3	3/25/00	3564.06'	36.18'	3527.88'	46.93'	0.00
MW – 4	3/25/00	3564.62'	36.65'	3527.97'	37.63'	0.00
MW – 5	3/25/00	3564.58'	36.51'	3528.07'	44.90'	0.00
MW – 6	3/25/00	3564.58'	36.70'	3527.88'	43.25'	0.00

III. Analytical Results

The analysis of the groundwater samples performed by Cardinal Laboratories are summarized as follows:

Contaminant	WQCC Standard	MW #1	MW #2	MW #3	MW #4	MW #5	MW #6
Chloride	250.0 ppm	2433 ppm	1216 ppm	1086 ppm	1554 ppm	2059 ppm	1104 ppm
Fluoride	1.6 ppm	1.90	1.87 ppm	1.92 ppm	1.83 ppm	1.98 ppm	1.97 ppm
Lead	0.05 ppm	0.597 ppm	0.580 ppm	0.611 ppm	0.603 ppm	0.747 ppm	0.770 ppm
Manganese	0.2 ppm	<0.2 ppm	.324 ppm	<0.20 ppm	.403 ppm	.308 ppm	<0.20 ppm
Silver	0.05 ppm	0.051 ppm	<0.05 ppm	<0.05 ppm	<0.05 ppm	0.103 ppm	0.088 ppm
Sulfate	600 ppm	2899 ppm	1180 ppm	1230 ppm	1040 ppm	2254 ppm	533 ppm
TDS	1000 ppm	8130ppm	3540ppm	3610ppm	4770ppm	7000ppm	2090ppm
pH	> 6 & <9	7.25	7.23	7.22	7.30	7.44	7.33
TPH	N/A	<1.0 ppm	2.36 ppm	1.47 ppm	1.11 ppm	2.38 ppm	<1.0 ppm
Benzene	0.01 ppm	<.002ppm	<.002ppm	<.002ppm	<.002ppm	<.002ppm	<.002ppm
Toluene	0.75 ppm	<.002ppm	<.002ppm	<.002ppm	<.002ppm	<.002ppm	<.002ppm
Ethyl Benzene	0.75 ppm	<.002ppm	<.002ppm	<.002ppm	.004ppm	<.002ppm	<.002ppm
Total Xylenes	0.62 ppm	<.006ppm	<.006ppm	<.006ppm	<.006ppm	<.006ppm	<.006ppm

SAMPLE ID	Na (mg/L)	Ca (mg/L)	Mg (mg/L)	K (mg/L)	CO ₃ (mg/L)	HCO ₃ (mg/L)
MW – 1	2065	445	417	11.6	0	282
MW – 2	1091	186	152	6.8	0	673
MW – 3	801	158	236	8.5	0	761
MW – 4	1224	178	228	12.1	0	976
MW – 5	1815	283	441	14.5	0	649
MW – 6	685	182	133	5.9	0	386

IV. Figures and Appendices

Figures:

Vicinity Map


Potentiometric Map

Appendices:

Cumulative Well Data

Analytical Results




Figure 1
Vicinity Map

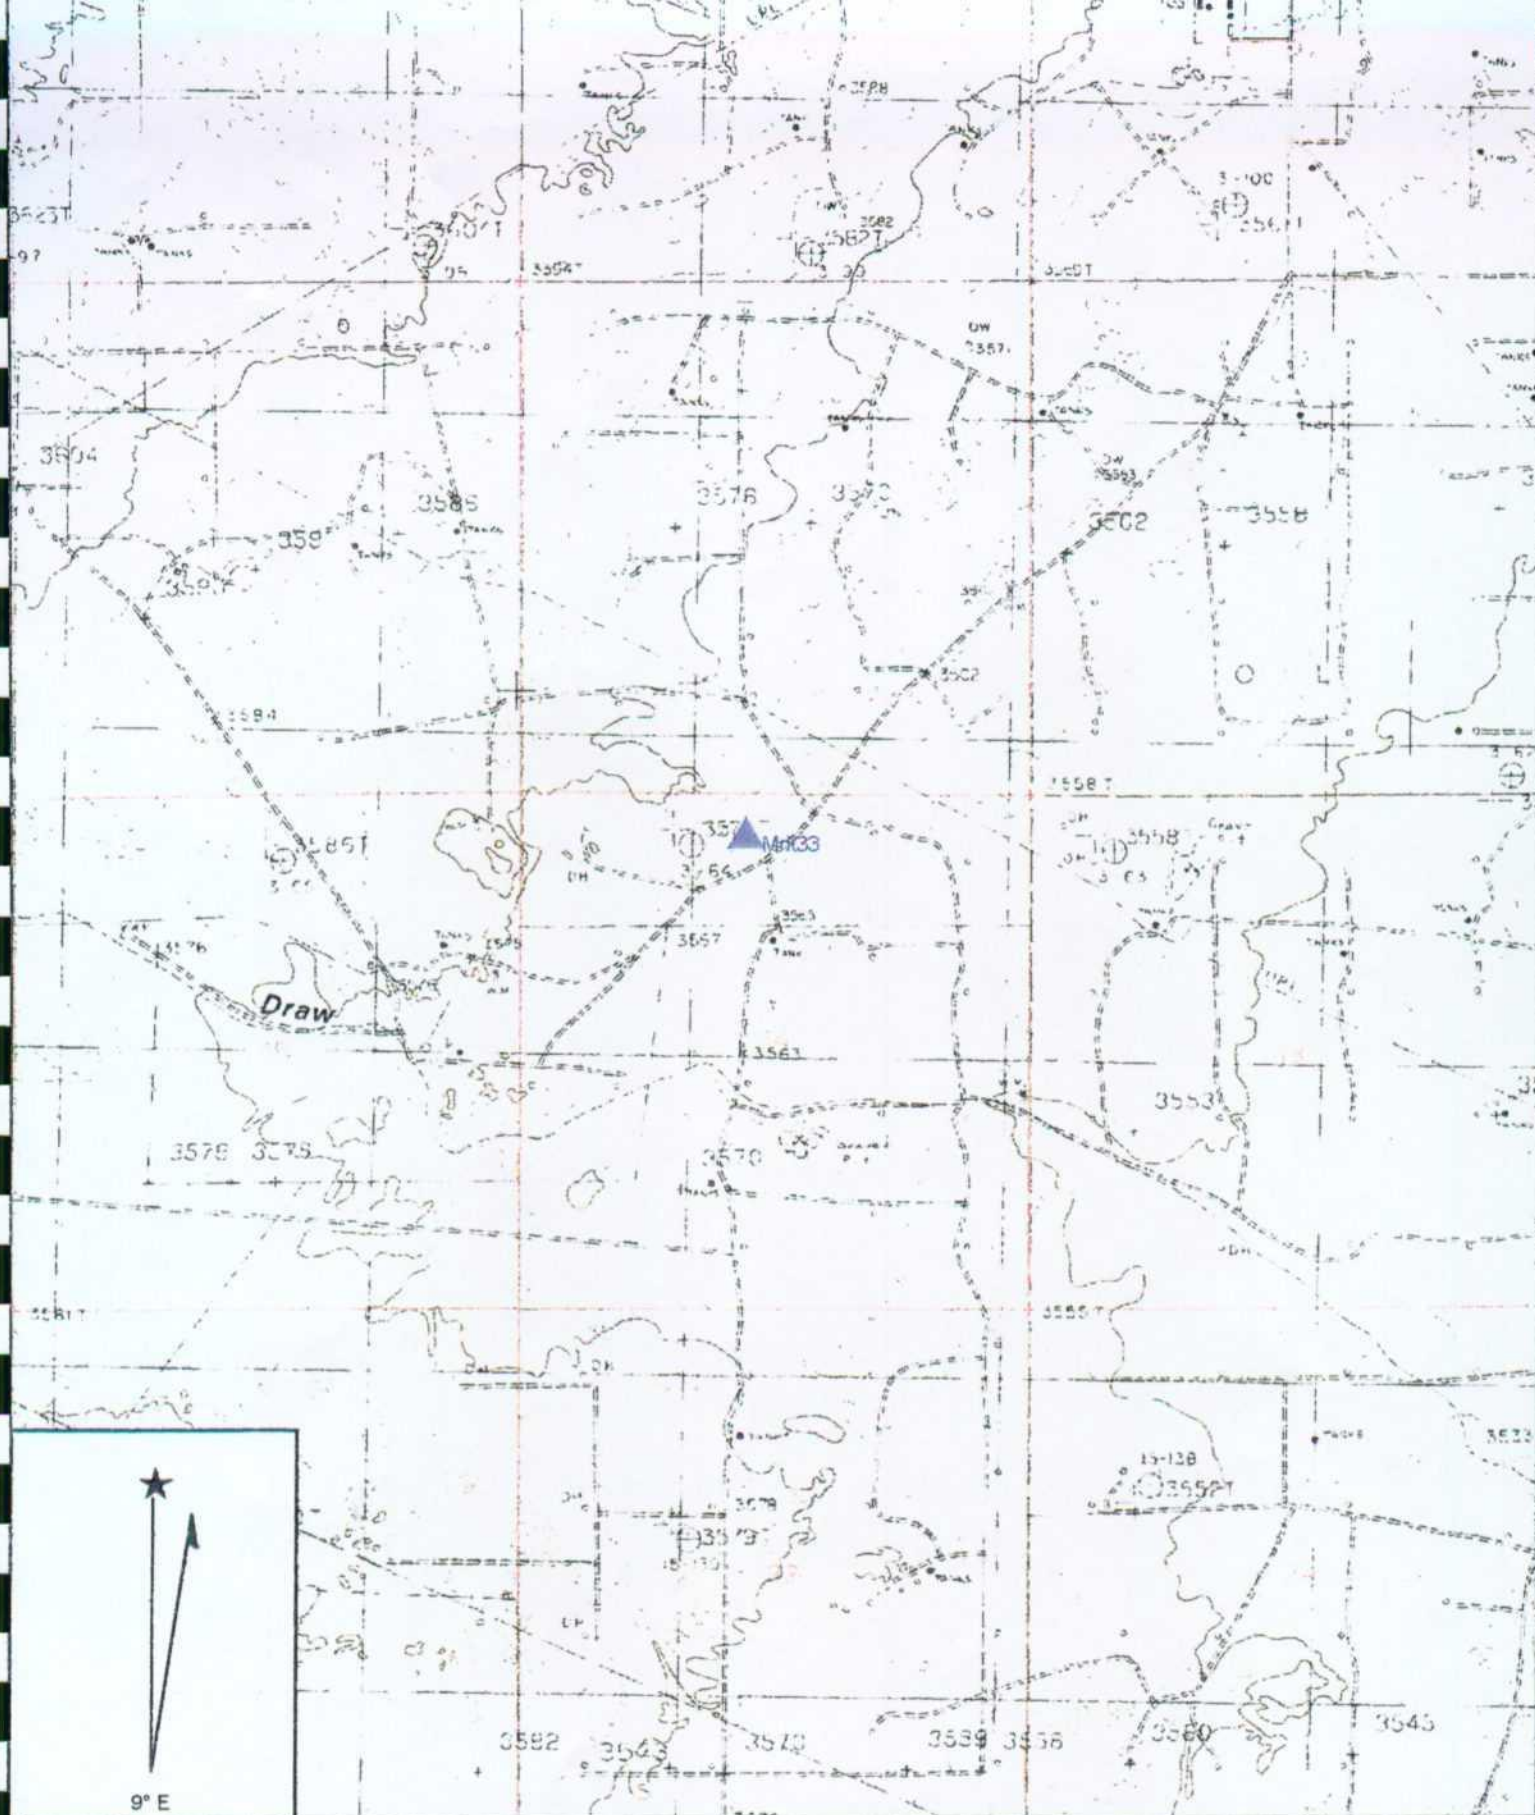

Name: MONUMENT SOUTH
 Date: 5/19/2000
 Scale: 1 inch equals 2000 feet

Location: 032° 34' 38.9" N 103° 19' 28.8" W
 Caption: Chevron Dynegy- Monument Vicinity Map

Figure 2
Potentiometric Map

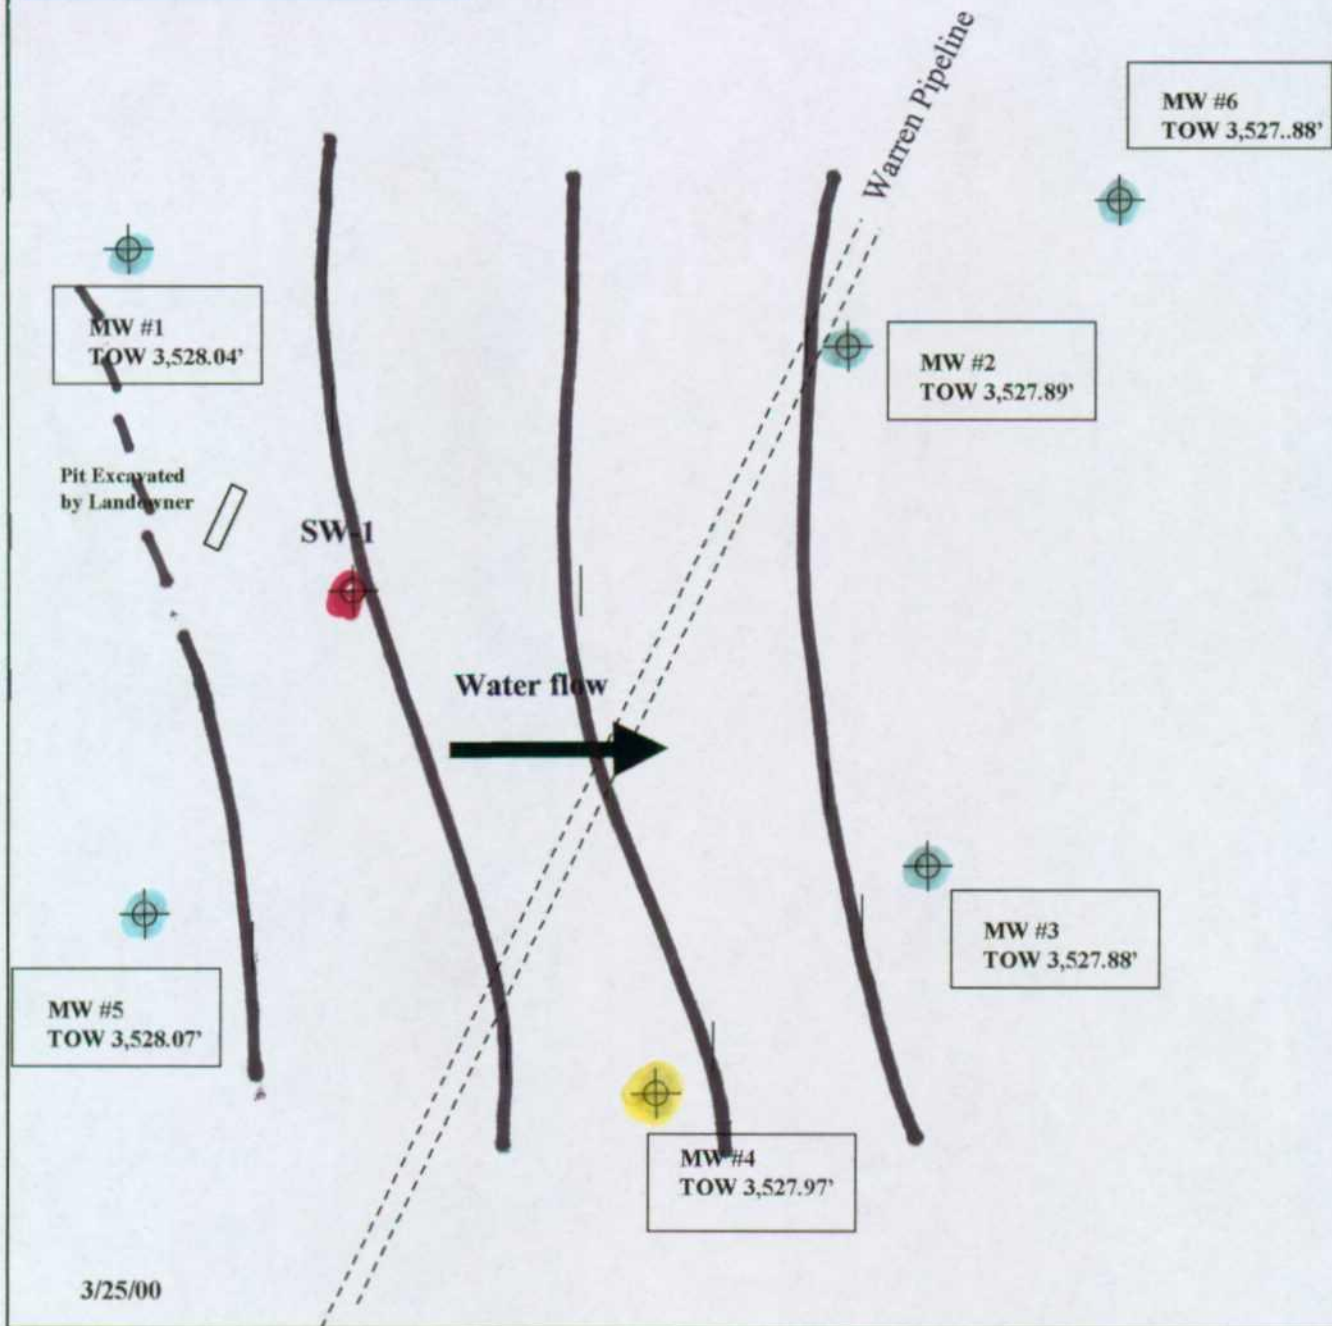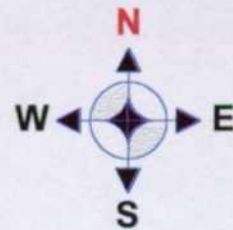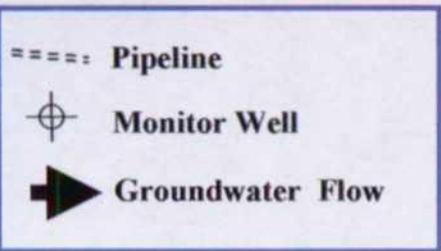

Chevron USA

**Water Contour and Flow
Dynegy Monument Site
Monitor Wells**

**Safety & Environmental
Solutions, Inc.
Hobbs, New Mexico**

Appendix A

Cumulative Well Data

Chevron Dynegy -Monument Cumulative Well Data

Monitor Well #1

Contaminant	WQCC Standard	Initial Test 3/25/00	Test Date	Test Date
Arsenic	0.1 ppm	N/A		
Barium	1.0 ppm	N/A		
Cadmium	0.01 ppm	N/A		
Chloride	250.0 ppm	2433		
Chromium	0.05 ppm	N/A		
Copper	1.0 ppm	N/A		
Cyanide	0.2 ppm	N/A		
Fluoride	1.6 ppm	1.90		
Iron	1.0 ppm	N/A		
Lead	0.05 ppm	0.597		
Manganese	0.2 ppm	<0.2		
Mercury	0.002 ppm	N/A		
Nitrate	10.0 ppm	N/A		
Phenols	0.005 ppm	N/A		
Selenium	0.05 ppm	N/A		
Silver	0.05 ppm	0.051		
Sulfate	600 ppm	2899		
Zinc	10.0 ppm	N/A		
TDS	1000.0 ppm	9212		
pH	> 6 & <9	7.26		
PAH	0.03 ppm	N/A		
PCBs	0.001 ppm	N/A		
Benzene	0.01 ppm	<0.002		
Toluene	0.75 ppm	<0.002		
Ethyl Benzene	0.75 ppm	<0.002		
Total Xylenes	0.62 ppm	<0.006		
TPH	N/A	<1.0		
Sodium	N/A	N/A		
Calcium	N/A	445		
Magnesium	N/A	417		
Potassium	N/A	11.6		
Conductivity	N/A	11.46		
T-Alkalinity	N/A	232		
CO ₃	N/A	0		
HCO ₃	N/A	282		

Chevron Dynegy -Monument Cumulative Well Data

Monitor Well #2

Contaminant	WQCC Standard	Initial Test 3/25/00	Test Date	Test Date
Arsenic	0.1 ppm	N/A		
Barium	1.0 ppm	N/A		
Cadmium	0.01 ppm	N/A		
Chloride	250.0 ppm	1216		
Chromium	0.05 ppm	N/A		
Copper	1.0 ppm	N/A		
Cyanide	0.2 ppm	N/A		
Fluoride	1.6 ppm	1.87		
Iron	1.0 ppm	N/A		
Lead	0.05 ppm	0.580		
Manganese	0.2 ppm	0.324		
Mercury	0.002 ppm	N/A		
Nitrate	10.0 ppm	N/A		
Phenols	0.005 ppm	N/A		
Selenium	0.05 ppm	N/A		
Silver	0.05 ppm	<0.05		
Sulfate	600 ppm	1180		
Zinc	10.0 ppm	N/A		
TDS	1000.0 ppm	3898		
pH	> 6 & <9	7.18		
PAH	0.03 ppm	N/A		
PCBs	0.001 ppm	N/A		
Benzene	0.01 ppm	<0.002		
Toluene	0.75 ppm	<0.002		
Ethyl Benzene	0.75 ppm	<0.002		
Total Xylenes	0.62 ppm	<0.006		
TPH	N/A	2.36		
Sodium	N/A	N/A		
Calcium	N/A	186		
Magnesium	N/A	152		
Potassium	N/A	6.8		
Conductivity	N/A	5770		
T-Alkalinity	N/A	552		
CO ₃	N/A	0		
HCO ₃	N/A	673		

Chevron Dynegy -Monument Cumulative Well Data

Monitor Well #3

Contaminant	WQCC Standard	Initial Test 3/25/00	Test Date	Test Date
Arsenic	0.1 ppm	N/A		
Barium	1.0 ppm	N/A		
Cadmium	0.01 ppm	N/A		
Chloride	250.0 ppm	1086		
Chromium	0.05 ppm	N/A		
Copper	1.0 ppm	N/A		
Cyanide	0.2 ppm	N/A		
Fluoride	1.6 ppm	1.92		
Iron	1.0 ppm	N/A		
Lead	0.05 ppm	0.611		
Manganese	0.2 ppm	<0.2		
Mercury	0.002 ppm	N/A		
Nitrate	10.0 ppm	N/A		
Phenols	0.005 ppm	N/A		
Selenium	0.05 ppm	N/A		
Silver	0.05 ppm	<0.05		
Sulfate	600 ppm	1230		
Zinc	10.0 ppm	N/A		
TDS	1000.0 ppm	4058		
pH	> 6 & <9	7.08		
PAH	0.03 ppm	N/A		
PCBs	0.001 ppm	N/A		
Benzene	0.01 ppm	<0.002		
Toluene	0.75 ppm	<0.002		
Ethyl Benzene	0.75 ppm	<0.002		
Total Xylenes	0.62 ppm	<0.006		
TPH	N/A	1.47		
Sodium	N/A	N/A		
Calcium	N/A	158		
Magnesium	N/A	236		
Potassium	N/A	8.5		
Conductivity	N/A	5550		
T-Alkalinity	N/A	624		
CO ₃	N/A	0		
HCO ₃	N/A	761		

Chevron Dynegy -Monument Cumulative Well Data

Monitor Well #4

Contaminant	WQCC Standard	Initial Test 3/25/00	Test Date	Test Date
Arsenic	0.1 ppm	N/A		
Barium	1.0 ppm	N/A		
Cadmium	0.01 ppm	N/A		
Chloride	250.0 ppm	1554		
Chromium	0.05 ppm	N/A		
Copper	1.0 ppm	N/A		
Cyanide	0.2 ppm	N/A		
Fluoride	1.6 ppm	1.83		
Iron	1.0 ppm	N/A		
Lead	0.05 ppm	0.603		
Manganese	0.2 ppm	0.403		
Mercury	0.002 ppm	N/A		
Nitrate	10.0 ppm	N/A		
Phenols	0.005 ppm	N/A		
Selenium	0.05 ppm	N/A		
Silver	0.05 ppm	<0.05		
Sulfate	600 ppm	1040		
Zinc	10.0 ppm	N/A		
TDS	1000.0 ppm	4730		
pH	> 6 & <9	7.52		
PAH	0.03 ppm	N/A		
PCBs	0.001 ppm	N/A		
Benzene	0.01 ppm	<0.002		
Toluene	0.75 ppm	<0.002		
Ethyl Benzene	0.75 ppm	<0.002		
Total Xylenes	0.62 ppm	<0.006		
TPH	N/A	1.11		
Sodium	N/A	N/A		
Calcium	N/A	178		
Magnesium	N/A	228		
Potassium	N/A	12.1		
Conductivity	N/A	6950		
T-Alkalinity	N/A	800		
CO ₃	N/A	0		
HCO ₃	N/A	673		

Chevron Dynegy -Monument Cumulative Well Data

Monitor Well #5

Contaminant	WQCC Standard	Initial Test 3/25/00	Test Date	Test Date
Arsenic	0.1 ppm	N/A		
Barium	1.0 ppm	N/A		
Cadmium	0.01 ppm	N/A		
Chloride	250.0 ppm	2059		
Chromium	0.05 ppm	N/A		
Copper	1.0 ppm	N/A		
Cyanide	0.2 ppm	N/A		
Fluoride	1.6 ppm	1.98		
Iron	1.0 ppm	N/A		
Lead	0.05 ppm	0.747		
Manganese	0.2 ppm	0.380		
Mercury	0.002 ppm	N/A		
Nitrate	10.0 ppm	N/A		
Phenols	0.005 ppm	N/A		
Selenium	0.05 ppm	N/A		
Silver	0.05 ppm	0.103		
Sulfate	600 ppm	2254		
Zinc	10.0 ppm	N/A		
TDS	1000.0 ppm	8054		
pH	> 6 & <9	7.14		
PAH	0.03 ppm	N/A		
PCBs	0.001 ppm	N/A		
Benzene	0.01 ppm	<0.002		
Toluene	0.75 ppm	<0.002		
Ethyl Benzene	0.75 ppm	<0.002		
Total Xylenes	0.62 ppm	<0.006		
TPH	N/A	2.38		
Sodium	N/A	N/A		
Calcium	N/A	283		
Magnesium	N/A	441		
Potassium	N/A	14.5		
Conductivity	N/A	10370		
T-Alkalinity	N/A	532		
CO ₃	N/A	0		
HCO ₃	N/A	649		

Chevron Dynegy -Monument Cumulative Well Data

Monitor Well #6

Contaminant	WQCC Standard	Initial Test 3/25/00	Test Date	Test Date
Arsenic	0.1 ppm	N/A		
Barium	1.0 ppm	N/A		
Cadmium	0.01 ppm	N/A		
Chloride	250.0 ppm	1104		
Chromium	0.05 ppm	N/A		
Copper	1.0 ppm	N/A		
Cyanide	0.2 ppm	N/A		
Fluoride	1.6 ppm	1.97		
Iron	1.0 ppm	N/A		
Lead	0.05 ppm	0.770		
Manganese	0.2 ppm	<0.2		
Mercury	0.002 ppm	N/A		
Nitrate	10.0 ppm	N/A		
Phenols	0.005 ppm	N/A		
Selenium	0.05 ppm	N/A		
Silver	0.05 ppm	0.088		
Sulfate	600 ppm	533		
Zinc	10.0 ppm	N/A		
TDS	1000.0 ppm	3096		
pH	> 6 & <9	7.33		
PAH	0.03 ppm	N/A		
PCBs	0.001 ppm	N/A		
Benzene	0.01 ppm	<0.002		
Toluene	0.75 ppm	<0.002		
Ethyl Benzene	0.75 ppm	<0.002		
Total Xylenes	0.62 ppm	<0.006		
TPH	N/A	<1.0		
Sodium	N/A	N/A		
Calcium	N/A	182		
Magnesium	N/A	133		
Potassium	N/A	5.9		
Conductivity	N/A	4700		
T-Alkalinity	N/A	316		
CO ₃	N/A	0		
HCO ₃	N/A	386		

Appendix B

Analytical Results



ARDINAL LABORATORIES

PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
SAFETY & ENVIRONMENTAL SOLUTIONS, INC.
ATTN: BOB ALLEN
703 E. CLINTON, SUITE 103
HOBBS, NM 88240
FAX TO: (505) 393-4388

Receiving Date: 03/27/00
Reporting Date: 04/07/00
Project Number: NOT GIVEN
Project Name: CHEVRON-DYNEGY
Project Location: COOPER/MONUMENT

Sampling Date: 03/25/00
Sample Type: GROUNDWATER
Sample Condition: COOL & INTACT
Sample Received By: AH
Analyzed By: AH

LAB NUMBER	SAMPLE ID	Na (mg/L)	Ca (mg/L)	Mg (mg/L)	K (mg/L)	Conductivity (μ mhos/cm)	T-Alkalinity (mgCaCO ₃ /L)
ANALYSIS DATE:		04/06/00	03/29/00	03/29/00	03/29/00	03/29/00	03/29/00
H4743-1	MW #1	2065	445	417	11.6	11.46	232
H4743-2	MW #2	1091	186	152	6.8	5770	552
H4743-3	MW #3	801	158	236	8.5	5550	624
H4743-4	MW #4	1224	178	228	12.1	6950	800
H4743-5	MW #5	1815	283	441	14.5	10370	532
H4743-6	MW #6	685	182	133	5.9	4700	316
Quality Control		4.988	52.0	53.0	5.06	1392	NR
True Value QC		5.000	50.0	50.0	5.00	1413	NR
% Accuracy		100	104	106	101	99	NR
Relative Percent Difference		1.0	0	0	0.6	0.2	NR
METHODS:	Std. Methods	273.1*	3500-Ca-D	3500-Mg E	8049**	120.1*	310.1*

*EPA 600/4-79-020

**HACH-Handbook of Water Analysis

		Cl ⁻ (mg/L)	SO ₄ (mg/L)	CO ₃ (mg/L)	HCO ₃ (mg/L)	pH (s.u.)	TDS (mg/L)
ANALYSIS DATE:		04/03/00	04/06/00	03/29/00	03/29/00	03/29/00	04/04/00
H4743-1	MW #1	2433	2899	0	282	7.26	9212
H4743-2	MW #2	1216	1180	0	673	7.18	3898
H4743-3	MW #3	1086	1230	0	761	7.08	4058
H4743-4	MW #4	1554	1040	0	976	7.52	4730
H4743-5	MW #5	2059	2254	0	649	7.14	8054
H4743-6	MW #6	1104	533	0	386	7.33	3096
Quality Control		1001	49.39	NR	971	6.98	NR
True Value QC		1000	50.00	NR	1000	7.00	NR
% Accuracy		100	99	NR	97	100	NR
Relative Percent Difference		2.4	3.5	NR	0	0.1	
METHODS:	Std. Methods	4500-Cl-B	375.4*	310.1*	310.1*	150.1*	160.1*

Amy Hill
Chemist

4/7/00
Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates, or persons claiming out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

H4743C.XLS



ARDINAL LABORATORIES

PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
SAFETY & ENVIRONMENTAL SOLUTIONS, INC.
ATTN: BOB ALLEN
703 E. CLINTON, SUITE 103
HOBBS, NM 88240
FAX TO: (505) 393-4388


Receiving Date: 03/27/00
Reporting Date: 03/31/00
Project Number: NOT GIVEN
Project Name: CHEVRON-DYNEGY
Project Location: COOPER/MONUMENT

Sampling Date: 03/25/00
Sample Type: GROUNDWATER
Sample Condition: COOL & INTACT
Sample Received By: AH
Analyzed By: AH

LAB NUMBER	SAMPLE ID	F (mg/L)	Ag (mg/L)	Mn (mg/L)	Pb (mg/L)
ANALYSIS DATE		03/30/00	03/30/00	03/30/00	03/30/00
H4743-1	MW #1	1.90	0.051	<0.2	0.597
H4743-2	MW #2	1.87	<0.05	0.324	0.580
H4743-3	MW #3	1.92	<0.05	<0.2	0.611
H4743-4	MW #4	1.83	<0.05	0.403	0.603
H4743-5	MW #5	1.98	0.103	0.380	0.747
H4743-6	MW #6	1.97	0.088	<0.2	0.770
Quality Control		0.95	1.020	0.971	5.391
True Value QC		1.00	1.000	1.000	5.000
% Accuracy		95	102	97	108
Relative Percent Difference		4.2	0.5	0.4	0.5

METHODS:	EPA 600/4-79-020	4500-FD*	272.1	243.1	239.1
----------	------------------	----------	-------	-------	-------

*Std Methods

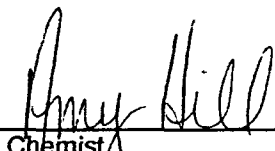
Chemist

03/31/00
Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

H4743M.XLS



ARDINAL LABORATORIES

PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
SAFETY & ENVIRONMENTAL SOLUTIONS, INC.
ATTN: BOB ALLEN
703 E. CLINTON, SUITE 103
HOBBS, NM 88240
FAX TO: (505) 393-4388

Receiving Date: 03/27/00
Reporting Date: 03/30/00
Project Number: NOT GIVEN
Project Name: CHEVRON-DYNEGY
Project Location: COOPER/MONUMENT

Sampling Date: 03/25/00
Sample Type: GROUNDWATER
Sample Condition: COOL & INTACT
Sample Received By: AH
Analyzed By: BC

LAB NO.	SAMPLE ID	TPH (mg/L)	BENZENE (mg/L)	TOLUENE (mg/L)	ETHYL BENZENE (mg/L)	TOTAL XYLENES (mg/L)
ANALYSIS DATE:		03/29/00	03/27/00	03/27/00	03/27/00	03/27/00
H4743-1	MW #1	<1.0	<0.002	<0.002	<0.002	<0.006
H4743-2	MW #2	2.36	<0.002	<0.002	<0.002	<0.006
H4743-3	MW #3	1.47	<0.002	<0.002	<0.002	<0.006
H4743-4	MW #4	1.11	<0.002	<0.002	<0.002	<0.006
H4743-5	MW #5	2.38	<0.002	<0.002	<0.002	<0.006
H4743-6	MW #6	<1.0	<0.002	<0.002	<0.002	<0.006
Quality Control		5.52	0.094	0.096	0.096	0.290
True Value QC		6.00	0.100	0.100	0.100	0.300
% Recovery		92.0	94.2	96.3	96.3	96.6
Relative Percent Difference		8.1	6.1	3.3	4.4	5.6

METHODS: TRPHC - EPA 600/4-79-020, 418.1; BTEX - EPA 624

Burgess P. Roche
Chemist

3/30/00
Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

ORDINAL LABORATORIES INC.

2111 Beechwood, Abilene, TX 79603 101 East Marland, Hobbs, NM 88240
(915) 673-7001 Fax (915) 673-7020 (505) 393-2326 Fax (505) 393-2476

Page of

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

[illegible]

+ Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2476.