

1R - 426-26

REPORTS

DATE:

7/29/2003

1R-426-26

FINAL REPORT

**RICE OPERATING COMPANY
JUNCTION BOX FINAL REPORT**

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX DIMENSIONS - FEET		
BD	L-1	L	1	22S	36E	Lea	Length	Width	Depth
							7	5	7.5

LAND TYPE: BLM _____ STATE _____ FEE LANDOWNER Nymeyer Property _____ OTHER _____

Depth to Groundwater 125 feet NMOCD SITE ASSESSMENT RANKING SCORE: 0

Date Started 5/9/2003 Date Completed 6/16/2003 OCD Witness No

Soil Excavated 222 cubic yards Excavation Length 25 Width 20 Depth 15 feet

Soil Disposed 0 cubic yards Offsite Facility n/a Location n/a

FINAL ANALYTICAL RESULTS: Sample Date 5/16/2003 Sample Depth 12' bgs

Procure 5-point composite sample of bottom and 4-point composite sample of sidewalls. TPH, BTEX and Chloride laboratory test results completed by using an approved lab and testing procedures pursuant to NMOCD guidelines.

Sample Location	Benzene mg/kg	Toluene mg/kg	Ethyl Benzene mg/kg	Total Xylenes mg/kg	GRO mg/kg	DRO mg/kg	Chlorides mg/kg
SIDEWALLS	<0.025	<0.025	<0.025	<0.025	<10.0	1730	106
BOTTOM	<0.025	<0.025	<0.025	<0.025	<10.0	226	160
REMEDIATED	<0.025	<0.025	<0.025	<0.025	<10.0	282	<20

General Description of Remedial Action: The site was delineated vertically and laterally producing a 25' x 20' x 12' bgs excavation. Chloride impact was minimal throughout and TPH concentrations exhibited a significant decline vertically and laterally below NMOCD guidelines. The excavated soil was landfarmed on site and then backfilled into the excavation. TPH and chloride concentrations left in place are not threatening to groundwater at 125 below the surface. The disturbed surface has been re-seeded with native vegetation and is expected to recover at a normal rate.

cc: chloride graph, lab results, photos

CHLORIDE FIELD TESTS

LOCATION	DEPTH (ft)	ppm
Vetical	4	750
	8	500
	12	420
10' N	12	275
15' S	3	400
10' E	12	275
10' W	12	250
Bottom Comp.	12	400
Wall Comp.	n/a	275
Remed. Comp.	n/a	100

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

DATE 7/29/2003 PRINTED NAME Kristin Farris
SIGNATURE *Kristin Farris* TITLE Project Scientist


CHLORIDE CONCENTRATION CURVE

RICE Operating Company

BD jct. L-1
T22S, R36E

Depth bgs (ft)	[Cl-] ppm
2	700
4	750
6	620
8	500
10	720
12	420

Groundwater = 125 ft

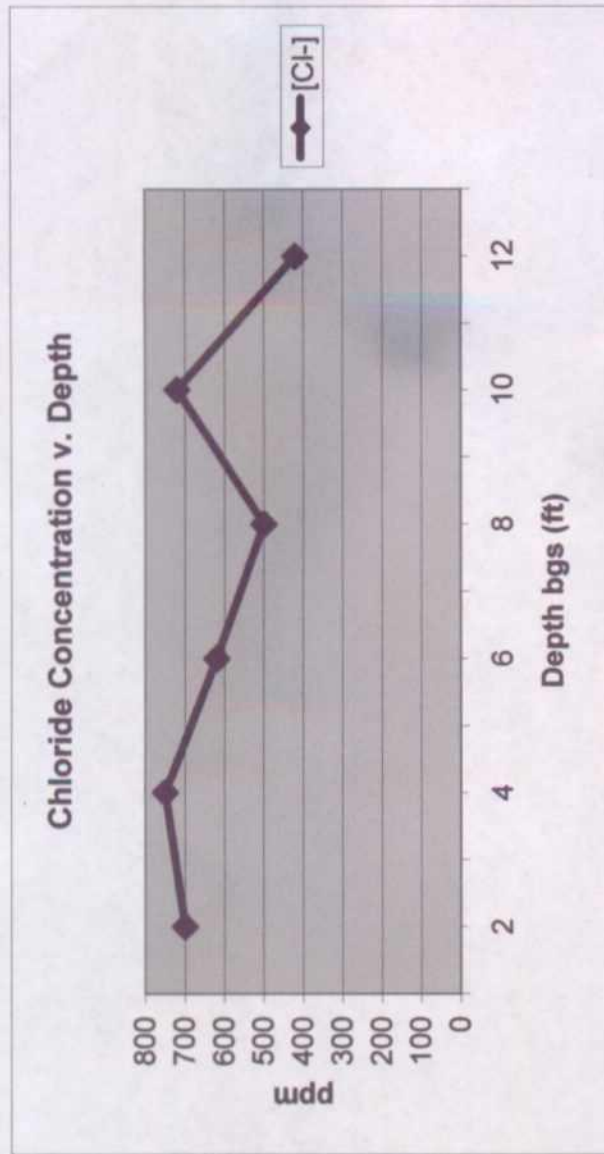


BD jct. L-1



Old Jct. Box (May 2003)



25 ft x 20 ft x 15 ft deep Excavation (June 2003)

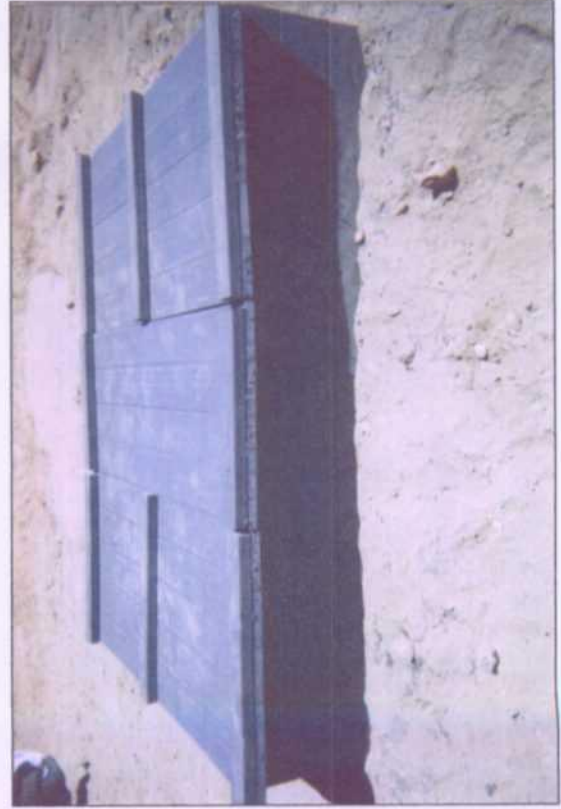

New Watertight Junction Box (July 2003)



Seeding & Fertilizing Surface (July 29, 2003)

ANALYTICAL REPORT

Prepared for:

GABRIEL TERRAZAS
RICE OPERATING COMPANY
122 WEST TAYLOR
HOBBS, NM 88240

Project: Jct. Box L-1
PO#: 755
Order#: G0306526
Report Date: 05/20/2003

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

RICE OPERATING COMPANY
122 WEST TAYLOR
HOBBS, NM 88240
505-397-1471

Order#: G0306526
Project:
Project Name: Jct. Box L-1
Location: BD

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas, unless otherwise noted.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u>	<u>Date / Time</u>	<u>Container</u>	<u>Preservative</u>
			<u>Collected</u>	<u>Received</u>		
0306526-01	Wall Comp.	SOIL	5/16/03	5/16/03 19:55	4 oz glass	Ice
	<u>Lab Testing:</u>	Rejected: No		Temp: 4 C		
	8015M					
	8021B/5030 BTEX					
	Chloride					
0306526-02	Bottom Comp. @ 12'	SOIL	5/16/03	5/16/03 19:55	4 oz glass	Ice
	<u>Lab Testing:</u>	Rejected: No		Temp: 4 C		
	8015M					
	8021B/5030 BTEX					
	Chloride					

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

GABRIEL TERRAZAS
RICE OPERATING COMPANY
122 WEST TAYLOR
HOBBS, NM 88240

Order#: G0306526
Project:
Project Name: Jct. Box L-1
Location: BD

Lab ID: 0306526-01
Sample ID: Wall Comp.

8015M

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
		5/19/03	1	1	CK	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	1,730	10.0
TOTAL, C6-C35	1,730	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	136%	70	130
1-Chlorooctadecane	108%	70	130

8021B/5030 BTEX

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
0005574-02		5/19/03 16:41	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	<0.025	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	80%	80	120
Bromofluorobenzene	100%	80	120

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

GABRIEL TERRAZAS
RICE OPERATING COMPANY
122 WEST TAYLOR
HOBBS, NM 88240

Order#: G0306526
Project:
Project Name: Jct. Box L-1
Location: BD

Lab ID: 0306526-02
Sample ID: Bottom Comp. @ 12'

8015M

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
		5/19/03	1	1	CK	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	226	10.0
TOTAL, C6-C35	226	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	132%	70	130
1-Chlorooctadecane	100%	70	130

8021B/5030 BTEX

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
0005574-02		5/19/03 17:03	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	<0.025	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	83%	80	120
Bromofluorobenzene	102%	80	120

Approval:

Raland K. Tuttle, Lab Director, QA Officer
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

Date

5-20-03

DL = Diluted out N/A = Not Applicable RL = Reporting Limit

Page 2 of 2

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

GABRIEL TERRAZAS
RICE OPERATING COMPANY
122 WEST TAYLOR
HOBBS, NM 88240

Order#: G0306526
Project:
Project Name: Jct. Box L-1
Location: BD

Lab ID: 0306526-01
Sample ID: Wall Comp.

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	106	mg/kg	1	20	9253	5/19/03	CK

Lab ID: 0306526-02
Sample ID: Bottom Comp. @ 12'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	160	mg/kg	1	20	9253	5/19/03	CK

Approval: Raland K Tuttle 5-20-03
Raland K. Tuttle, Lab Director, QA Officer Date
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8015M

Order#: G0306526

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005569-02			<10.0		
CONTROL	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005569-03		952	835	87.7%	
CONTROL DUP	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005569-04		952	820	86.1%	1.8%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005569-05		1000	755	75.5%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8021B/5030 BTEX

Order#: G0306526

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005574-02			<0.025		
Toluene-mg/kg		0005574-02			<0.025		
Ethylbenzene-mg/kg		0005574-02			<0.025		
p/m-Xylene-mg/kg		0005574-02			<0.025		
o-Xylene-mg/kg		0005574-02			<0.025		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306512-01	0	0.1	0.100	100.0%	
Toluene-mg/kg		0306512-01	0	0.1	0.098	98.0%	
Ethylbenzene-mg/kg		0306512-01	0	0.1	0.094	94.0%	
p/m-Xylene-mg/kg		0306512-01	0	0.2	0.194	97.0%	
o-Xylene-mg/kg		0306512-01	0	0.1	0.090	90.0%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306512-01	0	0.1	0.103	103.0%	3.0%
Toluene-mg/kg		0306512-01	0	0.1	0.102	102.0%	4.0%
Ethylbenzene-mg/kg		0306512-01	0	0.1	0.097	97.0%	3.1%
p/m-Xylene-mg/kg		0306512-01	0	0.2	0.200	100.0%	3.0%
o-Xylene-mg/kg		0306512-01	0	0.1	0.092	92.0%	2.2%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005574-05		0.1	0.104	104.0%	
Toluene-mg/kg		0005574-05		0.1	0.103	103.0%	
Ethylbenzene-mg/kg		0005574-05		0.1	0.093	93.0%	
p/m-Xylene-mg/kg		0005574-05		0.2	0.188	94.0%	
o-Xylene-mg/kg		0005574-05		0.1	0.085	85.0%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

Test Parameters

Order#: G0306526

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005571-01			<20.0		
Chloride-mg/kg		0005575-01			<20.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306487-02	8510	10000	18200	96.9%	
Chloride-mg/kg		0306526-02	160	500	638	95.6%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306487-02	8510	10000	18200	96.9%	0.0%
Chloride-mg/kg		0306526-02	160	500	656	99.2%	2.8%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005571-04		5000	5050	101.0%	
Chloride-mg/kg		0005575-04		5000	5050	101.0%	

CASE NARRATIVE

ENVIRONMENTAL LAB OF TEXAS

Prepared for:

RICE OPERATING COMPANY
122 WEST TAYLOR
HOBBS, NM 88240

Order#: G0306526

Project: Jct. Box L-1

The following samples were received as indicated below and on the attached Chain of Custody record. All analyses were performed within the holding time and with acceptable quality control results unless otherwise noted.

SAMPLE ID	LAB ID	MATRIX	Date Collected	Date Received
Wall Comp.	0306526-01	SOIL	05/16/2003	05/16/2003
Bottom Comp. @ 12'	0306526-02	SOIL	05/16/2003	05/16/2003

Surrogate recoveries on the 8015M are outside control limits due to matrix interference of coeluting compounds. (0306526-01,02)

The enclosed results of analyses are representative of the samples as received by the laboratory. Environmental Lab of Texas makes no representations or certifications as to the methods of sample collection, sample identification, or transportation handling procedures used prior to our receipt of samples. To the best of my knowledge, the information contained in this report is accurate and complete.

Approved By:

Ralanck J. J. J.
Environmental Lab of Texas I, Ltd.

Date:

5-20-03

Environmental Lab of Texas, Inc.

12600 West I-20 East
Odessa, Texas 79763

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

Project Manager:

Gabriel R Terrazas

Company Name

Rice

Company Address:

122 West Taylor

City/State/Zip:

Hobbs n/v. 88240

Telephone No:

Fax No: 397-1471

Sampler Signature:

Shiloh

[illegible]

Special Instructions:

Law Reported to RICE

Relinquished by:

Requisitioned by: John M. Long

Date	Time
------	------

5-16-03 1:20

Relinquished by:

Oliver

Date	Time
------	------

5-16/09 19:5

Received by:

Date _____

Time

Received by ELDT

Received by ELOP
R.L. Clark

ਉਸਤਾਦ

Time

Sample Containers Intact?	Y	N
---------------------------	---	---

Temperature Upon Receipt

Laboratory Comments:

400

ANALYTICAL REPORT

Prepared for:

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Project: L-1

PO#:

Order#: G0306743

Report Date: 06/24/2003

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

Rice Operating
122 W. Taylor
Hobbs, NM 88240
505-397-1471

Order#: G0306743
Project:
Project Name: L-1
Location: BD

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas, unless otherwise noted.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u> <u>Collected</u>	<u>Date / Time</u> <u>Received</u>	<u>Container</u>	<u>Preservative</u>
0306743-01	Backfill Comp.	SOIL	6/16/03 15:00	6/17/03 8:00	4 oz glass	Ice
<u>Lab Testing:</u>		Rejected: No	Temp: 5.0 C			
8015M						
8021B/5030 BTEX						
Chloride						

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306743
Project:
Project Name: L-1
Location: BD

Lab ID: 0306743-01
Sample ID: Backfill Comp.

8015M

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
		6/17/03	1	1	WL	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	282	10.0
TOTAL, C6-C35	282	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	105%	70	130
1-Chlorooctadecane	103%	70	130

8021B/5030 BTEX

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
0005943-02		6/23/03 18:35	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	<0.025	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	98%	80	120
Bromofluorobenzene	89%	80	120

Approval:

Raland K. Tuttle, Lab Director, QA Officer
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

Date

DL = Diluted out N/A = Not Applicable RL = Reporting Limit

Page 1 of 1

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306743
Project:
Project Name: L-1
Location: BD

Lab ID: 0306743-01
Sample ID: Backfill Comp.

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	<20	mg/kg	1	20	9253	6/19/03	SB

Approval: Raland K. Tuttle 6-25-03
Raland K. Tuttle, Lab Director, QA Officer Date
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8015M

Order#: G0306743

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005870-02			<10.0		
CONTROL	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005870-03		952	1123	118.0%	
CONTROL DUP	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005870-04		952	1141	119.9%	1.6%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0005870-05		1000	933	93.3%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8021B/5030 BTEX

Order#: G0306743

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005943-02			<0.025		
Toluene-mg/kg		0005943-02			<0.025		
Ethylbenzene-mg/kg		0005943-02			<0.025		
p/m-Xylene-mg/kg		0005943-02			<0.025		
o-Xylene-mg/kg		0005943-02			<0.025		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306740-04	0	0.1	0.101	101.%	
Toluene-mg/kg		0306740-04	0	0.1	0.105	105.%	
Ethylbenzene-mg/kg		0306740-04	0	0.1	0.105	105.%	
p/m-Xylene-mg/kg		0306740-04	0	0.2	0.215	107.5%	
o-Xylene-mg/kg		0306740-04	0	0.1	0.105	105.%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306740-04	0	0.1	0.102	102.%	1.%
Toluene-mg/kg		0306740-04	0	0.1	0.106	106.%	0.9%
Ethylbenzene-mg/kg		0306740-04	0	0.1	0.106	106.%	0.9%
p/m-Xylene-mg/kg		0306740-04	0	0.2	0.218	109.%	1.4%
o-Xylene-mg/kg		0306740-04	0	0.1	0.106	106.%	0.9%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005943-05		0.1	0.102	102.%	
Toluene-mg/kg		0005943-05		0.1	0.103	103.%	
Ethylbenzene-mg/kg		0005943-05		0.1	0.102	102.%	
p/m-Xylene-mg/kg		0005943-05		0.2	0.208	104.%	
o-Xylene-mg/kg		0005943-05		0.1	0.102	102.%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

Test Parameters

Order#: G0306743

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005908-01			<20		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306729-08	266	500	762	99.2%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306729-08	266	500	744	95.6%	2.4%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005908-04		5000	4960	99.2%	

12600 West I-20 East
Odessa, Texas 79763

Phone: 915-563-1800
Fax: 915-563-1713

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

Kristin Farris

Project Name:

Rice Operating

Project #:

122 W Taylor

Project Loc:

Hobbs, Nov 88 240

註
○
△

(505) 631-9174

Fax No:

Sampler Signature:

105

[illegible]

Special Instructions

Fax to Rice

Relinquished by:

Date _____

Time

Received by:

Date _____

Time

Received by:

Relinquished by:

Name

Time

21/10/2007

Time

Date

100

Time

Date _____

Relinquished by:

1001

1

15

167

Time

Name

Relinquished by:

Sample Containers Intact? Temperature Upon Receipt: Laboratory Comments:	
---	--

5