

1R - 427 - 97

REPORTS

DATE:

1-16-2002

100427-97
CL-SAR

**RICE OPERATING COMPANY
JUNCTION BOX FINAL REPORT**

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX DIMENSIONS - FEET		
EME	N-16-1	N	16	20S	37E	LEA	Length 10	Width 10	Depth 5

LAND TYPE: BLM _____ STATE X FEE LANDOWNER _____ OTHER _____

Depth to Groundwater 32 feet NMOCD SITE ASSESSMENT RANKING SCORE: 20

Date Started 12/17/2001 Date Completed 01/15/2002 OCD Witness NO

Soil Excavated 210 cubic yards Excavation Length 30 Width 30 Depth 7 feet

Soil Disposed 24 cubic yards Offsite Facility SUNDANCE Location EUNICE, NM

FINAL ANALYTICAL RESULTS: Sample Date 01/04/2002 Sample Depth 7'

Procure 5-point composite sample of bottom and 4-point composite sample of sidewalls. TPH, BTEX and Chloride laboratory test results completed by using an approved lab and testing procedures pursuant to NMOCD guidelines.

Sample Location	Benzene mg/kg	Toluene mg/kg	Ethyl Benzene mg/kg	Total Xylenes mg/kg	GRO mg/kg	DRO mg/kg	Chlorides mg/kg
SIDEWALLS	<0.005	<0.005	<0.005	<0.015	<50	323	224
BOTTOM	<0.005	<0.005	<0.005	<0.015	<50	264	560
Boring @ 28'	<0.005	<0.005	<0.005	<0.015	<50	<50	208

General Description of Remedial Action: The site was delineated vertically and laterally.


The vertical delineation found chlorides at 500 ppm, above NMOCD guidelines.

A soil boring was completed 12/20/01, and field tests indicated impact stopped before reaching groundwater. A boring sample from 28' was sent to the lab for confirmation. The high impact soil was hauled to a permitted disposal facility and the remaining soil was blended with fresh soil and used as backfill. A compacted clay liner was installed as a barrier to vertical transmissivity. Installed a water tight junction box and backfilled. Natural attenuation will remediate the remaining hydrocarbons.

CHLORIDE FIELD TESTS

LOCATION	DEPTH	mg/kg
SIDEWALLS	5'	250
BOTTOM	7'	500
Vertical Trench	15'	500
Soil Boring	6'	100
	10'	75
	16'	225
	22'	325
	26'	175
	28'	75

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

DATE January 16, 2002 PRINTED NAME D. E. Anderson
SIGNATURE  TITLE Project Leader - Environmental



ARDINAL LABORATORIES

PHONE (505) 393-2328 • 101 E. MARLAND • HOBBS, NM 88240

Sampling Date: 01/03/02
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: BC
Analyzed By: BC/AH

LAB NUMBER	SAMPLE ID	GRO (C ₆ -C ₁₀) (mg/Kg)	DRO (>C ₁₀ -C ₂₈) (mg/Kg)	Cl ⁻ (mg/Kg)
ANALYSIS DATE		01/08/02	01/08/02	01/09/02
H6397-1	WALL COMPOSITE	<50	323	224
H6397-2	BOTTOM COMPOSITE	<50	264	560
Quality Control		817	737	1040
True Value QC		800	800	1000
% Recovery		102	92.1	104
Relative Percent Difference		7.0	3.3	1.0

*Analyses performed on 1:4 w:v aqueous extracts.

Chemist

Date _____

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

**CARDINAL
LABORATORIES**

PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

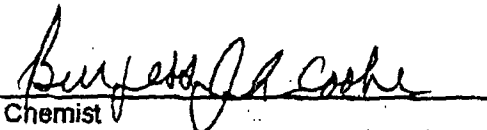
ANALYTICAL RESULTS FOR
RICE OPERATING CO.
ATTN: CHRIS RODRIGUEZ
122 W. TAYLOR
HOBBS, NM 88240
FAX TO: (505) 397-1471

Receiving Date: 01/08/02
Reporting Date: 01/09/02
Project Number: JCT. N-16-1
Project Name: WALL & BOTTOM COMPOSITE
Project Location: EME

Sampling Date: 01/03/02
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: BC
Analyzed By: BC

LAB NUMBER	SAMPLE ID	BENZENE (mg/Kg)	TOLUENE (mg/Kg)	ETHYL BENZENE (mg/Kg)	TOTAL XYLENES (mg/Kg)
ANALYSIS DATE		01/08/02	01/08/02	01/08/02	01/08/02
H6397-1	WALL COMPOSITE	<0.005	<0.005	<0.005	<0.015
H6397-2	BOTTOM COMPOSITE	<0.005	<0.005	<0.005	<0.015
Quality Control		0.102	0.102	0.105	0.309
True Value QC		0.100	0.100	0.100	0.300
% Recovery		102	102	105	103
Relative Percent Difference		0.6	0.3	1.4	2.7

METHOD: EPA SW-846 8260


Chemist


Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

H6397B.XLS



2111 Beechwood, Abilene, TX 79603 101 East Marland, Hobbs, NM 88240
(915) 673-7001 Fax (915) 673-7020 (505) 393-2326 Fax (505) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

+ Cardinal cannot accept verbal changes. Please fax written changes to 915-673-7020.

Atkins Engineering
Associates, Inc.

2904 W. 2nd St., Roswell, NM 88202-3156

LOG OF BORING Rice N-16-1 TH1

(Page 1 of 1)

Rice Operating Company
122 West Taylor
Hobbs, New Mexico 88240

Contact: Donnie Anderson

Job #Riceoil.air.01

Date : 12-20-01

Drill Start : 0955

Drill End : 1045

Site Location : 4.25 mi. South of Monument, NM

Auger Type : Hollow Stem

Logged By : Mort Bates

Boring Location : South edge of pit

Depth in feet	GRAPHIC	USCS	Samples	DESCRIPTION	Lab
0				Poorly graded sand, tan, loose, dry	
5	SP		100 75		
10			75	Poorly graded sand, redish, tan, loose, damp	
15	SP		50 50 225 275		
20			150 325 300		
25	SP		175 75 50	Sand, tan, loose, moist	
30					
35					

Backfill cuttings

Bentonite seal



PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
RICE OPERATING CO.
ATTN: CHRIS RODRIGUEZ
122 W. TAYLOR
HOBBS, NM 88240
FAX TO: (505) 397-1471

Receiving Date: 01/15/02
Reporting Date: 01/15/02
Project Number: N-16-1
Project Name: SOIL BORE @ 28' BGS
Project Location: EME

Sampling Date: 12/20/01
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: BC
Analyzed By: BC/HM

LAB NUMBER	SAMPLE ID	GRO (C ₆ -C ₁₀) (mg/Kg)	DRO (C ₁₀ -C ₂₈) (mg/Kg)	CI* (mg/Kg)
------------	-----------	--	---	----------------

ANALYSIS DATE	01/15/02	01/15/02	01/15/02
H6435-1 SOIL BORE @ 28' BGS	<50	<50	208
Quality Control	801	742	1040
True Value QC	800	800	1000
% Recovery	100	92.8	104
Relative Percent Difference	1.8	7.7	1.0

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; CI: Std. Methods 4500-CI^B

*Analysis performed on a 1:4 w:v aqueous extract.

Chris Rodriguez
Chemist

1/16/02
Date

H6435A.XLS
PLEASE NOTE: Cardinal and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.


CARDINAL
LABORATORIES

PHONE (915) 873-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

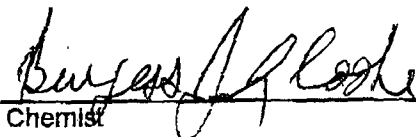
 ANALYTICAL RESULTS FOR
 RICE OPERATING CO.
 ATTN: CHRIS RODRIGUEZ
 122 W. TAYLOR
 HOBBS, NM 88240
 FAX TO: (505) 397-1471

 Receiving Date: 01/15/02
 Reporting Date: 01/16/02
 Project Number: N-16-1
 Project Name: SOIL BORE @ 28' BGS
 Project Location: EME

 Sampling Date: 12/20/01
 Sample Type: SOIL
 Sample Condition: COOL & INTACT
 Sample Received By: BC
 Analyzed By: BC

LAB NUMBER	SAMPLE ID	BENZENE (mg/Kg)	TOLUENE (mg/Kg)	ETHYL BENZENE (mg/Kg)	TOTAL XYLENES (mg/Kg)
ANALYSIS DATE		01/15/02	01/15/02	01/15/02	01/15/02
H0435-1	SOIL BORE @ 28' BGS	<0.005	<0.005	<0.005	<0.015
Quality Control		0.099	0.102	0.106	0.307
True Value QC		0.100	0.100	0.100	0.300
% Recovery		99.3	102	106	102
Relative Percent Difference		5.5	9.1	7.5	5.3

METHOD: EPA SW-846 8260


 Chemist

 1/16/02
 Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

H6435B.XLS

Sundance Services, Inc. P.O. Box 1737 ★ Eunice, NM 88231 (505) 394-2511		N2		48704	
LEASE OPERATOR/SHIPPER/COMPANY: _____					
LEASE NAME: _____					
TRANSPORTER COMPANY: _____					
DATE: _____ VEHICLE NO.: _____ DRIVER NO.: _____					
CHARGE TO: _____					
TYPE OF MATERIAL					
☐ Production Water ☐ Tank Bottoms ☐ Other Material: _____					
☐ Drilling Fluids ☐ Contaminated soil ☐ BS&W Content: _____					
☐ Completion Fluids ☐ C-117 No.: _____					
Description: _____					
VOLUME OF MATERIAL ☐ BBLs. _____ : ☐ YARD _____ : ☐ _____					
AS A CONDITION TO SUNDANCE SERVICES, INC.'S ACCEPTANCE OF THE MATERIALS SHIPPED WITH THIS JOB TICKET, OPERATOR/SHIPPER REPRESENTS AND WARRANTS THAT THE WASTE MATERIAL SHIPPED HEREWITH IS MATERIAL EXEMPT FROM THE RESOURCE, CONSERVATION AND RECOVERY ACT OF 1976, AS AMENDED FROM TIME TO TIME, 40 U.S.C. § 6901, et seq., THE NM HEALTH AND SAF. CODE § 361.001, et seq., AND REGULATIONS RELATED THERETO, BY VIRTUE OF THE EXEMPTION AFFORDED DRILLING FLUIDS, PRODUCED WATERS, AND OTHER WASTE ASSOCIATED WITH THE EXPLORATION, DEVELOPMENT OR PRODUCTION OF CRUDE OIL OR NATURAL GAS OR GEOTHERMAL ENERGY.					
ALSO AS A CONDITION TO SUNDANCE SERVICES, INC.'S ACCEPTANCE OF THE MATERIALS SHIPPED WITH THIS JOB TICKET, TRANSPORTER REPRESENTS AND WARRANTS THAT ONLY THE MATERIAL DELIVERED BY OPERATOR/SHIPPER TO TRANSPORTER IS NOW DELIVERED BY TRANSPORTER TO SUNDANCE SERVICES, INC.'S FACILITY FOR DISPOSAL.					
THIS WILL CERTIFY that the above Transporter loaded the material represented by this Transporter Statement at the above described location, and that it was tendered by the above described shipper. This will certify that no additional materials were added to this load, and that the material was delivered without incident.					
DRIVER: _____ (SIGNATURE)					
FACILITY REPRESENTATIVE: _____ (SIGNATURE)					
White-Sundance Canary-Sundance Act#1 Pink-Sundance Act#2 Gold-Transporter Revised 12/27/95					

Sundance Services, Inc. P.O. Box 1737 ★ Eunice, NM 88231 (505) 394-2511		N2		48704	
LEASE OPERATOR/SHIPPER/COMPANY: _____					
LEASE NAME: _____					
TRANSPORTER COMPANY: _____					
DATE: _____ VEHICLE NO.: _____ DRIVER NO.: _____					
CHARGE TO: _____					
TYPE OF MATERIAL					
☐ Production Water ☐ Tank Bottoms ☐ Other Material: _____					
☐ Drilling Fluids ☐ Contaminated soil ☐ BS&W Content: _____					
☐ Completion Fluids ☐ C-117 No.: _____					
Description: _____					
VOLUME OF MATERIAL ☐ BBLs. _____ : ☐ YARD _____ : ☐ _____					
AS A CONDITION TO SUNDANCE SERVICES, INC.'S ACCEPTANCE OF THE MATERIALS SHIPPED WITH THIS JOB TICKET, OPERATOR/SHIPPER REPRESENTS AND WARRANTS THAT THE WASTE MATERIAL SHIPPED HEREWITH IS MATERIAL EXEMPT FROM THE RESOURCE, CONSERVATION AND RECOVERY ACT OF 1976, AS AMENDED FROM TIME TO TIME, 40 U.S.C. § 6901, et seq., THE NM HEALTH AND SAF. CODE § 361.001, et seq., AND REGULATIONS RELATED THERETO, BY VIRTUE OF THE EXEMPTION AFFORDED DRILLING FLUIDS, PRODUCED WATERS, AND OTHER WASTE ASSOCIATED WITH THE EXPLORATION, DEVELOPMENT OR PRODUCTION OF CRUDE OIL OR NATURAL GAS OR GEOTHERMAL ENERGY.					
ALSO AS A CONDITION TO SUNDANCE SERVICES, INC.'S ACCEPTANCE OF THE MATERIALS SHIPPED WITH THIS JOB TICKET, TRANSPORTER REPRESENTS AND WARRANTS THAT ONLY THE MATERIAL DELIVERED BY OPERATOR/SHIPPER TO TRANSPORTER IS NOW DELIVERED BY TRANSPORTER TO SUNDANCE SERVICES, INC.'S FACILITY FOR DISPOSAL.					
THIS WILL CERTIFY that the above Transporter loaded the material represented by this Transporter Statement at the above described location, and that it was tendered by the above described shipper. This will certify that no additional materials were added to this load, and that the material was delivered without incident.					
DRIVER: _____ (SIGNATURE)					
FACILITY REPRESENTATIVE: _____ (SIGNATURE)					
White-Sundance Canary-Sundance Act#1 Pink-Sundance Act#2 Gold-Transporter Revised 12/27/95					

**RICE OPERATING COMPANY
JUNCTION BOX FINAL REPORT**

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX DIMENSIONS - FEET		
EME	N-16-1	N	16	20S	37E	LEA	Length 10	Width 10	Depth 5

LAND TYPE: BLM _____ STATE X FEE LANDOWNER _____ OTHER _____

Depth to Groundwater 32 feet NMOCD SITE ASSESSMENT RANKING SCORE: 20

Date Started 12/17/2001 Date Completed 01/15/2002 OCD Witness NO

Soil Excavated 210 cubic yards Excavation Length 30 Width 30 Depth 7 feet

Soil Disposed 24 cubic yards Offsite Facility SUNDANCE Location EUNICE, NM

FINAL ANALYTICAL RESULTS: Sample Date 01/04/2002 Sample Depth 7'

Procure 5-point composite sample of bottom and 4-point composite sample of sidewalls. TPH,
BTEX and Chloride laboratory test results completed by using an approved lab and testing
procedures pursuant to NMOCD guidelines.

Sample Location	Benzene mg/kg	Toluene mg/kg	Ethyl Benzene mg/kg	Total Xylenes mg/kg	GRO mg/kg	DRO mg/kg	Chlorides mg/kg
SIDEWALLS	<0.005	<0.005	<0.005	<0.015	<50	323	224
BOTTOM	<0.005	<0.005	<0.005	<0.015	<50	264	56

General Description of Remedial Action: The site was delineated vertically and laterally.

A soil boring was completed 12/20/01, and field tests indicated ground water was not impacted. A sample from 28' was sent to the lab for confirmation. The high impact soil was hauled to a permit disposal facility and the remaining soil was blended with fresh soil and used for backfill. A compact clay liner was installed as a barrier to vertical transmissivity and a water tight junction box was installed.

CHLORIDE FIELD TESTS

LOCATION	DEPTH	mg/kg
SIDEWALLS	5'	250
BOTTOM	7'	500

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY
KNOWLEDGE AND BELIEF.

DATE 01/16/2002 PRINTED NAME D. E. Anderson
SIGNATURE *D. E. Anderson* TITLE Project Leader - Environmental


CARDINAL
LABORATORIES

PHONE (916) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2328 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
 RICE OPERATING CO.
 ATTN: CHRIS RODRIGUEZ
 122 W. TAYLOR
 HOBBS, NM 88240
 FAX TO: (505) 397-1471

Receiving Date: 01/08/02
 Reporting Date: 01/09/02
 Project Number: JCT. N-16-1
 Project Name: WALL & BOTTOM COMPOSITE
 Project Location: EME

Sampling Date: 01/03/02
 Sample Type: SOIL
 Sample Condition: COOL & INTACT
 Sample Received By: BC
 Analyzed By: BC/AH

LAB NUMBER	SAMPLE ID	GRO (C ₆ -C ₁₀) (mg/Kg)	DRO (C ₁₀ -C ₂₈) (mg/Kg)	Cl* (mg/Kg)
------------	-----------	--	---	----------------

ANALYSIS DATE	01/08/02	01/08/02	01/09/02
H6397-1 WALL COMPOSITE	<50	323	224
H6397-2 BOTTOM COMPOSITE	<50	264	560
Quality Control	817	737	1040
True Value QC	800	800	1000
% Recovery	102	92.1	104
Relative Percent Difference	7.0	3.3	1.0

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; Cl: Std. Methods 4500-ClB

*Analyses performed on 1:4 w:v aqueous extracts.

Buffy J. Cash
 Chemist

1/9/02
 Date

H6397A.XLS
 PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

**CARDINAL
LABORATORIES**

PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

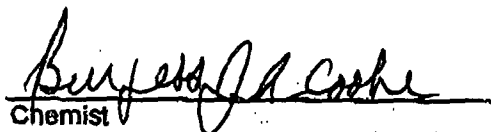
ANALYTICAL RESULTS FOR
RICE OPERATING CO.
ATTN: CHRIS RODRIGUEZ
122 W. TAYLOR
HOBBS, NM 88240
FAX TO: (505) 397-1471

Receiving Date: 01/08/02
Reporting Date: 01/08/02
Project Number: JCT. N-16-1
Project Name: WALL & BOTTOM COMPOSITE
Project Location: EME

Sampling Date: 01/03/02
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: BC
Analyzed By: BC

LAB NUMBER	SAMPLE ID	BENZENE (mg/Kg)	TOLUENE (mg/Kg)	ETHYL BENZENE (mg/Kg)	TOTAL XYLENES (mg/Kg)
ANALYSIS DATE		01/08/02	01/08/02	01/08/02	01/08/02
H6397-1	WALL COMPOSITE	<0.005	<0.005	<0.005	<0.015
H6397-2	BOTTOM COMPOSITE	<0.005	<0.005	<0.005	<0.015
Quality Control		0.102	0.102	0.105	0.309
True Value QC		0.100	0.100	0.100	0.300
% Recovery		102	102	105	103
Relative Percent Difference		0.6	0.3	1.4	2.7

METHOD: EPA SW-846 8260


Chemist


Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

H6397B.XLS

ARDINAL LABORATORIES, INC.

2111 Beechwood, Abilene, TX 79603 101 East Marland, Hobbs, NM 88240
(915) 673-7001 Fax (915) 673-7020 (505) 393-2326 Fax (505) 393-2476

Page of

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: <u>Pice Operating</u>		BILL TO		PO #:		ANALYSIS REQUEST																											
Project Manager: <u>Charles Rodriguez</u>		Company:																															
Address: <u>102 W. Taylor</u>		Attn:																															
City: <u>Hobbs</u>		Address:																															
Phone #: <u>595-9124</u>		City:																															
Fax #: <u>392-1471</u>		State:																															
Project #: <u>Jct N-16-1</u>		Zip:																															
Project Name: <u>Wall & Bottom Composite</u>		Phone #:																															
Project Location: <u>FME</u>		Fax #:																															
FOR LAB USE ONLY		PRES.		SAMPLING																													
LAB I.D.		Sample I.D.		(G)RAB OR (C)OMP.		# CONTAINERS		GROUNDWATER		WASTEWATER		MATRIX		DATE / TIME																			
H6397-1		wall Composite		C		2		SOIL		OIL		SLUDGE		OTHER:		ACID:		ICE / COOL		OTHER:													
-2		Bottom Composite		C		2		✓		✓		✓		✓		✓		✓		✓													

Atkins Engineering
Associates, Inc.

2904 W. 2nd St., Roswell, NM 88202-3156

LOG OF BORING Rice N-16-1 TH1

(Page 1 of 1)

Rice Operating Company
122 West Taylor
Hobbs, New Mexico 88240

Contact: Donnie Anderson

Job #Riceoil.air.01

Date : 12-20-01

Drill Start : 0955

Drill End : 1045

Site Location : 4.25 mi. South of Monument, NM

Auger Type : Hollow Stem

Logged By : Mort Bates

Boring Location : South edge of pit

Depth in feet	GRAPHIC	USCS	Samples	DESCRIPTION	Lab
0				Poorly graded sand, tan, loose, dry	
5		SP	100 75		
10			75	Poorly graded sand, redish, tan, loose, damp	
15			50		
20			50		
25		SP	225 275		
30			150		
35			325 300		
40				Sand, tan, loose, moist	
45		SP	175 75		
50			50		

Backfill cuttings

Bentonite seal


CARDINAL
LABORATORIES

PHONE (915) 673-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

ANALYTICAL RESULTS FOR
 RICE OPERATING CO.
 ATTN: CHRIS RODRIGUEZ
 122 W. TAYLOR
 HOBBS, NM 88240
 FAX TO: (505) 397-1471

Receiving Date: 01/15/02
 Reporting Date: 01/15/02
 Project Number: N-16-1
 Project Name: SOIL BORE @ 28' BGS
 Project Location: EME

Sampling Date: 12/20/01
 Sample Type: SOIL
 Sample Condition: COOL & INTACT
 Sample Received By: BC
 Analyzed By: BC/HM

LAB NUMBER SAMPLE ID	GRO (C ₆ -C ₁₀) (mg/Kg)	DRO (C ₁₀ -C ₂₈) (mg/Kg)	CI* (mg/Kg)
----------------------	--	---	----------------

ANALYSIS DATE	01/15/02	01/15/02	01/15/02
H6435-1 SOIL BORE @ 28' BGS	<50	<50	208
Quality Control	801	742	1040
True Value QC	800	800	1000
% Recovery	100	92.8	104
Relative Percent Difference	1.8	7.7	1.0

METHODS: TPH GRO & DRO: EPA SW-846 8015 M; CI: Std. Methods 4500-CI*
 *Analysis performed on a 1:4 w:v aqueous extract.

[Signature]
 Chemist

[Signature]
 Date 1/16/02

H6435A.XLS
 PLEASE NOTE: Cardinal and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

**ARDINAL**
LABORATORIES

PHONE (915) 873-7001 • 2111 BEECHWOOD • ABILENE, TX 79603

PHONE (505) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

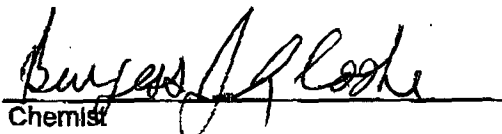
ANALYTICAL RESULTS FOR
RICE OPERATING CO.
ATTN: CHRIS RODRIGUEZ
122 W. TAYLOR
HOBBS, NM 88240
FAX TO: (505) 397-1471

Receiving Date: 01/15/02
Reporting Date: 01/16/02
Project Number: N-16-1
Project Name: SOIL BORE @ 28' BGS
Project Location: EME

Sampling Date: 12/20/01
Sample Type: SOIL
Sample Condition: COOL & INTACT
Sample Received By: BC
Analyzed By: BC

LAB NUMBER	SAMPLE ID	BENZENE (mg/Kg)	TOLUENE (mg/Kg)	ETHYL BENZENE (mg/Kg)	TOTAL XYLENES (mg/Kg)
ANALYSIS DATE		01/15/02	01/15/02	01/15/02	01/15/02
H6435-1	SOIL BORE @ 28' BGS	<0.005	<0.005	<0.005	<0.015
Quality Control		0.099	0.102	0.106	0.307
True Value QC		0.100	0.100	0.100	0.300
% Recovery		99.3	102	106	102
Relative Percent Difference		5.5	9.1	7.5	5.3

METHOD: EPA SW-846 8260


Chemist

1/16/02
Date

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above-stated reasons or otherwise.

H6435B.XLS

