

1R - 427-08

REPORTS

DATE:

4-28-2003

1R0427-8

DISCLOSURE REPORT

**RICE OPERATING COMPANY
JUNCTION BOX DISCLOSURE REPORT**

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX DIMENSIONS - FEET		
EME	D-25	D	25	20 S	36 E	Lea	Length	Width	Depth
							No Box		

LAND TYPE: BLM _____ STATE _____ FEE LANDOWNER Tuffy Cooper OTHER _____

Depth to Groundwater 68 feet NMOCD SITE ASSESSMENT RANKING SCORE: 10

Date Started 3/21/2002 Date Completed 4/8/2002 OCD Witness No

Soil Excavated 733 cubic yards Excavation Length 40 Width 33 Depth 15 feet

Soil Disposed 24 cubic yards Offsite Facility South Monument Location Monument, NM

FINAL ANALYTICAL RESULTS: Sample Date 4/1/2002 Sample Depth 15' bgs

Procure 5-point composite sample of bottom and 4-point composite sample of sidewalls. TPH, BTEX and Chloride laboratory test results completed by using an approved lab and testing procedures pursuant to NMOCD guidelines.

Sample Location	Benzene ug/kg	Toluene ug/kg	Ethyl Benzene ug/kg	Total Xylenes ug/kg	GRO mg/kg	DRO mg/kg	Chlorides mg/kg
SIDEWALLS	49.7	73.7	231	945	723	265	727
BOTTOM	50.8	284	228	1035	1210	538	727
REMEDiated	<0.025	<0.025	<0.025	0.029	<10.0	138	88.6

General Description of Remedial Action: A 40' x 33' x 15' excavation exhibited

relatively consistent chloride impact vertically and TPH concentrations did not meet NMOCD

guidelines so a compacted clay barrier was installed at the bottom of the excavation and the soil

was blended and backfilled. Because the concentrations did not meet guidelines,

this site is reported as a disclosure. An abandoned production battery is located 50' north

of this location.

A junction box was no longer required at this location.

cc: lab results, photos, disposal tickets


CHLORIDE FIELD TESTS

LOCATION	DEPTH (ft)	ppm
Vertical	5	500
	9	800
	13	800
	15	800
Wall comp.	n/a	650
bottom comp.	15	650

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

DATE 4/28/2003

PRINTED NAME Donnie Anderson

SIGNATURE 

TITLE Project Leader-Environmental

EME jct. D-25



Old jct. box (NORM removal)



New plumbing after NORM removal



Excavation



Backfilling

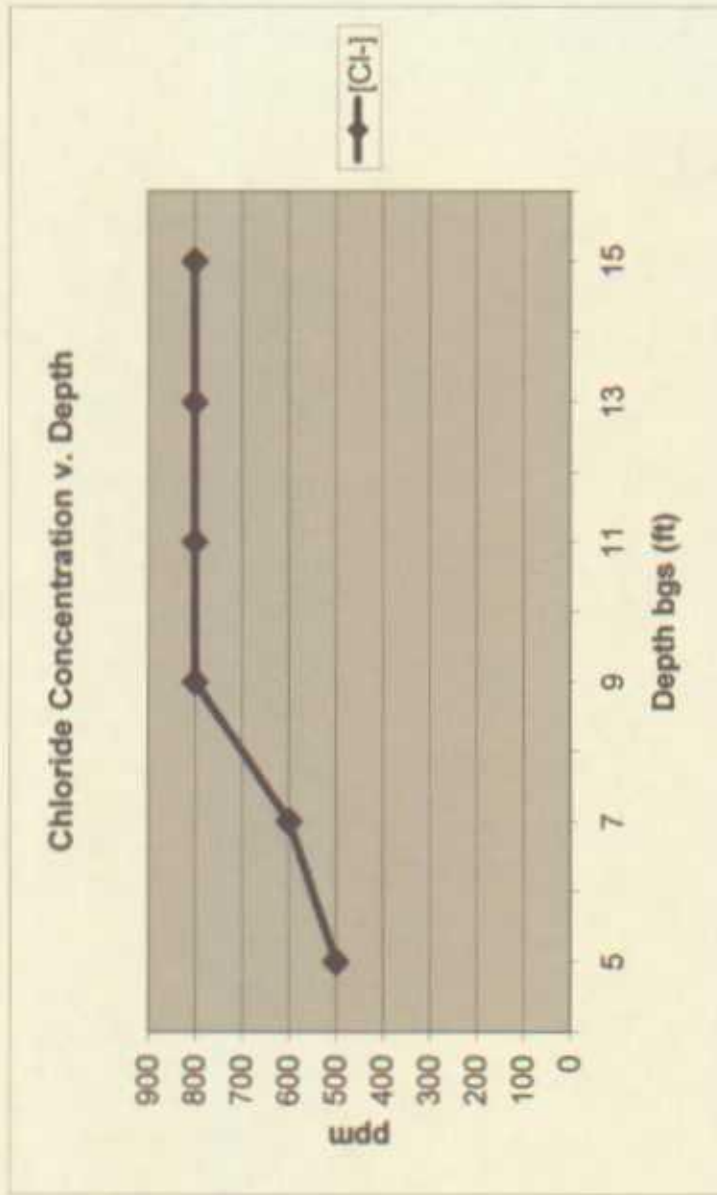
CHLORIDE CONCENTRATION CURVE

RICE Operating Company

EME jet, D-25

T20S R36E

Depth bgs (ft)	[Cl-] ppm
5	500
7	600
9	800
11	800
13	800
15	800



Groundwater = 68 ft

ANALYTICAL REPORT

Prepared for:

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Project: D-25

PO#:

Order#: G0306371

Report Date: 05/02/2003

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

Rice Operating
122 W. Taylor
Hobbs, NM 88240
505-397-1471

Order#: G0306371
Project:
Project Name: D-25
Location: EME

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas, unless otherwise noted.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u> <u>Collected</u>	<u>Date / Time</u> <u>Received</u>	<u>Container</u>	<u>Preservative</u>
0306371-01	Rem. Pile Comp	SOIL	4/28/03 11:00	4/29/03 14:10	4 oz Glass	Ice
<u>Lab Testing:</u>		Rejected: No	Temp:	4 C		
8015M						
8021B/5030 BTEX						
Chloride						

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306371
Project:
Project Name: D-25
Location: EME

Lab ID: 0306371-01
Sample ID: Rem. Pile Comp

8015M

Method <u>Blank</u>	Date <u>Prepared</u>	Date <u>Analyzed</u>	Sample <u>Amount</u>	Dilution <u>Factor</u>	Analyst	Method
		4/29/03	1	1	WL	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	138	10.0
TOTAL, C6-C35	138	10.0


Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	110%	70	130
1-Chlorooctadecane	102%	70	130

8021B/5030 BTEX

Method <u>Blank</u>	Date <u>Prepared</u>	Date <u>Analyzed</u>	Sample <u>Amount</u>	Dilution <u>Factor</u>	Analyst	Method
0005396-02		5/1/03 15:59	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	0.029	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	89%	80	120
Bromofluorobenzene	103%	80	120

Approval:  5-02-03
Raland K. Tuttle, Lab Director, QA Officer
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306371
Project:
Project Name: D-25
Location: EME

Lab ID: 0306371-01
Sample ID: Rem. Pile Comp

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	88.6	mg/kg	1	20	9253	5/1/03	CK

Approval:

Raland K. Tuttle 5-0203

Raland K. Tuttle, Lab Director, QA Officer

Date

Celey D. Keene, Org. Tech. Director

Jeanne McMurrey, Inorg. Tech. Director

Sandra Biezugbe, Lab Tech.

Sara Molina, Lab Tech.

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8015M

Order#: G0306371

BLANK SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005371-02			<10.0		
CONTROL SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005371-03		952	799	83.9%	
CONTROL DUP SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005371-04		952	814	85.5%	1.9%
SRM SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg	0005371-05		1000	792	79.2%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8021B/5030 BTEX

Order#: G0306371

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005396-02			<0.025		
Toluene-mg/kg		0005396-02			<0.025		
Ethylbenzene-mg/kg		0005396-02			<0.025		
p/m-Xylene-mg/kg		0005396-02			<0.025		
o-Xylene-mg/kg		0005396-02			<0.025		
CONTROL	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005396-03		0.1	0.098	98.%	
Toluene-mg/kg		0005396-03		0.1	0.100	100.%	
Ethylbenzene-mg/kg		0005396-03		0.1	0.109	109.%	
p/m-Xylene-mg/kg		0005396-03		0.2	0.230	115.%	
o-Xylene-mg/kg		0005396-03		0.1	0.105	105.%	
CONTROL DUP	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005396-04		0.1	0.101	101.%	3.%
Toluene-mg/kg		0005396-04		0.1	0.105	105.%	4.9%
Ethylbenzene-mg/kg		0005396-04		0.1	0.110	110.%	0.9%
p/m-Xylene-mg/kg		0005396-04		0.2	0.237	118.5%	3.%
o-Xylene-mg/kg		0005396-04		0.1	0.110	110.%	4.7%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0005396-05		0.1	0.088	88.%	
Toluene-mg/kg		0005396-05		0.1	0.091	91.%	
Ethylbenzene-mg/kg		0005396-05		0.1	0.099	99.%	
p/m-Xylene-mg/kg		0005396-05		0.2	0.208	104.%	
o-Xylene-mg/kg		0005396-05		0.1	0.096	96.%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

Test Parameters

Order#: G0306371

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005391-01			<20.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306371-01	88.6	500	638	109.9%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306371-01	88.6	500	603	102.9%	5.6%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0005391-04		5000	5050	101.1%	

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

Phone: 915-563-1800
Fax: 915-563-1713

Kristin Ferris

D-25

Rice

1

122 w Taylor

→ Wf

Hobbs, Wm 88240

1

Fax No:

[Signature]

Analyze For:

[illegible]

Special Instructions

Relinquished by:

Date	Time
------	------

Received by:

2

Received by: 

Date _____

Time

Sample Containers Intact?
Temperature Upon Receipt:
Laboratory Comments:

20

Time

Date _____

Received by: 

Received by:

2

Date	Time
------	------

Relinquished by:

Relinquished by:

Date	Time
------	------

Received by E

Y

Received by ELDT:

Date _____

Time:

ANALYTICAL REPORT

Prepared for:

Derek Robinson
RE Environmental
P.O. Box 13418
Odessa, TX 79764

Project: Rice Oper. Δ-JS

Order#: G0202987

Report Date:

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

RE Environmental
P.O. Box 13418
Odessa, TX 79764
366-0804

Order#: G0202987
Project: EME
Project Name: Rice Oper.
Location: D-25 Junction

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u> <u>Collected</u>	<u>Date / Time</u> <u>Received</u>	<u>Container</u>	<u>Preservative</u>
0202987-01	4 pt. Wall Comp. @ 14'	SOIL	03/28/2002 14:30	04/03/2002 8:25	4 oz glass	Ice
<u>Lab Testing:</u>		Rejected: No	Temp: 4.0 C			
8015M						
8021B/5030 BTEX						
Chloride						
0202987-02	5 pt. Bottom Comp. @ 15'	SOIL	04/01/2002 14:07	04/03/2002 8:25	4 oz glass	Ice
<u>Lab Testing:</u>		Rejected: No	Temp: 4.0 C			
8015M						
8021B/5030 BTEX						
Chloride						

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Derek Robinson
RE Environmental
P.O. Box 13418
Odessa, TX 79764

Order#: G0202987
Project: EME
Project Name: Rice Oper.
Location: D-25 Junction

Lab ID: 0202987-01
Sample ID: 4 pt. Wall Comp. @ 14'

8015M

<u>Method</u> <u>Blank</u>	<u>Date</u> <u>Prepared</u>	<u>Date</u> <u>Analyzed</u>	<u>Sample</u> <u>Amount</u>	<u>Dilution</u> <u>Factor</u>	<u>Analyst</u>	<u>Method</u>
		04/05/2002	1	1	CK	8015M

Parameter	Result mg/kg	RL
DRO, >C12-C35	723	10.0
GRO, C6-C12	265	10.0
TOTAL, C6-C35	988	10.0

8021B/5030 BTEX

<u>Method</u> <u>Blank</u>	<u>Date</u> <u>Prepared</u>	<u>Date</u> <u>Analyzed</u>	<u>Sample</u> <u>Amount</u>	<u>Dilution</u> <u>Factor</u>	<u>Analyst</u>	<u>Method</u>
0001102-02		04/04/2002 17:24	1	1	CK	8021B

Parameter	Result µg/kg	RL
Benzene	49.7	25.0
Ethylbenzene	231	25.0
Toluene	73.7	25.0
p/m-Xylene	750	25.0
o-Xylene	195	25.0

Lab ID: 0202987-02
Sample ID: 5 pt. Bottom Comp. @ 15'

8015M

<u>Method</u> <u>Blank</u>	<u>Date</u> <u>Prepared</u>	<u>Date</u> <u>Analyzed</u>	<u>Sample</u> <u>Amount</u>	<u>Dilution</u> <u>Factor</u>	<u>Analyst</u>	<u>Method</u>
		04/05/2002	1	1	CK	8015M

Parameter	Result mg/kg	RL
DRO, >C12-C35	1210	10.0
GRO, C6-C12	538	10.0
TOTAL, C6-C35	1748	10.0

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Derek Robinson
RE Environmental
P.O. Box 13418
Odessa, TX 79764

Order#: G0202987
Project: EME
Project Name: Rice Oper.
Location: D-25 Junction

Lab ID: 0202987-02
Sample ID: 5 pt. Bottom Comp. @ 15'

8021B/5030 BTEX

<u>Method</u> <u>Blank</u>	<u>Date</u> <u>Prepared</u>	<u>Date</u> <u>Analyzed</u>	<u>Sample</u> <u>Amount</u>	<u>Dilution</u> <u>Factor</u>	<u>Analyst</u>	<u>Method</u>
0001102-02		04/04/2002 17:46	1	1	CK	8021B

Parameter	Result µg/kg	RL
Benzene	50.8	25.0
Ethylbenzene	228	25.0
Toluene	284	25.0
p/m-Xylene	815	25.0
o-Xylene	220	25.0

Approval:

Coley D. Keene 4/9/02
Raland K. Tuttle, Lab Director, QA Officer
Coley D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

Date

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Derek Robinson
RE Environmental
P.O. Box 13418
Odessa, TX 79764

Order#: G0202987
Project: EME
Project Name: Rice Oper.
Location: D-25 Junction

Lab ID: 0202987-01
Sample ID: 4 pt. Wall Comp. @ 14'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	727	mg/kg	1	5.0	9253	04/04/2002	SB

Lab ID: 0202987-02
Sample ID: 5 pt. Bottom Comp. @ 15'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	727	mg/kg	1	5.0	9253	04/04/2002	SB

Approval:

Coley D. Keene
Raland K. Tuttle, Lab Director, QA Officer
Coley D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

4/9/02
Date

RL = Reporting Limit N/A = Not Applicable

Page 1 of 1

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8015M

Order#: G0202987

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0001114-02			<10.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0202971-02	42.7	952	1111	112.2%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0202971-02	42.7	952	1161	117.5%	4.4%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0001114-05		1000	954	95.4%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8021B/5030 BTEX

Order#: G0202987

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-µg/kg		0001102-02			<25.0		
Ethylbenzene-µg/kg		0001102-02			<25.0		
Toluene-µg/kg		0001102-02			<25.0		
p/m-Xylene-µg/kg		0001102-02			<25.0		
o-Xylene-µg/kg		0001102-02			<25.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-µg/kg		0202960-17	0	100	110	110.0%	
Ethylbenzene-µg/kg		0202960-17	0	100	112	112.0%	
Toluene-µg/kg		0202960-17	0	100	112	112.0%	
p/m-Xylene-µg/kg		0202960-17	0	200	226	113.0%	
o-Xylene-µg/kg		0202960-17	0	100	112	112.0%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-µg/kg		0202960-17	0	100	115	115.0%	4.4%
Ethylbenzene-µg/kg		0202960-17	0	100	114	114.0%	1.8%
Toluene-µg/kg		0202960-17	0	100	116	116.0%	3.5%
p/m-Xylene-µg/kg		0202960-17	0	200	239	119.5%	5.6%
o-Xylene-µg/kg		0202960-17	0	100	112	112.0%	0.0%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-µg/kg		0001102-05		100	110	110.0%	
Ethylbenzene-µg/kg		0001102-05		100	112	112.0%	
Toluene-µg/kg		0001102-05		100	110	110.0%	
p/m-Xylene-µg/kg		0001102-05		200	228	114.0%	
o-Xylene-µg/kg		0001102-05		100	112	112.0%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

Test Parameters

Order#: G0202987

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0001077-01			<5.00		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0202987-01	727	500	1230	100.6%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0202987-01	727	500	1220	98.6%	0.8%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0001077-04		5000	5050	101.%	

Phone: 915-563-1800
Fax: 915-563-1713

40°C

[illegible]

SOUTH MONUMENT SURFACE WASTE FACILITY

TICKET# _____

LEASE OPERATOR:

RICE OPERATING
122 WEST TAYLOR
HOBBS, NM 88240
ATTN: DONNIE ANDERSON

ORIGINATING LOCATION:

JCT. D-25
S25 T28S R36E

TRANSPORTER NAME & ADDRESS:

RE ENVIRONMENTAL

DESCRIPTION OF WASTE:

NON-HAZARDOUS HYDROCARBONS

QUANTITY:

27 YDS.

FACILITY CONTACT:


SIGNATURE OF CONTACT

DATE

CELL NUMBER MATERIAL PLACED IN:

C-1

SIGNATURE OF TRANSPORTER (DRIVER):


SIGNATURE OF DRIVER

DATE

DISPOSAL SITE

SOUTH MONUMENT SURFACE WASTE FACILITY
P.O. BOX 418
HOBBS, NM 88241-0418
S25 T20S R36E N/2 NE/4

"As a condition of acceptance for disposal, I hereby certify that this waste is an exempt waste as defined by the Environmental Protection Agency (EPA). The waste are: generated from oil and gas exploration and production operations; exempt from Resource Conservation and Recovery Act (RCRA) Subtitle C Regulations; and not mixed with non-exempt waste."

FACILITY REPRESENTATIVE

DATE

TRANSPORTERS MANIFEST

MANIFEST# _____

SHIPPING FACILITY NAME & ADDRESS:

RICE OPERATING COMPANY
122 WEST TAYLOR
HOBBS, NM 88240

LOCATION OF MATERIAL:

SEC. 25 T 20 S R 36 E
SYSTEM EME SWD
JCT. D-25

ALL This Info must be on Sundance ticket

Co. Man Donnie Anderson

TRANSPORTER NAME & ADDRESS:

RE Environmental
Post Office Box 13418
Odessa, TX 79768

DESCRIPTION OF WASTE:

OILFIELD CONTAMINATED SOIL
EXEMPT

QUANTITY YARDS 12

FACILITY CONTACT:

Donnie Anderson

DATE

4-2-02

SIGNATURE OF CONTACT:

Donnie Anderson

PHONE 370-5841

NAME OF TRANSPORTER: (DRIVER)

DATE:

SIGNATURE OF DRIVER

DISPOSAL SITE:

SUNDANCE SERVICES INC.
PARABO FACILITY
P.O. BOX 1737
EUNICE, NM 88231

DATE:

SIGNATURE OF REPRESENTATIVE

South Monument Surface Waste Facility

Permit # NM-01-0032

P.O. Box 418

Hobbs N.M. 88241

505-393-5174

OF Loads

11