

1R - 427 - 41

REPORTS

DATE:

2-9-2004

EME B-13 boot

1R0427-41

FINAL REPORT

**RICE OPERATING COMPANY
JUNCTION BOX FINAL REPORT**

BOX LOCATION

SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUNTY	BOX DIMENSIONS - FEET		
EME	B-13 boot	B	13	21 S	35 E	Lea	Length	Width	Depth
							Moved 30 ft Southwest		

LAND TYPE: BLM _____ STATE X FEE LANDOWNER _____ OTHER _____

Depth to Groundwater 170 feet NMOCD SITE ASSESSMENT RANKING SCORE: 0

Date Started 7/2/2003 Date Completed 12/30/2003 OCD Witness No

Soil Excavated 44 cubic yards Excavation Length 10 Width 10 Depth 12 feet

Soil Disposed 36 cubic yards Offsite Facility South Monument Location Monument, NM

FINAL ANALYTICAL RESULTS: Sample Date 7/11/2003 Sample Depth 12 ft bgs

Procure 5-point composite sample of bottom and 4-point composite sample of sidewalls. TPH, BTEX and Chloride laboratory test results completed by using an approved lab and testing procedures pursuant to NMOCD guidelines.

Sample Location	Benzene mg/kg	Toluene mg/kg	Ethyl Benzene mg/kg	Total Xylenes mg/kg	GRO mg/kg	DRO mg/kg	Chloride mg/kg
SIDEWALLS	<0.025	<0.025	<0.025	<0.025	<10.0	<10.0	1150
BOTTOM	<0.025	<0.025	<0.025	<0.025	<10.0	<10.0	922
BACKFILL	<0.025	<0.025	<0.025	<0.025	<10.0	177	638
Soil Bore @ 45 ft	XXX	XXX	XXX	XXX	XXX	XXX	479

General Description of Remedial Action: The box once contained a boot. The pipeline was re-plumbed and the box was moved 30 ft south. The old location was delineated with a backhoe producing a 10 x 10 x 12-ft deep excavation in which a sufficient decline in chloride concentrations was not observed. TPH and BTEX concentrations were well below NMOCD guidelines. The excavation was then backfilled. On 9/15/03, soil bores were conducted at this site to determine the vertical extent of chloride impact. The soil bores did exhibit a conclusive trend of decline (see graphs). A 30 x 30 x 6-ft excavation was produced in order to install a 1.5 ft thick compacted clay barrier at 6 ft to inhibit further chloride migration. The remainder of the hole was backfilled with remediated soil and excess dirt was disposed of at a permitted facility.

CHLORIDE FIELD TESTS

LOCATION	DEPTH (ft)	ppm
4-wall comp.	n/a	900
bottom	12	700
backfill	n/a	500
Soil Bore	19	938
	23	774
	27	954
	31	896
	35	802
	39	772
	43	596

enclosures: lab results, photos, graphs, disposal manifests

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

DATE 2/9/2004 PRINTED NAME Kristin Farris
SIGNATURE Kristin Farris TITLE Project Scientist

EME B-13 boot



Before Excavation at Old Box Site July 2003



10 x 10 x 12-ft-deep Excavation July 2003

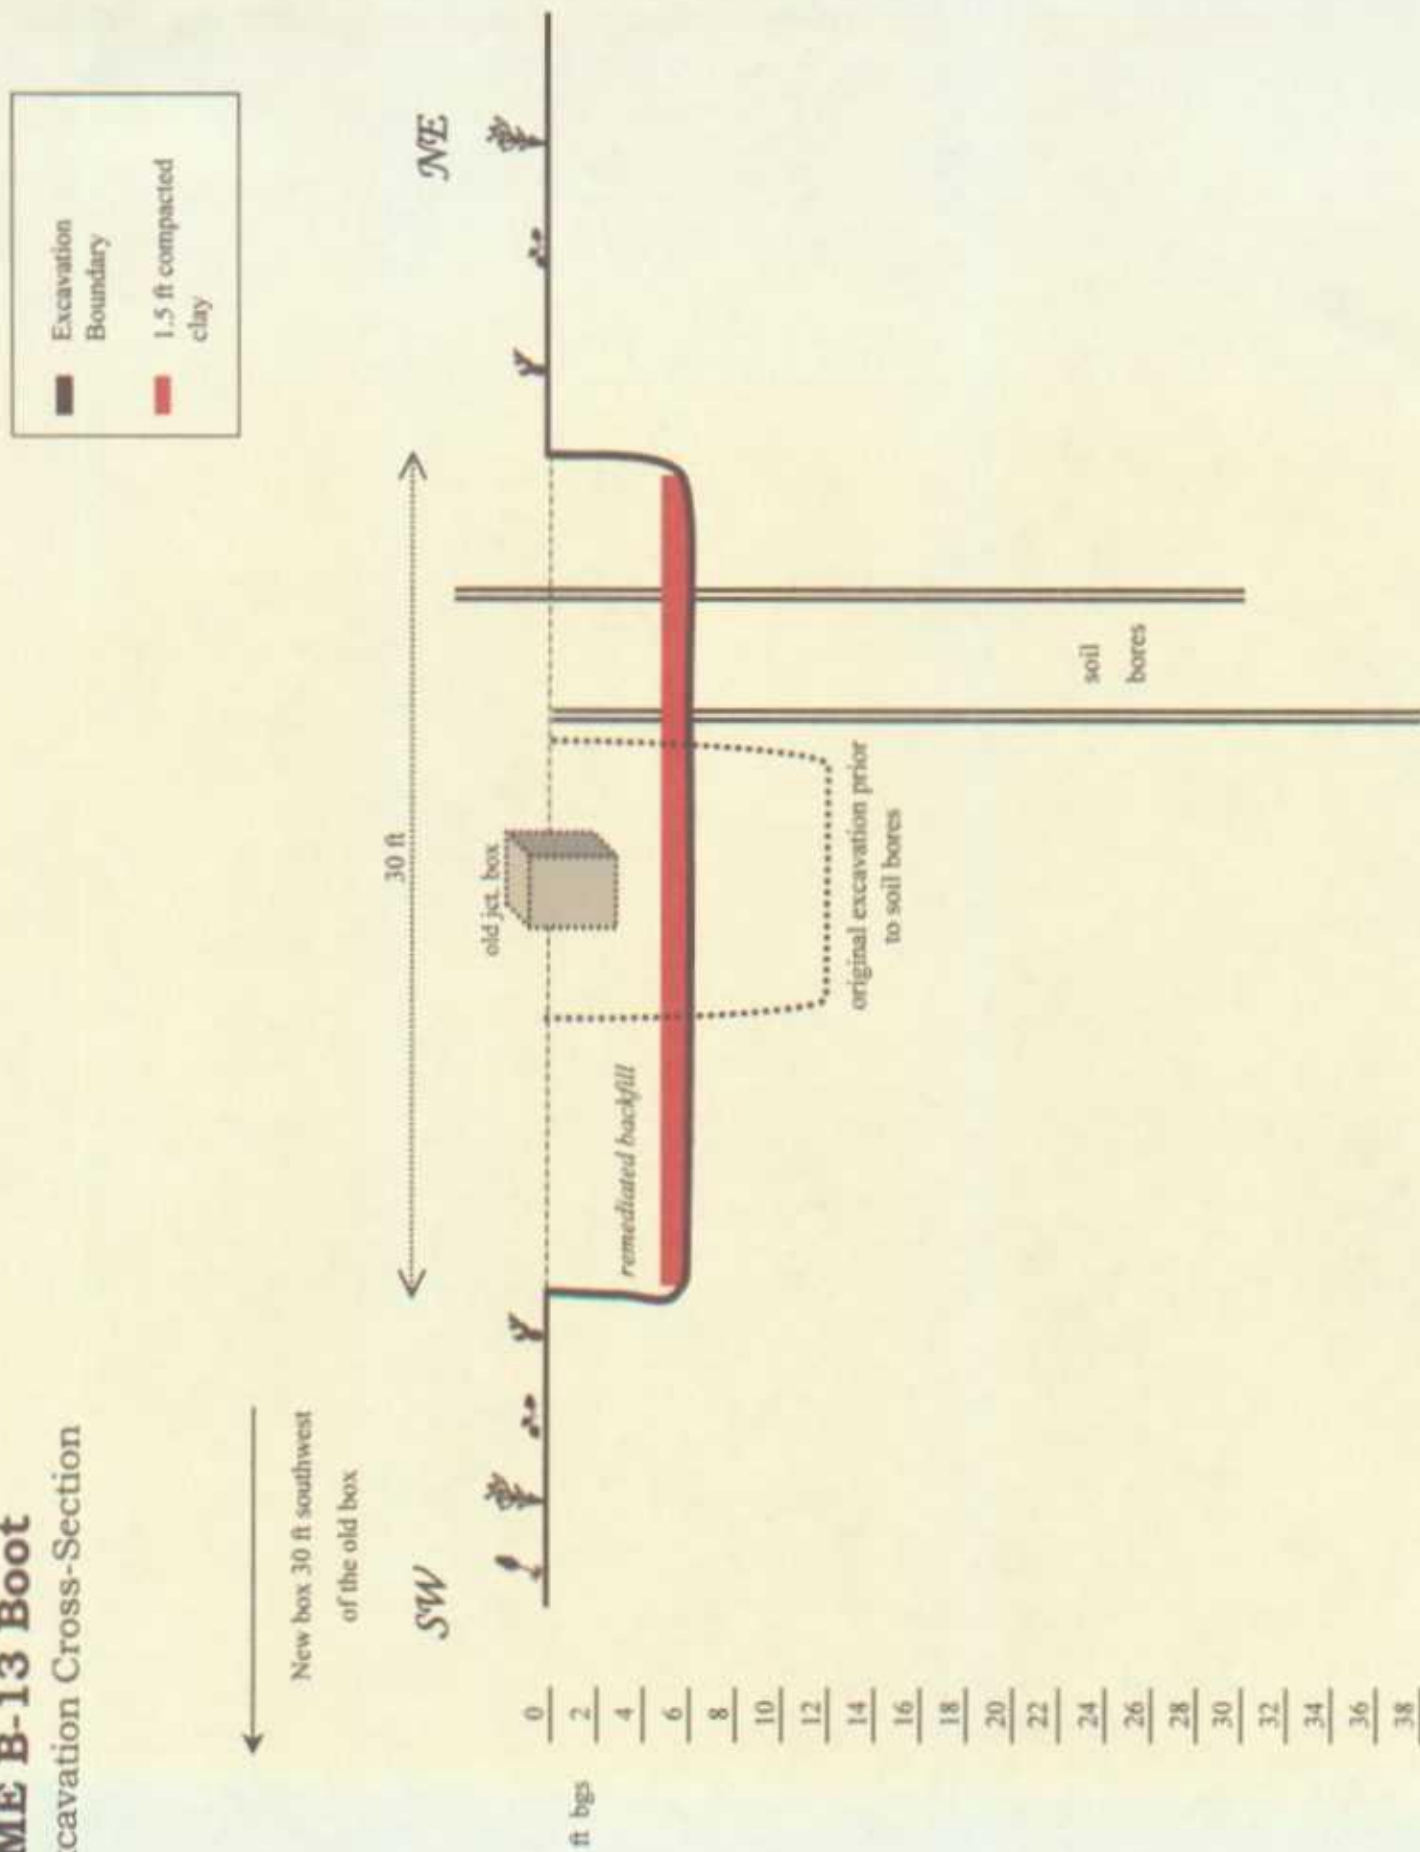


Delineation Drilling 9/15/2003



Looking South: New watertight jct. box with ID plate in foreground marking clay barrier below

EME B-13 Boot Excavation Cross-Section



ANALYTICAL REPORT

Prepared for:

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Project: EME B-13 (Boot)

PO#:

Order#: G0307649

Report Date: 10/08/2003

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

Rice Operating
122 W. Taylor
Hobbs, NM 88240
505-397-1471

Order#: G0307649
Project: Bore Samples
Project Name: EME B-13 (Boot)
Location: None Given

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas, unless otherwise noted.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u> <u>Collected</u>	<u>Date / Time</u> <u>Received</u>	<u>Container</u>	<u>Preservative</u>
0307649-01	Source @ 45'	SOIL	9/16/03 11:30	10/6/03 8:00	Plastic Bag	ice
	<u>Lab Testing:</u> Chloride	Rejected: No		Temp: 4.0 C		
0307649-02	10' N. Source @ 30'	SOIL	9/17/03 9:30	10/6/03 8:00	Plastic Bag	ice
	<u>Lab Testing:</u> Chloride	Rejected: No		Temp: 4.0 C		
0307649-03	10' S. Source @ 49'	SOIL	9/16/03 13:15	10/6/03 8:00	Plastic Bag	ice
	<u>Lab Testing:</u> Chloride	Rejected: No		Temp: 4.0 C		
0307649-04	10' E. Source @ 60'	SOIL	9/16/03 14:00	10/6/03 8:00	Plastic Bag	ice
	<u>Lab Testing:</u> Chloride	Rejected: No		Temp: 4.0 C		

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0307649
Project: Bore Samples
Project Name: EME B-13 (Boof)
Location: None Given

Lab ID: 0307649-01
Sample ID: Source @ 45'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	479	mg/kg	1	20	9253	10/7/03	SB

Lab ID: 0307649-02
Sample ID: 10' N. Source @ 30'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	656	mg/kg	1	20	9253	10/7/03	SB

Lab ID: 0307649-03
Sample ID: 10' S. Source @ 49'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	638	mg/kg	1	20	9253	10/7/03	SB

Lab ID: 0307649-04
Sample ID: 10' E. Source @ 60'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	390	mg/kg	1	20	9253	10/7/03	SB

Approval:

Cele D. Keene 10/9/03
Raland K. Tuttle, Lab Director, QA Officer
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

Date

RL = Reporting Limit N/A = Not Applicable

Page 1 of 1

ENVIRONMENTAL LAB OF TEXAS I, LTD.

12600 West I-20 East, Odessa, TX 79765 Ph: 915-563-1800

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

Test Parameters

Order#: G0307649

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0007064-01			<20		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0307648-01	1030	500	1540	102.2%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0307648-01	1030	500	1560	106.2%	1.3%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0007064-04		5000	4960	99.2%	

12600 West I-20 East
Odessa, Texas 79763

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

Project Name: EME B-13 (Boat)

Project #: Bore Samples

Project Lac:

PO#:

Fax No: 505-397-1471

Sampler Signature: Ray R. Rascon

Special Instructions:

Sample Containers Intact?
Temperature Upon Receipt
Laboratory Comments:

Received by:

Time

Date _____

Recovery of El Ctr

Time

Date

Discussion

Dec 22 1897

0280

11

2

17



34:

—

[illegible]

1

1

8

ANALYTICAL REPORT

Prepared for:

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Project: B-13

PO#:

Order#: G0306958

Report Date: 07/16/2003

Certificates

US EPA Laboratory Code TX00158

ENVIRONMENTAL LAB OF TEXAS

SAMPLE WORK LIST

Rice Operating
122 W. Taylor
Hobbs, NM 88240
505-397-1471

Order#: G0306958
Project:
Project Name: B-13
Location: EME

The samples listed below were submitted to Environmental Lab of Texas and were received under chain of custody. Environmental Lab of Texas makes no representation or certification as to the method of sample collection, sample identification, or transportation/handling procedures used prior to the receipt of samples by Environmental Lab of Texas, unless otherwise noted.

<u>Lab ID:</u>	<u>Sample :</u>	<u>Matrix:</u>	<u>Date / Time</u>	<u>Date / Time</u>	<u>Container</u>	<u>Preservative</u>
			<u>Collected</u>	<u>Received</u>		
0306958-01	5pt. Bottom Comp. @ 12'	SOIL	7/11/03 10:00	7/11/03 17:25	4 oz glass	ice
	<u>Lab Testing:</u>	Rejected: No		Temp: 4.0 C		
	8015M					
	8021B/5030 BTEX					
	Chloride					
0306958-02	Wall Comp.	SOIL	7/11/03 10:00	7/11/03 17:25	4 oz glass	ice
	<u>Lab Testing:</u>	Rejected: No		Temp: 4.0 C		
	8015M					
	8021B/5030 BTEX					
	Chloride					
0306958-03	Backfill Comp.	SOIL	7/11/03 10:00	7/11/03 17:25	4 oz glass	ice
	<u>Lab Testing:</u>	Rejected: No		Temp: 4.0 C		
	8015M					
	8021B/5030 BTEX					
	Chloride					

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306958
Project:
Project Name: B-13
Location: EME

Lab ID: 0306958-01
Sample ID: 5pt. Bottom Comp. @ 12'

8015M

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
		7/14/03	1	1	CK	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	<10.0	10.0
TOTAL, C6-C35	<10.0	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	101%	70	130
1-Chlorooctadecane	98%	70	130

8021B/5030 BTEX

Method	Date	Date	Sample	Dilution	Analyst	Method
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
0006182-02		7/15/03 10:07	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	0.030	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	118%	80	120
Bromofluorobenzene	101%	80	120

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306958
Project:
Project Name: B-13
Location: EME

Lab ID: 0306958-02
Sample ID: Wall Comp.

8015M

<u>Method</u>	<u>Date</u>	<u>Date</u>	<u>Sample</u>	<u>Dilution</u>	<u>Analyst</u>	<u>Method</u>
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
		7/14/03	1	1	CK	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	<10.0	10.0
TOTAL, C6-C35	<10.0	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	104%	70	130
1-Chlorooctadecane	100%	70	130

8021B/5030 BTEX

<u>Method</u>	<u>Date</u>	<u>Date</u>	<u>Sample</u>	<u>Dilution</u>	<u>Analyst</u>	<u>Method</u>
<u>Blank</u>	<u>Prepared</u>	<u>Analyzed</u>	<u>Amount</u>	<u>Factor</u>		
0006182-02		7/15/03 10:29	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	0.028	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	113%	80	120
Bromofluorobenzene	104%	80	120

DL = Diluted out N/A = Not Applicable RL = Reporting Limit

Page 2 of 3

ENVIRONMENTAL LAB OF TEXAS I, LTD.

12600 West I-20 East, Odessa, TX 79765 Ph: 915-563-1800

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306958
Project:
Project Name: B-13
Location: EME

Lab ID: 0306958-03
Sample ID: Backfill Comp.

8015M

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
		7/14/03	1	1	CK	8015M

Parameter	Result mg/kg	RL
GRO, C6-C12	<10.0	10.0
DRO, >C12-C35	177	10.0
TOTAL, C6-C35	177	10.0

Surrogates	% Recovered	QC Limits (%)	
1-Chlorooctane	106%	70	130
1-Chlorooctadecane	103%	70	130

8021B/5030 BTEX

Method Blank	Date Prepared	Date Analyzed	Sample Amount	Dilution Factor	Analyst	Method
0006182-02		7/14/03 20:19	1	25	CK	8021B

Parameter	Result mg/kg	RL
Benzene	<0.025	0.025
Toluene	<0.025	0.025
Ethylbenzene	<0.025	0.025
p/m-Xylene	<0.025	0.025
o-Xylene	<0.025	0.025

Surrogates	% Recovered	QC Limits (%)	
aaa-Toluene	97%	80	120
Bromofluorobenzene	100%	80	120

Approval: Jeanne McMurrey 07-17-03
Raland K. Tattle, Lab Director, QA Officer Date
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

ENVIRONMENTAL LAB OF TEXAS

ANALYTICAL REPORT

Kristin Farris
Rice Operating
122 W. Taylor
Hobbs, NM 88240

Order#: G0306958
Project:
Project Name: B-13
Location: EME

Lab ID: 0306958-01
Sample ID: 5pt. Bottom Comp. @ 12'

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	922	mg/kg	1	20	9253	7/16/03	SB

Lab ID: 0306958-02
Sample ID: Wall Comp.

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	1150	mg/kg	1	20	9253	7/16/03	SB

Lab ID: 0306958-03
Sample ID: Backfill Comp.

Test Parameters

<u>Parameter</u>	<u>Result</u>	<u>Units</u>	<u>Dilution Factor</u>	<u>RL</u>	<u>Method</u>	<u>Date Analyzed</u>	<u>Analyst</u>
Chloride	638	mg/kg	1	20	9253	7/16/03	SB

Approval: Jeanne McMurrey 07-17-03
Raland K. Tuttle, Lab Director, QA Officer Date
Celey D. Keene, Org. Tech. Director
Jeanne McMurrey, Inorg. Tech. Director
Sandra Biezugbe, Lab Tech.
Sara Molina, Lab Tech.

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8015M

Order#: G0306958

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0006180-02			<10		
CONTROL	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0006180-03		952	839	88.1%	
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0306958-01	0	952	1057	111.1%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0306958-01	0	952	1086	114.1%	2.7%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
TOTAL, C6-C35-mg/kg		0006180-05		1000	1021	102.1%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

8021B/5030 BTEX

Order#: G0306958

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0006182-02			<0.025		
Toluene-mg/kg		0006182-02			<0.025		
Ethylbenzene-mg/kg		0006182-02			<0.025		
p/m-Xylene-mg/kg		0006182-02			<0.025		
o-Xylene-mg/kg		0006182-02			<0.025		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306958-01	0	2.5	2.64	105.6%	
Toluene-mg/kg		0306958-01	0	2.5	2.58	103.2%	
Ethylbenzene-mg/kg		0306958-01	0	2.5	2.61	104.4%	
p/m-Xylene-mg/kg		0306958-01	0.03	5	5.28	105.%	
o-Xylene-mg/kg		0306958-01	0	2.5	2.56	102.4%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0306958-01	0	2.5	2.58	103.2%	2.3%
Toluene-mg/kg		0306958-01	0	2.5	2.50	100.%	3.1%
Ethylbenzene-mg/kg		0306958-01	0	2.5	2.46	98.4%	5.9%
p/m-Xylene-mg/kg		0306958-01	0.03	5	5.02	99.8%	5.%
o-Xylene-mg/kg		0306958-01	0	2.5	2.44	97.6%	4.8%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Benzene-mg/kg		0006182-05		0.1	0.096	96.%	
Toluene-mg/kg		0006182-05		0.1	0.094	94.%	
Ethylbenzene-mg/kg		0006182-05		0.1	0.093	93.%	
p/m-Xylene-mg/kg		0006182-05		0.2	0.191	95.5%	
o-Xylene-mg/kg		0006182-05		0.1	0.095	95.%	

ENVIRONMENTAL LAB OF TEXAS

QUALITY CONTROL REPORT

Test Parameters

Order#: G0306958

BLANK	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0006217-01			<20.0		
MS	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306958-01	922	500	1350	85.6%	
MSD	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0306958-01	922	500	1360	87.6%	0.7%
SRM	SOIL	LAB-ID #	Sample Concentr.	Spike Concentr.	QC Test Result	Pct (%) Recovery	RPD
Chloride-mg/kg		0006217-04		5000	4963	99.3%	

SOUTH MONUMENT SURFACE WASTE FACILITY

LEASE OPERATOR:

RiceB-13

ORIGINATING LOCATION:

SEC-13 T21S-35EUnit 6 H&B

TRANSPORTER NAME & ADDRESS:

HPE

DESCRIPTION OF WASTE:

NON-HAZARDOUS HYDROCARBONS

QUANTITY:

12 YDS.

FACILITY CONTACT:

[Signature]
SIGNATURE OF CONTACT1-6-04
DATE

CELL NUMBER MATERIAL PLACED IN:

B-1
023

SIGNATURE OF TRANSPORTER (DRIVER):

[Signature]
SIGNATURE OF DRIVER1-6-04
DATE

DISPOSAL SITE

SOUTH MONUMENT SURFACE WASTE FACILITY

P.O. BOX 418

HOBBS, NM 88241-0418

S25 T20S R36E N/2 NE/4

"As a condition of acceptance for disposal, I hereby certify that this waste is an exempt waste as defined by the Environmental Protection Agency (EPA). The waste are: generated from oil and gas exploration and production operations; exempt from Resource Conservation and Recovery Act (RCRA) Subtitle C Regulations; and not mixed with non-exempt waste."

[Signature]
FACILITY REPRESENTATIVE01/06/04
DATE

MANIFEST # 9757

SOUTH MONUMENT SURFACE WASTE FACILITY

LEASE OPERATOR:

Rice

B-13

ORIGINATING LOCATION:

Sec 13 T21S 35E
Un. 1 CCHB B.

TRANSPORTER NAME & ADDRESS:

HALTO

P

E

DESCRIPTION OF WASTE:

NO. HAZARDOUS HYDROCARBONS

QUANTITY:

12 YDS.

FACILITY CONTACT:

[Signature]
SIGNATURE OF CONTACT

1-6-04
DATE

CELL NUMBER MATERIAL PLACED IN:

B-1

SIGNATURE OF TRANSPORTER (DRIVER):

Phillip G
SIGNATURE OF DRIVER

1-6-04
DATE

DISPOSAL SITE

SOUTH MONUMENT SURFACE WASTE FACILITY
P.O. BOX 418
HOBBS, NM 88241-0418
S25 T20S R36E N/2 NE/4

"As a condition of acceptance for disposal, I hereby certify that this waste is an exempt waste as defined by the Environmental Protection Agency (EPA). The waste are: generated from oil and gas exploration and production operations; exempt from Resource Conservation and Recovery Act (RCRA) Subtitle C Regulations; and not mixed with non-exempt waste."

[Signature]
FACILITY REPRESENTATIVE

01/06/04
DATE

SOUTH MONUMENT SURFACE WASTE FACILITY

LEASE OPERATOR:

Rice

B-13

ORIGINATING LOCATION:

Sec-13 T21S R.35E
Un. + Lot 11 B.

TRANSPORTER NAME & ADDRESS:

H

P

E


DESCRIPTION OF WASTE:

NON-HAZARDOUS HYDROCARBONS

QUANTITY:

12 YDS.


FACILITY CONTACT:


SIGNATURE OF CONTACT1-6-04
DATE

CELL NUMBER MATERIAL PLACED IN:

B-1
00

SIGNATURE OF TRANSPORTER (DRIVER):


SIGNATURE OF DRIVER1-6-04
DATE

DISPOSAL SITE

SOUTH MONUMENT SURFACE WASTE FACILITY

P.O. BOX 418

HOBBS, NM 88241-0418

S25 T20S R36E N/2 NE/4

"As a condition of acceptance for disposal, I hereby certify that this waste is an exempt waste as defined by the Environmental Protection Agency (EPA). The waste are: generated from oil and gas exploration and production operations; exempt from Resource Conservation and Recovery Act (RCRA) Subtitle C Regulations; and not mixed with non-exempt waste."


FACILITY REPRESENTATIVE01/06/04
DATE