

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico NMOCD Dist 2
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

nAB1808528967

OPERATOR

Initial Report Final Report

Name of Company XTO Energy	Contact Kyle Littrell	
Address 3104 E Greene Street Carlsbad, N.M. 88220	Telephone No. 432-221-7331	
Facility Name Avalon Delaware Unit #517	Facility Type Exploration and Production	
Surface Owner Federal	Mineral Owner Federal	API No. 30-015-24337

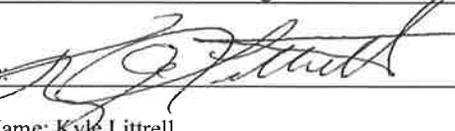

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
B	31	20S	28E	780	North	1690	East	Eddy

Latitude N 32.535011 Longitude -104.214235 NAD83

NATURE OF RELEASE

Type of Release Produced Water and crude oil	Volume of Release 92 bbls (originally estimated as 49 bbls, but revised based on field observations made during remediation activities)	Volume Recovered 0 bbls
Source of Release flow line	Date and Hour of Occurrence unknown	Date and Hour of Discovery 3-6-2018 @ 8AM
Was Immediate Notice Given? <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher/ Crystal Weaver (NMOCD) Shelly Tucker/ Jim Amos(BLM)	
By Whom? Amy Ruth	Date and Hour 3/6/2018 3:21 pm	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	
If a Watercourse was Impacted, Describe Fully.* N/A		
Describe Cause of Problem and Remedial Action Taken.* Fluid was released from what appeared to be a bullet hole through the poly flow line. The line was clamped until it was repaired.		
Describe Area Affected and Cleanup Action Taken.* The release affected approximately 2,030 square feet of pasture extending about 240 feet southwest of the source. The impacted soil was excavated and confirmation soil samples were collected from the side walls and bottom of the excavation on March 15, 2018 and April 12, 2018. Laboratory analytical results from 23 confirmation soil samples indicate concentrations of BTEX, TPH, and chloride do not exceed NMOCD remediation action levels. Based on the volume of soil removed, XTO requests no further action for this release and will backfill, re-contour, and re-seed the excavation with BLM seed mix #2.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Kyle Littrell	Approved by Environmental Specialist: 	
Title: SH&E Coordinator	Approval Date: 5/3/2018	Expiration Date: N/A
E-mail Address: Kyle_Littrell@xtoenergy.com	Conditions of Approval: Like Approval BLM	Attached <input type="checkbox"/>
Date: 5/01/2018	Phone: 432-221-7331	FINAL

* Attach Additional Sheets If Necessary