
NOTES REGARDING BLOWOUT PREVENTERS

Devon Energy Production Company, LP

Cotton Draw 11 Fed Com 2H

Surface Location: 330' FSL & 860' FWL, Unit M, Sec 11 T25S R31E, Eddy, NM Bottom Hole Location: 330' FNL & 660' FWL, Unit D, Sec 11 T25S R31E, Eddy, NM

- 1. Drilling nipple will be constructed so it can be removed mechanically without the aid of a welder. The minimum internal diameter will equal BOP bore.
- 2. Wear ring will be properly installed in head.
- 3. Blowout preventer and all associated fittings will be in operable condition to withstand a minimum 3,000 psi working pressure.
- 4. All fittings will be flanged.
- 5. A full bore safety valve tested to a minimum 3,000 psi WP with proper thread connections will be available on the rotary rig floor at all times.
- 6. All choke lines will be anchored to prevent movement.
- 7. All BOP equipment will be equal to or larger in bore than the internal diameter of the last casing string.
- 8. Will maintain a kelly cock attached to the kelly.
- 9. Hand wheels and wrenches will be properly installed and tested for safe operation.
- 10. Hydraulic floor control for blowout preventer will be located as near in proximity to driller's controls as possible.
- 11. All BOP equipment will meet API standards and include a minimum 40 gallon accumulator having two independent means of power to initiate closing operation.

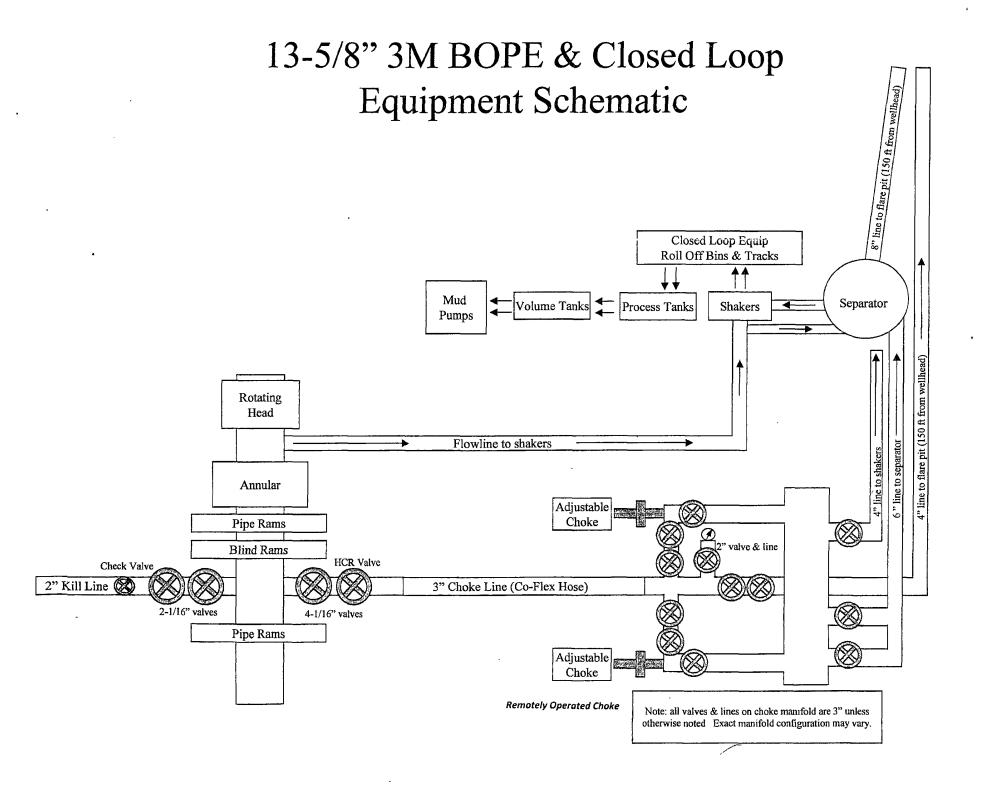





ContiTech Beattie Corp. Website: www.contitechbeattie.com

Monday, June 14, 2010

RE:

Drilling & Production Hoses Lifting & Safety Equipment

To Helmerich & Payne,

A Continental ContiTech hose assembly can perform as intended and suitable for the application regardless of whether the hose is secured or unsecured in its configuration. As a manufacturer of High Pressure Hose Assemblies for use in Drilling & Production, we do offer the corresponding lifting and safety equipment, this has the added benefit of easing the lifting and handling of each hose assembly whilst affording hose longevity by ensuring correct handling methods and procedures as well as securing the hose in the unlikely event of a failure; but in no way does the lifting and safety equipment affect the performance of the hoses providing the hoses have been handled and installed correctly. It is good practice to use lifting & safety equipment but not mandatory.

Should you have any questions or require any additional information/clarification then please do not hesitate to contact us.

ContiTech Beattie is part of the Continental AG Corporation and can offer the full support resources associated with a global organization.

Best regards,

Robin Hodgson Sales Manager ContiTech Beattie Corp

ContiTech Beattie Corp, 11535 Brittmoore Park Drive, Houston, TX 77041 Phone: +1 (832) 327-0141 Fax: +1 (832) 327-0148 www.contitechbeattie.com





JALITY DOCUMENT

ENT PHOENIX RUBBER INDUSTRIAL LTD. EXTERNAL LTD. EXTERNAL LTD.

H-5728 Szeged, Budapesti út 10. Hurgary • H-6701 Szeged, P. Ö. Box 152 Phone: (3662) 506-737 • Fax (3662) 566-738 SALES & MARKETING: H-1092 Budapest, Raday u. 42-44. Hungary • H-1440 Budapest, F. O. Box 26 Phone: (351) 456-4200 • Fax: (351) 217-2972, 456-4273 • www.teurusamasiga hu

	ALITY CONTR N AND TEST		TIFICA	ATE .		CERT. N	V°:	555	***************************************
PURCHASER:	Phoenix Bea	P.O. Nº:	151	519FA-871					
PHOENIX RUBBER order i	N°: 170466	Hos	E TYPE:	3"	10	Chi	oke and Ki	ll Hose	, and the same
HOSE SERIAL Nº:	34137	МОМ	INAL / AC	TUAL LE	ENGTH:		11,43 n	a	
W.P. 68,96 MPa	10000 ps	T.P.	103,4	MPa	1500	O psi	Duration:	60	min.
		tachm	coupli						
Type ·		Seria	l No		• •	Quality		Heat N°	
3* coupling with		714	715		.A	ISI 4130	. [C7626	
4 1/16" Flange e	end'.	•	٠,		A	JSI 4130		47357	•
		•			-	-			
All motal parts are flawless WE CERTIFY THAT THE AB PRESSULE TESTED AS ABO	OVE HOSE HAS BE			· Temp		e rate:"		S OF THE ORE	ER AND
Date: 30. April: 2002.	Inspector		ada an Company de Cambrello de Proposition de la company de Cambrello	Qua	lity Cont		OENIX R Industria osa Inspec	l Ltd. tion and triDentAce	

.Page: 1/1

LtL	1.1.3	_!_	-1_1	1.	1 1	_1_'	!_!	1_	<u>.</u> †	1_	1	 .	П	ĿĿ	L I	,	1_	1_1		Į.	<u></u>	_1	1	L	1_1	1	1	1	_1	ı		1
23,	72	ġ.	7-E									7		1									T				-					
R0 B1 02	+ 2 + 2 + 1 + 2	5.	4	1	0			T		1	1			क्रायाच्याच्या						1		-	1									
22		İ	H	\dagger	d			T		1	Ī						1							1						1		
15 BT BG	+14	STEEL ST		1	1400	1					1		1	1999						-										Y		OCA TOO S PENIX RUBBER
	1.5											$\ $					I												H	ı	1.	DENTX RUBBER Industrial Ltd. se Inspection and
25 121 121 121 121 121 121 121 121 121 1	+1+2	5	1		100	1					72.51		****	TO COME										1						+	è	ertification Dept.
20)		1			a a						1		A CLE	Ü		5								-								<u>.</u>
125 127 127 127	# 22 # 24 # 24 # 24	<u> </u>			91	!					4	1201		200										-								
19			11																					-				-				
770			3020	l ÷		•		П	j				The state of the s			5		F		-	1			3(C	}			4			10	00
100		13 14				1		,	5		1	<u>L</u>		3	1			Ī	3	- 1	,			-1								
																		-														
											-																	-				

AEBILIED TRUE COL

H&P Flex Rig Location Layout

