

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
OCD Artesia

FORM APPROVED
OMB No. 1004-0137
Expires: March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE- Other instructions on reverse side.

1. Type of Well <input checked="" type="checkbox"/> Oil Well. <input type="checkbox"/> Gas Well. <input type="checkbox"/> Other		5. Lease Serial No. NMNM 054183
2. Name of Operator OXY USA Inc. 16696		6. If Indian, Allottee or Tribe Name
3a. Address P.O. Box 50250 Midland, TX 79710	3b. Phone No (include area code) 432-685-5717	7. If Unit or CA/Agreement, Name and/or No.
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 2310 FNL 660 FEL SENE(H) Sec 19 T18S R29E		8. Well Name and No. South Loc Hills Unit #8
		9. API Well No. 30-015-03520
		10. Field and Pool, or Exploratory Area Loco Hills QUGBSA
		11. County or Parish, State Eddy NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection)

SEE ATTACHED



RECLAMATION
DUE 4-4-13

Accepted as to plugging of the well bore.
Liability under bond is retained until
Surface restoration is completed.

14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) David Stewart		Title Regulatory Advisor
Signature 	Date 10/9/12	<div style="border: 2px solid black; padding: 5px; text-align: center;"> ACCEPTED FOR RECORD </div>
THIS SPACE FOR FEDERAL OR STATE OFFICE USE		
Approved by Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Title Office	Date OCT 13 2012
<p>Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.</p> <p>(Instructions on page 2)</p>		

10/17/2012

Accepted for record
NMOCD

SLHU #8

- 9/19/12 MIRU PU, NDWH, NU BOP, RU WL & DHV to fluid level @ 360', POOH. RIH to 396' w/ mule shoe jt, POOH, RIH w/ DHV to 404', no clarity, POOH.
- 9/20/12 PUH w/ 1 jt to 364', RIH w/ camera, severe csg damage @ 402', POOH. Dig out cellar.
- 9/21/12 ND BOP, ND 4.5" X 2 3/8" WH, NID 7" X 4.5" SH, NU 7" X 900 WH, NU BOP. RU csg tools, POOH w/ 409', 13 jts 4-1/2" csg. RIH w/ tbq & subs to 385'
- 9/24/12 RU WL & DHV, locate top of csg @ 409', POOH, RIH w/ tbq, attempt to get inside csg stub.
- 9/25/12 WO order, set & spot rev ut.
- 9/26/12 RIH w/ 6" shoe w/ 5.25 ID, 1 jt.5.5" wash pipe & 4.5 DC & tag @ 409', RU pwr swl, wash down to 546', POOH.
- 9/27/12 RIH w/ 6" shoe w/ 5.25 ID, 1 jt.5.5" wash pipe & 4.5 DC & tbq
- 9/28/12 RU PS, spud on top of 4-1/2" csg, could not get over it, POOH. RIH w/ bent jt & tbq, attempt to get through, POOH.
- 10/1/12 RIH w/ DC, POOH, LD. RIH w/ tbq, POOH, LD. RIH w/ 2-3/8" mule shoe & tbq to 2280'.
- 10/2/12 WO cmtrs, circ hole w/ 10# MLF, spot 30sx CL C cmt w/ 2% CaCl₂, PUH, WOC. RIH & tag cmt @ 1843', PUH to 1388'.
- 10/3/12 Spot 25sx CL C cmt w/ 2% CaCl₂, PUH to 450', WOC. RIH & tag cmt @ 1098', PUH to 450'. RIH w/ WL & perf @ 905', RIH w/ tbq to 969', M&P 300sx CL C cmt, did not circ to surf, POOH, WOC.
- 10/4/12 RIH & tag cmt @ 290', circ 70sx CL C cmt to surf, POOH w/ tbq, ND BOP, top off csg, RDMO.


OXY USA Inc. - Final
South Loco Hills Unit #8
API No. 30-015-03520

70sx @ 290'-Surface-Circ-Verified

300sx @ 969'-290' WOC-Tagged

25sx @ 1388-1098' WOC-Tagged

30sx @ 2280-1843' WOC-Tagged

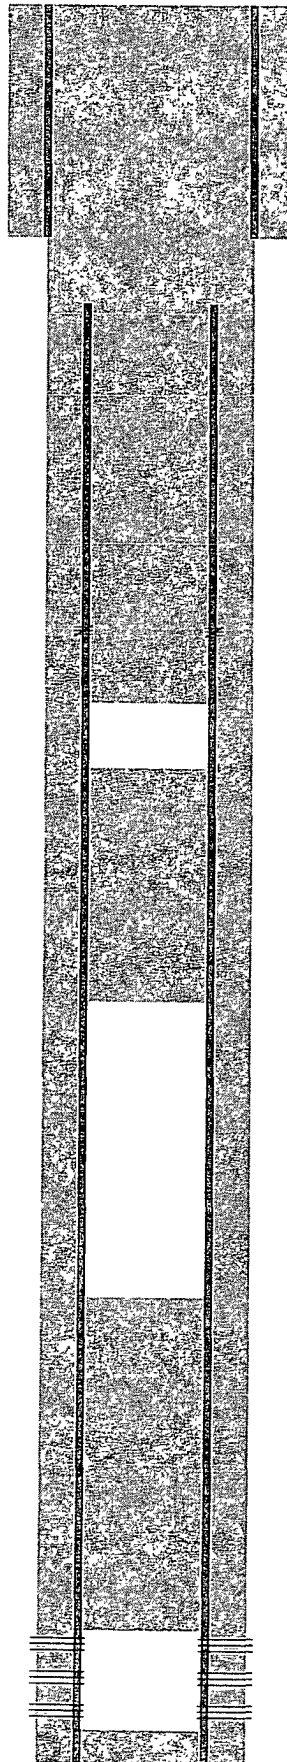

8-3/4" hole @ 400'
7" csg @ 396'
w/ 50sx-TOC-Surf-Calc

Bad Csg @ 409', Cut & pull 4-1/2 csg

Perf @ 905'

6-1/4" hole @ 2451'
4-1/2" csg @ 2451'
w/ 150sx-TOC-617'-Calc

Perfs @ 2332-2422'

TD-2451'