

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM

87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103

May 27, 2004

RECEIVED

OIL CONSERVATION DIVISION

JUL 17 2006

1220 South St. Francis Dr.

ARTEZIA

Santa Fe, NM 87505

WELL API NO.

30-015-23217

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil &amp; Gas Lease No.

V-176

7. Lease Name or Unit Agreement Name

NEW MEXICO "CY" STATE

8. Well Number

1

9. OGRID Number

10. Pool name or Wildcat

RED LAKE; QUEEN GRBG

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other ☐ WDW

2. Name of Operator

MARBOB ENERGY CORPORATION

3. Address of Operator

PO BOX 227, ARTESIA, NM 88 211-0227

4. Well Location

Unit Letter J : 1980 feet from the SOUTH line and 1650 feet from the EAST lineSection 23 Township 17S Range 28E NMPM EDDY County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

3692' GL

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type \_\_\_\_\_ Depth to Groundwater \_\_\_\_\_ Distance from nearest fresh water well \_\_\_\_\_ Distance from nearest surface water \_\_\_\_\_

Pit Liner Thickness: \_\_\_\_\_ mil Below-Grade Tank: Volume \_\_\_\_\_ bbls; Construction Material \_\_\_\_\_

## 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

## NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐TEMPORARILY ABANDON ☐ CHANGE PLANS ☐PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐OTHER: ☐

## SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐COMMENCE DRILLING OPNS. ☐ P AND A ☐CASING/CEMENT JOB ☐OTHER: MIT TEST ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

7/6/06 - SET & TESTED 2 NEW ANCHORS. ND W/H. NU BOP. RLS PKR & POOH W/ TBG. FOUND SEVERAL BAD COLLARS &/OR BAD PINS. FOUND HOLE IN COLLAR OF THE 18TH JT. L/D TBG. LEFT 18 STD'S IN THE DERRICK. WILL L/D IN THE AM.

7/7/06 - PU NEW 2 7/8" X 5 1/2" PC PLS PKR. RIH W/ 265 JTS NEW IPC 2 7/8" TBG TO 8557'. CIRC PKR FLUID. SET PKR @ 8557'. TEST CSG TO 350# FOR 30 MIN. HELD OK.

OK TO TEST WITHOUT WITNESS PER VAN BARTON 7/7/06

(SEE CHART ATTACHED)

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.SIGNATURE Jeannie Sillas TITLE PRODUCTION ASSISTANT DATE 7/14/06Type or print name JEANNIE SILLAS

For State Use Only

E-mail address: production@marbob.com Telephone No. (505) 748-330


Gerry Guye

JUL 25 2006

APPROVED BY: Gerry Guye TITLE Deputy Field Inspector DATE \_\_\_\_\_

Conditions of Approval (if any):

District II - Artesia

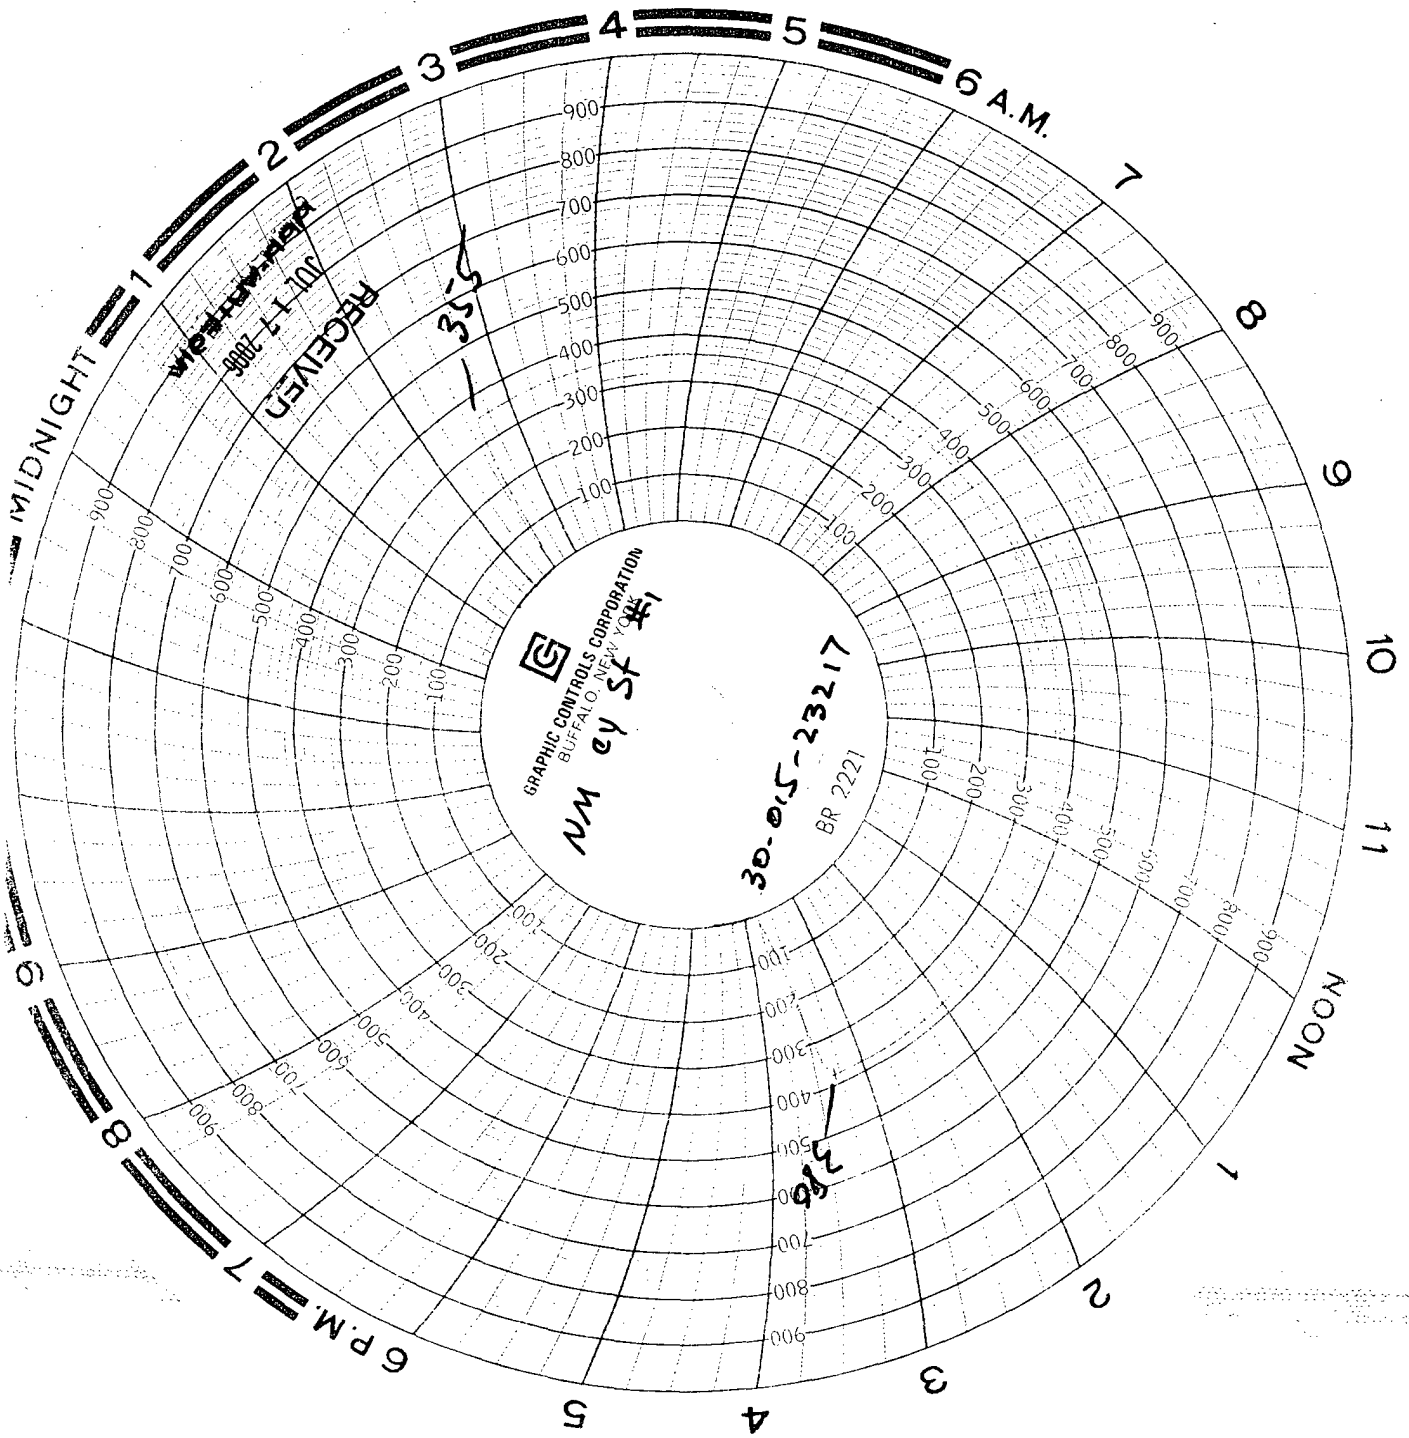

(505) 391-1331  
Lobo Trucking, LTD

De. Dilla #5

OSI

7-7-06  
6:30 PM

New Mexico SY ST<sup>1</sup>