

District I
1625 N. Ranch Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 E. Rios Pecos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-144
June 1, 2004

For drilling and production facilities, submit to appropriate NMOC District Office.
For downstream facilities, submit to Santa Fe office

Pit or Below-Grade Tank Registration or Closure

Is pit or below-grade tank covered by a "general permit"? Yes ☐ No ☒

Type of action: Registration of a pit or below-grade tank ☐ Closure of a pit or below-grade tank ☒

Operator: <u>Ameri-state Exploration</u> Telephone: <u>(505) 623-5500</u> e-mail address: _____		
Address: <u>401 Congress Ave, Ste 2900, Austin TX 78701</u>		
Facility or well name: <u>East Millman Unit #232</u> API #: <u>30-015-34860</u> UEL or QUL: <u>H</u> Sec: <u>15</u> T: <u>19S</u> R: <u>28E</u>		
County: <u>Eddy</u> Latitude: <u>N32° 39' 39.2"</u> Longitude: <u>W104° 09' 33.5"</u> NAD: 1983 ☐ 1983 ☐		
Surface Owner: Federal ☐ State ☒ Private ☐ Indian ☐		
Pit Type: Drilling ☒ Production ☐ Disposal ☐ Workover ☐ Emergency ☐ Liner: ☒ Unlined ☐ Liner type: Synthetic ☒ Thickness: <u>12</u> mil Clay ☐ Pit Volume: _____ MB		
Below-grade tank Volume: _____ MB Type of fluid: _____ Construction material: _____ Double-walled, with leak detection? Yes ☐ If not, explain why not: _____		
Depth to ground water (vertical distance from bottom of pit to seasonal high water elevation of ground water.)	Less than 30 feet 30 feet or more, but less than 100 feet <u>100 feet or more 150'</u>	(20 points) (10 points) 0 (0 points)
Wellhead protection area: (Less than 200 feet from a private domestic water source, or less than 1000 feet from all other water sources.)	Yes <u>No</u>	(20 points) (0 points) 0
Distance to surface water: (Horizontal distance to all wetlands, playas, irrigated canals, ditches, and perennial and ephemeral watercourses.)	Less than 200 feet 200 feet or more, but less than 1000 feet <u>1000 feet or more</u>	(20 points) (10 points) 0 (0 points)
Ranking Score (Total Points)		0

If this is a pit closure: (1) Attach a diagram of the facility showing the pit's relationship to other equipment and tanks. (2) Indicate disposal location: (check the circle box if you are burying in place) circle ☒ offsite ☐ If offsite, name of facility: N/A. (3) Attach a general description of removal action taken including remediation start date and end date. (4) Groundwater encountered: No ☒ Yes ☐ If yes, show depth below ground surface: N/A ft. and attach sample results.

(5) Attach soil sample results and a diagram of sample locations and concentrations.

Additional Comments: <u>Refer to Attached Pit Closure Plans</u>
<u>* Reserve pit Closed as of 9/7/07 according to NMOC Requirements. Photos of Deep Bury Process Provided. Soil Sample Analysis Results Provided. *</u>

I hereby certify that the information shown is true and complete to the best of my knowledge and belief. I further certify that the above-described pit or below-grade tank has been fully constructed or closed according to NMOC guidelines ☒ a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

Date: 5/24/07

Printed Name/Title: Dusty L. Wilson/Field Agent Signature: _____

Your certification and NMOC approval of this application/closure does not relieve the operator of liability should the contents of the pit or tank contaminate ground water or otherwise endanger public health or the environment. Nor does it relieve the operator of its responsibility for compliance with any other federal, state, or local laws and/or regulations.

Approved:

Printed Name/Title: _____

Signature: Mike Bennett

Date: 6/5/07

Notify OCD 24 hours prior to beginning pit closure.

Samples are to be obtained from pit area and analysis submitted to NMOC prior to back-filling

Closure 9/7/07
Accepted for record
NMOC

(8)

P.O. Box 310
Hobbs, NM 88241-0310

Off 505.392.8584
Cell 505.631.2442
Fax 505.392.3085

New Mexico Environmental Services

Hobbs, New Mexico

Reserve Pit Remediation

SURFACE PIT CLOSURE PLAN

PIT PARAMETERS

COMPANY: Ameristate Exploration

WELL SITE: East Millman Unit #232

LEGAL DESCRIPTION: Unit H Sec 15 T19s R28e, 2610

FNL 1090 FEL, Eddy co.

The reserve pit inset on this leasehold is being permitted to close as per New Mexico OCD "Pit and Below Grade Tank Guidelines" dated November 1, 2004.

This pit was excavated and formed to the dimensions roughly 120' X 120' X 6' deep. A 12 mil membrane liner and pad was used to prevent leakage to the surface soils. A visual examination of the membrane liner indicates that the liner had maintained its integrity.


After the drilling and completion phase of this project, the water phase of the pit contents were pumped and hauled to an approved water injection facility. It is estimated that the volume of solids remaining are to +/- 1400 yards. The burial cell is to be excavated and lined with a minimum 12 mil membrane that complies with ASTM Standards: D-5747, D-5199, D-5994, and D-4833. The cuttings will be loaded as to allow for > 36" freeboard to ground level. After the cuttings are loaded the 12 mil liner will be folded over the top, and a 20 mil minimum thickness liner meeting the minimum requirements as outlined in ASTM Standard Methods: D-5747, D-5199, D-5994, D-4833; will be used to cap and cover to an extended area that exceeds three feet in all directions from the

edge of the burial cell. This cap will be constructed as to slope and allow for water runoff from burial cell.

A minimum of 36" of top soil will be used to cover the burial cell. This soil must be capable of supporting plant growth. A seed mixture will be used as to conform to local BLM and OCD requirements.

After the drilling solids are buried, the *natural* contour of the surrounding soils will be mechanically shaped as to prevent erosion of the well site until vegetation is established.

AMERISTATE EXPLORATION L.L.C.
EAST MILLMAN UNIT #232
API#30-015-34860
V-DOOR NORTH

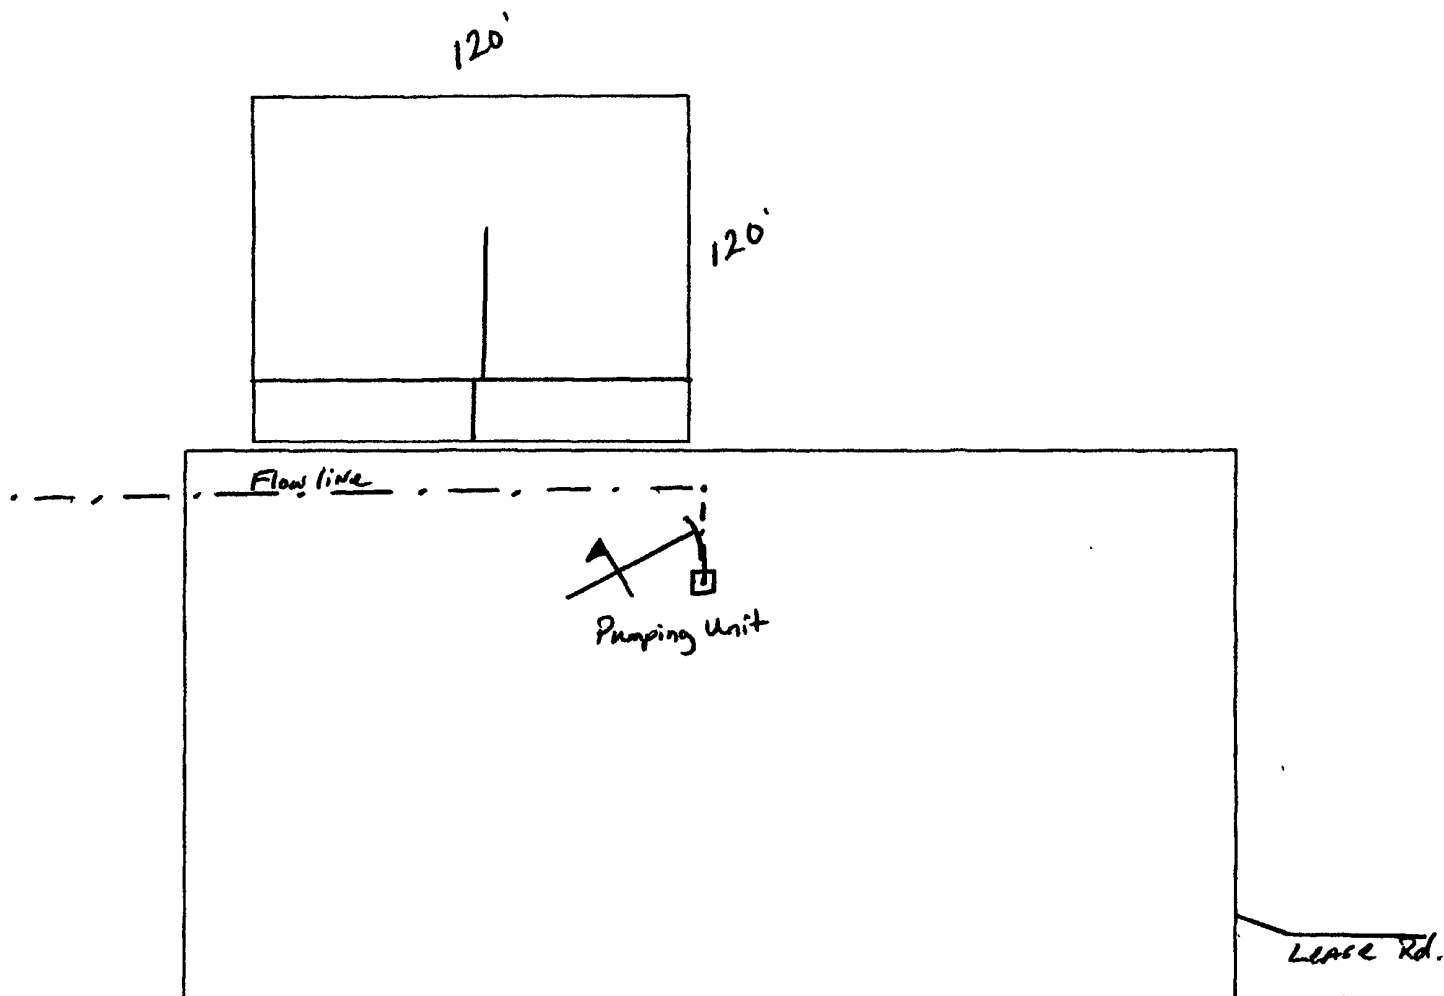

Summary Report

Cris Busby
New Mexico Environmental
P.O. Box 310
Hobbs, NM, 88241

Report Date: August 29, 2007

Work Order: 7082819



Project Location: Sec. 15, T19s, R28E, Eddy, NM
Project Name: Ameri State East Millman #232
Project Number: API 30-015-34860

Sample	Description	Matrix	Date Taken	Time Taken	Date Received
134659	#001 Working Pit 12'	soil	2007-08-24	13:00	2007-08-28
134660	#002 N LEg 15'	soil	2007-08-24	14:00	2007-08-28
134661	#003 S. Leg 12'	soil	2007-08-24	15:00	2007-08-28
134662	#004 Background	soil	2007-08-24	16:00	2007-08-28

Sample: 134659 - #001 Working Pit 12'

Param	Flag	Result	Units	RL
Chloride		74.9	mg/Kg	5.00

Sample: 134660 - #002 N LEg 15'

Param	Flag	Result	Units	RL
Chloride		130	mg/Kg	5.00

Sample: 134661 - #003 S. Leg 12'

Param	Flag	Result	Units	RL
Chloride		55.2	mg/Kg	5.00

Sample: 134662 - #004 Background

Param	Flag	Result	Units	RL
Chloride		<20.0	mg/Kg	5.00

