

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY


SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to recomplete gas, look to a different reservoir. Use Form 9-331-B for such proposals.)

- 1. Oil well Gas well Other
- 2. NAME OF OPERATOR
Yates Petroleum Corporation
- 3. ADDRESS OF OPERATOR
207 South 4th St., Artesia, NM 88210
- 4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 660 FNL & 1850 FWL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:
- 16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:
 TEST WATER SHUTOFF
 FRACTURE TRIAL
 SHOOT OR ACIDIZE
 REPAIR WELL
 PULL OR ALTER GAS NO.
 MULTIPLE COMPLETE
 CHANGE ZONES
 ABANDON*
 (other)

SUBSEQUENT REPORT ON:

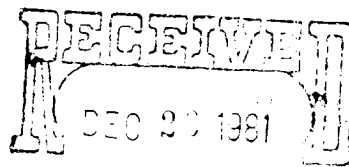

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is abandoned, include subsurface locations, and measured and true vertical depths for all markers and zones pertinent to the well.)

Spudded a 14-3/4" hole 1:30 AM 12-11-81. Ran 23 joints of 10-3/4" 40.5# J-55 casing set at 945'. 1-Texas Pattern guide shoe at 945'. Insert float at 905'. Cemented w/400 sacks Pacesetter C 3% CaCl₂. Tailed in w/300 sacks Class C 2% CaCl₂. Compressive strength of cement - 1925 psi in 12 hours. PD 11:00 AM 12-14-81. Bumped plug to 1000 psi, released pressure and float held okay. WOC. Drilled out 5:00 AM 12-15-81. WOC 18 hours. Reduced hole to 7-7/8". Drilled plug and resumed drilling.


Subsurface Safety Valve: Manu. and Type

Set of

18. I hereby certify that the foregoing is true and correct

SIGNED: _____ Engineering Society, 12-21-81

APPROVED BY
CONDITIONS OF APPROVAL

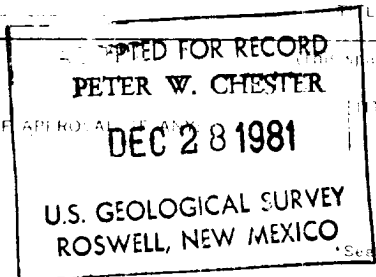

*See instructions on Reverse Side