


- 11/18/61 - No report
- 11/19/61 - No report
- 11/20/61 - TD 5194' Shale & lime - Making trip
- 11/21/61 - TD 7297' Line - Drig. break at 7225' - 7225' - Trip to DST #1 - Jackerr
didn't hold - coming out to re-set pipe
- 11/22/61 - TD 7797' Line - DST #1 7770' - 7770' (from Reed) - Open 1 hr., Gas
in 4 mins., Flow test 1 million 2000' - 1" surface cam. - Rec'd 600' and
10-15IP-2915, 10-15IP-2850, 10-15IP-2800
- 11/23/61 - TD 7583' Line, Lost cone on bit - Reed's same - needed starch to control
water loss.
- 11/24/61 - TD 7383' Line - down for rig repairs
- 11/25/61 - Drig. 7447' Line
- 11/26/61 - Drig. 7528' Line
- 11/27/61 - Drig. 7608' Line, Sand & Quartz
- 11/28/61 - TD 7645' Line - laid down 4" drill pipe - picking up 3" drill pipe
- 11/29/61 - Drig. 7750' Line
- 11/30/61 - Drig. 7864' Line & Chert
- 12/1/61 - Drig. 7958' Line & Chert
- 12/2/61 - No report
- 12/3/61 - No report
- 12/4/61 - Drig. 8336' Line, Shale & Chert
- 12/5/61 - TD 8409' Sand & Shale - Lost circulation - & covered same
- 12/6/61 - Drig. 8481' Line & Shale
- 12/7/61 - TD 8490' Line - 1st 7230' - 8490' (bottom hole 7645') Open 30 mins., no
slt blow 10 mins. & died. Rec'd 7040' bit later - 15-15IP-8470, 15-15IP-
8400, FP 830-8350.
- 12/8/61 - Drig. 8575' Line
- 12/9/61 - Drig. 8755' Shale - T/Barnett Shale 8050'
- 12/10/61 - Drig. 8858' Shale w/some lime
- 12/11/61 - Drig. 8894' Line & Shale
- 12/12/61 - Drig. 8980' Line & Chert
- 12/13/61 - Drig. 9062' Line
- 12/14/61 - TD 9102' Line - Making trip
- 12/15/61 - Drig. 9148' Line
- 12/16/61 - TD 9310' Dolo. - DST #3 9280' - 9310', Open 1 hr. 9 mins., good blow 45 mins.
& died. Rec'd 600' Drig. mud & 600' Salt wtr., 15-15IP-9350, 50-15IP-9350,
FP 1530 - 3665. Sample Top Dev. 9271'
- 12/17/61 - TD 9310' Dolo. - Running logs
- 12/18/61 - TD 9310' Dolo. Set 4 1/2" liner at 7515' - hanger at 6645', com/w/110 sx.
of 30/30 encore pozmix 24 gel - Circulated out 10 sx. excess cem. tested
w/2000 #'s 30 mins. - held on -
(Set 15 sx plug 9100 - 9220 and 60 sx. plug 8080 - 8560')
- 12/19/61 to 1/9/62 - TD 9310' Dolo. - PBFD 7515' - shut down to move rig and move
on completion unit.

Form 9-331a
(Feb. 1951)

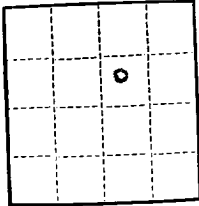

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office New Mexico
Lease No. 06425-A
Unit _____

RECEIVED
NOV 10 1961

SUNDRY NOTICES AND REPORTS ON WELLS

D. C. C.
ARTESIAN OFFICE

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	X
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 3, 1961

Well No. 1 is located 1980 ft. from N line and 1980 ft. from E line of sec. 19
SW/4 NE/4 19 21-S 23-E NMPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wildcat Eddy New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 4075.5 ft. Gr.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

10/31/61 - TD 5391' Shale & Sand - Lost Circulation
11/1/61 - Drlg. 5604' Lime & Dolo.
11/2/61 - Drlg. 5975' Shale, Bit #6
11/3/61 - Drlg. 6120' Sand & Shale, Bit #6


I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company J. C. WILLIAMSON

Address BOX 16

MIDLAND, TEXAS

By Mary E. Sayre
Asst. to Supt.
Title _____

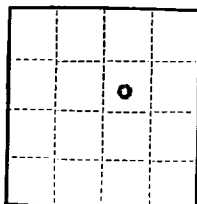

(SUBMIT IN TRIPLICATE)

Land Office **New Mexico**

Lease No. **06415-A**

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 3, 19 61

Well No. 1 is located 1980 ft. from N line and 1980 ft. from E line of sec. 19
SW/4 NE/4 19 21-S 23-E NMPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wildcat Eddy New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 4075.5 ft. Gr.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

- 10/21/61 - Drlg. 1459' Sdy. Lime, Bit #2
- 10/22/61 - Drlg. 1600' Sdy. Lime, Tot. 3/4 deg. at 1600'
- 10/23/61 - TD 1720' Sdy. Lime, Ran 53 Jts. of 9 5/8" csg. (66' of 40#, 142' of 36# and 1512' of 32.30#) set at 1720' cemented W/200 sx reg. 50/50 pozmix 4% gel plus 100 sx neat on bottom. Plug down 8:45 AM 10/23/61, WOC 24 hrs., Tested w/ 1000#'s - 30 mins. - Held OK
- 10/24/61 - TD 1720' Sdy. Lime - WOC
- 10/25/61 - Drlg. 2035' Sdy. Lime, Tot. 1/4 deg. at 1700'
- 10/26/61 - Drlg. 2870' Sdy. Lime, Bit #3
- 10/27/61 - Drlg. 3520' Lime & Sand
- 10/28/61 - Drlg. 4050' Shale & Lime
- 10/29/61 - Drlg. 4785' Shale & Lime
- 10/30/61 - Drlg. 5120' Sand & Shale

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company J. C. WILLIAMSON

Address BOX 16

MIDLAND, TEXAS

By Mary E. Smyre
 Title Asst. to Supt.