

RANKING SCORE (TOTAL POINTS): 0

Date Remediation Started: 1/22/2003 Date Completed: 1/22/03

Excavation X Approx. cubic yards 0

Landfarmed _____ Insitu Bioremediation _____

Other _____

Remediation Method: Onsite N/A Offsite _____

(Check all appropriate sections)

General Description of Remedial Action : A soil sample was obtained from the center bottom of the pit at a depth of 6 feet utilizing U.S.E.P.A. protocol and evaluated for GRO/DRO analysis.
The sample was tested and provided concentrations below NMOCD guidelines.

Ground Water Encountered: No X Yes _____ Depth _____

Final Pit:
Closure Sampling:
(if multiple samples,
attach sample results
and diagram of sample
locations and depths)

Sample location Center Bottom

Sample depth 6 feet

Sample date 1/22/03

Sample time 11:20

Sample Results

Benzene(ppm) _____

Total BTEX (PPM) _____

Field Headspace (ppm) non-detect

TPH <10 ppm

Ground Water Sample: Yes _____ No X (if yes, attach sample results)


I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETED TO THE BEST OF MY KNOWLEDGE AND BELIEF.

DATE _____ PRINTED NAME Frank McDonald

SIGNATURE _____ and TITLE Environmental Specialist

Location: <u>SJ 29-6 # 24 MV</u>		
Unit Letter: <u>A</u>	Sec. <u>21</u> Twn. <u>29</u> Rng <u>6</u>	
Pit Reference from Wellhead:		
<u>60° S 12 degrees E</u>		
Pit: <u>abandoned pit 2</u>		
Initial size:	<u>15' x 20' x 3' deep</u>	
Final Size:	<u>15' x 20' x 3' deep</u>	
Total Cubic Yards:	<u>0</u>	
Distances from (ft):		
Groundwater:	<u>> 100 ft</u>	
Wellhead Protection Area:	<u>> 1000 ft</u>	
Nearest Surface Water:	<u>> 1000 ft</u>	
Distance to ephemeral stream:	<u>N/A</u>	
Ranking Score (points):	<u>0</u>	
Sample ID Sample Depth (ft) OVM Reading		
1	centerbottom @ 6ft	NON DETECT
2		
3		
4		
5		
6		
7		
8		
9		
10		
Comments:		
Topography is sagebrush flats Soil is sandy clay loam		
No hydrocarbon staining or odor was noticed. Sample was		
extracted from 6 ft below surface (3 ft below pit bottom).		
Sample from 6-ft was sent to IML for GRO/DRO analysis.		

Site Diagram:

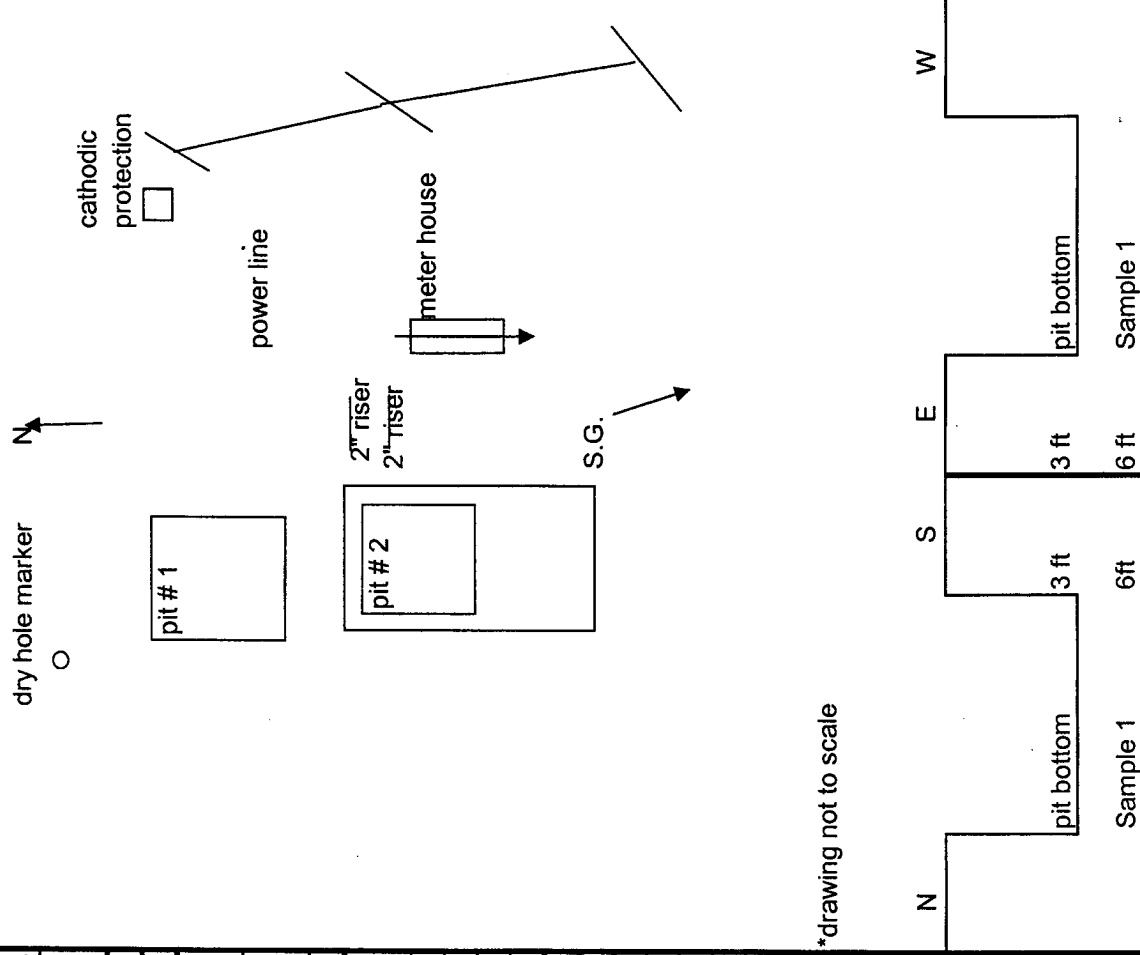

Inter-Mountain Laboratories, Inc.

2506 West Main Street
Farmington, NM 87401

Client: Conoco Phillips
Project: TPH
Sample ID: SJ 29-6 #24 MV PIT# 2
Lab ID: 0303W00240
Matrix: Soil
Condition: Intact

Date Reported: 01/31/03
Date Sampled: 01/22/03
Date Received: 01/22/03
Date Analyzed: 01/28/03

Parameter	Analytical Result	PQL	MCL	Units
TPH - Method 8015M				
Gasoline Range Organics(C6-C10)	<10	10		mg/Kg
Diesel Range Organics (C10 - C22)	<10	10		mg/Kg
Total Petroleum Hydrocarbons (C6-C22)	<10	10		mg/Kg
Quality Control - Surrogate Recovery				
	%		QC Limits	
4-Bromofluorobenzene(SUR-8015B)	72		50 - 150	
o-Terphenyl(SUR-8015)	112		50 - 150	

Reference: Method 8015AZ, C10 - C32 Hydrocarbons in Soil, Arizona Department of Health Services, Revision - 1.0, 09/25/98.

Reviewed By: 