1625 N French Dr., Hobbs, NM 88240 District II 1301 W Grand Avenue, Artesia, NM 88210 District III 1000 Rio Biazos Road, Aztec, NM 87410 District IV 1220 S St Fiancis Di , Santa Fe, NM 87505

State of New Mexico **Energy Minerals and Natural Resources** Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

Pit, Closed-Loop System, Below-Grade Tank, or

Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances
Operator WILLIAMS PRODUCTION COMPANY, LLC OGRID # 120782
Address PO Box 640 Aztec, NM 87410
Facility or well name: COX CANYON UNIT #012
API Number OCD Permit Number
Section 20I Township 32N Range 11W County SAN JUAN
Latitude. 36 96781 Longitude 108.0057 NAD. 1983 Surface Owner FEDERAL
□ Pit: Subsection F or G of 19 15 17 11 NMAC Temporary: □ Drilling □ Workover □ Permanent □ Emergency □ Cavitation □ P&A
□ Lined □ Unlined Liner type Thicknessmil □ LLDPE □ HDPE □ PVC □ Other □ String-Reinforced Liner Seams □ Welded □ Factory □ Other Volume· bbl Dimensions· L x W x D
☐ String-Reinforced
String-Reinforced Liner Seams
String-Reinforced Liner Seams Welded Factory Other Volume bbl Dimensions L x W x D Closed-loop System: Subsection H of 19 15 17 11 NMAC Type of Operation P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent) Drying Pad Above Ground Steel Tanks Haul-off Bins Other Lined Unlined Liner type Thickness mil LLDPE HDPE PVC Other Liner Seams Welded Factory Other Melow-grade tank: Subsection I of 19 15.17 11 NMAC Volume: 120 bbl Type of fluid PRODUCED WATER Tank Construction material FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER

submittal of an exception request is required	on of approval
Fencing: Subsection D of 19 15 17 11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks) Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, institution or church) Four foot height, four strands of barbed wire evenly spaced between one and four feet Alternate Please specify	hospital.
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks) Screen Netting Other Monthly inspections (If netting or screening is not physically feasible)	
Signs: Subsection C of 19 15 17 11 NMAC 12"x 24". 2" lettering, providing Operator's name, site location, and emergency telephone numbers Signed in compliance with 19 15 3 103 NMAC	
Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s) Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval	office for
Siting Criteria (regarding permitting): 19 15 17 10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the approoffice or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dry above-grade tanks associated with a closed-loop system.	priate district pproval.
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells	☐ Yes ☐ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☐ No ☐ NA
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to permanent pits) - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☐ No ☐ NA
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application - NM Office of the State Engineer - iWATERS database search, Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality	☐ Yes ☐ No
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS; NM Geological	□ Vaa □ Na
Society, Topographic map	∐ Yes ∐ No

- FEMA map
Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15 17 9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15.17 9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15 17 10 NMAC Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15.17 13 NMAC
Previously Approved Design (attach copy of design) API Number or Permit Number
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15 17 9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19 15 17 10 NMAC Design Plan - based upon the appropriate requirements of 19 15 17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15.17.9 NMAC and 19 15 17 13 NMAC
Previously Approved Design (attach copy of design) API Number
Previously Approved Operating and Maintenance Plan API Number (Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19 15 17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19 15 17 9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19 15 17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19 15 17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19 15 17.11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15 17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19 15 17 11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15 17 9 NMAC and 19 15 17 13 NMAC
14. Proposed Closure: 19 15 17 13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19 15 17 13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. ☐ Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC ☐ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17.13 NMAC ☐ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) ☐ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC ☐ Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC

Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC					
Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: (19 15 17 13.1 Instructions: Please indentify the facility or facilities for the disposal of liquids, drilling fluids and drill cuttings. Use attachment if facilities are required.					
Disposal Facility Name Disposal Facility Permit Number					
Disposal Facility Name Disposal Facility Permit Number					
Will any of the proposed closed-loop system operations and associated activities occur on or in areas that will not be used for future ser Yes (If yes, please provide the information below) No	vice and operations?				
Required for impacted areas which will not be used for future service and operations Soil Backfill and Cover Design Specifications based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15 17 13 NMAC	C				
Siting Criteria (regarding on-site closure methods only): 19 15 17 10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable sour provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate dist considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. Just demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC for guidance.	rict office or may be				
Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells	☐ Yes ☑ No ☐ NA				
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS, Data obtained from nearby wells	☐ Yes ⊠ No ☐ NA				
Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA				
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site					
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☒ No				
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site	☐ Yes ⊠ No				
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ⊠ No				
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ⊠ No				
Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ⊠ No				
Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map	☐ Yes ⊠ No				
Within a 100-year floodplain - FEMA map	☐ Yes ⊠ No				
On-Site Closure Plan Checklist: (19 15 17 13 NMAC) Instructions: Each of the following items must be attached to the closure puby a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15.17 10 NMAC Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of 19 15 17 11 NMAC Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) - based upon the appropriate requirements of 19 Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC					

Confirmation Sampling Plan (if applicable) - based upon the appropriate Waste Material Sampling Plan - based upon the appropriate requirem Disposal Facility Name and Permit Number (for liquids, drilling fluid Soil Cover Design - based upon the appropriate requirements of Sub Re-vegetation Plan - based upon the appropriate requirements of Sub Site Reclamation Plan - based upon the appropriate requirements of Sub Site Reclamation Plan - based upon the appropriate requirements of Sub Site Reclamation Plan - based upon the appropriate requirements of Sub Site Reclamation Plan - based upon the appropriate requirements of Sub Site Reclamation Plan - based upon the appropriate requirements of Sub-	nents of Subsection F of 19 15 17 13 NMAC ds and drill cuttings or in case on-site closure standards cannot be achieved) section H of 19 15 17 13 NMAC osection I of 19 15 17 13 NMAC
Operator Application Certification:	
I hereby certify that the information submitted with this application is true,	accurate and complete to the best of my knowledge and belief
Name (Print) Title	
Signature:	Date
e-mail address' Telephone	
OCD Approval: Permit Application (including closure plan) Closure COCD Representative Signature:	sure Plan (only) OCD Conditions (see attachment) Approval Date: \(\frac{5}{200} \)
Title: Compliance Officer	OCD Permit Number:
The closure report is required to be submitted to the division within 60 da section of the form until an approved closure plan has been obtained and	prior to implementing any closure activities and submitting the closure report. ys of the completion of the closure activities. Please do not complete this
Closure Method: Waste Excavation and Removal On-Site Closure Method If different from approved plan, please explain	Alternative Closure Method Waste Removal (Closed-loop systems only)
Closure Report Regarding Waste Removal Closure For Closed-loop Sy Instructions: Please indentify the facility or facilities for where the liquid two facilities were utilized.	stems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: ds, drilling fluids and drill cuttings were disposed. Use attachment if more than
Disposal Facility Name	Disposal Facility Permit Number
Disposal Facility Name	Disposal Facility Permit Number
Were the closed-loop system operations and associated activities performed Yes (If yes, please demonstrate compliance to the items below)	
Required for impacted areas which will not be used for future service and of Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique	perations
mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closures) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation)	osure) Longitude NAD 1927 1983

25.
'Operato' Closure Certification:
I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and
belief I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan
Name (Print) Vanessa Fields TitleEH&S Coordinator
SignatureDate10-26-10
e-mail addressvanessa fields@williams comTelephone505-634-4209



Exploration & Production FO BC 640 Aziec NM 81137 505, 624 4619 505/634 4814 Lax

March 10, 2009

Mr Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure

Rule 19 15 17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co. LLC

Pursuant to Rule 19 15 17 13 NMAC this correspondence is to notify the Bureau of Land Management, Farmington Field Office of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County, New Mexico. Closure will follow the plan included with this correspondence.

Thank you for your consideration. If there are any questions or additional information is requested please contact me at (505) 634-4209.

Respectfully submitted

Holly C Perkins EH&S Specialist

Encl Williams Production Pit Inventory List (Federal wells)

San Juan Basin New Mexico Assets Below-Grade Tank Closure Plai

cc Environmental Fig.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below Grade Tank Removal Closure Flori

In a condance with Rule 19.15.17.13.NMAC, the following plan describes the general closure requirements of below grade tanks (BC-1) on Williams Froduction Co. LLC. (WFX) to cations in the San Joan Basin of New Mexico. This is WEX estandard closure procedure for all BC-1s regulated under Rule 19.15.17.NMAC and operated by WEX. For those closures which do not conform to this standard closure plan a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing

Parsoant to 1915 1713 (A) NMAC WPX will initiate closure of any 5G1 should any one of these conditions occur.

- The Division requires closure because of imminent danger to tresh water public health or the environment.
- The integrity of the BG1 fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WEX chooses to take the BGT out of service due to operational needs. Clasure under these conditions will be closed within 60 days of dessation of the BGT's operation.
- BC-1s installed prior to June 16, 2008 that do not meet the requirements under 19,15,17,11 (C) WAAC and WEX chooses not to retrofit or opgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- Frici to initiating any BGT Closure except in the case of an emergency. WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to close the PGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- Notice of Closure will be given to the Aztoc District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following.
 - a Operators Name (WPX)
 - b. Well Nome and All Number
 - c Tocation (USIR)
- All produced water will be removed from the BC-1 following discharge pipe rerouting Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site. Rosa Unit SWD #1 (Order SWD 916. API 30.039-27055). Rosa Unit #94 (Order SWD 3RP-1003.0. API 30.039-23035). Jillson Fed. SWD #001 (Order R10168/R10168A, AFI 30.039-25465). Middle Mesa SWD #001 (Order SWD 350.0. AFI 30.045-27004). and/or Basin Disposal (Permit. NM.01.0005).
 - solids and studges will be shoveled and toll validation out for disposal at Envirofech (Fermit Gonzael NM (1) (1):1
- who will an prior approval from 1870 Charlest researched reason of the Book and provide documentation of the disposition of the Form the crosure report. Stee materials will be recycled or reused as approved by the fingless. Energiass tanks will be early at the or shie disease and FA decided to disposal as some waste. Their materials will

be cleaned without soils or contaminated moterial for disposal as solid waste. Fit ergloss tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712. NAAC—Disposal will be at a licensed disposal facility, presently San Juan Regional Lanafill operated LV Waste Management under NAED Fermit SWM 052426.

- Any equipment associated with the RGI that is no longer required for some other purpose following the closure will be removed from the location.
- Ecollowing removal of the tank and any liner material a five point composite sample will be taken of the excavation and fested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C.141.

Table 1 Closure Criteria for BGTs

	Take to the training to the tr		
Components	Testing Methods	Closure Limits (mg/Kg)	
Benzene	EPA SW 846 Method 8021B or 8260B	0.2	
BILX	IPA SW 846 Method 8021B of 8260B	50	
Trit	Ef A SW-846 Method 418 111	100	
Chlondes	EPA SW 846 Method 300 117	250(-)	

the thick modified for solid waste.

- If the Division and/or WEX determine there is a release. WEX will comply with 19.15.3.118. TIMAC and 19.15.1.19 NIMAC.
- Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be reconfoured to match the notive grade and prevent ponding.
- Let those portions of the former pit are a no longer required for production activities. Why will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via diffing on the contour whenever practical or by other Division approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover fun impacted) consisting of at least three native plant species, including at least one grass that not including novious weeds, and maintained that cover through two successive growing scasons. Repeat seeding or plantling will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that ac not meet he vegetation requirements of 19-15-17-13 LNMAC, then WEX will schart the proposed afternative with written documentation that the surface owner agrees to the afternative, for Division of proval.
- 12 For those portions of the former pit area required for production activities reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report

All closure activities will include propor accomentation and will be submitted to OCD within 60 days of the BCI closure on a Closure Report using Livision Form C-144. The Report will include the following.

- Provide a soute transport of a content of the transport of th
- · MORTHING STORE MAIN
- · SHE LADOR PLANTE COLORDAN
- · AVENCE HERE IN THE TO

- Communication Southwood or an exception.
- · LasticsOnfactory (400.46 to 0.50 to 100 for the file)
- · ALDROHOLER SEED OF COLOR
- · Frederic Comment agence the comment

If book are one concentration of Ottomaes greater than 200 mg. For the orbigher concentration will be used for closure.

WELLS W/FEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
COX CANYON UNIT #001	3004511397	PLANCO MV	16N	32N	1 1 VV	BGT	DBL WALL STEEL FIBERGLASS TANK w.BANDED 20 mil
COX CANYON UNIT #001A	3004522086	PLANCO MV	16C	3211	1 1 VV	RG1	HIDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
COX CANYON UNIT #001B	3004530791	PLANCO MV	161	3211	11W	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	16 F	3214	11Vv	BGT	DBL WALL STEFL FIRERGLASS TANK WBANDED 20 mil
COX CANYON UNIT #003	3004511495	BLANCO MV	91	32N	11V√	BGT	HOPE SECONDARY LINER
COX CANYON UNIT #003A	3004522088	BLANCO MV	9P	32N	11W	BGI	DBI WALL STEEL
COX CANYON UNIT #003B	3004530871	BLANCO MV	9.J	32N	11W	BGT	DBI WALL STEFI
COX CANYON UNIT #004	3004511368	BLANCO MV	21A	32N	11W	BGT	DBI WALL STEFI
COX CANYON UNIT #004A	3004522093	BLANCO MV	21F	32N	11W	BGI	DBL WALL STEEL
COX CANYON UNIT #004B	3004532186	BLANCO MV	211	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #005	3004511326	BLANCO MV	21K	32N	11Vv	BGI	DBI WALL STEFL
COX CANYON UNIT #00AA	3004522094	BLANCO MV BASIN DK /	211)	32N	11VV	BGT	DBI WALL STEEL
COX CANYON UNIT #005B	3004532142	BLANCO MV	2111	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #005C	3004533493	BLANCO MV	211	3211	11VV	BG1	DBI WALL STEEL
COX CANYON UNIT #006	3004511463	BLANCO MV	16A	32N	11W	BGT	DBL WALL STEEL
A000# TINU NOYNAD XOD	3004522095	BLANCO MV	161	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #006P	3004532693	BLANCO MV	16B	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #006C	3004532733	BLANCO MV	160	32N	11W	FG1	DBI WALL STEEL
COX CANYON UNIT #007	3004511455	PL ANCO MA	176	32N	11W	FGP	DBL WALL STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	32N	11W	BGT	DBL WALL STEFL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	32N	11W	BG1	DBI WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #008	3004511492	BLANCO MV	81	32N	11W	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	BLANCO MV	1711	32N	11W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDFD 20 mile
COX CANYON UNIT #008B	3004532080	BLANCO MV	8P	32N	11W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #008C COX CANYON UNIT #009A	3004531187	BLANCO MV	175	3211	11W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
COM COX CANYON UNIT #009B	3004522092	BLANCO MV BASIN DK /	20D	32N	11W	BGT	HDPE SECONDARY LINER
COM	3004533926	BLANCO MV BASIN DK /	20B	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #009C	3003933851	BLANCO MV	50£	3211	11W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
COX CANYON ÚNIT #013	3004521489	BLANCO PC	20A	32N	11W	BGT	HDPE SECONDARY LINER

WELLS W/FEDERAL		سالها القال المال ميد المهاد المالية المالية المالية المالية المالية المالية المالية المالية المالية					
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
COX CANYON UNIT #023							FIBERGLASS TANK w/BANDED 20 mil
COM	3004522537	RLANCO PC	17C	32N	11 V V	BGI	HOPE SECONDARY LINER
}							FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #025	3004522572	BLANCOPL	90	32N	11VV	BG1	HDPE SECONDARY LINER
600 (6100) 1 (100)							FIBERGLASS TANK WBANDED 20 mil
COX CANYON UNIT #200	3004527878	BASINETC	91	32N	11VV	BGT	HDPE SECONDARY LINER
CON CARNON HALL HOUSE	000460040						FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #200A	3004532126	BASINFIC	9()	3211	1 1 VV	BGT	HDPE SECONDARY LINER
CONTRACTOR LIBERT 4000	0064007070	23.4.6344.15.17	474				FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #203	3004527872	BASINFIC	17A	32N	111/	BGT	HDPE SECONDARY LINER
 MADDOX #001	1004644467	DI ANICO MA	1/161	16.4.1		0.01	DEL MALL OTELL
I WADDOX #001	3004511487	BLANCO MV	10N	32N	11W	BG1	DBI WALL STELL
 MADDOX #001A	20045225.30	EDILANIC (DINAVI	105	OOKE	1.4\61	001	DDI MMI CIELI
WADDOX #001A	3004523539	BLANCO MV	10F	32N	11VV	BG1	DBI WALL STEFI
 NM 32 11 #001	3004511309	BLANCO MV	200	2081	1.1167	BGT	DBI WALL STEEL
11777	3004311308	BASIN DK /	2007	32N	11W	ונאנו	DBC WALL STEEL
NM 32-11 #001B COM	3004532024	BLANCO MV	20J	32N	11W	BGT	DBL WALL STEEL
11 100 10 00 11	300400Z0Z4	BASIN DK /	2 (1.7	3214	1100	1501	DDL WALL STEEL
NM 32 11 #001C COM	3004532804	BLANCO MV	201	32N	11W	BG1	DBI WALL STEEL
	000 1002 00		•	0211		1.01	FIBERGLASS TANK w BANDED 20 mil
NM 32 11 #002 COM	3004511380	BLANCO MV	19A	32N	11W	BG1	HDPE SECONDARY LINER
				<i>(,</i> 1, 1, 1)	. , , ,	20.	
NM 32 11 #002A COM	3004529017	BLANCO MV	190	3211	1 1 VV	BGT	DBI WALL STEEL
NM 32 11 #002B COM	3004532670	BLANCO MV	191	3214	11W	BGT	DBL WALL STEFL
NM 32-11 #002C COM	3004533077	BLANCO MV	19G	32N	11VV	BG1	DBL WALL STEEL
ROSA UNIT #001 SWD	3003927055	SWD	231	31N	06W	BGT	DBI WALL STEEL
		BASIN DK /					FIBERGLASS TANK w/banded 20 mil
RUSA UNIT #001E	3003925411	BLANCO MV	11P	31N	06W	BGT	HDPE SECONDARY LINER
		BLANCO MV					
ROSA UNIT #005A	3003925407	ROSA PC	26P	31 N	0644	BGT	DBI WALL STEFL
TACACA LIBERT ACCOUNT		BASIN DK /					
ROSA UNIT #005B	3003926927	BLANCO MV	26B	3114	OGW	BGT	UBL WALL STEEL
CALIFFE HALL ADOLD	0000000000	D) 41444 1444					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #005Y	3003926078	BI ANCO MV	26H	51N	00	BG1	HDPE SECONDARY LINER
ROSA UNIT #008	200.1207011	BLANCO MV /	4.4 8 4		5	0.07	FIBERGLASS TANK W/BANDED 20-mil
KOSA ONTI #006	3003907944	ROSA PC BLANCO MV /	26M	31N	OGW		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	OGW	BG1	HDPE SECONDARY LINER
100010111111100	3003801844	BLANCO MV /	ZOIVI	9117	OOVV	БСТ	FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #008A	3003925430	ROSA PC	26D	31N	06W	BG1	HDPE SECONDARY LINER
	3000020100		200	0114	(70)		FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008C	3003926944	BLANCO MV	26N	31N	06W		HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #009	3003907975	BLANCO MV	11K	31N	06W		HDPE SECONDARY LINER
		BASIN DK /					,
ROSA UNIT #009A	3003925584	BLANCO MV	11C	31N	06W	BG1	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
Beoo# TINU ASOS	3003927042	BI ANCO MV	11F	3111	06W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
OSA UNIT #010B	3003926556	BLANCO MV	13N	31N	06W	BG7	HDPE SECONDARY LINER
5.6							
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	06W	BGT	DBL WALL STEEL
/AC & 136117 42.4751	6060	DI ANDASTO:	4		****		
OSA UNIT #0160	3003926556	BLANCO MV	13N	31N	06W	BG1	DBL WALL STEEL

· WELLS W/FEDERAL							
SURF MGT	API	FM1	SEC	TWN	RNG	PITTY	E CONSTRUCTION MATERIAL
61/56 A LIBIT 11040 A		BLANCO MV /					07/51
ROSA UNIT #012A	3003925900	ROSA PC	15J	,31N	OEW	FGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT#012B	3003926555	BASIN DK / PLANCO MV	15F	31N	(JbVV	BGI	HDPF SECONDARY LINER
The state of the s	KICOOL GOOG	r transcript	13.7	1111	(11700	[7(7)	
ROSA UNIT #0120	3003929486	BLANCO MV	15/4	<1N	0644	5(,1	SINGLE WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #013	3003907936	BLANCO MV	31G	3114	OtiVV	BG1	HDPE SECONDARY LINER
ROSA UNIT #013A	00000000000	DI 61-00-11/	145		4,5,64	4 4 7	FIBERGLASS TANK W/BANDED 20 mil
ROSA CINIT #UTSA	3003926298	BLANCO MV BASIN DK /	311	31N	051	BG1	HOPE SECONDARY LINER
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	05Vv	BGT	DBL WALL STEEL
			ζ- // ,	.,,,,			FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #014	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPF SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #014A	3003926280	BLANCO MV	23F	3111	06/7	RG1	HDPE SECONDARY LINER
ROSA UNIT #014(,	3003930132	BASIN DK / BLANCO MV	נונים	21.61	OCIA	(/C)	DBI WALL STEEL
NOON CHILL HOLAC	3003930132	DI MINCO MA	2311	31N	06W	BG1	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #015	3003907946	BLANCO MV	2911	31N	05Vv	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #016	3003907963	BLANCO M\	14N	3111	06 V V	BGI	HDPE SECONDARY LINER
m. 0.0 4 114 127 144 14							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #016A	3003925496	BLANCO MV	14C	31N	OGVV	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #016B	3003926218	BLANCO MV	141/1	31N	06Vv	BGT	HDPE SECONDARY LINER
TOOK OTT FORCE	3003520210	DI ANCOMIV	1411	3114	OOVV	15(2)	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #01/A	3003926272	BLANCO MV	200	31N	05W	BGT	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #017H	3003926971	BLANCO MV	20J	31N	05W	BGI	HDPE SECONDARY LINER
DANCA LIBERT WORK		BLANCO MV /					FIBERGLASS TANK w/BANDFD 20-mil
ROSA UNIT #018	3003907960	ROSA PC BLANCO MV /	22H	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #018A	3003925436	ROSA PC	22F	31N	06W	SGT	DBL WALL STEEL
	000002	1100/170		() ()	17(7**	(0)	THE WALL STEEL
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W	BGT	DBI WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06Vv	5G1	HDPE SECONDARY LINER
ROSA UNIT #019B	2002020500	BLANCO MV	241	2.181	OWN	DCI	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
NOSA GIVET #0 (86)	3003926560	BI ANCO MV	241	31N	06W	BGT	THE SECONDARY THERE
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #019C	3003929625	BLANCO MV	24()	3111	06W	BGT	DBL WALL STEEL
DOCA LIMIT WOOD		D. 11100.111	110				FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	31N	OGW	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #020A	3003925495	BLANCO MV	140	31N	06W	BG1	HDPE SECONDARY LINER
	00020100			0774		00.	
ROSA UNIT #020B	3003926220	BLANCO MV	14A	31N	0677	BG1	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #021A	2002020404	DI ANICO MA	220	2464	()()()	D/C7	FIBERGLASS TANK W/BANDED 20-mil
NOOM CINE FUZ IA	3003926121	BL ANCO MV	23C	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #021B	3003926554	BLANCO MV	23K	31N	06W	BG1	DBL WALL STEEL
•			- • •			,	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #UZL	3003907971	BLANCO MV	18A	31N	05W	BGT	HDPE SECONDARY LINER

WELLS WIFEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #022A	3003926390	BLANCO MV	18C	3111	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #02+	3003907942	BLANCO MV	29M	31N	05Vv	BGI	HDPE SECONDARY LINER FIBERGLASS TANK v/BANDED 20 mil
ROSA UNIT #023P	3003926553	BLANCO MV BASIN DK /	29F	31N	06\\	PGI	HDPE SECONDARY LINER LIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #023C	3003927609	BI ANCO MV	291	31N	05VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #024	3003907933	BLANCO MV BASIN DK /	32M	31N	05Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #024A	3003925568	BLANCO MV	32 E	31N	05W	S(-1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #024B	3003 92 6630	BASIN DK / BLANCO MV	32N	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #0240	3003926968	BASIN DK / BLANCO MV	32C	31N	05VV	BGT	HDPE SECONDARY LINER
ROSA UNIT #026A	3003925580	BASIN DK / BI ANCO MV	320	31N	05W	SGI	DBL WALL STEEL
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W	SGI	DBI WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #029	3004511136	BLANCO MV	32H	12N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
FOSA UNIT #029B	3004530709	BASIN DK / BLANCO MV	32B	32N	06Vv	B61	HDPF SECONDARY LINER
ROSA UNIT #029M	3004529584	BASIN DK / BLANCO MV	321	32N	(mW	BG1	DBL WALL STEFL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #030 COM	3003925570	BASIN DK / BLANCO MV	120	31N	06//	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #030A	3003926068	BLANCO MV	12M	31N	06W	BGT	HOPE SECONDARY LINER
ROSA UNIT #030B	3003926601	BLANCO MV	12N	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #030C	3003929842	BLANCO MV	125	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #031	3003926279	BLANCO MV	17C	31N	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #031A	3003926346	BLANCO MV BASIN DK /	171	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #0.316	3003926579	BLANCO MV	17D	31N	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #0310	3003926578	BLANCO MV BLANCO MV /	17N	3111	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #032	3003925389	ROSA PC BLANCO MV /	2111	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #032A	3003925417	ROSA PC BASIN DK /	21F	31N	06W	BG1	DBI WALL STEFL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #032B	3003926771	BI ANCO MV	21G	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #0320	3003927240	BASIN DK / BLANCO MV	21F	31N	OOVV	BGT	HDPE SECONDARY LINER
ROSA UNIT #034	3003907984	BLANCO MV	36B	32N	06W		FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #034A	3003926119	BI ANCO MV	361	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #034A	3003926119	BI ANCO MV	361	32N	06W		DBL WALL STEEL
ROSA UNIT #034E	3003926629	BLANCO MV	36J	3211	06W		FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER

WELL'S W/FEDERAL			·				
SURF MG1	API	FMT	SEC	TWN	RNG	PIT TY	
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034(,	3003926969	BLANCO MV	36H	NSE	()(₂ Vv	[46]	HUPE SECONDARY LINER
ROSA UIIII #035X	3004510996	PLANCO MV	5k	3111	06\/v	BG1	DBI WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #036	3003907977	STANCO MA	1111	3110	OOV	101	HOPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #0360	3003930182	BLANCO MV	116	3111	GEVV	HGT	HDPE SECONDARY LINER
							FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #041	3003907981	BLANCO MV	5K	31N	05W	BGT	HDPE SECONDARY LINER
5 436 6 1 14 14 7 WG 4 4 1		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #041B	3003927014	BLANCO MV	49	31N	05Vv	BGT	HDPE SECONDARY LINER
ROSA UNII #044	3003925873	BLANCO MV	35K	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	0(·W	SGI	SINGLE WALL STEFL
KOSA OWI #044A	3003920101	DI ANCO INV	331	3218	OCVV	301	- SHOLE WALL STELL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	OGW	SGI	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06W	BGT	HOPE SECONDARY LINER
5O							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #045	3003923013	BLANCO MV	Me	31N	05W	BG1	HDPE SECONDARY LINER
ricit a chill arrae a	0.4.4.004.004.1	BASIN DK /	071		414.16.	001	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #046A	3003926986	BLANCO MV	8O	3114	05W	BG1	HIDE SECONDARY LINER
ROSA UNIT #05-1	3003920289	BASIN DK	23C	31N	06Vv	BGT	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #053	3003920293	BASIN DK	8B	31N	05VV	BGT	HDPE SECONDARY LINER
						,	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #055	3003920923	BASIN DK	341	31N	()5W	BGT	HDPE SECONDARY LINER
ROSA UNIT #059 DF	3003923270	BASIN DK	25N	31N	06W	BG1	DBI WALL STEEL
TOO TO THE PORT OF	300,032.0270	DAGIN LAC	2014	SIIN	(IOVV	COT	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06W	BG1	HDPE SECONDARY LINER
	(101/302 (12 / 6			•		27137	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	06Vv	BG1	HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05 V V	BGT	DBL WALL STEEL
5 5 5 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		D. A. O. L. D. L.				<i>.</i>	001 1461 1 0751
ROSA UNIT #064	3003921703	BASIN DK BASIN DK /	29A	31N	05Vv	SGI	DBI WALL STEEL
ROSA UNIT #064M	3003925563	BLANCO MV	29F	31N	05W	BGT	DBL WALL STEEL
NOON ONLY WORK!	<u> </u>	DI ANO INV	201	2114	(7,777	DOI	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	U5W	BGT	HDPE SECONDARY LINER
	SOUGOETTAL		,	0.114		1,0	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #066	3003921758	BASIN DK	13L	31N	0674	BG1	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #066M	3003925747	BLANCO MV	13F	31N	06W	BGT	HDPE SECONDARY LINER
•							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #072	3003925509	BLANCO MV	61	31N	05W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #072A	3003925795	BI ANCO MV	6K	31N	05W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #075	3004529895	BLANCO MV	101	31N	06W	BG1	HDPE SECONDARY LINER
						·	FIBERGLASS TANK w/BANDED 20 mil
ROSA LINIT #075A	3004529854	BLANCO MV	4()	31N	₩V	BGT	HDPE SECONDARY LINER
MAK A LIBIT COST	\	DK/UNDES	201	241	()(18)	001	FIBERGLASS TANK W/BANDFD 20 mil
ROSA UNIT #07	3003922538	GL/BLANCO	33L	31N	05W	BG1	HDPE SECONDARY LINER

. WELL3 W/FEDERAL							
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
		BASIN DK /					*
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK	22K	3114	06W	BG1	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV	22K	31N	06W	SGI	DBL WALL STEEL
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	221	2111	OPA	BGT	DBL WALL STEEL
ROSA UNIT #079B	3003926920	BLANCO MV	220	31N	06\/	BGT	DBI WALL STEEL
ROSA UNIT #0790	3003929902	BLANCO MV BASIN DK /	31P	31N	05W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #080	3003922537	BI ANCO MV	8K	31N	05Vv	BGT	HDPE SECONDARY LINER LIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #080A	3003926413	BLANCO MV	8 f	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05·W	BGT	HOPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	0517	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085A	3003926314	BLANCO MV	20C	31N	05W	ВСТ	HDPE SECONDARY LINER
ROSA UNIT #085F	3003930130	BLANCO MV	20D	3114	05W	BG1	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GL BLANCO MV /	12W	31N	()4W	SGT	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	ROSA PC	8E	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #089	3003922782	BI ANCO MV	34A	32N	O6VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #089A	3003925512	BI ANCO MV	34()	32N	06W	HGT	HDPE SECONDARY LINER
ROSA UNIT #089B	3003926851	PLANCO MV	341	3214	06W	BGT	DBI WALL STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	34G	3214	06\	5G1	SINGLE WALL STELL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #090 COM	3004525370	BLANCO MV	33G	4136	0 6V V	BGT	HDPE SECONDARYLINER
ROSA UNIT #090A COM	3004529259	BI ANCO MV	33G	3514	0674	BGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
≺OSA UNIT #091	3003922780	BLANCO MV	35H	32N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #091A	3003925790	BLANCO MV	35()	32N	()GW	SG1	DBL WALL STEFL
ROSA UNIT #091B	3003926684	BI ANCO MV	35P	3211	06₩	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #091C	3003926991	BI ANCO MV	35G	32N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
890# TINU A2OS	3003923265	BASIN DK / GI BASIN DK /	231	31N	W80	BG1	HDPF SECONDARY LINER
:OSA UNIT #100B	3003929547	BI ANCO MV	210	31N	06W	BGT	DBI WALI STEEL
OSA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	06W	BG1	DBL WALL STEEL
OSA UNIT #100F	3003925135	ROSA PC	211	31N	06W	SG1	SINGLE WALL STEEL
OSA UNIT #10HM	3003925577	BLANCO MV	24f	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
OSA UNIT #108	3003923506	BASIN DK / GL	7G	3111	U5W	BG1	HDPE SECONDARY LINER

WELL'S W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNIT #119	1003925145	FASIN DK	18N	31N	0514	BG1	DBL WALL STEEL FIBERGLASS TANK W.BANDED 20 mil
ROSA UNIT #125	3003925144	BLANCO MV	13B	3111	0647	BGT	HDPF SECONDARY LINER
ROSA UNIT #1250	3003929843	BLANCO MV BASIN DK	13G	31N	06W	BG1	DEL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #125E	3003925526	BLANCO MV	13.J	3119	06W	BGT	HOPE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	.34F	32N	(16VV	b G1	DBI WALL STEEL
ROSA UNIT #129A	3003926297	BLANCO MV	34K	32N	06\\	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #137	3003925410	BLANCO MV BLANCO MV	31K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSAPO	311	31N	05W	BG1	DBL WALL STELL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #137B	3003927002	BLANCO MV BLANCO MV	31F	31N	05VV	BG1	HDFE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #138	3004529147	ROSA PC BLANCO MV /	171	31N	06VV	BGT	HUPE SECONDARY LINER
ROSA UNII #138A	3004529134	ROSA PC	1711	3111	W80	BG1	(IBL WALL STEEL
ROSA UNIT #138B	3004532168	BLANCO MV	17#	3111	06VV	BGT	DRI WALL STEFL
ROSA UNIT #139A	3004529600	BLANCO MV	17M	3111	004	BG1	OPL WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	06W	BG1	DBL WALL STEFL
ROSA UNII #144	3003925421	ROSA FC	26A	31N	0617	BG1	DBI WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16F	3111	06W	861	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #1460	3003930187	BLANCO MV	28B	31N	05W	BGT	UBL WALL STEEL
R()SA UNIT #148	3003925493	BASIN DK	20	31N	06W	BG1	DBI WALL STEFL
ROSA UNIT #148A	3003925776	BLANCO MV	51/	31N	06W	RG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV	12F	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #149B	3003926599	BASIN DK / BLANCO MV	12F	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #150	3004529229	BLANCO MV	32F	32N	06W		FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINFR
ROSA UNIT #150A	3004529592	BLANCO MV	32M	32N	06W	BGI	DBI WALL STEEL
ROSA UNIT #150B	3004530874	BASIN DK / BLANCO MV	32D	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #15()(3004532157	BI ANCO MV	32K	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #15	3004529267	BLANCO MV	33C	32N	06W	BG1	DBL WALL STEEL

WELL'S W/FEDERAL SURF MGT	API	FMT	SEC	IWN	RNG	PIT TYE	PE CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	331	32N	061/v	BGI	DBI WALL STEEL
ROSA UNIT #1510	3004532196	BLANCO MV	488	32N	061/v	HG1	DBI WALL STEEL
ROSA UNIT #152	3003925494	BLANCO MV	36E	32N	06/7	EGI	FIBERGLASS TANK WBANDED 20 mil HDPL SECONDARY LINER
ROSA UNIT #152A	3003925695	BI ANCO MV	36N	3211	06Vv	BG1	DBI WALL STEEL
ROSA UNIT #152B	3003926631	BLANCO MV	36C	32N	06W	861	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #152C.	3003927635	BLANCO MV	361	32N	06W	EGI	HDPE SECONDARY LINER TIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #153	3003925524	BLANCO MV	17()	31N	05VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #153A	3003926329	BLANCO MV BASIN DK /	17A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #153B	3003927603	BLANCO MV	171	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	711	31N	05VV	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #154A	3003926274	PLANCO MV	7P	3111	(15VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDLD 20 mil
ROSA UNIT #156	3004529661	BLANCO MV	9.4	3111	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #156A	3004529640	BLANCO MV BASIN DK	91	31N	OoW	BG1	HOPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BLANCO MV	19O	31N	U5VV	BG1	DBL WALL STEFT FIBERGLASS TANK w/BANDFD 20 mil
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3111	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #15C	3003930111	BLANCO MV	29G	31N	06/7	BGT	HDFE SECONDARY LINER
ROSA UNIT #160	3003925890	ROSA PC	250	31N	06V?	BGT	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV BASIN DK /	25N	31N	06\/v	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #160B	3003926962	BI ANCO MV	251	31N	06Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BI ANCO MV	25J	31N	06W	BGI	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #162	3003926069	BLANCO MV	30K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BLANCO MV	30P	31N	05W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #163	3003926345	BLANCO MV	24G	31N	06W	BG1	HDF/E SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #163A	3003926336	BLANC() MV	240	31N	06VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	3111	06W	SGT	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV BASIN DK /	24J	31N	06W	SGT	SINGLE WALL STEEL FIBERGLASS TANK w/BANDE() 20 mil
ROSA (11417 #164	3003926151	BI ANCO MV	1J	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #164A	3003926080	BLANCO MV BASIN DK /	1 J	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDF() 20 mil
ROSA UNIT #164E	3003927242	BLANCO MV	1J	31N	06W	BG1	HDPE SECONDARY LINER

• WELL'S W/FEDERAL							
SURF MG1	API	FM1	SEC	IWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNIT #165	3003926070	BLANCO MV / ROSA PC	261	31N	()6VV	BGT	DBE WALL STEEL FIBERGLASS TANK WBANDED 20 not
ROSA UNIT #165A	3003926150	BLANCO MV BASIN DK /	25B	31N	06VV	BG1	HDFE SECONDARY LINER
ROSA UND #165B	3003926557	BLANCO MV BASIN DK /	251	311/	OOVV	E61	DBI WALL STEEL
ROSA UNIT #1650	3003926961	BLANCO MV	∠ 5G	3114	W8U	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BGT	HOPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #166A	3003926282	BLANCO MV	301	31N	05W	H61	HUFE SECONDARY LINER
ROSA UNIT #167A	3004529886	BLANCO MV	A8	31N	06Vv	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #169	3003926130	BLANCO MV	3J	3111	06W	BG1	DRI WALL STEFF
ROSA UNIT #169A	3003926149	BLANCO MV	31	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #1690	3003927717	BLANCO MV	2M	3111	06Vv	BGT	FIBERGLASS TANK w/BANDED 20-mil HDFE SECONDARY LINER
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	06W	BG1	DBI WALL STEFF
ROSA UNIT #171	3003926280	BLANCO MV	1G	3111	05W	B(-)	DBI WALL STEEL
ROSA UNIT #171A	3003926389	PLANCO MV	7(3	MIE	(15W	BG1	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #171B	3003927013	BLANCO MV	6P	31N	05W	BG1	FIBERGLASS TANK WBANDED 20 mil HDFE SECONDARY LINER
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	06W	6G1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #180F	3004533134	BLANCO MV	91	31N	06Vv	BGT	DBL WALL STEFF
ROSA UNIT #180C	3004533191	BLANCO MV	9E	31N	06W	19a	DBL WALL STEEL
ROSA UNIT #181	3003926463	BLANCO MV	11K	31N	06VV	BG1	DBI WALL STEEL
ROSA UNIT #181A	3003926312	BLANCO MV	15A	31N	06W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDDE SECONDARY LINER
ROSA UNIT #1810 (shared w/1690)	3003927714	BLANCO MV	2M	31N	06W	RGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #182	3003926283	BI ANCO MV	18N	31N	05W	BGT	HBERGLASS TANK WBANDED 20 mil HDDE SECONDARY LINER
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05 V V	ьст	DBL WALL STEEL
ROSA UNIT #1820	3003930180	BLANCO MV	18F	31N	05W	SG1	SINGLE WALL STEFL
ROSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W	BGT	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #183A	3003926386	BI ANCO MV	19F	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20-nul HDPF SECONDARY LINER
ROSA UNIT #183B	3003930087	BLANCO MV	19B	31N	()5W	BGT	DBI WALL STEFL
ROSA UNIT #185B	3004532734	BASIN DK / BLANCO MV	16F	31N	06W	BG1	DBL WALL STEFL
ROSA UNIT #1850	3004534484	BLANCO MV	16F	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #18	3003930186	BLANCO MV	21G	31N	05W	BG1	DBL WALL STEEL

Meador, Tasha

From: Meador, Tasha

Sent: Wednesday, May 26, 2010 10:25 AM

To: 'Jones, Brad A., EMNRD'

Cc: Lane, Myke; 'Powell, Brandon, EMNRD'; Snyder, Walden

Subject: RE: Request for Review Pit Closure - Cox Canyon 012, Cox Canyon 017, Cox Canyon 202

Brad:

We need to take the following below grade tanks out of service, and we would like to close/modify these existing BGTs. We request your review and approval to allow closure.

_	WELLSITE	API	FMT	SEC	TWN	RN
	Cox-Canyon-012	3004521488	BLANCO PC	201	32N	11\
	Cox Canyon 017	3004521581	BLANCO PC	16M	32N	11\
	Cox Canyon 202	3004527751	BASIN FTC	16M	32N	11\

Please contact me or Myke Lane if there are any problems or you request additional information. Thanks for your consideration

Tasha Meador

EH&S Coordinator Williams Exploration & Production 721 S Main Aztec, NM

Office: 505-634-4200 Direct:505-634-4241 Fax: 505-634-4205

tasha.meador@williams.com

District I

1625 N French Dr , Hobbs, NM 88240
District II ,
1301 W Grand Avenue, Artesia, NM 88210
District III 1000 Rio Biazos Road, Aztec, NM 87410 District IV 1220 S St Francis Dr , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back

Form C-141

Revised October 10, 2003

side of form

Attached

	Release Notification and Corrective Action									
						OPERATOR Initial Report Fin				
						Vanessa Fields				
					Telephone l		4209			
Facility Nan	ne	Cox Canyor	ı #012			Facility Typ	e Well Site			
Surface Ow	ner: Fede	ral		Mineral C	wner:			Lease	No.	
				LOCA	TIO	N OF RE	LEASE			
Unit Letter	Section	Township	Range	Feet from the		h/South Line	Feet from the	East/West Line	County	
I	20	32N	11W							
		J	atitude	36.96781N		Longitude	-108.0057W	J	_l	
		1	amuuc_			_		·		
Type of Relea	ngo No Dol	and Onguerrad		NAT	UKE	Volume of		Volumo	Recovered	
Source of Rel		ease Occurred					lour of Occurrence		Hour of Dis	covery
Was Immedia		Tiven?				If YES, To		e Date and	Tiour or Dis	covery
			Yes [No 🛛 Not Re	equired					
By Whom?						Date and I	lour			
Was a Watero	course Read		Yes 🗵] No		If YES, Volume Impacting the Watercourse				
If a Watercou	rce was Im	nacted Descr	the Fully?	* N/Δ						
Describe Cau No action req		em and Reme	dial Actio	n Taken *						
Describe Are	a Affected	and Cleanup A	Action Tal	cen *						
		ana oreanap i	ionon rui							
N/A										
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.						may endanger rator of liability ater, human health				
Signature. OIL CONS					SERVATION	DIVISIO	<u>DN</u>			
Printed Name	· Vanessa	Fields				Approved by District Supervisor				
Title: EH&S	Coordinate	or				Approval Da	te.	Expiration	Date	
E-mail Addre	ss Vaness	a fields@will	iams com			Conditions of Approval				

Phone (505) 634-4209

Date 10-26-10

^{*} Attach Additional Sheets If Necessary

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
 under these conditions will be closed within 60 days of cessation of the BGT's
 operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Wethods	Closure Jimils (mg//kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

- (1) Method modified for solid waste.
- $^{(2)}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.
- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.I NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports
- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Fiberglass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15,3.116.8 (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:


- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the followina:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed, of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.


Table 1: Closure Criteria for BGTs

	Table 1: Clearly efficient to Be 13						
Components:	Jesting Wethods.	Closure dimits (mg/kg)					
Benzene	EPA SW-846 Method 8021B or 8260B	0.2					
BTEX	EPA SW-846 Method 8021B or 8260B	50					
TPH	EPA SW-846 Method 8015 M(Full Range)*	100					
	or Method 418.1						
Chlorides	EPA SW-846 Method 300.1	250					

^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-appröved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

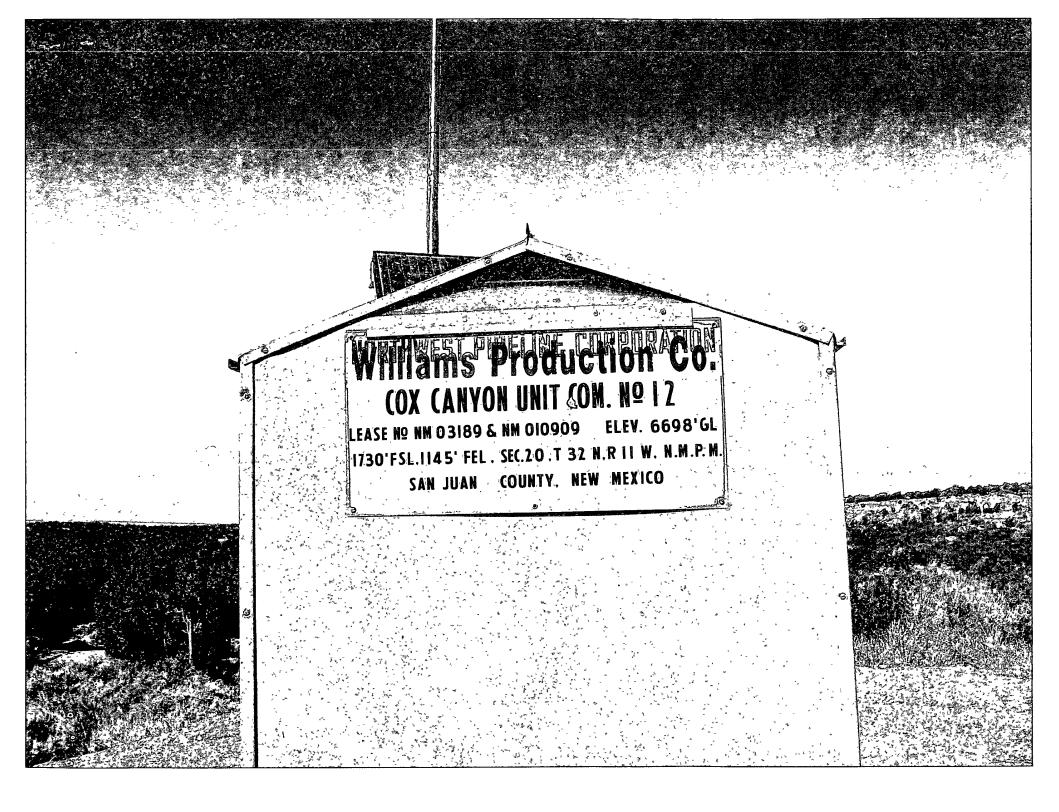

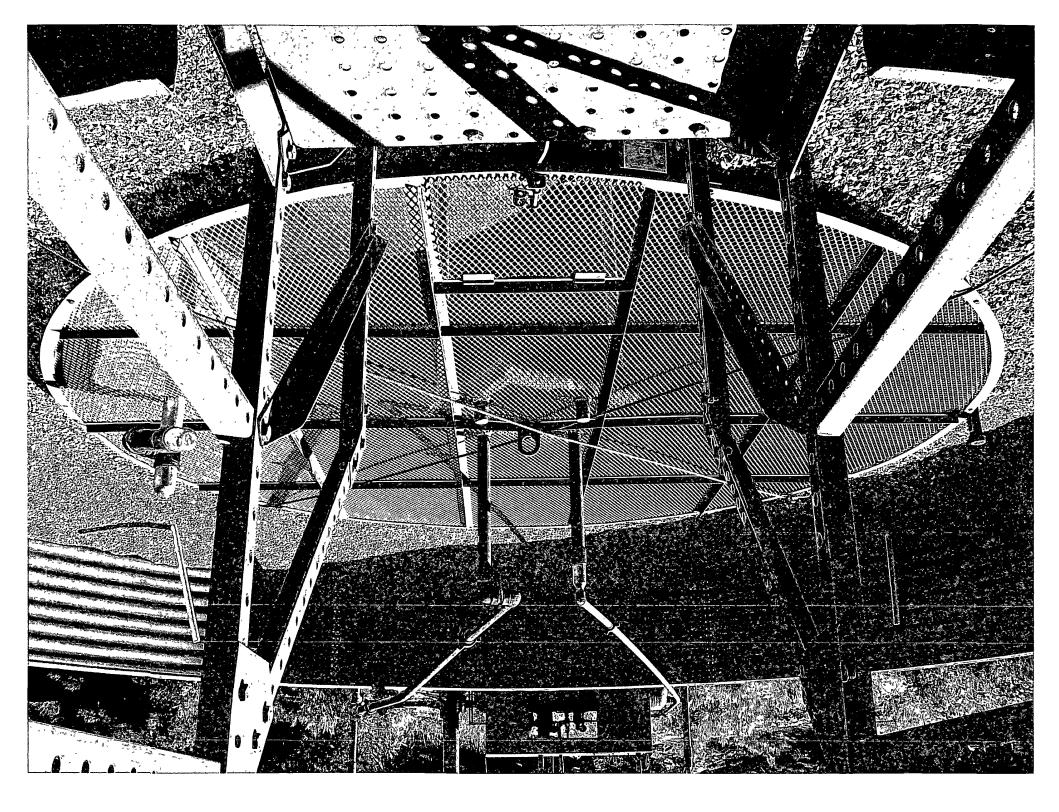




meter

house

Cox Canyon #12



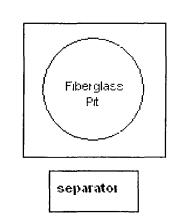





EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Williams	Project #:	04108-0136
Sample ID:	CC #12	Date Reported:	07-28-10
Laboratory Number:	55308	Date Sampled:	07-23-10
Chain of Custody No:	9845	Date Received:	07-27-10
Sample Matrix:	Soil	Date Extracted:	07-27-10
Preservative:		Date Analyzed:	07-28-10
Condition:	Intact	Analysis Requested:	8015 TPH
		•	

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Cox Canyon #12 BGT

Analyst

Ph /505/632-0615 Fr /200/362-1270 Ev /505/632-12865 Ish@onvirotoch.inc.com povirotoch-inc.com



EPA Method 8015 Modified Nonhalogenated Volatile Organics **Total Petroleum Hydrocarbons**

Quality Assurance Report

Client:	QA/QC		Project #:		N/A
Sample ID:	07-28-10 QA/	QC	Date Reported:		07-28-10
Laboratory Number:	55304		Date Sampled:		N/A
Sample Matrix:	Methylene Chlo	ride	Date Received:		N/A
Preservative:	N/A		Date Analyzed:		07-28-10
Condition:	N/A		Analysis Reque		TPH
the state of the s	I-Cal Date	I-Cal RF:	C-Cal RF:	% Difference	Accept. Range
Gasoline Range C5 - C10	05-07-07	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Diesel Range C10 - C28	05-07-07	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Blank Conc. (mg/L - mg/Kg)		Concentration		Detection Limit	
Gasoline Range C5 - C10		ND		0.2	
Diesel Range C10 - C28		ND		0,1	
Total Petroleum Hydrocarbons		ND		0.2	
Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Accept. Range	
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%	
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%	
Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept. Range
Gasoline Range C5 - C10	ND.	250	258	103%	75 - 125%
Diesel Range C10 - C28	ND	250	257	103%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 55302-55304, 55306-55309, 55312-55313



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Williams	Project #:	04108-0136
Sample ID:	CC #12	Date Reported:	07-28-10
Laboratory Number:	55308	Date Sampled:	07-23-10
Chain of Custody:	9845	Date Received:	07-27-10
Sample Matrix:	Soil	Date Analyzed:	07-28-10
Preservative:		Date Extracted:	07-27-10
Condition:	Intact	Analysis Requested:	BTEX

Concentration (ug/Kg)	Det. Limit (ug/Kg)	
ND	0.9	
1.2	1.0	
ND	1.0	
ND	1.2	
ND	0.9	
	(ug/Kg) ND 1.2 ND ND	Concentration (ug/Kg) Limit (ug/Kg) ND 0.9 1.2 1.0 ND 1.0 ND 1.2

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	101 %
	1,4-difluorobenzene	98 %
	Bromochlorobenzene	99 %

1.2

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments: Cox Canyon #12 BGT

Analyst

Total BTEX



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client: Sample ID- Laboratory Number: Sample Matrix. Preservative: Condition:	N/A 0728BBLK QA/QC 55313 Soil N/A N/A		Project #: Date Reported: Date Sampled: Date Received: Date Analyzed: Analysis:		N/A 07-28-10 N/A N/A 07-28-10 BTEX		
Calibration and	I-Cal RF;	C-Cal RF:	%Diff.	Blank	Detect.		
Detection Limits (ug/L)		Accept. Rar	nge U - 15%	Conc	Limit		
Benzene Toluene Ethylbenzene p,m-Xylene o-Xylene	7 1937E+005 7.8905E+005 7.1315E+005 1.7198E+006 6.1621E+005	7 2081E+005 7.9063E+005 7.1458E+005 1 7232E+006 6 1744E+005	0.2% 0.2% 0.2% 0.2% 0.2%	ND ND ND ND ND	0.1 0.1 0.1 0.1 0.1		
Duplicate Conc. (ug/Kg)	Sample	Duplicate	%Diff.	Accept Range	Detect. Limit		
Benzene	7,300	7,240	0.8%	0 - 30%	0.9		
Toluene	51,800	51,800		0 - 30%	1.0		
Ethylbenzene	4,450	4,420		0 - 30%	1.0		
p,m-Xylene o-Xylene	42,900 8,230	43,200 8,450		0 - 30% 0 - 30%	1.2 0.9		
Spike Conc. (ug/Kg)	Sample	Amount Spiked	Spiked Sample	% Recovery	Accept Range		
Benzene	7,300	50.0	7,850	101%	39 - 150		
Toluene	51,800	50.0	52,200	100%	46 - 148		
Ethylbenzene	4,450	50.0	4,690	94.7%	32 - 160		
p,m-Xylene	42,900	100	43,600	100%	46 - 148		
o-Xylene	8,230	50.0	8,940	102%	46 - 148		

ND - Parameter not detected at the stated detection limit.

References⁻ Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using

Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments: QA/QC for Samples 55302-55304, 55306, 55308-55309 and 55343

Analyst



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Williams	Project #:	04108-0136
Sample ID:	CC #12	Date Reported:	07-28-10
Laboratory Number:	55308	Date Sampled:	07-23-10
Chain of Custody No:	9845	Date Received:	07-27-10
Sample Matrix:	Soil	Date Extracted:	07-28-10
Preservative:		Date Analyzed:	07-28-10
Condition:	Intact	Analysis Needed:	TPH-418.1

	•	Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

28.8

22.2

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Cox Canyon #12 BGT

5796 US Highway 64 Farmington NM 87401 Ph (505) 632-0615 Fr (800) 362-1879 Fy (505) 632-1865 Jah@envirotech-inc.com envirotech-inc.com



EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client:	QA/QC	Project #:	N/A
Sample ID:	QA/QC	Date Reported:	07-28-10
Laboratory Number:	07-28-TPH.QA/QC 55302	Date Sampled:	N/A
Sample Matrix:	Freon-113	Date Analyzed:	07-28-10
Preservative:	N/A	Date Extracted:	07-28-10
Condition:	N/A	Analysis Needed:	TPH

Calibration	I-Cal Date	C-Cal Date	I-Cal RF:	C-Cal RF:	% Difference	Accept. Range
	07-15-10	07-28-10	1,846	1,770	4.1%	+/- 10%

	07-15-10	07-28-10	1,846	1,770	4.1%	+/- 10%
Blank Conc. (n TPH	ng/Kg)		Concentration ND		Detection Lim	it
Duplicate Con-	c. (mg/Kg)		Sample 35.5	Duplicate 36.9	% Difference 3.9%	Accept. Range +/- 30%
Spike Conc. (n TPH	ng/Kg)	Sample 35.5	Spike Added 2,000	Spike Result 1,920	% Recovery 94.3%	Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

References: Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: QA/QC for Samples 55302, 55303, 55306, 55308-55309



Chloride

Williams	Project #:	04108-0136
CC #12	Date Reported:	07-28-10
55308	Date Sampled:	07-23-10
Soil	Date Received:	07-27-10
	Date Analyzed:	07-28-10
Intact	Chain of Custody:	9845
	CC #12 55308 Soil	CC #12 Date Reported: 55308 Date Sampled: Soil Date Received: Date Analyzed:

Parameter Concentration (mg/Kg)

Total Chloride 60

Reference: U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments: Cox Canyon #12 BGT

CHAIN OF CUSTODY RECORD

09845

Client:	····	P	roject Name /	Location	¥+ /	n R6	. T	-						ANAL	YSIS	/ PAR	AME	ΓERS					۲۰
WILLIAMS Client Address:		S	ampler Name	ryo	1 de 1	200	\$ (<u> </u>	X		1	T	<u> </u>	T	 _	K	X 1			T	- 1	ε
7215.ma		1	ampler Name:	Sin	, d e 1)			TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	,,,											
Client Phone No.:			Client No.:		yus !				- 8 B	poq	g go	RCRA 8 Metals	<u>5</u>		呈		=				1	- l	ğ
1034-4241			04108-	0131	Ö				eth	Met	eth	Ž	An'		it i		8.					Š	Inte
Sample No./	Sample	Sample			ample	No./Volume	Pres	servativ		×	2	₹	Cation / Anion		TCLP with H/P	_	TPH (418.1)	CHLORIDE		:		Sample Cool	Sample Intact
Identification	Date	Time	Lab No.		// Matrix	of Containers		на	一直	HE	Š	교	Cat	泛	덛	PAH	ā	동			l	San	San
CC#15	olee	<i>টেද</i> 0/	5538	Soil Solid	Sludge Aqueous	1403			X	X							X	X	•			N	Y
				Soil Solid	Sludge Aqueous	0				'													O
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous									-									
				Soil Solid	Sludge Aqueous																		
		_		Soil Solid	Sludge Aqueous																		
Relinquished by: (Signa	ture)	1	/	. !.	Date	Time	7	teseiv	ed by:	(Sign	ajure))		<u> </u>	L			L1		Da	ite	Tin	ne
1 Trtaxia	N/	l all	14		1/27/10	2:25	1,	\mathcal{L}	ſ.	1/	RO.	ua.	a							7/2-	n	2	27
Relinquished by: (Signa		<u> </u>	(A		1-11-	101.01.0	F	leceiv	ed by: ed by:	(Sign:	ature))								Val	/10	<i>V</i> . <i>c</i>	~/
Relinquished by: (Signa	ature)						F	Receiv	ed by:	(Sign	ature))		•									\dashv
						<u> </u>													******				
						en\ An) [
I			5796 U	S Highwa	64 • Farmin	gton, NM 87	401 •	• 505-6	32-061	5 • lat	o@env	/irotec	h-inc.c	om									

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Report

> **Well:** (Cox Canyon #012) **API No:** 30-04521488

Location: I-S20-T32N-R11W, NMPM



In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be initiated within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.I(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

Prior to initiating any BGT Closure except in the case of an emergency, WPX will
review County Tax Records for the current landowner of record. The landowner of
record will be notified of the intent to closure the BGT by certified mail and a copy of
this notification will be included in the closure report. In the case of an emergency,
the landowner of record will be notified as soon as practical.

<u>Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March</u> 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)

<u>Aztec District office was notified of Williams E&P intent to close on (05/26/2010). Email</u> attached.

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

Williams closed the BGT used by the Cox Canyon #012 separator and piped all liquids to the Produced Water Storage Tank.

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled to the Rosa Unit disposal wells listed</u>

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

 The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Tabla	1 •	Closure	Critoria	for	RCT _C
iane	Ι:	Closure	Cinena	ЮI	DCZIS

Components	Testing Methods	Closure Limits (mg/kg)	Sample Results (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2	ND
BTEX	EPA SW-846 Method 8021B or 8260B	50	ND
TPH	EPA SW-846 Method 418.1(1)	100	33.2
Chlorides	EPA SW-846 Method 300.1(1)	250(2)	5

⁽¹⁾ Method modified for solid waste.

9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site.</u> Backfill compacted to avoid settling and pit area remains in use for production operations.

 $^{^{(2)}}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13., I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above. See above notes.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical
 Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation