District I 1625 N. French Dr., Hobbs, NM 88240 District II

1301 W. Grand Avenue, Artesia, NM 88210

District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division

1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office.
For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

	-		
1	1	1	5

Pit, Closed-Loop System, Below-Grade Tank, or

Proposed Alternative Method Permit or Closure Plan Application
Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
Operator: WILLIAMS PRODUCTION COMPANY, LLC OGRID #: 120782
Address: PO Box 640 Aztec, NM 87410
Facility or well name: ROSA UNIT #091
API Number: OCD Permit Number:
Section 35H Township 32N Range 06W County RIO ARRIBA
Latitude: 36.93265999999998 Longitude 107.42401 NAD: 1983 Surface Owner: FEDERAL
Editate
Pit: Subsection F or G of 19.15.17.11 NMAC Temporary: Drilling Workover Permanent Emergency Cavitation P&A Lined Unlined Liner type: Thickness mil LLDPE HDPE PVC Other String-Reinforced Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D
Closed-loop System: Subsection H of 19.15 17.11 NMAC Type of Operation: P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent) Drying Pad Above Ground Steel Tanks Haul-off Bins Other Lined Unlined Liner type: Thickness mil LLDPE HDPE PVC Other Liner Seams: Welded Factory Other
Liner Seams: Welded Factory Other 4. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 120
5. Alternative Method:

Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks) Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hinstitution or church) Four foot height, four strands of barbed wire evenly spaced between one and four feet	nospital.
Alternate. Please specify	
Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks) Screen Netting Other Monthly inspections (If netting or screening is not physically feasible)	
Signs: Subsection C of 19.15.17.11 NMAC ☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers ☐ Signed in compliance with 19.15.3.103 NMAC	
Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance. Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s): Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau of consideration of approval. Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	office for
Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the approp office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dryin above-grade tanks associated with a closed-loop system.	priate district pproval.
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No ☐ NA
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to permanent pits) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No ☐ NA
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Yes No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	Yes No
Within a 100-year floodplain FEMA map	☐ Yes ☐ No

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC Previously Approved Design (attach copy of design) API Number: or Permit Number:
12.
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19.15.17.9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design) API Number:
Previously Approved Operating and Maintenance Plan API Number:(Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.19 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Erosion Control Plan Erosion Control Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan. Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Maste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. □ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC □ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC □ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) □ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC □ Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC □ Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please indentify the facility or facilities for the disposal of liquids, facilities are required.		
facilities are required. Disposal Facility Name:	Disposal Facility Permit Number:	
Disposal Facility Name:	Disposal Facility Permit Number:	
Will any of the proposed closed-loop system operations and associated activities o ☐ Yes (If yes, please provide the information below) ☐ No	ccur on or in areas that will not be used for future serv	vice and operations?
Required for impacted areas which will not be used for future service and operation Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	e requirements of Subsection H of 19.15.17.13 NMAC 11 of 19.15.17.13 NMAC	2
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may required considered an exception which must be submitted to the Santa Fe Environmental demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC	re administrative approval from the appropriate disti Il Bureau office for consideration of approval. Justi	rict office or may be
Ground water is less than 50 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Da	a obtained from nearby wells	☐ Yes ☑ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Da	ta obtained from nearby wells	☐ Yes ☒ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Da	ta obtained from nearby wells	☐ Ycs ☐ No ☑ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other signake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	gnificant watercourse or lakebed, sinkhole, or playa	☐ Yes ⊠ No
Within 300 feet from a permanent residence, school, hospital, institution, or churci- Visual inspection (certification) of the proposed site; Aerial photo; Satellit		☐ Yes ⊠ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that les watering purposes, or within 1000 horizontal feet of any other fresh water well or - NM Office of the State Engineer - iWATERS database; Visual inspection	spring, in existence at the time of initial application.	☐ Yes ☒ No
Within incorporated municipal boundaries or within a defined municipal fresh wat adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approx	·	☐ Yes ⊠ No
Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visu	al inspection (certification) of the proposed site	☐ Yes ☑ No
Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Minin	g and Mineral Division	☐ Yes ☒ No
 Within an unstable area. Engineering measures incorporated into the design; NM Bureau of Geolog Society; Topographic map 	gy & Mineral Resources; USGS; NM Geological	☐ Yes ⊠ No
Within a 100-year floodplain FEMA map		☐ Yes ⊠ No
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the a Construction/Design Plan of Temporary Pit (for in-place burial of a drying Protocols and Procedures - based upon the appropriate requirements of 19.1 Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	quirements of 19.15.17.10 NMAC f Subsection F of 19.15.17.13 NMAC ppropriate requirements of 19.15.17.11 NMAC pad) - based upon the appropriate requirements of 19. 5.17.13 NMAC quirements of Subsection F of 19.15.17.13 NMAC f Subsection F of 19.15.17 13 NMAC drill cuttings or in case on-site closure standards cannot H of 19.15.17.13 NMAC at of 19.15.17.13 NMAC	15.17.11 NMAC

Operator Application Certification: I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief.
Name (Print):Title:
Signature: Date:
e-mail address: Telephone
OCD Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment) OCD Representative Signature: Approval Date: S/25/2011 Title: OCD Permit Number:
Closure Report (required within 60 days of closure completion): Subsection K of 19.15.17.13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed.
Closure Completion Date:6/17/10 \omega Disposal Facility Name & Permit #:San Juan Regional Landfill, NMED Permit SWM-052426
22. Closure Method: Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain.
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized. Disposal Facility Name: Disposal Facility Permit Number: Disposal Facility Name: Disposal Facility Permit Number:
Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closure) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude
Operator Closure Certification:
I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.
Name (Print): Vanessa Fields
Signature: Date: 10-26-10
e-mail address:_vanessa.fields@williams.com



Exploration & Finduction FC BC> 640 Azicc NM 81137 505/634 4214 fox

March 10, 2009

Mr. Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE: Notification of Production Pit Closure

Rule 19 15.17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co. LLC

Pursuant to Rule 19 15 17 13 NMAC, this correspondence is to notify the Bureau of Land Management. Farmington Field Office of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County, New Mexico. Closure will follow the plan included with this correspondence.

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted

Holly C Perkins EH&S Specialist

Encl: Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets. Below-Grade Tank Closure Plan

cc Environmental File

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below Grade Tank Removal Closure Flan

th accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below grade tanks (BC-1) on Williams Production Co. H.C. (WFX) to cations in the San Juan Basic of New Mexico. This is WEX estandard closure procedure for all BGIs regulated under Rule 19.15.17 NMAC and operated by WEX. For those closures which do not conform to this standard closure plan a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

forsulant to 19.15.17.13 (A) NMAC. WEX will initiate closure of any 6G1 should any one of these conditions occur.

- The Division requires closure because of imminent danger to tresh water public health or the environment.
- The integrity of the BG1 foils. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19-15-17-12 [A][5] NMAC.
- WEX chooses to take the BGI out of service due to operational needs. Closure under these conditions will be closed within 60 days of dessation of the BGT's operation.
- BC-Is installed pilor to June 16, 2008 that do not meet the requirements under 19.15.17.11 (6).
 BIMAC and WEX; thooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- First to initiating any BGT Closure except in the case of an emergency. WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to close the PGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- Notice of Closure will be given to the Azte of District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following.
 - a Operators Name (WPX)
 - b. Well Name and All Humber
 - c Location (USIR)
- All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks temporary fractank...). The well will be temporarily shut in until the rerouting is completed.
- All produced water will be removed from the BCF following discharge pipe rerouting Froduced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGF site. Rosa Unit SWD #1 (Order SWD 916, API 30 039 27055). Rosa Unit #94 (Order: SWD 3RP-1003-0, API 30-039-23035). Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465). Middle Mesa SWD #001 (Order SWD 350-0-API 30-045-27004). and/or Basin Disposal (Permit NM-01-0005).

solids and sludges will be shoveted and 70% var domen out for disposal at Envirotech (Fermit Monther 1996).

Who will of fair prior approval from RMOC() to alshore incording reason of reciain the BCT and provide documentation of the argicular of the FCF in the closure report. Sieculaterals will be recycled or reuseo as approved by the Eivistor. Thoracist tanks will be empty of the argicular and FA decided for disposal as sollowaste. Their materials will

be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9-42 NMAC. Disposal will be at a licensed disposal facility presently San Juan Regional Landfill operated by Waste Management under IVMLD Fermit SWM 052426.

- Any equipment associated with the RGI that is no longer required for some other purpose following the closure will be removed from the for after
- taken of the excavation and fested per 19.15.17.13(f.)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet also oldred or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C. 141

Table 1. Closure Criteria for BG1s

		5	
Components	Testing Methods	Closure Limits (mg/Kg)	1
Benzene	EPA SW 846 Method 8021B or 8260B	() 2	
BILX	EPA SW-846 Method 8021B or 8260B	50	į
TEH	EFA SW-846 Method 418 1111	100	
Chlorides	FPA SW 846 Method 300 1"	250%	

Method modified for solid waste.

If background cancentration of Chlandes greater than 200 mg it gothers higher concentration will be used for allowing.

- 4 If the Division and/or WEX determine there is a release. WEX will comply with 19-15-3-116. NMAC and 19-15-1,19 NMAC.
- Upon completion of the tank removal, the excavation will be backfilled with non-waste carthen material compacted and covered with a minimum of one, foot of top soil or background thickness whichever is greater and to existing grade. The suitace will be reconfoured to match the native grade and prevent ponding.
- For those portions of the formal pit area no longer required for production activities. Whi will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via diffing on the contour whenever practical or by other Division approved methods. Vegetative, cover will equal 70% of the native perennial vegetative cover (un impacted) consisting of at least three native plant species, including at least one grass. Lut not including noxious weeds and maintained that cover through two successive growing seasons. Repeat seeding or plantling will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that ac not meet re-vegetation requirements of 19.15.17.13.1 NMAC, then WPA will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12 For those portions of the former pit area required for production activities reseeding will be done at well abandonment, and following the procedure noted above:

Closure Report

All closure activities will include pic per abcomentation and will be submitted to OCD within 60 days of the BCI closure on a Closure Kenort using Division Form C-144. The Kenort will include the following:

- Experience of the second of the
- · Pacifienci & Crie Connor
- · Sile (nogram with the marks -
- · Available not echo net

- · Confirmation Sampling Francis of Fee 1
- Lisposor Lacient Teaméra, or a remail teamberga
- · Add to office knote & seeding, technique
- Endo become number of Federator or

WELLS W/FEDERAL						Concession make to record affiliate	A STATE OF THE PARTY OF THE PAR
SURF MGT	<u>API</u>	FMT	SEC	TWN	RNG	PIT TY	E CONSTRUCTION MATERIAL
COX CANYON UNIT #001	3004511397	PLANCO MV	16N	32N	11W	BG1	DBL WALL STEEL FIBERGLASS TANK w.BANDED 20 mil
COX CANYON UNH #001A	3004522086	PLANCO MV	16C	3211	11Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
COX CANYON UNIT #001B	3004530791	BLANCO MV	161	32N	11W	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	16F	3211	11W	BG1	DBL WALL STEEL FIRERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #003	3004511495	BLANCO MV	. 91	32N	11VV	BGT	HDPE SECONDARY LINER
COX CANYON UNIT #003A	3004522088	BLANCO MV	9P	32N	11W	BGI	DBI WALL STEEL
COX CANYON UNIT #003B	3004530871	BLANCO MV	9,1	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #004	3004511368	BLANCO MV	21A	32N	11W	BGT	DBL WALL STEFL
COX CANYON UNIT #004A	3004522093	BLANCO MV	21F	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #004B	3004532186	BLANCO MV	211	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #005	3004511326	BLANCO MV	21K	32N	1 1 Vv	BGI	DBI WALL STEFL
COX CANYON UNIT #005A	3004522094	BLANCO MV BASIN DK /	211)	3214	1 1 V V	BGT	DBI WALL STEEL
COX CANYON UNIT #005B	3004532142	BLANCO MV	2111	3214	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #005C	3004533493	BLANCO MV	21F	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #006	3004511463	BLANCO MV	16A	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006A	3004522095	BLANCO MV	161	3211	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #006B	3004532693	BLANCO MV	16B	32N	11W	BGT	DBI WALL STEFL
COX CANYON UNIT #006C	3004532733	BLANCO MV	16()	32N	11W	PG1	DBI WALL STEEL
COX CANYON UNIT #607	3004511455	BLANCO MV	17G	32N	11W	F GP	DBL WALL STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	32N	11W	BGT	DBL WALL STEFL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	32N	11W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #008	3004511492	BLANCO MV	81	32N	11W	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	BLANCO MV	17H	32N	11W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #0088	3004532080	BLANCO MV	8P	32N	11W	BG1	HDPE SECONDARY LINER .
COX CANYON UNIT #008C	3004531187	BLANCO MV	17F	32N	11W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
COX CANYON UNIT #009A	3004522092	BLANCO MV	20D	32N	11W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
COX CANYON UNIT #009B	3004533926	BASIN DK / BLANCO MV	20B	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #009C	3003933851	BASIN DK / BLANCO MV	20F	3211	11W	BGT	DBI WALL STEEL
CÓX CANYON ÚNH #013	3004521489	BLANCO PC	20A	32N	11W_	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER

• ,

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
COX CANYON UNIT #023		no. Marie decomposare, disconspiratelle, seculto es se					FIBERGLASS TANK W/BANDED 20-mi
COM	3004522537	BLANCO PC	17C	32N	11W	BG1	HOPE SECONDARY LINER
	3000-022001	DI MACCOLLO	17(,	, 1214	1144	,	FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #025	000.44.05.4.30	DEANICO DE	()()	25.61	1.1167	DOI	HDPE SECONDARY LINER
COX CAINTON ONLY #025	3004522572	BLANCOPC	90	32N	111/	BG1	
CAN CANADA DE CAMA SA OA							FIBERGLASS TANK W/BANDED 20 mi
COX CANYON UNIT #200	3004527878	BASINFIC	91	32N	1 I VV	BGT	HDPE SECONDARY LINER
				,			FIBERGLASS TANK W/BANDED 20-mi
COX CANYON UNIT #200A	3004532126	BASINFIC	90	3211	11VV	BGT	HOPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #203	3004527872	BASINFIC	17A	32N	11W	BGT	HDPE SECONDARY LINER
MADDOX #001	3004511487	BLANCO MV	10N	.32N	11Vv	BG1	DBL WALL STEEL
				•			
MADDOX #001A	3004523539	BLANCO MV	10F)	32N	11W	BGI	DBL WALL STEEL
						£/ 🗸 T	
NM 32-11 #001	3004511309	BLANCO MV	200	32N	11W	BGI	DBI WALL STEEL
	30043711303	BASIN DK /	200	3214	1100	13(3)	DBI WALL STEEL
NM 32-11 #001B COM	20045 2202	BLANCO MV	20.1	2011	4.41.64	001	INDE WALL CIET!
NIC 52-11 HOUTE CON	3004532024		203	32N	11W	BGT	DBL WALL STEEL
NM 32-11-#001C COM	0004500004	BASIN DK /	2101	0011		0.01	AND ANALL CREEK
NM 32 TE #00 TO COM	3004532804	BLANCO MV	201	32N	1 1 VV		DBI, WALL STEEL
							FIBERGLASS TANK w'BANDED 20-mir
NM 32-11 #002 COM	3004511380	BLANCO MV	19A	32N	11W	BG1	HDPE SECONDARY LINER
NM 32-11 #002A COM	3004529017	BLANCO MV	190	3211	11W	BGI	DBL WALL STEEL
NM 32-11 #002B COM	3004532670	BLANCO MV	191	32N	11W	BG1	DBI WALL STEEL
NM 32-11 #002C COM	3004533077	BLANCO MV	19G	32N	11W	BG1	DBL WALL STEFI
ROSA UNIT #001 SWD	3003927055	SW()	231	31N	06VV	BGT	DBI WALL STEEL
		.BASIN DK /	- 117		((() ()		FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #001E	3003925411	BLANCO MV	11F	31N	06W		HDPE SECONDARY LINER
	0000020411	BLANCO MV	1 11	OIN	OOVY	1301	THE COLORS TO THE REAL PROPERTY OF THE PERTY
ROSA UNIT #005A	2002001.402	ROSA PC	0211	1484	ALCO L	50.7	INDUALAN CITTI
NOSA ONT HOOM	3003925407		26P	31N	0644	BGT	DBL WALL STEEL
DONG A HIANT HOOKE		BASIN DK /	45.45				071.0
ROSA UNIT #005B	3003926927	BLANCO MV	26B	3114	06W		DBL WALL STEEL
							FIBERGLASS TANK WIBANDED 20 mil
ROSA UNIT #005Y	3003926078	BI ANCO MV	26H	51N	06W		HDPE SECONDARY LINER
		BLANCO MV /				-	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	OGW	BGT	HDPE SECONDARY LINER
		BLANCO MV /				1	FIBERGLASS TANK W/BANDED 20 mill
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	06W	BGT	HDPE SECONDARY LINER
		BLANCO MV /				i	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #006A	3003925430	ROSA PC	26D	31N	06W	8G1 1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
KOSA UNIT #008C	3003926944	BLANCO MV	26N	31N	06W		HDPE SECONDARY LINER
	000000000000000000000000000000000000000			.,,,,,	000		BERGLASS TANK W/BANDED 20 mil
20SA UNIT #009	3003907975	BLANCO MV	11K	31N	06W		HDPE SECONDARY LINER
	0000301010	BASIN DK /	1 111	3114	OOVV	1001	IDI E SECONDARI EMER
ROSA UNIT #009A	JOURGERA	BLANCO MV	110	21.4.6.1	07.167	מיז ו	DDL WALL STEEL
CCON CHAIL BOOCH	3003925584	BI AINCO MV	11C	31N	06W		OBL WALL STEEL
ACC & LIMIT MOOVE	00000000000	01.44100.4414					(IBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #009B	3003927042	BI ANCO MV	11E	31N	06W		IDPE SECONDARY LINER
6.5.4.4.15							FIBERGLASS TANK w/BANDED 20-mil
OSA UNIT #010B	3003926556	BLANCO MV	13N	31N	06W	BG1	IDPE SECONDARY LINER
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	06W	BG7 (OBL WALL STEEL

WELLS W/FEDERAL	to the second se	The same and the same should be appealed to the same state of the					
SURF MG1	API	FM1	SEC	IWN	RNG	PITTYP	E CONSTRUCTION MATERIAL
ROSA UNIT #012A	3003925900	BLANCO MV / ROSA PC	15J	.31N	oeW	EGT	OBI WALL STEEL
ROSA UNIT #012B	3003926555	BASIN DK / BLANCO MV	16F	31N	U6W	BGI	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	154	*1N	0644	\$61	SINGLE WALL STELL
ROSA UNII #013	3003907936	BLANCO MV	31G	31N	osvv.	BG1	HIBERGLASS TANK WBANDED 20 mil HIDPE SECONDARY LINER
ROSA UNIT #013A	3003926298	BLANCO MV BASIN DK /	311	31N	0574	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	0544	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #014	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #014A	3003926280	BLANCO MV BASIN DK /	23P	3111	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #014C	3003930132	BLANCO MV	23H	31N	06W	BGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #015	3003907946	BI ANCO MV	29H	31N	05VV	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #016	3003907963	BLANCO MV	14N	3114	06VV	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA-UNIT #U1GA	3003925496	BLANCO MV	14C	31N	06W	BGT	HIDPE SECONDARY LINER HIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #016H	3003926218	BLANCO MV	1414	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #017A	3003926272	BLANCO MV	200	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #017B	3003926971	BASIN DK / BLANCO MV	20J	31N ·	05Vv	HG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #018	3003907960	BLANCO MV / ROSA PC BLANCO MV /	22H	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #018A	3003925436	ROSA PC	22F	31N	06W	SGT	DBL WALL STEEL
ROSA UNIT #018B	3003927052	BLANĆO MV	220	31N	06W	BGI	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #019	3003907955	BI ANCO MV	24K	31N	06Vv	BGT	
ROSA UNIT #019B	3003926560	BI ANCO MV	241	3110	06W	BGI	HDPE SECONDARY LINER
ROSA UNIT #019C	3003929625	BL ANCO MV	24D	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #020A	3003925495	BLANCO MV	14()	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #020B	3003926220	BI ANCO MV	14A	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #021A	3003926121	BL ANCO MV	23C	31N	06W		HDPE SECONDARY LINER
ROSA LINIT #021B	3003926554	BLANCO MV	23K	31N	06W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #02	3003907971	BLANCO MV	18A	31N	05VV		HDPE SECONDARY LINER

WELLS W/FEDERAL	ADI	CMT	2.12	T14/41	DAIC	מער דעמב	CONSTRUCTION MATERIAL
SURF MGT	API	FMT	SEC	TWN	KNG	PIT TYPE	FIBERGI ASS TANK W/BANDED 20 mil
ROSA UNIT #022A	3003926390	BLANCO MV	16C	31N	0574	BGI	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #021	3003907942	BLANCO MV	29M	31N	(15Vv	BGT	HDPE SECONDARY LINER LIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #023B	3003926553	BLANCO MV BASIN DK /	29F	31N	05W	BGT	HDPE SECONDARY LINER LIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #023C	3003927609	BI ANCO MV	291	31N	05Vv	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #024	3003907933	BLANCO MV BASIN DK /	32M	31N	05Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #024A	3003925568	BLANCO MV BASIN DK /	32E	31N	05VV	SGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #024B	3003926630	BLANCO MV BASIN DK /	32N	31N	()5W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #024C	3003926968	BLANCO MV BASIN DK /	32C	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #026A	3003925580	BLANCO MV	320	31N	05W	SG1	DBL WALL STEEL
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W		DBI WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #029	3004511136	BLANCO MV BASIN DK /	32H	32N	0674		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
POSA UNIT #029B	3004530709	BLANCO MV BASIN DK /	32B	32N	0644	BG1	HDPE SECONDARY LINER
ROSA UNIT #029M	3004529584	BLANCO MV BASIN DK /	321	32N	(16/07)		DBL WALL STEFL FIBERGLASS TANK wBANDED 20-mil
ROSA UNIT #030 COM	3003925570	BLANCO MV	120	31N	0677		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDFD 20-mil
ROSA UNIT #030A	3003926068	BLANCO MV	121/1	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #030B	3003926601	BLANCO MV	12N	318	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #030C	3003929842	BL ANCO MV	12F'	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #031	3003926279	BLANCO MV	17C	31N	05Vv		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #031A	3003926346	BLANCO MV BASIN DK /	171	31N	05W	1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #031B	3003926579	BLANCO MV	17D	31N	05Vv	1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #031C	3003926578	BLANCO MV /	17N	3111	05W		HDPE SECONDARY LINER
ROSA UNIT #032	3003925389	ROSA PC BLANCO MV /	2111	31N	06W		OBL WALL STEEL
ROSA UNIT #032A	3003925417	ROSA PC BASIN DK /	21F	31N	06W	f	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #032B	3003926771	BLANCO MV BASIN DK /	21G	31N	06W	ſ	IDPE SECONDARY LINER TIBERGLASS TANK W/BANDED 20-mile
ROSA UNIT #032C	3003927240	BI ANCO MV	21F	31N	ObVV	ſ	IDPE SECONDARY LINER IBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #034	3003907984	BI ANCO MV	36B	32N	06W	BG1 I	HDPE SECONDARY LINER
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W	BGT (OBL WALL STEEL
ROSA UNIT #034A	3003926119	BI ANCO MV	364	32N	06W		DBL WALL STEEL IBERGLASS TANK WBANDED 20-mil
ROSA UNIT #034E	3003926629	BLANCO MV	36J	32R	06W	BG1 F	IDPE SECONDARY LINER

WELLS W/FEDERAL		•					
SURF MG1	API	FMT	SEC	TWN	RNG	PITTY	
T.CALA LIAUT GOOD							FIBERGLASS TANK W/BANDED 20 mill
ROSA UNIT #034C	3003926969	ELANCO MV	36H	32N	()(₂ V/	BG1	HDPE SECONDARY LINER
ROSA UNIT #035X	3004510996	PLANCO MV	5K	3114	oevv	B61	DBI WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #03C	3003907977	PLANCO MV	1111	3110	()(:\V	EGI	
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #0360	3003930182	BLANCO MV	11G	3111	06Vv	BGT	HDPE SECONDARY LINER
E 004 1042 404							FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #041	3003907981	BLANCO MV	5K	3114	05Vv	BGT	HDPE SECONDARY LINER
FIAN A LIBRA WALL		BASIN DK /					FIBERGLASS TANK w/BANDFD 20 mil
ROSA UNIT #04 (B	3003927014	BLANCO MV	6P	31N	05Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #044	3003925873	BLANCO MV	35K	32N	06W	BG1	DBL WALL STEEL
5700 6 1 14 11 7 2 0 4 4 6		B. 41104141					
ROSA UNIT #044A	3003926161	BI ANCO MV	35E	3214	06.70	SGT	SINGLE WALL STEEL
ROSA UNIT #044/-	3003926161	BLANCO MV	35E	32N	OGVV	SGI	DBL WALL STEEL
				OL.		1/1/21	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06W	BG1	HOPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #045	3003923013	BLANCO MV	9M	31N	05W	BGT	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #046A	3003926986	BLANCO MV	80	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	06W	פעיז	DBL WALL STEEL
THE CONTROL HEAVE	30038Z0Z08	DASIN DA	230	3 114	COVV	BGT	FIBERGLASS TANK w/BANDED 20-mit
ROSA UNIT #053	3003920293	BASIN DK	8B	31N	05Vv	BGT	HDPE SECONDARY LINER
	0000020200	Brienii (11)	OL	CHIN	COVV	1561	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #055	3003920923	BASIN DK	341	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #059 Fit	3003923270	BASIN DK	25N	3111	06W	BG1	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	3111	06W	BGT	HDPE SECONDARY LINER
200							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	06Vv	BG1	HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05Vv	BGT	DBL WALL STEEL
	200001 1700		2071	3114	(7,777	001	THE WAR CHELL
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05W	SGT	DBL WALL STEEL
		BASIN DK /					
ROSA UNIT #064M	3003925563	BLANCO MV	29F	31N	05W	BGT	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	05W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #066	3003921758	BASIN DK	13L	31N	06Vv	BGT	HDPE SECONDARY LINER
2001		BASIN DK /					FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #066M	3003925747	BLANCO MV	13F	31N	06W	BGT	HDPE SECONDARY LINER
2004 1 1 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #072	3003925509	BLANCO MV	Gf	31N	05W	BGT	HDPE SECONDARY LINER
MACA LIMIT BATAL		DI ANIGO ::::					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #072A	3003925795	BI ANCO MV	6K	31N	05W	BG1	HDPE SECONDARY LINER
OOCA LIBUT MOVE	00046	DI 41100 1111					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #075	3004529895	BLANCO MV	101	31N	06VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #075A	0004506654	DI ANCO MA	425	244	0011	0.05	FIBERGLASS TANK W/BANDED 20-mil
NOCH UNIT #UTDA	3004529854	BLANCO MV	4()	31N	06V√	BGT	HDPE SECONDARY LINER
ROSA UNIT #07 ²		DK/UNDES	991	2481	OC MA	0.07	FIBERGLASS TANK W/BANDED 20 mil
OUR UNIT HUT	3003922538	GL/BLANCO	33L	31N	05W	BG1	HDPE SECONDARY LINER

(WELLS WEEDERAL							
WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	E CONSTRUCTION MATERIAL
		BASIN DK /					
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK /	22K	3111	06VV	BG1	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV -	22k	31N	06W	SGT	DBL WALL STEFL
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	221	3111	06Vv	BGT	DBL WALL STEEL
ROSA UNIT #079B	3003926920	BLANCO MV	22C	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3111	05W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #080	3003922537	BLANCO MV	8K	31N	05//	BG1	HDPE SECONDARY LINER LIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #080A	3003926413	BLANCO MV	8f	31N	U5W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	051/1	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085A	3003926314	BLANCO MV	20C	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #085P	3003930130	BLANCO MV	20D	3111	05W	BG1	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GI BLANÇO MV /	12W	31N	()4W	SG1	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	ROSA PC	8F	31N	06W	BGI	DBL WALL STELL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #069	3003922782	BI ANCO MV	34A	32N	06VV	BG1	HUPE SECONDARY LINER FIBERGLASS TANK w'BANDED 20 mil
ROSA UNIT #089A	3003925512	BI ANCO MV	34()	32N	()6W	FG1	HDPL SECONDARY LINER
ROSA UNIT #089B	3003926851	BLANCO MV	341	32N	06W	BGT	DBI WALL STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	34G	3211	06\/	SGI	SINGLE WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #090 COM	3004525370	BLANCO MV	33G	3211	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #090A COM	3004529259	BLANCO MV	33G	35И	06VV	BGT	DBI WALL STEEL FIBERGLASS TANK w.BANDED 20 mil
ROSA UNIT #091	3003922780	BLANCO MV	3511	32N	W00	BG1	HDPE SECONDARY LINER
KOSA UNIT #091A	3003925790	BLANCO MV -	350	32N	06W	SG1	DBL WALL STEEL
ROSA UNIT #091B	3003926684	BI ANCO MV	35P	32N	W90	BGT	OBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #091C	3003926991	BLANCO MV	35G	32N	W60	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #098	3003923265	BASIN DK / GL BASIN DK /	231	31N	06W	BG1	HDPF SECONDARY LINER
1008 UNIT #1008	3003929547	BLANCO MV	210	31N	06W	BGT	DBL WALL STEEL
OSA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	06W	BGT	DBL WALL STEEL
OSA UNIT #100F	3003925135	ROSA PC	211	31N	06W	SG1	SINGLE WALL STEEL
OSA UNIT #10114	3003925577	BLANCO MV	24F	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
OSA UNIT #10E	3003923506	BASIN DK / GL	7G	3111	U5W_		HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	7 W/N	PNG	PIT TVE	E CONSTRUCTION MATERIAL
30/11/11/11	AII	T 101 1	310	1 4 4 14	KNO		E CONTINUE MATERIAL
ROSA UNIT #119	3003925143	PASIN DK	16N	31N	05W	BG1	DBL WALL STEEL FIBERGLASS TANK & BANDED 20 mil
ROSA UNIT #125	3003925144	BLANCO MV	13B	3117	()6₩	BGT	HDPE SECONDARY LINER
ROSA UNIT #1250	3003929843	BLANCO MV BASIN DK :	13G	31N	06W	BGT	DEL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #125E	3003925526	BLANCO MV	13J	3111	06\\	BGI	HDFE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34E	32N	06Vv	ьG1	DBL WALL STEEL
ROSA UNIT #129A	3003926297	BLANCO MV	34K	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #137	3003925410	BLANCO MV	31K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSA PC	311	31N	05W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #137B	3003927002	BLANCO MV BLANCO MV	31P	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #138	3004529147	ROSA PC	171	31N	06W	BGT	HOPE SECONDARY LINER
ROSA UNII #138A	3004529134	BLANCO MV / ROSA PC	1711	3111	06W	BGT	DBI WALL STEFF
ROSA UNIT #138B	3004532168	BLANCO MV	1711	3111	06VV	BGT	DBL WALL STEEL
ROSA UNIT #139A	3004529600	BLANCO MV	17M	31N	06W	RGI	DBL WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #144	3003925421	ROSA FC	2(·A	3111	06W	BGT	DBL WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16if	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 nat
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #146C	3003930187	BLANCO MV	28B	31N	05W	BGT	DBI WALL STEEL
ROSA UNIT #148	3003925493	BASIN DK	20	31N	06W	BG1	DBL WALL STEFL
ROSA UNIT #148A	3003925776	BLANCO MV	2N	31N	06W	BG1	DBL WALL STEFL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	W80	BG1	HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	121	3111	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #149B	3003926599	BLANCO MV	12E	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #150	3004529229	BLANCO MV	32F	32N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #150A	3004529592	BLANCO MV	32M	32N	06W	BGT	DBI WALL STEEL
ROSA UNIT #150B	3004530874	BASIN DK / BLANCO MV	32D	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #15()(3004532157	BI ANCO MV	32K	32N	06W	BGT	DBI WALL STEEL
ROSA UNIT #15	3004529267	BLANCO MV	33C	32N	06VV	BG1	DBL WALL STEEL

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	1WN	RNG	PITTY	PE CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	331	32N	06Vv	BG1	DBI WALL STEEL
ROSA UNIT #151C	3004532196	BLANCO MI	3314	32N	061/v	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #152	3003925494	BLANCO MV	36E	32N	061/7	EGI	HDPF SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	3214	06W	BGI	DBL WALL STEEL
ROSA UNIT #152B	3003926631	BLANCO MV	36C	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #152C	3003927635	BLANCO MV	361	32N	06VV	E G1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #153	3003925524	BLANCO MV	17()	31N	05VV	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UIVIT #153A	3003926329	BLANCO MV BASIN DK /	1/A	31N	05W	861	HDPE SECONDARY LINER FIBERGLASS TANK WIBANDED 20-mil
ROSA UNIT #153B	3003927603	BLANCO MV	171	31N	05W	BGI	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	7N	31N	05Vv	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #154A	3003926274	PLANCO MV	74	3111	05VV	BGI	HDPE SECONDARY LINER FIBERGLASS TANK WBANDLD 20 mil
ROSA UNIT #156	3004529661	BLANCO MV	94	31N	06W	BGT	HDPE SECONDARY LINER LIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #156A	3004529640	BLANCO MV BASIN DK /	91	31N	OoW	BGT	HOPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BLANCO MV	190	31N	05W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3111	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #15C	3003930111	BLANCO MV	296	31N	05W	RGT	HDPE SECONDARY LINER
ROSA UNIT #160	3003925890	ROSA PC	250	31N	0674	BGT	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV BASIN DK /	25N	31N	06Vv	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #160B	3003926962	BLANCO MV	251	31N	06Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #162	3003926069	BLANCO MV	30K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BLANCO MV	30P	31N	05W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #163	3003926345	BLANCO MV	24G	31N	06W	BG1	HDP'E SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #163A	3003926336	BLANCO MV	240	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	31N	06W	SGI	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV BASIN DK /	24J	31N	06W	SGT	SINGLE WALL STEEL
ROSA UNIT #164	3003926151	BLANCO MV	13	31N	06W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #164A	3003926080	BLANCO MV	1J	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #164E	3003927242	BASIN DK / BLANCO MV	1.J	31N	06W	RG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER

•

WELLS W/FEDERAL							, may a large application of the control of the con
SURF MG1	API	FM1	SEC	IWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNIT #165	3003926070	BLANCO MV / ROSA DC	261	31N	06\V	1991	DBI WALL STELL
ROSA UNIT #165A	3003926150	BLANCO MV BASIN DK /	26B	31N	06VV	861	FIBERGLASS TANK WBANDLD 20 mil HDFE SECONDARY LINER
ROSA UNIT #165B	3003926557	BLANCO MV BASIN DK /	25F	31N	OoVV	BG1	DBI WALL STEFT
ROSA UNIT #1650	3003926961	BI ANCO MV	25G	31N	06VV	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BGT	HOPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #166A	3003926282	BLANCO MV	30F	31N	05VV	HG1	FIDER SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #167A	3004529886	BLANCO MV	8A	31N	06Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #169	3003926130	BLANCO MV	3J	31N	06W	BG1	DBI WALL STEFL
ROSA UNIT #169A	3003926149	BLANCO MV	3.1	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #1690	3003927717	BLANCO MV	2M	3111	06Vv	BG1	HDFE SECONDARY LINER
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	06W	BGI	ORI WALL STEFT
ROSA UNIT #171	3003926286	BLANCO MV	7G	3111	()6W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNII #171A 	3003926389	PLANCO MV	7G	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil HDFE SECONDARY LINER
ROSA UNIT #180	3003927013 3004529898	BLANCO MV	6P 9N	31N 31N	05W 06W	BG1 bG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #180B	3004523636	BLANCO MV	91	3110	06W	BG1	DBL WALL STEEL
ROSA UNIT #180C	3004533191	BLANCO MV	9E	31N	0674	BG1	DBL WALL STEEL
ROSA UNIT #181	3003926463	BLANCO MV	11K	31N	06VV	BG1	DBL WALL STEEL
ROSA UNIT #181A	3003926312	BLANCO MV	15A	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #181C (shared w/169C)	3003927714	BLANCO MV	2M	31N	06W	RGT	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #182	3003926283	BI ANCO MV	18N	31N	05W	BGT	FIBERGLASS TANK WBANDED 20 mil HDFE SECONDARY LINER
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	BG1	DBL WALL STEEL
ROSA UNIT #182C	3003930180	BLANCO MV	18F	31N	05W	SGI	SINGLE WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #183A	3003926386	BI ANCO MV	19F	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #183E	3003930087	BLANCO MV BASIN DK /	1,9B	31N	05W	BG1	UBL WALL STEEL
ROSA UNIT #185B	3004532734	BLANCO MV	16F	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #1850	3004534484	BLANCO MV	16F	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #18	3003930186	BLANCO MV	21G	31N	05W	BG1	DBL WALL STEEL

•

٠.

SURF MG1	API	FMT	<u>SEC</u>	TWN	RNG	PIT TYPE	CONSTR	UCTION MATERIAL
ROSA UNIT #231	3003924441	RASINTIC	31N	31N	05V/	561	SINGLE WALL	SHEL
ROSA UNIT #335A	3003930222	BASIN FTC.	05J	31N	05 V V	567	SINGLE WALL	STEEL

. .

Meador, Tasha

From:

Meador, Tasha

Sent:

Monday, June 07, 2010 7:29 AM

To:

Meador, Tasha; 'Jones, Brad A., EMNRD'

Cc:

Basye, Matt; Lane, Myke; 'Powell, Brandon, EMNRD'

Subject: Review for Pit Closure-Rosa 080A, Rosa 044B, and Rosa 091

Brad:

We need to take the following below grade tanks out of service, and we would like to close these existing BGTs. We request your review and approval to allow closure.

WELLSITE	API	FMT	SEC	TW
Rosa Unit #080A	3003926413	BLANCO MV	8F	05\
Rosa Unit #044B	3003926685	BLANCO MV	35C	06/
Rosa-Unit-#091	3003922780	BLANCO MV	35H	06\

Please contact me or Myke Lane if there are any problems or you request additional information. Thanks for your consideration

Tasha Meador

EH&S Coordinator Williams Exploration & Production 721 S Main Aztec, NM

Office: 505-634-4200 Direct:505-634-4241 Fax: 505-634-4205

tasha.meador@williams.com

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Form C-141

Revised October 10, 2003

Release Notification and Corrective Action

						OPERA	ΓOR	[🛛 Initia	ıl Report		Final Report
Name of Co	mpany	WILLIAMS	PRODU	CTION, LLC		Contact Vanessa Fields						
Address		P.O. BOX 64	40, AZTI	EC, NM 87410	7	Telephone No. (505) 634-4209						
Facility Nan	ne	Rosa Unit#	091		F	Facility Typ	e Well Site					
Surface Own	ner: Fede	eral		Mineral Ov	wner:				Lease N	lo.		
				LOCA	TION	OF REI	LEASE					
Unit Letter	Section	Township	Range			South Line	Feet from the	Fast/W	est Line	County		
Н	35	32N	06W			30 4 00 200 4		Lagur	200 200	county		
		Lati	tude	36.9326598N	L	ongitude_	107.424240)1W				
				NAT	URE (OF REL	EASE					
		case Occurred				Volume of			Volume R			
Source of Rel							lour of Occurrenc	e	Date and l	Hour of Disc	covery	
Was Immedia	ite Notice		Yes [No ⊠ Not Rec	uired	If YES, To	Whom?					
By Whom?					•	Date and H	lour					
Was a Watero	course Rea	ched?					olume Impacting t	he Water	course.			
			Yes 🛚] No		ĺ	1 0					
If a Watercou	rse was In	npacted, Descr	ibe Fully.	* N/A		1		-				
Describe Cause of Problem and Remedial Action Taken.* No action required .												
Describe Area	a Affected	and Cleanup A	Action Tak	en.*								
N/A												
regulations al public health should their o or the environ	l operators or the envi perations l unent. In a	are required to ironment. The nave failed to a	o report ar acceptance adequately OCD accep	is true and completed of the certain rese of a C-141 report investigate and restance of a C-141 research	lease no t by the mediate	otifications ar NMOCD m contaminati	nd perform correct arked as "Final Roon that pose a thre	tive action eport" do eat to gro	ons for rele ses not reli- ound water	eases which i eve the opera , surface wat	may end ator of ter, hun	danger liability nan health
a 1	\) _				OIL CON	SERV	ATION	DIVISIO	N	
Signature: Printed Name	: Vanessa		-	<i>></i>	A	Approved by	District Supervise	or:				
Title: EH&S	Coordinat	or			A	Approval Dat	e:	E	xpiration I	Date:		
E-mail Addre	ss: Vanes	sa.fields@willi	iams.com		c	Conditions of	Approval:			Attached	П	
Date: 10-26	Date: 10-26-10 Phone: (505) 634-4209											

^{*} Attach Additional Sheets If Necessary

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- Prior to initiating any BGT Closure except in the case of an emergency, WPX will
 review County Tax Records for the current surface owner of record. The surface
 owner of record will be notified of the intent to closure the BGT by certified mail and
 a copy of this notification will be included in the closure report. In the case of an
 emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

		<u> </u>
Components	Jesting Methods	Closure Limits (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	- 0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

- (1) Method modified for solid waste.
- (2) If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.
- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Fiberglass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin-Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:


- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed. of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs

Components	Jesting Methods:	Closvie Alimits (mg//kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 8015 M(Full Range)*	100
	or Method 418.1	
Chlorides	EPA SW-846 Method 300.1	250


^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-appröved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

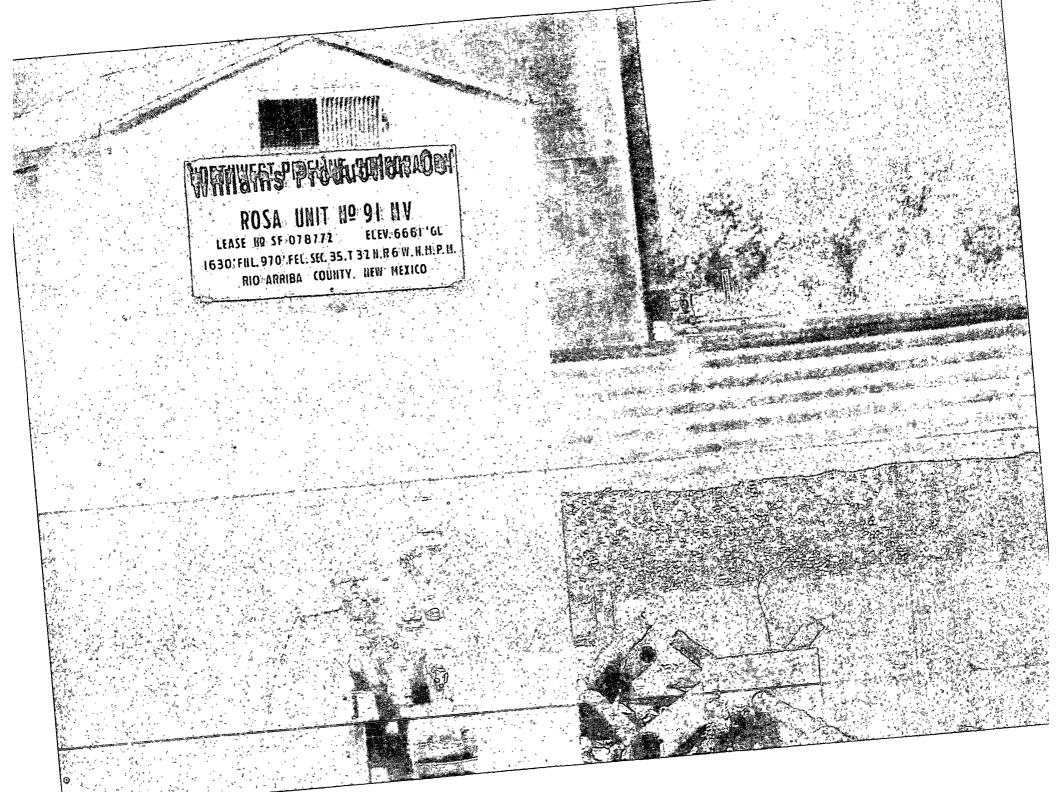

North

Williams Production Company Rosa # 91 St.# 8556901 Sec. 35 T32N R6W 1630' FNL 970' FEL Rio Arriba County N.M.

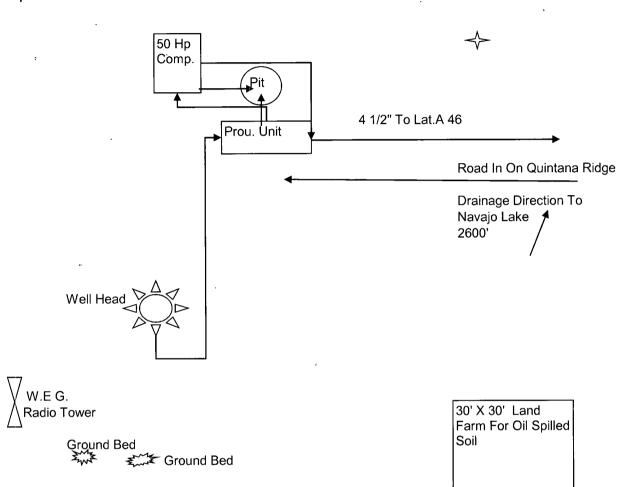

Sep. Olman Heath 2 Ph. Ser.# E004 16377
Rectifier J A 180/240 Volt Ser # 87177 Shared With The Rosa 279 & Rosa 118
Pit 120 Bbl. Fiberglass Lined & Leak Detection
Compressor 50 HP. Gas Jack Supplied Compresso

04-64

Rosa Unit # 091

Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Banded Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
0./4/2000	ROSA UNIT #091	04-64	Mana Varda	FIBERGLASS	BGT	Banded Plastic Liner		47!!	22"	Oil In Leak
9/4/2008	ROSA	04-64	iviesa verde	FIBERGLASS	ВСТ	Banded	Yes	17"	23"	Detection, Kolor Kut
9/9/2008		04-64	Mesa Verde	FIBERGLASS	BGT	Plastic Liner	Yes	6.5"	31"	showed solid
5,5,25	ROSA									Solid Oil In
10/29/2008	UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	YES	5.5"	39"	Leak
	ROSA				_			,		Oil In
11/18/2008		04-64	Mesa Verde	FIBERGLASS	BGT	NO	Yes	3.5"	0"	Inspection
1/2/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	4"	12"	
1/22/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	5"	26"	
2/12/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	, NO	yes	,		
3/5/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	5"	15"	
5/14/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	11"	27"	hole init water/oil in
6/1/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	11"	27"	hole init water/oil in
6/30/2009	ROSA	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	17"	20"	
	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	37"	12"	

		<u> </u>			SGT. BGT,					Comments / Repairs
Date	WellName	Run	Formation	Construction	Above		Y/N	level	level	needed
8/20/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	12	40"	
9/29/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	12	44"	
10/30/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	12"	44"	
11/19/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	12"	48"	
12/23/2009	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	12"	12"	
1/14/2010	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	12"	20"	
2/16/2010	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	10"	24''	
3/11/2010	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	10"	28"	
4/22/2010	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	10"	6"	
5/18/2010	ROSA UNIT #091	04-64	Mesa Verde	FIBERGLASS	BGT	NO	yes	8"	0	



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Williams	Project #:	04108-0136
Sample ID:	Rosa 91	Date Reported:	06-21-10
Laboratory Number:	54780	Date Sampled:	06-14-10
Chain of Custody No:	9585	Date Received:	06-17-10
Sample Matrix:	Soil	Date Extracted:	06-17-10
Preservative:	Cool	Date Analyzed:	06-18-10
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	1.5	0.2
Diesel Range (C10 - C28)	2.3	0.1
Total Petroleum Hydrocarbons	3.8	0.2

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Analyst

Review



EPA Method 8015 Modified Nonhalogenated Volatile Organics **Total Petroleum Hydrocarbons**

Quality Assurance Report

QA/QC Client: Sample ID:

06-18-10 QA/QC 54780

Project #: Date Reported: Date Sampled:

06-21-10 N/A

N/A

Laboratory Number: Sample Matrix:

Methylene Chloride

Date Received:

N/A

Preservative: Condition:

N/A N/A Date Analyzed: Analysis Requested: 06-18-10 **TPH**

Gasoline Range C5 - C10

05-07-07

9.9960E+002 1.0000E+003 0.04%

Detaction Limit

I-Cali Date - I-Cal RF> LC-Cal RF: - Will Utterence - Accept Range 0 - 15%

Diesel Range C10 - C28

05-07-07

9.9960E+002

1.0000E+003

0.04%

0 - 15%

Blank Conc. (mg/L) = mg/kc Gasoline Range C5 - C10 Diesel Range C10 - C28

Concentration ND ND

0.2 0.1

Total Petroleum Hydrocarbons

ND

Spike Added

0.2

in it blicars a	
Gasoline Rang	ge C5 - C10
Diesel Range	C10 - C28

1.5	1.2
2.3	1.8

20.0% 21.7%

Ofference:

0 - 30% 0 - 30%

Accept Range.

			計 拉塞
Gasoline	Range	C5 -	C10
Diesel Ra	nge C	10 -	C28

1.5	
23	

Samole

250 250 Solke Result 276 203

% Recovery 110%

80.4%

Accept Ranges 75 - 125% 75 - 125%

ND - Parameter not detected at the stated detection limit.

IM

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 54792-54793, 54746, 54710-54714, 54770, 54780 and 54771.

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Williams .	Project #:	04108-0136
Sample ID:	Rosa 91	Date Reported:	06-21-10
Laboratory Number:	54780	Date Sampled:	06-14-10
Chain of Custody:	9585	Date Received:	06-17-10
Sample Matrix:	Soil	Date Analyzed:	06-18-10
Preservative:		Date Extracted:	06-17-10
Condition:	Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Benzene	8.3	0.9	
Toluene	1.7	1.0	
Ethylbenzene	ND	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	2.2	0.9	
Total BTEX	12.2		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	100 %
	1,4-difluorobenzene	100 %
	Bromochlorobenzene	100 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client: Sample ID:	N/A 0617BBL2 QA/QC	Project #: Date Reported:	N/A 06-21-10
Laboratory Number:	54780	Date Sampled:	N/A
Sample Matrix:	Soil	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	06-17-10
Condition:	N/A	Analysis:	BTEX

(Callbration and	Petton Reserve	CACALRE - Accept Rang	%OM ps/0 = 45%	u Blank 1119€ene :	Petjact Limit
Benzene	1.3165E+006	1.3192E+006	0.2%	ND	0.1
Toluene	1.2088E+006	1.2112E+006	0.2%	ND	0.1
Ethylbenzene	1.0701E+006	1.0723E+006	0.2%	ND	0.1
p,m-Xylene	2.6845E+006	2.6899E+006	0.2%	ND	0.1
o-Xylene	1.0055E+006	1.0076E+006	0.2%	ND	0.1

Piplicate Feries (Prikty)	i a "A Saimblean ar aibh	oliestes su		/Accept Renoe	Deled. Linit
Benzene	8.3	9.3	12.0%	0 - 30%	0.9
Toluene	1.7	1.4	17.6%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	ND	ND	0.0%	0 - 30%	1.2
o-Xylene	2.2	2.3	4.5%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Sample Amo	um Spikes Spi	(ed/Sample)	% Recovery	Áccept Range
Benzene	8.3	50.0	49.0	84.1%	39 - 150
Toluene	1.7	50.0	50.1	96.9%	46 - 148
Ethylbenzene	ND	50.0	50.2	100%	32 - 160
p,m-Xylene	ND	100	98.8	98.8%	46 - 148
o-Xylene	2.2	50.0	49.8	95.4%	46 - 148

ND - Parameter not detected at the stated detection limit.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using

Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 54770, 54771, 54780, <u>5479</u>2, 54793, 54746 and 54710-54714.

Analyst

EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Williams	Project #:	04108-0136		
Sample ID:	Rosa 91	Date Reported:	06-21-10		
Laboratory Number:	54780	Date Sampled:			
Chain of Custody No:	9585	9585 Date Received:			
Sample Matrix:	Soil	Date Extracted:	06-18-10		
Preservative:		Date Analyzed:	06-18-10		
Condition:	Intact	Analysis Needed:	TPH-418.1		

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

28.3

8.1

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:



EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client:

·QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

06-21-10

Laboratory Number:

06-18-TPH.QA/QC 54782

Date Sampled:

N/A

Sample Matrix:

Freon-113

Date Analyzed:

06-18-10

Preservative: Condition:

N/A N/A Date Extracted: Analysis Needed: 06-18-10 TPH

Calibration I-Cal Date

C-Cal Date I-Cal RF:

C-Cal RF: % Difference Accept. Range

06-03-10

06-18-10

1,686

1,770

5.0%

+/- 10%

Blank Conc. (mg/Kg)

Concentration

Detection Limit

TPH

ND

8.1

Duplicate Conc. (mg/Kg)

Sample

Duplicate :

% Difference Accept. Range

TPH

48.6

45.9

5.6%

+/- 30%

Spike Conc. (mg/Kg) TPH

Sample 48.6

Spike Added Spike Result % Recovery Accept Range 2,000

1,860

90.8%

80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 54780-54782, 54786 and 54787.

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



Chloride

Client: Williams Project #: 04108-0136 Sample ID: Rosa 91 Date Reported: 06-21-10 Lab ID#: 54780 Date Sampled: 06-14-10 Sample Matrix: Soil Date Received: 06-17-10 Preservative: Date Analyzed: 06-18-10 Condition: Intact Chain of Custody: 9585

Parameter

Concentration (mg/Kg)

Total Chloride

25

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Analyst

Réview

CHAIN OF CUSTODY RECORD

09585 RUS

Client: Project Name / Location:					T					ANAL	YSIS	 / PAR	AME	TERS	ERS										
Muliams			Rosa 91																						
Client Address:	•		Sampler Name:	a	1				2	[]	8														
7213.M	<u>un</u>		MY Catt	D	use					980	88	S			_							i			
Client Phone No.:		1	Client No.:	lin	30°	171.			ğ	l E	1 2	leta	<u>.</u>		王		<u> </u>	ш				8	tact		
634-4241	_		04108-0136				Met	(Ne	Met	8 8	۲ <u>۸</u>		with		418	<u>e</u>				e C	le ln				
Sample No./ Identification	Sample Date	Sample Time	Lab No.		Sample Matrix	No./Volume of Containers	Pres	ervativ HG	TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	RCRA 8 Metals	Cation / Anion	22	TCLP with H/P	PAH	TPH (418.1)	CHLORIDE				Sample Cool	Sample Intact		
Rosa 91		14.21	54786	Solid Solid	Sludge Aqueous	1-Hos			X	λ	-	-		-	-	<u> </u>	X	X				N	J		
reason.	+ + + + + + + + + + + + + + + + + + +	17.00	4	Soil	Sludge	1-702	+	+	+	-			-			 -	-	/\			 				
				Solid	Aqueous]					
			-	Soil Solid	Sludge Aqueous																				
				Soil Solid	Sludge																				
				Soil	Aqueous Sludge	 		+	+	_												-			
				Solid	Aqueous																				
				Soil Solid	Sludge Aqueous																				
				Soil Solid	Sludge Aqueous																				
				Soll Solid	Sludge Aqueous																				
				Soil	Sludge			<u> </u>	+													\neg			
		<u> </u>		Solid	Aqueous	ļ		_														,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			
				Soil Solid	Sludge Aqueous	1																			
Relinquished by: (Signature) Date Time Receive				ed by:	(Sign	ature)			<u> </u>	l	<u> </u>	L	<u> </u>	L	D	ate	Ti	me							
			Olrila	11:15		6/17/10 11:1							15												
Relinquished by: (Signature)							R	Received by: (Signature)																	
Relinquished by: (Signature)						R	Received by: (Signature)									-									
envirotech																									

Analytical Laboratory

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Report

> Well: API No:

(Rosa Unit#091) 30-03922780

Location: H-S35-T32N-R06W, NMPM



In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be initiated within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current landowner of record. The landowner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the landowner of record will be notified as soon as practical.

Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)

Aztec District office was notified of Williams E&P intent to close on (06/07/2010). Email attached.

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

Williams closed the BGT used by the Rosa Unit#091 separator and piped all liquids to the Produced Water Storage Tank.

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled to the Rosa Unit disposal wells listed.</u>

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

 The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Methods	Closure Limits (mg/Kg)	Sample Results (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2	0.008
BTEX	EPA SW-846 Method 8021B or 8260B	50	12.2
TPH	EPA SW-846 Method 418.1(1)	100	28.3
Chlorides	EPA SW-846 Method 300.1(1)	250(2)	25

⁽¹⁾ Method modified for solid waste.

9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site.</u> Backfill compacted to avoid settling and pit area remains in use for production operations.

⁽²⁾ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13., I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above. See above notes.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation