District I

1625 N French Dr , Hobbs, NM 88240

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rto Brazos Rd , Aztec, NM 87410

District IV

1220 S St Francis Dr , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-144 July 21, 2008

For temporary pits, closed-loop sytems, and below-grade tanks, submit to the appropriate NMOCD District Office.

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

8663)
------	---

Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method X Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method

Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request

Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the

environment. Nor does approval relieve the operator of its responsibility to comply with any other applications.	able governmental authority's rules, regulations or ordinances
Operator: ConocoPhillips Company	OGRID#: 217817
Address: P.O. Box 4289, Farmington, NM 87499	
Facility or well name: STATE COM R 14B	
API Number: 30-045-35039 OCD Permit Nu	ımber:
U/L or Qtr/Qtr: I(NE/SE) Section: 36 Township: 30N Range:	9W County: SAN JUAN
Center of Proposed Design: Latitude: 36.7656 °N Longitude:	107.7234
Surface Owner: Federal X State Private Tribal Trust or Ir	ndian Allotment
X Pit: Subsection F or G of 19.15.17.11 NMAC	
Temporary: X Drilling Workover Permanent Emergency Cavitation P&A	
	HDPE PVC Other
X String-Reinforced	
	7700 bbl Dimensions L 120' x W 55' x D 12'
Closed-loop System: Subsection H of 19.15.17.11 NMAC Type of Operation: P&A Drilling a new well Workover or Drilling (Applination)	es to activities which require prior approval of a permit or
Drying Pad Above Ground Steel Tanks Haul-off Bins Other Lined Unlined Liner type: Thickness mil LLDPE Liner Seams Welded Factory Other	HDPE PVD Other Other
4 Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: bbl Type of fluid: Tank Construction material:	automatic overflow shut-off
Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and Visible sidewalls and liner Visible sidewalls only Other Liner Type: Thickness mil HDPE PVC Other	SE027282930
Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe En	vironmental Bureau office for consideration of approval.

Form C-144

Oil Conservation Division

Page 1 of 5

6		i			
Fencing: Subsection D of 19 15 17 11 NMAC (Applies to permanent pit, temporary pits, and below-grade tanks)		:			
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institution or church)					
Four foot height, four strands of barbed wire evenly spaced between one and four feet		ĺ			
Alternate Please specify					
7					
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks)					
Screen Netting Other					
Monthly inspections (If netting or screening is not physically feasible)					
8					
Signs: Subsection C of 19 15 17 11 NMAC					
12" X 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers					
X Signed in compliance with 19 15 3 103 NMAC					
0					
Administrative Approvals and Exceptions:					
Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance					
Please check a box if one or more of the following is requested, if not leave blank:					
Administrative approval(s) Requests must be submitted to the appropriate division district of the Santa Fe Environmental Bureau office for consideration (Fencing/BGT Liner)	leration of appr	roval			
Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval					
		ļ			
Siting Criteria (regarding permitting) 19 15 17.10 NMAC		!			
Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptable source material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the					
appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau Office for					
consideration of approval. Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria					
does not apply to drying pads or above grade-tanks associated with a closed-loop system.					
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - IWATERS database search, USGS, Data obtained from nearby wells	Yes	□No			
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other watercourse, lakebed, sinkhole, or playa lake	Yes	No			
(measured from the ordinary high-water mark).		_			
- Topographic map; Visual inspection (certification) of the proposed site					
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial	Yes	No			
application.					
(Applies to temporary, emergency, or cavitation pits and below-grade tanks)	□ NA				
- Visual inspection (certification) of the proposed site, Aerial photo; Satellite image					
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes	No			
(Applied to permanent pits)	∐NA				
- Visual inspection (certification) of the proposed site, Aerial photo; Satellite image					
Within 500 horizonal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.	Yes	No			
- NM Office of the State Engineer - 1WATERS database search; Visual inspection (certification) of the proposed site					
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended					
- Written confirmation or verification from the municipality, Written approval obtained from the municipality		□No			
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site					
Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD - Mining and Mineral Division	Yes	□No			
Within an unstable area.	∏Yes	□No			
- Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological	ا ا				
Society; Topographic map					
Within a 100-year floodplain	Yes	□No			
- FEMA map	ı				

Form C-144 Oil Conservation Division Page 2 of 5

Form C-144 Oil Conservation Division Page 3 of 5

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Ste Instructions Please identify the facility or facilities for the disposal of liquids, drilling	el Tanks or Haul-off Bins Only: (19.15 17.13 D NMAC)			
facilities are required.	naids and arm caning, Ose and ciment if more than two			
	Disposal Facility Permit #:			
	Disposal Facility Permit #:			
Will any of the proposed closed-loop system operations and associated activity Yes (If yes, please provide the information No	ties occur on or in areas that will nbe used for future	service and		
Required for impacted areas which will not be used for future service and operations Soil Backfill and Cover Design Specification - based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subset Site Reclamation Plan - based upon the appropriate requirements of Subset	etion I of 19 15 17 13 NMAC	MAC		
17 Siting Criteria (Regarding on-site closure methods only: 19 15 17 10 NMA6 Instructions Each string criteria requires a demonstration of compliance in the closure plan Recertain siting criteria may require administrative approval from the appropriate district office or office for consideration of approval Justifications and/or demonstrations of equivalency are required.	commendations of acceptable source material are provided below may be considered an exception which must be submitted to the Sc			
Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS. Data obt	ained from nearby wells	Yes No		
Ground water is between 50 and 100 feet below the bottom of the buried was - NM Office of the State Engineer - iWATERS database search; USGS, Data obta		☐Yes ☐No ☐N/A		
Ground water is more than 100 feet below the bottom of the buried waste.	10 1 1	Yes No		
- NM Office of the State Engineer - IWATERS database search, USGS; Data obta	·	∐N/A		
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other signif (measured from the ordinary high-water mark) - Topographic map; Visual inspection (certification) of the proposed site	icant watercourse or lakebed, sinkhole, or playa lake	YesNo		
Within 300 feet from a permanent residence, school, hospital, institution, or church in	existence at the time of initial application	Yes No		
- Visual inspection (certification) of the proposed site, Aerial photo; satellite imag	e	TYes TNo		
Within 500 horizontal feet of a private, domestic fresh water well or spring that less the purposes, or within 1000 horizontal fee of any other fresh water well or spring, in exis - NM Office of the State Engineer - iWATERS database, Visual inspection (certif	tence at the time of the initial application.			
Within incorporated municipal boundaries or within a defined municipal fresh water we pursuant to NMSA 1978, Section 3-27-3, as amended		∏Yes ∏No		
 Written confirmation or verification from the municipality, Written approval ob Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visual ins 		Yes No		
Within the area overlying a subsurface mine. - Written confirantion or verification or map from the NM EMNRD-Mining and		Yes No		
Within an unstable area.		Yes No		
 Engineering measures incorporated into the design; NM Bureau of Geology & M Topographic map 	Ineral Resources, USGS; NM Geological Society;			
Within a 100-year floodplain. - FEMA map		Yes No		
18 On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each				
by a check mark in the box, that the documents are attached.	i of the following tiems must bee uttached to the cio.	sure piuri. Fieuse inuicuie,		
Siting Criteria Compliance Demonstrations - based upon the appropri	ate requirements of 19.15.17.10 NMAC			
Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC				
Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of 19.15.17.11 NMAC				
Construction/Design Plan of Temporary Pit (for in place burial of a di	-	of 19.15.17.11 NMAC		
		AC		
Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC Waste Material Sampling Plan - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC				
Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cannot be achieved)				
Soil Cover Design - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC				
Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC				
Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC				

19 Operator Application Certification:
I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief
Name (Print) Title:
Signature: Date
e-mail address: Telephone.
20 OCD Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment)
OCD Representative Signature: 8/8/2011
Title: Compande Companie OCD Permit Number:
Closure Report (required within 60 days of closure completion): Subsection K of 19 15 17 13 NMAC Instructions Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed. [X] Closure Completion Date: May 16, 2011
22
Closure Method:
Waste Excavation and Removal X On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only)
If different from approved plan, please explain.
23 <u>Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only:</u> Instructions: Please identify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities
were utilized. Disposal Facility Name Disposal Facility Permit Number
Disposal Facility Name Disposal Facility Permit Number
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations?
Yes (If yes, please demonstrate compliane to the items below)
Required for impacted areas which will not be used for future service and operations. Site Reclamation (Photo Documentation)
Soil Backfilling and Cover Installation
Re-vegetation Application Rates and Seeding Technique
24 <u>Closure Report Attachment Checklist:</u> Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in
the box, that the documents are attached. X Proof of Closure Notice (surface owner and division)
X Proof of Deed Notice (required for on-site closure)
X Plot Plan (for on-site closures and temporary pits)
X Confirmation Sampling Analytical Results (if applicable)
Waste Material Sampling Analytical Results (if applicable)
X Disposal Facility Name and Permit Number
X Soil Backfilling and Cover Installation X Re-vegetation Application Rates and Seeding Technique
X Site Reclamation (Photo Documentation)
On-site Closure Location: Latitude: 36.76571 °N Longitude: 107.72324 °W NAD 1927 X 1983
Operator Closure Certification: I hereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan
Name (Print): Jamie Goodwin , Title: Regulatory Tech.
Signature: Date:
e-mail address: jamie.l.goodiwn@conocophillips.com Telephone 505-326-9784

ConocoPhillips Company San Juan Basin Closure Report

Lease Name: STATE COM R 14B

API No.: 30-045-35039

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the temporary pit referenced above. All proper documentation regarding closure activities is being included with the C-144. The temporary pit for this location was constructed and location drilled before June 16, 2008 (effective date for Rule 19.15.17). While closure of the temporary pit did fall within the rule some dates for submittals are after the rig release date.

- Details on Capping and Covering, where applicable. (See report)
- Plot Plan (Pit Diagram) (Included as an attachment)
- Inspection Reports (Included as an attachment)
- Sampling Results (Included as an attachment)
- C-105 (Included as an attachment)
- Copy of Deed Notice will be filed with County Clerk (Not required on Federal, State, or Tribal land as stated by FAQ dated October 30, 2008)

General Plan:

1. All free standing liquids will be removed at the start of the pit closure process from the pit and disposed of in a division—approved facility or recycle, reuse or reclaim the liquids in a manner that the appropriate division district office approves.

All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B).

2. The preferred method of closure for all temporary pits will be on-site burial, assuming that all the criteria listed in sub-section (B) of 19.15.17.13 are met.

The pit was closed using onsite burial.

3. The surface owner shall be notified of COPC's closing of the temporary pit as per the approved closure plan using certified mail, return receipt requested.

The closure process notification to the landowner was sent via permit submittal. (See Attached)(Well located on State Land, certified mail is not required for Federal Land per BLM/OCD MOU.)

4. Within 6 months of the Rig Off status occurring COPC will ensure that temporary pits are closed, re-contoured, and reseeded.

Provision 4 of the closure plan requirements were not met due to rig move off date as noted on C-105 which was prior to pit rule change. ConocoPhillips will ensure compliance with this rule in the future.

- 5. Notice of Closure will be given to the Aztec Division office between 72 hours and one week of closure via email, or verbally. The notification of closure will include the following:
 - i. Operator's name
 - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

Notification is attached.

6. Liner of temporary pit shall be removed above "mud level" after stabilization. Removal of liner will consist of manually or mechanically cutting liner at mud level and removing all remaining liner. Care will be taken to remove "All" of the liner i.e., edges of liner entrenched or buried. All excessive liner will be disposed of at a licensed disposal facility.

Liner of temporary pit was removed above "mud level" after stabilization. Removal of the liner consisted of manually cutting liner at mud level and removing all remaining liner. Care was taken to remove "ALL" of the liner i.e., edges of liner entrenched or buried. All excessive liner was disposed of at a licensed disposal facility, (San Juan County Landfill).

7. Pit contents shall be mixed with non-waste containing, earthen material in order to achieve the solidification process. The solidification process will be accomplished using a combination of natural drying and mechanically mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed a safe and stable. The mixing ratio shall not exceed 3 parts clean soil to 1 part pit contents.

ConocoPhillips mixed the Pit contents with non-waste containing, earthen material in order to achieve the solidification process. The solidification process was accomplished by using a combination of natural drying and mechanically mixing. Pit contents were mixed with non-waste, earthen material to a consistency that is deemed as safe and stable. The mixing ratio consisted of approximately 3 parts clean soil to 1 part pit contents.

8. A five point composite sample will be taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.13(B)(1)(b). In the event that the criteria are not met, all contents will be handled per Subparagraph (a) of Paragraph (1) of Subsection B of 19.15.17.13 i.e., Dig and haul.

A five point composite sample was taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached).

Components	Tests Method	Limit (mg/Kg)	Results
Benzene	EPA SW-846 8021B or 8260B	0.2	2.4 ug/kg
BTEX	EPA SW-846 8021B or 8260B	50	180 ug/kG
TPH	EPA SW-846 418.1	2500	91.9mg/kg
GRO/DRO	EPA SW-846 8015M	500,	16.1 mg/Kg
Chlorides	EPA 300.1	1000/500	340 mg/L

9. Upon completion of solidification and testing standards being passed, the pit area will be backfilled with compacted, non-waste containing, earthen material. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater. If standard testing fails BR will dig and haul all contents pursuant to 19.15.17.13.i.a. After doing such, confirmation sampling will be conducted to ensure a release has not occurred.

The pit material passed solidification and testing standards. The pit area was then backfilled with compacted, non-waste containing, earthen material. More than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

10. During the stabilization process if the liner is ripped by equipment the Aztec OCD office will be notified within 48 hours and the liner will be repaired if possible. If the liner can not be repaired then all contents will be excavated and removed.

The integrity of the liner was not damaged in the pit closure process.

11. Dig and Haul Material will be transported to the Envirotech Land Farm located 16 miles south of Bloomfield on Angel Peak Road, CR 7175. Permit # NM010011

Dig and Haul was not required.

12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final recontour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The pit area was re-contoured to match fit, shape, line, form and texture of the surrounding area. Reshaping included drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final recontour has a uniform appearance with smooth surface, fitting the natural landscape.

13. Notification will be sent to OCD when the reclaimed area is seeded.

Provision 13 was accomplished on 5/25/11 with the following seeding regiment:

Туре	Variety or Cultivator	PLS/A
Western wheatgrass	Arriba	3.0
Indian ricegrass	Paloma or Rimrock	3.0
Slender wheatgrass	San Luis	2.0
Crested wheatgrass	Hy-crest	3.0
Bottlebrush Squirreltail	Unknown	2.0
Four-wing Saltbrush	Delar	.25

14. COPC shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM or Forest Service stipulated seed mixes will used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs.

Provision 14 was accomplished on 5/25/11 with the above seeding regiment. Seeing was accomplished via drilling on the contour whenever practical or by other division-approved methods. The OCD will be notified once two successive growing seasons have been accomplished by submitting a C-103.

15. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial upon the abandonment of all the wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the operator's information at the time of all wells on the pad are abandoned. The operator's information will include the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

Provision 15 was accomplished by installing a steel marker in the temporary pit, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial. The marker is flush with the ground to allow access of the active well pad and for safety concerns. The top of the marker contains a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate contains the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the following operator's information at the time of all wells on the pad are abandoned. The riser will be labeled: COP, State, STATE COM R 14B, UL-I, Sec. 36, T 30N, R 9W, API # 30-045-35039

DISTRICT I 1625 N. French Dr., Hobbs, N.M. 66240

State of New Mexico Energy, Minerals & Natural Resources Department

Form C-102 Revised October 12, 2005

DISTRICT II 1301 W. Grand Avenue, Artesia, N.M. 88210

DISTRICT III 1000 Rio Brezos Rd., Aztec, N.M. 87410 OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit to Appropriate District Office State Lease - 4 Copies Fee Lease - 3 Copies

☐ AMENDED REPORT

DISTRICT IV 1220 S. St. Francis Dr., Santa Fe, NM 67606


WELL LOCATION AND ACREAGE DEDICATION PLAT

¹ API Number	*Pool Code	Pool Name
	BLANG	CO MESA VERDE / BASIN DAKOTA
*Property Code	Property Name STATE COM R	
OGRID No.	Operator Name	
	CONOCOPHILLIPS COMPANY	

¹⁰ Surface Location

UL or lot no.	Section 36	Township 30N	Range 9W	Lot Idn	Feet from the 1895'	North/South line SOUTH	Feet from the 907'	East/West line EAST	County SAN JUA
			11 Botto	om Hole	Location I	f Different Fro	om Surface		
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
B Dedicated Acre	8	_	18 Joint or	Infill	¹⁴ Consolidation C	Code	18 Order No.		
320.00 A	CRES -	S/2							

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED

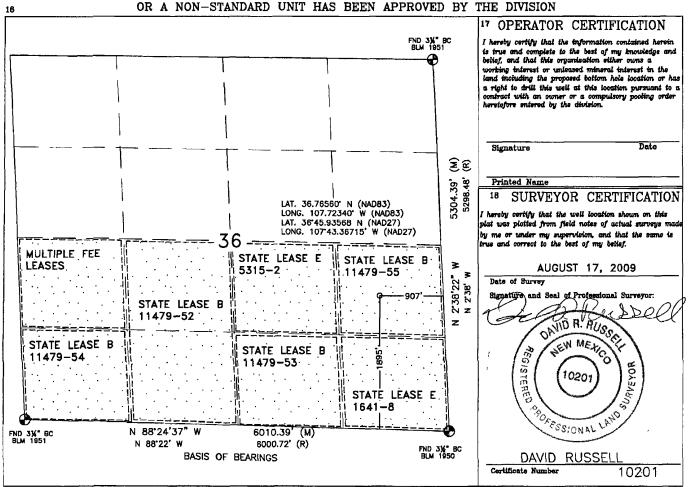

CONOCOPHILLIPS COMPANY **WELL FLAG** STATE COM R #14 B LATITUDE: 36 76560° N 1895' FSL & 907' FEL LONGITUDE: 107.72340° W LOCATED IN THE NE/4 SE/4 OF SECTION 36. **CENTER OF PIT** T30N, R9W, N M.P.M., LATITUDE: 36.76571° N SAN JUAN COUNTY, NEW MEXICO ONGITUDE: 107.72324° W 30' **GROUND ELEVATION: 5851'. NAVD 88** ELEVATION: 5838.9' FINISHED PAD ELEVATION: 5850.9', NAVD 88 SCALE = 60' DATUM: NAD83 & NAVD88 1.) BASIS OF BEARING BETWEEN FOUND MONUMENTS AT THE SOUTHEAST CORNER AND THE SOUTHEAST CORNER OF SECTION 36, TOWNSHIP 30 NORTH, RANGE 9 WEST, N.M.P.M. SAN JUAN COUNTY, NEW MEXICO LINE BEARS: N. 882437 W A DISTANCE OF 6010.39 FEET AS MEASURED BY G.P.S. C'F+12.3 B'F+7.4 A'_®/ F+6.1 2.) LATITUDE, LONGITUDE AND ELLIPSOIDAL HEIGHT BASED ON AZTEC CORS LI PHASE CENTER. DISTANCES SHOWN ARE GROUND DISTANCES USING A TRAVERSE MERCATOR PROJECTION FROM A WOSB4 ELLIPSOID, CONVERTED TO MADBS ANDOBE ELEVATIONS AS PREDICTED BY GEOIDOS 2:1 Slopes Reserve Pit Positive drain e, DEED CENTER OF PIT 쥬 ᆵ 10' Deep 12' Deep 3.) LOCATION OF UNDERGROUND UTILITIES DEPICTED ARE APPROXIMATE. PRIOR TO EXCAVATION UNDERGROUND UTILITIES SHOULD BE FIELD VERIFIED. ALL DH-DELHI STATE COM #1 0 LONG. 107 72340° W SHOULD BE FIELD VERNIED ALL CONSTRUCTION ACTIVITIES SHOULD BE FIELD VERIFIED WITH NEW MEXICO ONE—CALL AUTHORITIES AT LEAST 48 HOURS PRIOR TO CONSTRUCTION RIG ANCHOR (NAD 83) RIG ANCHOR REAR Wellhead to back Wellhead to front LAYDOWN 0 5 00°00′00″ W 200' **©** 140' S 11°15′55" E 160 C-0.5 C-0.5 EXISTING ACCESS 9 GATE TO BE 0 O Wellhead INSTALLED RIG ANCHOR RIG ANCHOR 38 EXISTING WELL PAD C-3.8 C-14.8 ② C-11.2 B

TOTAL PERMITTED AREA 330' x 400' = 3.03 ACRES

SCALE: 1" = 60' JOB No.: COPC339 DATE: 08/18/09 DRAWN BY: TWT

RESERVE PIT DIKE: TO BE 8' ABOVE DEEP SIDE (OVERFLOW - 3' WIDE AND 1' ABOVE SHALLOW SIDE). RUSSELL SURVEYING, INC. IS NOT LIABLE FOR UNDERGROUND UTILITIES OR PIPELINES. CONTRACTOR SHOULD CALL ONE-CALL FOR LOCATION OF ANY MARKED OR UNMARKED, BURIED PIPELINES OR CABLES ON WELL PAD, IN CONSTRUCTION ZONE AND/OR ACCESS ROAD AT LEAST TWO (2) WORKING DAYS PRIOR TO CONSTRUCTION.



Russell Surveying 1409 W. Aztec Blvd. #2 Aztec, New Mexico 87410 (505) 334-8637

SLOPES TO BE CONSTRUCTED TO MATCH THE ORIGINAL CONTOURS AS CLOSE AS POSSIBLE.

30'

~

60'



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	03-31-11
Laboratory Number:	57749	Date Sampled:	03-30-11
Chain of Custody No:	11190	Date Received:	03-30-11
Sample Matrix:	Soil	Date Extracted:	03-30-11
Preservative:	Cool	Date Analyzed:	03-31-11
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	5.3	0.2
Diesel Range (C10 - C28)	10.8	0.1
Total Petroleum Hydrocarbons	16.1	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

State Com R 14B



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	ConocoPhillips	Project#:	96052-1706
Sample ID:	Back Ground	Date Reported:	03-31-11
Laboratory Number:	57750	Date Sampled:	03-30-11
Chain of Custody No:	11190	Date Received:	03-30-11
Sample Matrix:	Soil	Date Extracted:	03-30-11
Preservative:	Cool	Date Analyzed:	03-31-11
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)	
Gasoline Range (C5 - C10)	ND	0.2	
Diesel Range (C10 - C28)	ND	0.1	
Total Petroleum Hydrocarbons	ND		

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

State Com R 14B

Analyst



EPA Method 8015 Modified Nonhalogenated Volatile Organics **Total Petroleum Hydrocarbons**

Quality Assurance Report

Client:	QA/QC		Project #:		N/A
Sample ID:	03-31-11 QA/0	OC .	Date Reported:		03-31-11
Laboratory Number:	57736		Date Sampled:		N/A
Sample Matrix:	Methylene Chlori	ide	Date Received:		N/A
Preservative:	N/A		Date Analyzed:		03-31-11
Condition:	N/A		Analysis Requested	d:	TPH
Gasoline Range C5 - C10 Diesel Range C10 - C28	03-31-11 03-31-11	9.9960E+002 9.9960E+002	C-Cal RF: 1.0000E+003 1.0000E+003	% Difference 0.04% 0.04%	Accept Range 0 - 15% 0 - 15%
Blank Conc. (mg/L= mg/l	(g)	Concentration		Detection Lim	
Gasoline Range C5 - C10		ND		0.2	
Diesel Range C10 - C28		ND		0.1	

Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Accept Range
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%
Diesei Range C10 - C28	ND	ND	0.0%	0 - 30%

Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept Range
Gasoline Range C5 - C10	ND	250	202	80.8%	75 - 125%
Diesel Range C10 - C28	ND	250	262	105%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 57736, 57745, 57747-57753



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	03-31-11
Laboratory Number:	57749	Date Sampled: ,	03-30-11
Chain of Custody:	11190	Date Received:	03-30-11
Sample Matrix:	Soil	Date Analyzed:	03-30-11
Preservative:	Cool	Date Extracted:	03-30-11
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

	Diagon.	10	
Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Danasas	2.4		
Benzene	2.4	0.9	
Toluene	36.5	1.0	
Ethylbenzene	5.7	1.0	
p,m-Xylene	126	1.2	
o-Xylene	9.2	0.9	
Total BTEX	180		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery	
	Fluorobenzene	104 %	•
	1,4-difluorobenzene	103 %	
	Bromochlorobenzene	107 %	

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

State Com R 14B

Analysi



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported:	03-31-11
Laboratory Number:	57750	Date Sampled:	03-30-11
Chain of Custody:	11190	Date Received:	03-30-11
Sample Matrix:	Soil	Date Analyzed:	03-30-11
Preservative:	Cool	Date Extracted:	03-30-11
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

		Det.	
	Concentration	Limit	1
Parameter	(ug/Kg)	(ug/Kg)	
Benzene	ND	0.9	

I oluene	ND	1.0
Ethylbenzene	ND	1.0
p,m-Xylene	2.1	1.2
o-Xylene	2.4	0.9
-		

Total BTEX 4.5

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	102 %
	1,4-difluorobenzene	104 %
	Bromochlorobenzene	102 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

State Com R 14B



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Benzene	4.4478E+006	4.4567E+006	0.2%	ND	0.1
Calibration and Detection Limits (ug/L	I-Cal RF	C-Cal RF: Accept Rang	%Diff. e.0 - 15%	Blank Cönc	Detect. Limit
Legister Michigan Grace Addition Library es	ىرغىدىدۇرىي <mark>ى ئەندىدىدىدىدىدىدىدىدىدىدىدىدىدىدىدىدىدىدى</mark>	7-12-7-7-7-12-12-7-7-12-12-12-12-12-12-7-7-7-7	Dilution:	1()
Condition:	N/A		Analysis:	E	TEX
Preservative:	N/A	1	Date Analyzed:	0	3-30-11
Sample Matrix:	Soil	1	Date Received:	1	I/A
Laboratory Number:	57736	Į	Date Sampled:	٨	1/A
Sample ID:	0330BBLK QA/QC	;	Date Reported:	0	3-31-11
Client:	N/A	I	Project#:	N	I/A

Benzene	4.4478E+006	4.4567E+006	0.2%	ND	0.1
Toluene	1.5897E+006	1.5928E+006	0.2%	ND	0.1
Ethylbenzene	1.2398E+006	1.2423E+006	0.2%	ND	0.1
o,m-Xylene	2.7234E+006	2.7288E+006	0.2%	ND	0.1
o-Xylene	1.0122E+006	1.0142E+006	0.2%	ND	0.1

Duplicate Conc. (ug/Kg)	Sample Du	plicate	%Diff	Accept Range	Detect: Limit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	ND	ND	0.0%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	2.3	2.5	8.7%	0 - 30%	1.2
o-Xylene	3.6	3.5	2.8%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Sample	Amount Spiked	Spiked Sample	% Recovery	Accept Range
Benzene	ND	500	549	110%	39 - 150
Toluene	ND	500	543	109%	46 - 148
Ethylbenzene	NÐ	500	515	103%	32 - 160
p,m-Xylene	2.3	1000	1,060	106%	46 - 148
o-Xylene	3.6	500	521	103%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 57736, 57745-57753



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	03/31/11
Laboratory Number:	57749	Date Sampled:	03-30-11
Chain of Custody No:	11190	Date Received:	03/30/11
Sample Matrix:	Soil	Date Extracted:	03/31/11
Preservative:	Cool	Date Analyzed:	03/31/11
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

91.9

59.9

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: St

State Com R 14B



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client: .	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported:	03/31/11
Laboratory Number:	57750	Date Sampled:	03-30-11
Chain of Custody No:	11190	Date Received:	03/30/11
Sample Matrix:	Soil	Date Extracted:	03/31/11
Preservative:	Cool	Date Analyzed:	03/31/11
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

93.2

59.9

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

State Com R 14B



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS **QUALITY ASSURANCE REPORT**

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

03/31/11

Laboratory Number:

03-31-TPH.QA/QC 57753

Date Sampled:

N/A

Sample Matrix:

Freon-113

Date Analyzed:

03/31/11

Preservative: Condition:

N/A N/A Date Extracted: Analysis Needed: 03/31/11 TPH

Calibration

C-Cal Date I-Cal Date

I-Cal RF:

C-Cal RF: % Difference Accept. Range

03/01/11

03/31/11

1,660

1,670

0.6%

+/- 10%

Blank Conc. (mg/Kg)

Concentration

Detection Limit

TPH

TPH

ND

59.9

Duplicate Conc. (mg/Kg) **TPH**

Sample 107

Duplicate 127

18.7%

% Difference Accept. Range: +/- 30%

Spike Conc. (mg/Kg)

Sample 107

Spike Added Spike Result % Recovery 2.000

1.860

88.3%

Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 57745, 57747-57753



Chloride

Client: ConocoPhillips Project #: 96052-1706 Sample ID: Reserve Pit Date Reported: 03/31/11 Lab ID#: 57749 Date Sampled: 03/30/11 Sample Matrix: Soil Date Received: 03/30/11 Preservative: Cool Date Analyzed: 03/31/11 Condition: Intact Chain of Custody: 11190

Davanastav	O = = = = = 4 = = 4 = = = 1 = = = 1 = = 1 = = 1
Parameter	Concentration (mg/Kg)
	0011001110111(1119)119)

Total Chloride

340

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

State Com R 14B



Chloride

Client: Sample ID: ConocoPhillips

Project #:

96052-1706

Back Ground

Date Reported:

03/31/11

Lab ID#:

57750

Date Sampled:

03/30/11

Sample Matrix:

Soil

Date Received:

Preservative:

Cool

Date Analyzed:

03/30/11 03/31/11

Condition:

Intact

Chain of Custody:

11190

Parameter

Concentration (mg/Kg)

Total Chloride

20

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

State Com R 14B

Analyst

Review

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com

Submit To Appropriate Copies District I	State of New Mexico Energy, Minerals and Natural Resources				Form C-105 July 17, 2008										
1625 N French Dr. District II 1301 W Grand Av					l Conserva					1. WELL A		NO.			
District III 1000 Rio Brazos R					20 South S					2 Type of Le				DIAN	
District IV 1220 S. St. Francis					Santa Fe, N			71.		STATE FEE FED/INDIAN 3 State Oil & Gas Lease No					
				<u>-</u>						NM - B - 1					
4. Reason for fil		LETION (RRECO	MPL	ETION RE	POF	RT ANI	D LOG		5. Lease Name or Unit Agreement Name					
	COMPLETION REPORT (Fill in boxes #1 through #31 for State and Fee wells						only)			STATE CO	OM I		meni Name		
_		•		Ü			•	and #22 and	1/0-4	14B	ber -				
#33; attach this a	nd the plat								/or						
7. Type of Comp		T workove	R □ DEEP	ENING	□PLUGBACI	кΠ	DIFFERF	NT RESERV	/OIF	ROTHER					
8 Name of Oper	ator			5111.10		· <u> </u>	DIT LIKE	A TELESIA	<u> </u>	9. OGRID					
ConocoPhilli 10 Address of O		pany								217817	or W	ildaat		· · · · · · · · · · · · · · · · · · ·	
PO Box 4298, Fa		, NM 87499								11. Pool name	or w	nacat			
12.Location	Unit Ltr	Section	Town	ship	Range	Lot		Feet from t	the	N/S Line	Feet	from the	E/W Line	County	
Surface:						ļ							_		
BH:	<u> </u>							<u> </u>					<u> </u>		
13. Date Spudde	d 14. Da	ate T.D. Reach		Date Rig 0/2010	Released		16	. Date Comp	letec	d (Ready to Proc	iuce)		7. Elevations (I Γ, GR, etc.)	OF and RKB,	
18. Total Measur	red Depth	of Well	19.	Plug Bac	ck Measured De	pth	20	Was Direct	tiona	al Survey Made)	21. Typ	e Electric and	Other Logs Run	
22. Producing In	terval(s), o	of this complet	on - Top, Bo	ttom, Na	ame		L					<u> </u>			
23.	<u> </u>			CAS	ING REC	OR	D (Rer	ort all st	rin	gs set in w	ell)				
CASING SI	IZE	WEIGHT	LB./FT.		DEPTH SET			OLE SIZE		CEMENTIN		CORD	AMOUN	T PULLED	
										 					
SIZE	TOP		ВОТТОМ	LIN	ER RECORD SACKS CEM	ENT	SCREE	N	25	5. TUBING RECORD IZE DEPTH SET PACKER SET			VED CET		
SIZE	IOF		BOTTOM		SACKS CEW	IENI	SCREE	in .	31.	ZE	100	er in se i	PAC	NEK SEI	
26. Perforation	n record (it	nterval, size, a	d number)					ID, SHOT, INTERVAL		ACTURE, CE			EEZE, ETC. TERIAL USE		
							DEFIN	INTERVAL	-	AWIOUNT	IND	LIND MA	TERIAL USE	<u> </u>	
							<u> </u>								
28. Date First Produc	otion	l p.	duction Ma	thad (El	owing, gas lift, p			TION		Well Status	(Duo	d ou Chut	:\		
Date i list i lodd	CHOII	' '	oduction Me	illou (1° te	owing, gus iiji, p	штріп	g - Size ui	ла туре ритр	<i>'</i>	Wen Status	5 (1 700	a. or shul-	-in)		
Date of Test	Hours	Tested	Choke Size	;	Prod'n For Test Period		Oil - Bl	ol .	Ga	ıs - MCF	W.	ater - Bbl	Gas	- Oıl Ratıo	
Flow Tubing Press.	Casin	g Pressure	Calculated Hour Rate	24-	Oil - Bbl.		Gas	- MCF	<u> </u>	Water - Bbl.		Oil Gra	vity - API - (C	'orr.)	
29. Disposition of	of Gas (Sol	ld, used for fue	, vented, etc.)	l		1		1		30. 1	Test Witne	essed By		
31. List Attachm	ents										1				
32. If a temporar	y pit was u	used at the wel	, attach a pla	t with th	e location of the	temp	orary pit								
33. If an on-site	burial was	used at the we	ll, report the	exact lo	cation of the on-	site bu	ırial:	· · · · · ·					<u> </u>		
7,		Latitude	36.76571°N	Lon	gitude 107.7232	24°W	NAD 🔲	1927 🛭 198	3		<u> </u>	, ,	, , , ,	• •	
I hereby certi	ify that the	. 1	1 .	Pri	h sides of this nted ne Jamie Go	-		_				knowled 2: 7/11/2		ef	
E-mail Addre						Jouw	111	.c. Regui	aiO.	iy 10011.	Dail	, 1/11/4	· · · · · · · · · · · · · · · · · · ·		

ConocoPhillips

Pit Closure Form:
Date: <u>5/16/11</u>
Well Name: State Con R 148
Footages: <u>/895 F51, 907 FEL</u> Unit Letter: <u>I</u>
Section: 36, T-30-N, R-9-W, County: State: NM
Contractor Closing Pit: AZTEC EXCAUATION
Construction Inspector: JARED CHAVET Date: 5/10/11
Revised 11/4/10 Office Use Only: Subtask DSM

Goodwin, Jamie L

From: Sent:

Payne, Wendy F

Tuesday, May 10, 2011 12:55 PM

To:

Eli (Cimarron) (eliv@gwestoffice.net); GRP:SJBU Regulatory;

(Brandon.Powell@state.nm.us); Bassing, Kendal R.; Berenz (mxberenz@yahoo.com); Elmer

Perry; Faver Norman; Fred Martinez; Jared Chavez; Lowe, Terry; Payne, Wendy F; Spearman, Bobby E; Steve McGlasson; Tally, Ethel; Becker, Joey W; Bowker, Terry D;

Gordon Chenault; GRP:SJBU Production Leads; Hockett, Christy R; Johnson, Kirk L; Bassing, Kendal R.; Kennedy, Jim R; Lopez, Richard A; O'Nan, Mike J.; Peace, James T; Pierce,

Richard M; Poulson, Mark E; Smith, Randall O; Spearman, Bobby E; Stamets, Steve A; Thacker, LARRY; Work, Jim A; Corey Alfandre; 'isaiah@crossfire-llc.com'; Jerid Cabot (jerid@crossfire-llc.com); Blair, Maxwell O; Blakley, Mac; Farrell, Juanita R; Gillette, Steven L (PAC); Hines, Derek J; Maxwell, Mary Alice; McWilliams, Peggy L; Saiz, Kooper (Finney Land Co.); Seabolt, Elmo F; Stallsmith, Mark R; Thayer, Ashley A; Thompson, Trey E (Finney Land

Co.)

Cc:

'Aztec Excavation'

Subject:

Reclamation Notice: State Com R 14B

Importance:

High

Attachments:

STATE COM R 14B.pdf

Aztec Excavation will move a tractor to the **State Com R 14B** to start the reclamation process on Friday, May 13. 2011. Please contact Jared Chavez (793-7912) if you have questions and need further assistance.



STATE COM R 14B.pdf (13 KB)

ConocoPhillips Company Well - Network # 10287413 - Activity Code D250 (reclamation) & D260 (pit closure) San Juan County, NM

State Com R 14B - STATE surface/STATE minerals

Onsited: n/a

Twin: Delhi State Com 1 - P&A (nothing to strip)

1895' FSL, 907' FEL Sec.36, T30N, R9W Unit Letter " I " Lease: B-11479-55

Latitude: 36° 45' 56" N (NAD 83) Longitude: 107° 43' 24" W (NAD 83)

Elevation: 5851'

Total Acres Disturbed: 1.58 acres

Access Road: n/a API # 30-045-35039 Within City Limits: NO

Pit Lined: YES


Note: Arch Monitoring is **NOT** required.


Wendy Payne ConocoPhillips-SJBU 505-326-9533

Wendy.F.Payne@conocophillips.com


ConocoPhillips

Reclamation Form:		
Date: 3/9/11		
Well Name: 5707E	Com R 14B	<u> </u>
Footages: <u>/895 / F5</u>	L, 907 FEL	_ Unit Letter: $oldsymbol{\mathcal{I}}$
Section: <u>36</u> , T- <u>36</u>		
Reclamation Contractor:	AZTEC EXCAVATED	. N
Reclamation Date:	5/23/11	
Road Completion Date:	5/24/11	
	5/25/11	
		(DATE)
Pit Manifold removed Construction Inspector: Inspector Signature:	JARED CHAVEZ	(DATE) Date: <u>6/9/11</u>
	() 0	
Office Use Only: Subtask		

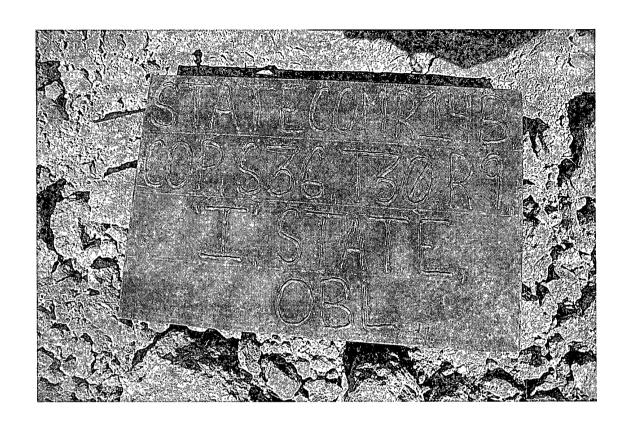

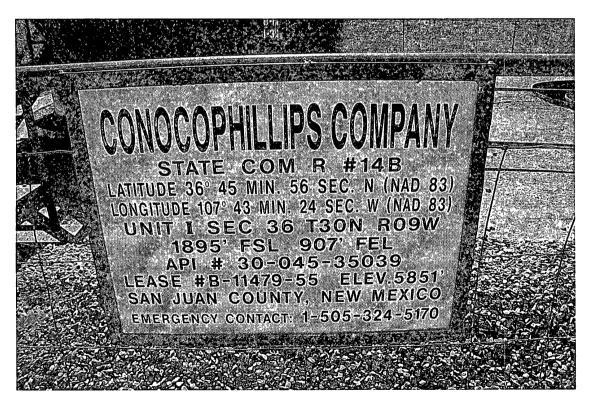



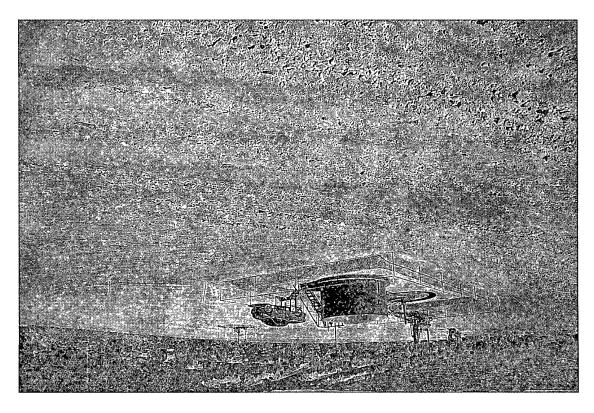

	WELL NAME:	OPEN P	ITINSPE	CTION F	ORM				ocoPh	
	State Com R#14b	-17-41-17-5		45000000000000000000000000000000000000		建制的图 别				
	INSPECTOR		Fred Mtz	Fred Mtz	Fred Mtz	Fred Mtz	Fred Mtz	Fred Mtz	Fred Mtz	Fred Mtz
	*Please request for pit extention after 26 weeks	08/23/10 Week 1	08/30/10 Week 2	09/07/10 Week 3	09/13/10 Week 4	09/20/10 Week 5	09/27/10 Week 6	10/04/10 Week 7	10/11/10 Week 8	11/08/10 Week 9
-	Fieuse request for pir externiori uner 20 weeks	Drilled	Drilled	□ Drilled	Drilled	Drilled	Drilled	Drilled	Drilled	☐ Drilled
	PIT STATUS		☐ Completed	Completed	Completed	☐ Completed	☐ Completed	☐ Completed	Completed	☐ Completed
:		Clean-Up	Clean-Up	☐ Clean-Up	☐ Clean-Up	Clean-Up	Clean-Up	Clean-Up	Clean-Up	Clean-Up
7	T			 		· :::				
LOCATION	Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.)	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	✓ Yes ☐ No	Yes No	☐ Yes ☐ No
δ 0 0	Is the temporary well sign on location and visible from access road?	Yes V No	☐ Yes ☐ No	✓ Yes	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐ No	☑ Yes ☐ No	Yes No	☐ Yes ☐ No
F										
	Is the access road in good driving condition? (deep ruts, bladed)	☑ Yes ☐ No	☑ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes □ No	☑ Yes ☐ No	☐ Yes ☐ No	Yes No
	Are the culverts free from debris or any object preventing flow?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Is the top of the location bladed and in good operating condition?	✓ Yes	✓ Yes □ No	☑ Yes ☐ No	✓ Yes □ No	✓ Yes 🗌 No	☑Yes □No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
NG.	Is the fence stock-proof? (fences tight, barbed wire, fence clips in place?	☐ Yes ☑ No	☑ Yes ☐ No	☐ Yes ☑ No	☑Yes ☐No	☑Yes ☐No	✓ Yes	✓ Yes □ No	☐ Yes ☐ No	☐ Yes ☐ No
COMPLIANCE	Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.)	☑ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☑Yes ☐ No	✓ Yes	✓ Yes □ No	☐ Yes ☐ No	☐ Yes ☐ No
S C C	Is the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.)	☑ Yes ☐ No	✓ Yes	☑ Yes ☐ No	✓ Yes □ No	☑Yes ☐No	✓ Yes 🗌 No	✓ Yes □ No	☐ Yes ☐ No	☐ Yes ☐ No
MENTA	Does the pit contain two feet of free board? (check the water levels)	☑Yes ☐ No	✓ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☑ Yes ☐ No	✓ Yes □ No	☐ Yes ☐ No	☐ Yes ☐ No
ENVIRONMENTA	Is there any standing water on the blow pit?	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes □No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
EN	Are the pits free of trash and oil?	✓ Yes □ No	✓ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐ No	☑Yes ☐No	Yes No	☐ Yes ☐ No
	Are there diversion ditches around the pits for natural drainage?	✓ Yes □ No	✓ Yes □ No	✓ Yes	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes □ No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☐ No
	Is there a Manifold on location?	☐ Yes ☑ No	☐ Yes ☑ No	Yes INO	☑Yes ☐No	Yes □ No ☑ Yes □ No ☐		☑Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Is the Manifold free of leaks? Are the hoses in good condition?	☑ Yes ☐ No	✓ Yes □ No	☑ Yes □ No	☑Yes ☐No	☑ Yes ☐ No	☑Yes ☐No	☑Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
ပ္က	Was the OCD contacted?	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐Yes ☐ No	☐ Yes ☐ No
	PICTURE TAKEN	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐Yes ☐No	Yes No
	COMMENTS	Contact Flint to fix			Contact Flint to fix liner had small holes on East side.				surface crew on	A.W.S. 730 Rig on

	WELL NAME:							一日本 日本 一年 一日 日本 一日 日本	The state of the s	
	State Com R#14b									
	INSPECTOR		Fred Mtz	Fred MTZ	JARED CHAVEZ	JARED CHAVEZ	JARED CHAVEZ	JARED CHAVEZ		E. Perry
-	*Please request for pit extention after 26 weeks	11/15/10 Week 10	12/06/10 Week 11	12/13/10 Week 12	01/07/11 Week 13	01/18/11 Week 14	01/26/11 Week 15	02/02/11 Week 16	Week 17	02/10/11 Week 18
PIT STATUS		✓ Drifled ☐ Completed ☐ Clean-Up	☐ Drilled ☐ Completed ☐ Clean-Up	✓ Drilled Completed Clean-Up	☐ Completed☐ Clean-Up	✓ Drilled ☐ Completed ☐ Clean-Up	☐ Drilled ☐ Completed ☐ Clean-Up	☑ Drilled ☐ Completed ☐ Clean-Up	Drilled Completed Clean-Up	☐ Drilled ☐ Completed ☐ Clean-Up
ATION	Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.)	✓ Yes ☐ No	✓ Yes □ No	✓ Yes No	☑ Yes ☐ No	✓ Yes No	☑Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes
10C	Is the temporary well sign on location and visible from access road?	☑ Yes ☐ No	✓ Yes □ No	✓ Yes	✓ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No	☑ Yes ☐ No	Yes No	✓ Yes □ No
	Is the access road in good driving condition? (deep ruts, bladed)	✓ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☑ No
	Are the culverts free from debris or any object preventing flow?	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐ No	☑Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No
	Is the top of the location bladed and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☑ No	☑ Yes ☐ No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	Yes No	☐ Yes ☑ No
NCE	Is the fence stock-proof? (fences tight, barbed wire, fence clips in place?	✓ Yes □ No	✓ Yes	✓ Yes □ No	☑Yes ☐No	☑Yes ☐ No	☑ Yes ☐ No	☑Yes ☐No	☐ Yes ☐ No	☑ Yes ☐ No
OMPLIAN	Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.)	✓ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐ No	✓ Yes 🗌 No	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes ☐ No
Ŭ	Is the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.)	✓ Yes No	☑ Yes ☐ No	☑Yes ☐ No	☑ Yes ☐ No	☑Yes ☐ No	✓ Yes 🗌 No	☑Yes ☐No	☐ Yes ☐ No	✓ Yes ☐ No
MENTAL	Does the pit contain two feet of free board? (check the water levels)	☑ Yes □ No	☑Yes ☐ No	☑Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes □ No
ENVIRONM	Is there any standing water on the blow pit?	✓ Yes □ No	☑ Yes ☐ No	☑Yes ☐ No	☐ Yes ☑ No	☐Yes ☑No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐Yes ☑No
EN	Are the pits free of trash and oil?	✓ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	✓ Yes □ No	✓ Yes □ No	☑ Yes ☐ No	Yes No	✓ Yes □ No
B	Are there diversion ditches around the pits for natural drainage?	☑Yes ☐No	☑ Yes ☐ No	☑Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	· ☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No
	Is there a Manifold on location?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No
	Is the Manifold free of leaks? Are the hoses in good condition?	☑Yes ☐ No	✓ Yes No	✓ Yes □ No	✓ Yes □ No	✓ Yes □ No	✓ Yes □ No	✓ Yes	☐ Yes ☐ No	☑Yes ☐ No
၁၀	Was the OCD contacted?	☐ Yes ☑ No	☐Yes ☑No	☐Yes ☑No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☑ No			
	PICTURE TAKEN	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☑ No
	COMMENTS		No repairs same as last week contact Dawn to pull pit.	Location needs bladed.	LOCATION IS IN GOOD CONDITION	LOCATION IS IN GOOD CONDITION	LOCATION IS IN GOOD CONDITION	LOCATION IS IN GOOD CONDITION		Rd. and Loc. Rutted

8	WELL NAME:									
	State Com R#14b	[13] (13] [4] [4] [4] [4] [4] [4] [4] [4] [4] [4				2.1 (12) 12 (13) 14 (14) 14 (
-	INSPECTOR DATE		E. Perry 02/24/11	E. Perry 03/03/11	E. Perry 03/10/11	E. Perry 03/18/11	E. Perry 03/24/11	E. Perry 03/31/11		
	*Please request for pit extention after 26 weeks	Week 19	Week 20	Week 21	Week 22	Week 23	Week 24	Week 25	*Week 26*	Week 27
PIT STATUS		✓ Drilled ☐ Completed ☐ Clean-Up	✓ Drilled ☐ Completed ☐ Clean-Up	✓ Drilled ☐ Completed ☐ Clean-Up	✓ Drilled ☐ Completed ☐ Clean-Up	✓ Drilled ☐ Completed ☐ Clean-Up	☑ Drilled ☑ Completed ☐ Clean-Up	✓ Drilled ✓ Completed ☐ Clean-Up	☐ Drilled ☐ Completed ☐ Clean-Up	☐ Drilled☐ Completed☐ Clean-Up
LOCATION	ls the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.)	✓ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☑ Yes ☐ No	☑Yes ☐No	☑Yes ☐ No	☑Yes ☐No	☐ Yes ☐ No	Yes No
	Is the temporary well sign on location and visible from access road?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐ No	☑ Yes ☐ No	☑Yes □ No	☑Yes ☐No	Yes No	Yes No
	Is the access road in good driving condition? (deep ruts, bladed)	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐Yes ☑No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☐ No
	Are the culverts free from debris or any object preventing flow?	☑ Yes ☐ No	☑Yes ☐No	☐ Yes ☑ No	☐Yes ☑No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☐ No
İ	Is the top of the location bladed and in good operating condition?	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐Yes ☑No	☐Yes ☑No	☐ Yes ☑ No	□Yes ☑No	☐ Yes ☐ No	☐ Yes ☐ No
NCE	Is the fence stock-proof? (fences tight, barbed wire, fence clips in place?	✓ Yes	☑ Yes ☐ No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐No	☑Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	Yes No
ENVIRONMENTAL COMPLIANCE	Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.)	✓ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Is the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.)	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐No	☑ Yes ☐ No	☑Yes ☐ No	✓ Yes 🗌 No	✓ Yes □ No	☐ Yes ☐ No	☐ Yes ☐ No
	Does the pit contain two feet of free board? (check the water levels)	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No	☐ Yes ☐ No	☐ Yes ☐ No
	Is there any standing water on the blow pit?	☐ Yes ☑ No	☐Yes ☑No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐Yes ☑No	☐ Yes ☐ No	☐ Yes ☐ No
EN	Are the pits free of trash and oil?	☑ Yes ☐ No	☑Yes ☐ No	☑Yes ☐No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Are there diversion ditches around the pits for natural drainage?	✓ Yes ☐ No	☑Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑Yes ☐No	☑ Yes ☐ No	☑Yes ☐No	☐ Yes ☐ No	☐ Yes ☐ No
	Is there a Manifold on location?	☑ Yes ☐ No	☑Yes ☐ No	☑Yes ☐No	☑ Yes ☐ No	☑Yes ☐No	✓ Yes □ No	✓ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Is the Manifold free of leaks? Are the hoses in good condition?	✓ Yes ☐ No	☑Yes ☐No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No	☐ Yes ☐ No	☐ Yes ☐ No
၁ ၁	Was the OCD contacted?	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☐ No
	PICTURE TAKEN	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	Yes Vo	☐ Yes ☑ No	☐ Yes ☑ No	Yes No	Yes No
The state of the s	COMMENTS	Fence down for	Rd. and Loc. Rough No Dulverts	Rd. and Loc. Rough No Culverts	Rd. and Loc Rough No Culverts		Road and Loc. Rough No Culverts	Rd. and Loc. Rough No Cukverts		

WELL NAME: State Com R#14b INSPECTOR E. Perry E. Perrv E. Perry E. Perry F. Miz 04/20/11 04/26/11 05/02/11 05/06/11 05/11/11 DATE Week 28 Week 29 Week 30 Week 31 Week 32 Week 33 Week 34 Week 35 Week 36 *Please request for pit extention after 26 weeks Drilled ☑ Drilled Drilled Drilled ✓ Drilled ☑ Drilled ✓ Drilled ☑ Drilled Drilled ☐ Completed ☐ Completed ☐ Completed ☐ Completed ✓ Completed ✓ Completed ✓ Completed ✓ Completed Completed PIT STATUS Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Is the location marked with the proper flagging? ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No. ☐ Yes ☐ No ✓ Yes ☐ No (Const. Zone, poles, pipelines, etc.) Is the temporary well sign on location and visible ☐ Yes ☐ No. ☐ Yes ☐ No ☐ Yes ☐ No. ☐ Yes ☐ No ✓ Yes No ✓ Yes ☐ No. ✓ Yes ☐ No. ☐ Yes ☑ No ☐ Yes ☐ No from access road? Is the access road in good driving condition? (deep ☐Yes ☐No ☐Yes ☐ No ☐ Yes 🗸 No ☐ Yes ☑ No Yes V No ☐ Yes ☑ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No. ruts. bladed) Are the culverts free from debris or any object Yes No ☐ Yes 🗸 No ☐ Yes ☑ No Yes No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes 🗸 No Yes V No preventing flow? is the top of the location bladed and in good ☐ Yes ☑ No ☐ Yes ☑ No ☐ Yes ☑ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Yes No ☐ Yes ☑ No operating condition? Is the fence stock-proof? (fences tight, barbed wire, ☑ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No. Yes No Yes No ☐Yes ☐ No ✓ Yes ☐ No ✓ Yes No fence clips in place? Is the pit liner in good operating condition? (no ✓ Yes ☐ No. ☑ Yes ☐ No ✓ Yes No ✓ Yes □ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No tears, up-rooting corners, etc.) Is the the location free from trash, oil stains and ☐ Yes ☐ No ☐ Yes ☐ No Yes No ☑Yes ☐No ☑ Yes ☐ No ☐ Yes ☑ No Yes No ☐ Yes ☐ No ✓ Yes 🗆 No other materials? (cables, pipe threads, etc.) ENVIRONMENTAL Does the pit contain two feet of free board? (check Yes No ☐ Yes ☐ No ✓ Yes 🗌 No ☑ Yes ☐ No ✓ Yes No ✓ Yes 🗀 No Yes No Yes No Yes No the water levels) Is there any standing water on the blow pit? Yes No ☐ Yes ☑ No ☐Yes ☑No Yes No ☐ Yes 🗸 No Yes No Yes No ☐ Yes ☐ No Yes No Are the pits free of trash and oil? ☐ Yes ☐ No ✓ Yes 🗌 No ✓ Yes No ✓ Yes 🗌 No ✓ Yes No Yes No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Are there diversion ditches around the pits for ✓ Yes 🗌 No ✓ Yes 🗌 No ✓ Yes No ☑ Yes ☐ No Yes No ☐ Yes ☐ No ☐Yes ☐ No. ☐ Yes ☐ No. ☐Yes ☐ No natural drainaae? Is there a Manifold on location? ☑ Yes ☐ No ☑ Yes ☐ No ☐ Yes ☐ No Yes No Yes No Yes No Yes No ✓ Yes 🗌 No ☑ Yes ☐ No Is the Manifold free of leaks? Are the hoses in good ✓ Yes 🗌 No ☐ Yes ☐ No Yes No ☐ Yes ☐ No ☐ Yes ☐ No Yes No ☑ Yes ☐ No condition? \bigcirc \square Was the OCD contacted? ☐ Yes 🔽 No ☐ Yes ☑ No Yes V No. ☐ Yes ☑ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Yes No Yes No Yes No ☐ Yes ☐ No ☐ Yes 🔽 No ☐ Yes 🔽 No ☐ Yes ☑ No Yes No Yes No PICTURE TAKEN Sign on Facility Rd. and Loc. COMMENTS Rough No Rd. and Loc. Rd. and Loc. Rd. and Loc. Culverts Stains on Rough No Rough No Rough No Culverts Loc. Culverts Culverts