District I 1625 N French Dr., Hobbs, NM 88240 District II 1301 W Grand Avenue, Artesia, NM 88210 District III
1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S St Francis Di , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office
For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

7316		Pit, Closed-Loop System, Below-Grade Tank, or
	<u>Propo</u>	sed Alternative Method Permit or Closure Plan Application
	Type of action	Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method
		Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method
	,	Modification to an existing permit
	halam anda sanl	Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system,

below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the
environment Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances
Operator WILLIAMS PRODUCTION COMPANY, LLC OGRID # 120782
Address: PO Box 640 Aztec, NM 87410
Facility or well name: COX CANYON UNIT #200A
API Number 3004532126 OCD Permit Number
Section 90 Township 32N Range 11W County SAN JUAN
Latitude. 36 99488999999999 Longitude 107 99363 NAD 1983 Surface Owner <u>FEDERAL</u>
2
Pit: Subsection F or G of 19 15.17.11 NMAC
Temporary Drilling Workover
☐ Permanent ☐ Emergency ☐ Cavitation ☐ P&A
☐ Permanent ☐ Emergency ☐ Cavitation ☐ P&A ☐ Lined ☐ Unlined Liner type Thicknessmil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other
Liner Seams
3
☐ Closed-loop System: Subsection H of 19 15 17 11 NMAC Type of Operation ☐ P&A ☐ Drilling a new well ☐ Workover or Drilling (Applies to activities which require prior approval of a permit or notice of
intent)
☐ Drying Pad ☐ Above Ground Steel Tanks ☐ Haul-off Bins ☐ Other
Lined Unlined Liner type: Thicknessmil LLDPE HDPE PVC Other
□ Drying Pad □ Above Ground Steel Tanks □ Haul-off Bins □ Other □ Lined □ Unlined □ Liner type: Thickness □ mil □ LLDPE □ HDPE □ PVC □ Other □ Liner Seams. □ Welded □ Factory □ Other □ Othe
4 (O MENTED ON)
Below-grade tank: Subsection I of 19 15 17 11 NMAC
Volume: 120 bbl Type of fluid PRODUCED WATER CONS. DIV. DIST.
Tank Construction material FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
Secondary containment with leak detection Usible sidewalls, liner, 6-inch lift and automatic overflow shut-off
☐ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other
Liner type Thickness mil HDPE PVC Other
5
Alternative Method:
Submittal of an exception request is required Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval

Fencing: Subsection D of 19 15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)	
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, but the strange of a permanent residence, school, but the strange of the school of the strange of the school of the	hospital,
 Institution or church) ☐ Four foot height, four strands of barbed wire evenly spaced between one and four feet 	
Alternate Please specify	
7	
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks)	
☐ Screen ☐ Netting ☐ Other	
Monthly inspections (If netting or screening is not physically feasible)	
8	
Signs: Subsection C of 19 15 17 11 NMAC	
12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
☐ Signed in compliance with 19 15 3 103 NMAC	
9. Administrative Approvals and Exceptions:	
Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance	
Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s) Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau of the Santa Fe Env	office for
consideration of approval Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval	
10 Siting Criteria (regarding permitting): 19 15 17 10 NMAC	
Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accepmaterial are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appro-	
office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a	pproval.
Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dryi above-grade tanks associated with a closed-loop system.	ng pads or
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells	☐ Yes ☐ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa	☐ Yes ☐ No
lake (measured from the ordinary high-water mark)	
- Topographic map, Visual inspection (certification) of the proposed site	
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to temporary, emergency, or cavitation pits and below-grade tanks)	☐ Yes ☐ No
- Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application	☐ Yes ☐ No ☐ NA
 (Applies to permanent pits) Visual inspection (certification) of the proposed site, Aerial photo, Satellite image 	
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock	☐ Yes ☐ No
watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application NM Office of the State Engineer - iWATERS database search, Visual inspection (certification) of the proposed site	
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	☐ Yes ☐ No
adopted pursuant to NMSA 1978, Section 3-27-3, as amended.	
- Written confirmation or verification from the municipality; Written approval obtained from the municipality	
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine	
- Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area.	☐ Yes ☐ No
 Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources; USGS, NM Geological Society, Topographic map 	
Within a 100-year floodplain - FEMA map	☐ Yes ☐ No

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are
attached. ☐ Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15 17 9 NMAC ☐ Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15 17 9 NMAC ☐ Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC ☐ Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC ☐ Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC ☐ Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15 17.9 NMAC
and 19 15 17 13 NMAC Previously Approved Design (attach copy of design) API Number or Permit Number
12
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15 17.9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19 15 17 10 NMAC Design Plan - based upon the appropriate requirements of 19.15 17 11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17.9 NMAC
and 19 15 17 13 NMAC
Previously Approved Design (attach copy of design) API Number
Previously Approved Operating and Maintenance Plan API Number(Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
13 Permanent Pits Permit Application Checklist: Subsection B of 19 15 17 9 NMAC
Permanent Pits Permit Application Checklist: Subsection B of 19 15.17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15 17 9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19 15.17 11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19 15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19 15.17 11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15.17 11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15 17 12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19 15.17 11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15 17 9 NMAC and 19 15 17 13 NMAC
Proposed Closure: 19 15.17 13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative
Proposed Closure Method Waste Excavation and Removal Waste Removal (Closed-loop systems only)
 ☐ On-site Closure Method (Only for temporary pits and closed-loop systems) ☐ In-place Burial ☐ On-site Trench Burial
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19 15 17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. ☐ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC ☐ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15 17 13 NMAC ☐ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) ☐ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC ☐ Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17.13 NMAC ☐ Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Stee Instructions: Please indentify the facility or facilities for the disposal of liquids, drill		
facilities are required.	LD Properties	
•	posal Facility Permit Number	
•	posal Facility Permit Number	
Will any of the proposed closed-loop system operations and associated activities occur Yes (If yes, please provide the information below) No	on or in areas that will not be used for future serv	ice and operations?
Required for impacted areas which will not be used for future service and operations Soil Backfill and Cover Design Specifications based upon the appropriate requirements of Subsection I of Site Reclamation Plan - based upon the appropriate requirements of Subsection of Subsection Plan - based upon the appropriate requirements of Subsection of Subsection Plan - based upon the appropriate requirements of Subsection of Subsection Plan - based upon the appropriate requirements of Subsection of Subsection Plan - based upon the appropriate requirements of Subsection of Subsection Plan - based upon the appropriate requirements of Subsec	19 15 17 13 NMAC	2
Siting Criteria (regarding on-site closure methods only): 19 15 17 10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the clos provided below. Requests regarding changes to certain siting criteria may require acconsidered an exception which must be submitted to the Santa Fe Environmental Budemonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC for grant and the submitted to the santa Fe Environmental Budemonstrations of equivalency are required.	lministrative approval from the appropriate distr reau office for consideration of approval. Justij	ict office or may be
Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS; Data ob	tained from nearby wells	☐ Yes ☑ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS, Data ob	tained from nearby wells	☐ Yes ☐ No ☑ NA
Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS, Data ob	tained from nearby wells	☐ Yes ☑ No ☐ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significance (measured from the ordinary high-water mark). - Topographic map, Visual inspection (certification) of the proposed site	cant watercourse or lakebed, sınkhole, or playa	☐ Yes ☒ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in Visual inspection (certification) of the proposed site, Aerial photo, Satellite im		☐ Yes ☒ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that less that watering purposes, or within 1000 horizontal feet of any other fresh water well or spring - NM Office of the State Engineer - iWATERS database, Visual inspection (cert	g, in existence at the time of initial application.	☐ Yes ☒ No
Within incorporated municipal boundaries or within a defined municipal fresh water w adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval or		☐ Yes ☒ No
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual in	spection (certification) of the proposed site	☐ Yes ⊠ No
Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and	d Mineral Division	☐ Yes ⊠ No
Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Society, Topographic map	Mineral Resources; USGS; NM Geological	☐ Yes ☑ No
Within a 100-year floodplain - FEMA map		☐ Yes ⊠ No
On-Site Closure Plan Checklist: (19.15 17 13 NMAC) Instructions: Each of the for by a check mark in the box, that the documents are attached. Sting Criteria Compliance Demonstrations - based upon the appropriate requirements of Su Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) Protocols and Procedures - based upon the appropriate requirements of 19 15 17 Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Sul Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill Soil Cover Design - based upon the appropriate requirements of Subsection Ho Re-vegetation Plan - based upon the appropriate requirements of Subsection I of Site Reclamation Plan - based upon the appropriate requirements of Subsection	ements of 19 15.17.10 NMAC besection F of 19.15.17 13 NMAC priate requirements of 19 15.17 11 NMAC - based upon the appropriate requirements of 19 13 NMAC ements of Subsection F of 19.15.17.13 NMAC exercise or in case on-site closure standards cannot f 19 15 17.13 NMAC f 19 15 17.13 NMAC	15 17 11 NMAC

Operator Application Certification: I hereby certify that the information submitted with this application is	s true, accurate and complete to the be	st of my knowledge and belief
Name (Print)	Title:	
Signature	Date <u>.</u>	
e-mail address:	Telephone	
OCD Approval: Permit Application (including closure plan) OCD Representative Signature: Title:		Approval Date: 9/82/2011
Closure Report (required within 60 days of closure completion): Instructions: Operators are required to obtain an approved closure The closure report is required to be submitted to the division within section of the form until an approved closure plan has been obtained Closure Completion Date:10/11/10	plan prior to implementing any closu 60 days of the completion of the closu d and the closure activities have been	ure activities. Please do not complete this completed.
22. Closure Method: Waste Excavation and Removal On-Site Closure Method If different from approved plan, please explain	☐ Alternative Closure Method ☐	Waste Removal (Closed-loop systems only)
Closure Report Regarding Waste Removal Closure For Closed-lo Instructions: Please indentify the facility or facilities for where the two facilities were utilized. Disposal Facility Name. Disposal Facility Name Were the closed-loop system operations and associated activities perful Yes (If yes, please demonstrate compliance to the items below) Required for impacted areas which will not be used for future service Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation	Disposal Facility Permi Disposal Facility Permi Disposal Facility Permi Ormed on or in areas that will not be u	ngs were disposed. Use attachment if more than t Number t Number
Re-vegetation Application Rates and Seeding Technique 24 Closure Report Attachment Checklist: Instructions: Each of the mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location Latitude		
Operator Closure Certification: I hereby certify that the information and attachments submitted with the belief. I also certify that the closure complies with all applicable closure (Print). Vanessa Fields. Signature: e-mail address. vanessa fields@williams.com	ure requirements and conditions speci	

District İ
1625 N French Dr , Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Biazos Road, Aztec, NM 87410
District IV
1220 S St Francis Dr , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form


Form C-141

Revised October 10, 2003

Release Notification and Corrective Action

						OPERA:	ГOR		ıl Report		Final Report
Name of Company WILLIAMS PRODUCTION, LLC							Vanessa Fields				
Address P O. BOX 640, AZTEC, NM 87410					Telephone 1		4209				
Facility Name Cox Canyon # 200A				I	Facility Typ	e Well Site		<u></u>			
Surface Own	ner: Feder	ral		Mineral C	wner:			Lease N	lo.		
				LOCA	TION	OF RE	LEASE				
Unit Letter	Section	Township	Range	Feet from the	North/	South Line	Feet from the	East/West Line	County		
0	09	32N	11W								
	Latitude 36 994898 Longitude -107.99363W										
				NAT	URE	OF REL	EASE				
Type of Relea	ase No Rele	ease Occurred	:			Volume of	Release	Volume R			
Source of Re							lour of Occurrenc	e Date and	Hour of Disc	overy	
Was Immedia	ate Notice (Given?	Yes [] No ⊠ Not Re	equired	If YES, To	Whom?				
By Whom?			-			Date and I	lour				
Was a Water	course Read	ched?	Yes ⊠	l No		If YES, Vo	olume Impacting t	he Watercourse.			
If a Watercou		-		_							
	Describe Cause of Problem and Remedial Action Taken * No action required										
Describe Are	a Affected	and Cleanup a	Action Tal	ken *			·				
N/A											
regulations al public health should their cor the environ	I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations										
Signature Signature							OIL CON	SERVATION	DIVISIO	N	
Printed Name	e: Vanessa	ı Fıelds			1	Approved by District Supervisor					
Title EH&S	Coordinate	or				Approval Da	te	Expiration	Date.		
E-mail Addre	ess Vaness	sa fields@wıll	iams com		(Conditions o	f Approval		Attached		
Date 11-24-10 Phone. (505) 634-4209											

^{*} Attach Additional Sheets If Necessary

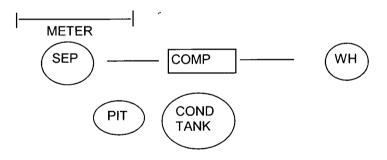



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client: WPX	Project #:	04108-0136
Sample ID: BGT Remova	al Date Reported:	10-13-10
Laboratory Number: 56166	Date Sampled:	10-11-10
Chain of Custody No: 10513	Date Received:	10-12-10
Sample Matrix: Soil	Date Extracted:	10-12-10
Preservative:	Date Analyzed:	10-13-10
Condition: Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Cox Cyn #200A

Analyst

Review

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

Client:	QA/QC		Project #:		N/A
Sample ID:	10-13-10 QA/QC	;	Date Reported:		10-13-10
Laboratory Number:	56145		Date Sampled:		N/A
Sample Matrix:	Methylene Chlorid	е	Date Received:		N/A
Preservative:	N/A		Date Analyzed:		10-13-10
Condition:	N/A		Analysis Requeste	d:	TPH
		8.250(M3742HW000000000000000000000000000000000000			
	. Il-CaliDate	IFCal) RF	©EGALIRE 9	6 Difference	Accept Range
Gasoline Range C5 - C10	10-13-10	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Diesel Range C10 - C28	10-13-10	9.9960E+002	1.0000E+003	0.04%	0 - 15%
CONTRACTOR OF THE SECOND SECON					•
Blank Conc. (mg/L mg/Kg).					
DISTURBATION (MIGHT: MG/VAIL)		Concentration	L L	etection Limit	
Gasoline Range C5 - C10		ND	<u> </u>	erections almit	l
		THE RESERVE THE PROPERTY OF THE PARTY OF THE	<u> </u>		İ
Gasoline Range C5 - C10 Diesel Range C10 - C28		ND		0.2	i
Gasoline Range C5 - C10	Sample	ND		0.2	
Gasoline Range C5 - C10 Diesel Range C10 - C28		ND ND		0.2 0.1	
Gasoline Range C5 - C10 Diesel Range C10 - C28 Duplicate Gonc, (mg/kg)	Sample :	ND ND Duplicates	% Difference, ∠A	0.2 0.1 scept@Range	
Gasoline Range C5 - C10 Diesel Range C10 - C28 Duplicate Gonc. (mg/kg) Gasoline Range C5 - C10 Diesel Range C10 - C28	Sample ND ND	ND ND Duplicates ND ND	%Difference Ax 0.0% 0.0%	0.2 0.1 cept Range 0 - 30%	
Gasoline Range C5 - C10 Diesel Range C10 - C28 Duplicate Gong (mg/kg) Gasoline Range C5 - C10	Sample ND	ND ND *Duplicate ND	‰⊡ifierence, ∠Av 0.0% 0.0%	0.2 0.1 scepte Range 0 - 30% 0 - 30%	Accept Range
Gasoline Range C5 - C10 Diesel Range C10 - C28 Duplicate Gonc. (mg/kg) Gasoline Range C5 - C10 Diesel Range C10 - C28	Sample ND ND	ND ND Duplicates ND ND	‰⊡ifierence, ∠Av 0.0% 0.0%	0.2 0.1 scepte Range 0 - 30% 0 - 30%	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 56145, 56156-56158, 56120-56121, 56166-56168

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT Removal	Date Reported:	10-13-10
Laboratory Number:	56166	Date Sampled:	10 - 11-10
Chain of Custody:	10513	Date Received:	10-12-10
Sample Matrix:	Soil	Date Analyzed:	10-13-10
Preservative:		Date Extracted:	10-12-10
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Danmana	ND.		
Benzene	ND	0.9	
Toluene	ND	1.0	
Ethylbenzene	ND	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	ND	0.9	
Total BTEX	ND		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	98.0 %
	1,4-difluorobenzene	99.3 %
	Bromochlorobenzene	97.9 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Cox Cyn #200A

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A	Project #:	N/A
Sample ID:	1013BBLK QA/QC	Date Reported:	10-13-10
Laboratory Number:	56156	Date Sampled:	N/A
Sample Matrix:	Soil	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	10-13-10
Condition:	N/A	Analysis:	BTEX
		Dilution	10

Gallbration and Detection Limits (ug/L)	Licaling:	C-CallRF: Accept Rang	%©lff. j6(0 = 45%	Blank Øone	Detegtar 2 Li m it
Benzene	4.7878E+005	4.7974E+005	0.2%	ND	0.1
Toluene	5.8244E+005	5.8361E+005	0.2%	ND	0.1
Ethylbenzene	5.3540E+005	5.3648E+005	0.2%	ND	0.1
p,m-Xylene	1.2801E+006	1.2826E+006	0.2%	ND	0.1
o-Xylene	4.8462E+005	4.8559E+005	0.2%	ND	0.1

Duplicate Conc. (ug/Kg)	Sample Du	plicate	%Diff.	/Accept/Range	@DetectaLimit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	ND	ND	0.0%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	4.2	4.1	2.4%	0 - 30%	1.2
o-Xylene	3.5	3.2	8.6%	0 - 30%	0.9

Spike:Conc. (ug/kg)	: Sample, Amo	ount/Spiked Spi	ked Sample %	Recovery	AcceptiRange
Benzene	ND	500	503	101%	39 - 150
Toluene	ND	500	503	101%	46 - 148
Ethylbenzene	ND	500	514	103%	32 - 160
p,m-Xylene	4.2	1000	1,020	102%	46 - 148
o-Xylene	3.5	500	512	102%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References⁻

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using

Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 56156-56158, 56166-56168

Analyst Review



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client: **WPX** Project #: 04108-0136 Sample ID: **BGT Removal** Date Reported: 10-13-10 Laboratory Number: 56166 Date Sampled: 10-11-10 Chain of Custody No: 10513 Date Received: 10-12-10 Sample Matrix: Soil Date Extracted: 10-13-10 Preservative: Date Analyzed: 10-13-10 Condition: Intact Analysis Needed: TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

22.3

14.5

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Cox Cyn #200A

Analyst



EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

10-13-10

Laboratory Number:

10-13-TPH.QA/QC 54241

Date Sampled:

N/A

TPH

Sample Matrix:

Freon-113

Date Analyzed:

10-13-10

Preservative: Condition:

N/A N/A Date Extracted: Analysis Needed: 10-13-10

Calibration

I-Cal Date

C-Cal Date

I-Cal RF:

C-Cal RF:

% Difference

Accept. Range

10-05-10

10-13-10

1,640

1,670

1.8%

+/- 10%

Blank Conc. (mg/Kg)

TPH

Concentration ND

Detection Limit 14.5

Duplicate Conc. (mg/Kg)

TPH

Sample 22.3

Duplicate 23.7

% Difference 6.3%

Accept. Range +/- 30%

Spike Conc. (mg/Kg)

TPH

Sample 22.3

Spike Added Spike Result 2,000

1,710

% Recovery: 84.6%

Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 56166-56170, 56175

Analyst



Chloride

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT Removal	Date Reported:	10-13-10
Lab ID#:	56166	Date Sampled:	10-11-10
Sample Matrix:	Soil	Date Received:	10-12-10
Preservative:		Date Analyzed:	10-13-10
Condition:	Intact	Chain of Custody:	10513

Parameter

Concentration (mg/Kg)

Total Chloride

5

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:


Cox Cyn #200A


Analyst

CHAIN OF CUSTODY RECORD

10513

Client:			Project Name /	Location						ANALYSIS / PARAMETERS														
MPX	·		Cox Cyx Sampler Name: W.,		2004				_	/ -	×				r			-	×	,				
Client Address:			Sampler Name:	_					1	TPH (Method 8015)	BTEX (Method 8021)	8										'		
MYKELA	<u> </u>		<u>kl.</u> :	5 ₄₄	DEC_					80	8	VOC (Method 8260)	<u>s</u>	_		Д		İ	1					
Client Phone No.:] 1	Client No.:							poq	욡	bod	/leta	ig		ΉL		E	ш				00	ıtacı
			04108	-0137	b					Met	Š	₩	RCRA 8 Metals	Cation / Anion		TCLP with H/P		TPH (418.1)	CHLORIDE				Sample Cool	Sample Intact
Sample No./	Sample		Lab No.		ample	No./Volume of			tive) H	EX	စ္က	¥	tioi.	_	Ϋ́	PAH	 	2				tmp	du
Identification	Date	Time		 	/latrix	Ontainers	HgCl	HCt	4	<u> </u>	В	>	Œ	ర	RCI	77	P.	F	5	 				
BGT ROWN	11/10	1201	56166	Solid	Sludge Aqueous	人			~	~	U							0	-				N	4
	_			Soil Solid	Sludge Aqueous																			
				Soil Solid	Sludge Aqueous																			
				Soil Solid	Sludge Aqueous																			
				Soil Solid	Sludge				\dashv										-					
				Soft	Aqueous Sludge				\dashv															
				Solid Soil	Aqueous Sludge				-															
				Solid Soil	Aqueous Sludge			\dashv	+		_								-					
				Solid	Aqueous													ļ	<u> </u>					
				Soil Solid	Sludge Aqueous																			
	~			Soil Solid	Sludge Aqueous																			
Relinquished by (Signs	(dre)	<u> </u>			Date	Time	F	lece	ivec	l by: (Signa	ture)			•							ate		ne
Relinquished by: (Signa	ture)		<u>oe</u>		112/10	1405	R	ece	<i>WW</i>	by: (Signa	ature)									10.1	2.10	14.	05
Relinquished by: (Signa	ture)						R	lece	ivec	by: (Signa	ture)												
Rust					San Farmin		aly	rtic	al	Lab	ога	itory	•			····					I		L	

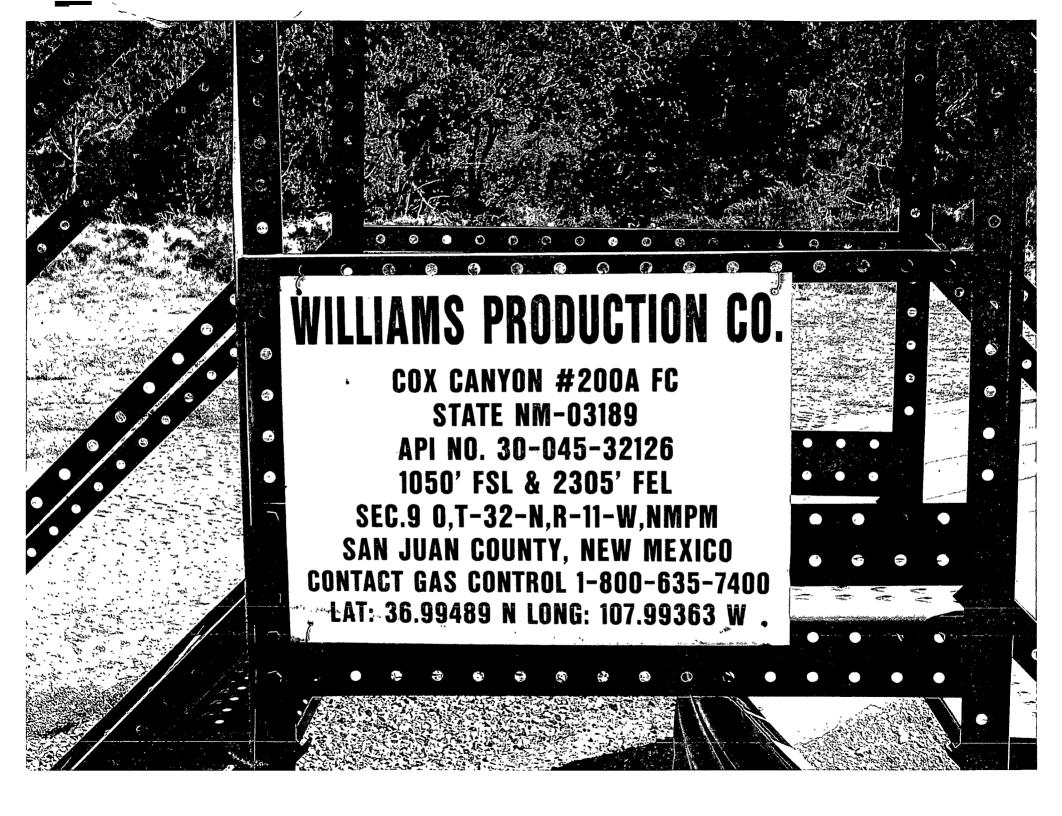

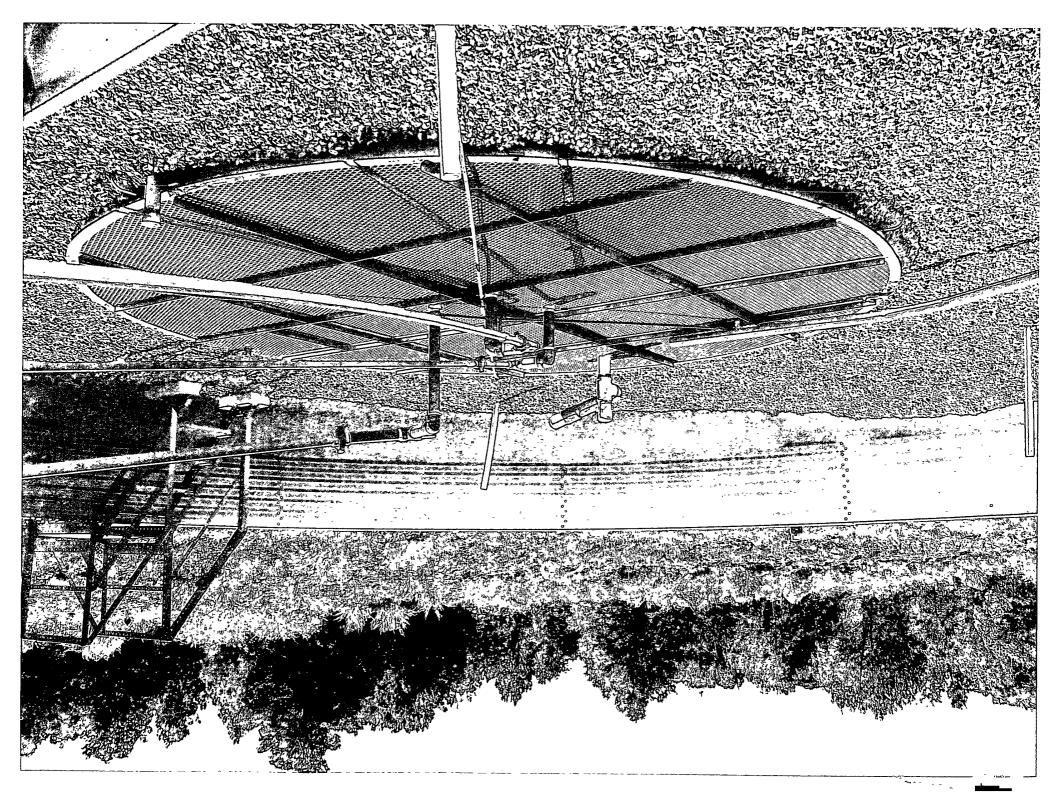

Fields, Vanessa

From:

Fields, Vanessa

Sent:

Friday, October 08, 2010 2 26 PM

To:

'Powell, Brandon, EMNRD'

Cc: Subject: Snyder, Walden; Lucero, Christopher, Lane, Myke; Meador, Tasha

Notice of Pit Closures (Cox Canyon 023, 025, 200A)

Brandon⁻ Williams tentatively plans to initiate closure of the following BGT later next week, depending on weather and available resources

Location	API#	Formation	Sec	Twn:	RG:	
Cox Canyon # 023	30-04522537	BLANCO PC	C17	32N	11W	
Cox Canyon # 200A	30-04532126	BASIN FTC	09	32N	11W	?
Cox Canyon # 025	30-04522572	BLANCO PC	О9	32N	11 W	

Please contact me if there are any problems or you request additional information. Thanks for your consideration

Thank You, Vanessa

Vanessa Fields

EH&S Coordinator
Williams Exploration and Production
721 S. Main Aztec, NM 87410

office: 505-634-4200 fax: 505-634-4205

vanessa.fields@williams.com

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Fiberglass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3 Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank
Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:

- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed, of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs

Table 1: Clearle Cilicita for Bella						
Components	Testing Methods 4.1	Closure timits (mg/kg)				
Benzene	EPA SW-846 Method 8021B or 8260B	0.2				
BTEX	EPA SW-846 Method 8021B or 8260B	50				
TPH	EPA SW-846 Method 8015 M(Full Range)*	100				
	or Method 418.1					
Chlorides	EPA SW-846 Method 300.1	250				

^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-appróved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1:	Closure	Criteria	for	RGTs.

		<u> </u>
Components	Testing/Methods	Closvie Limits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	~ 0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

⁽¹⁾ Method modified for solid waste.

- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports
- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

 $^{^{(2)}}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.



Exploration & Funduction FC Box 640 Aztro NM 81137 505/624 4719 505/634 4714 fox

March 10, 2009

Mr Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure

Rule 19 15 17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co. LLC.

Pursuant to Rule 19 15 17 13 NMAC this correspondence is to notify the Bureau of Land Management. Farmington Field Office of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County. New Mexico Closure will follow the plan included with this correspondence

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted

Holly C Perkins EH&S Specialist

Encl Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets Below-Grade Tank Closure Plai

cc Environmental Fire

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below Grade Tank Removal Closure Flan

the accordance with Rule 19.15.17.13.NMAC, the following plan describes the general closure requirements of below grade tanks (BC-1) on Williams Fraduction Co. LLC. (WEX) to cations in the Sandran Basin of New Mexico. This is WEX's standard closure procedure for all BCBs regulated under Fulle 19.15.17.NMAC, and operated by WEX. For those closures which do not conform to this standard closure plan a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Luisoant to 19.15.17.13 (A) NMAC. WEX will initiate closure of any BG3 should any one of these conditions occur.

- The Division requires closure because of imminent danger to tresh water public health or the environment.
- The integrity of the BGI fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)[5] NMAC.
- WEX chooses to take the BGI out of service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGI's operation.
- BC-Is installed prior to Tune 16, 2008 that do not meet the requirements under 19.15.17.11.1(C).
 BMAC and WPX chooses not to retrofit or apprade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- First to initiating any BGT Closure except in the case of an emergency WPX will review a County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to close the PGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2 Notice of Closure will be given to the Azter District office hetween 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following.
 - a Operators Name (WEX)
 - b. Well Name and All Humber
 - Locotion (USTR)
- All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks temporary frac tank....). The well will be temporarily shut in until the rerouting is completed.
- All produced water will be removed from the BCI following discharge pipe rerouting Froduced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGI site. Rosa Unit SWD #1 (Order SWD-916 API 30 039 27055). Rosa Unit #94 (Order SWD 3RP-1003 0 API 30 039 23035). Jillson fed. SWD #001 (Order R10168/R10168A: AFI 30 039 25465). Middle Mesa SWD #001 (Order SWD 350 0 AFI 30 045 27004). and/or Basin Disposal (Permit. NM 01-0005).

solids and studges will be shoveled and torival trainers out for disposal at Envirotech (Permit Hamber 14M ()). (16):1

Who will be found the disposal from MACCD to also be to cacle fields. One could be BCT and provide documentation of the also estion of the figure to closure report. Size and ends will be recycled or reused as approved to the fivision. Final glass tanks will be either to also be somether than the also will be the street and EA decored to disposor or some waste. The materials will

be cleaned without solk or contaminated moterial for disposal as solid waste. Fill-eralges tanks and line i materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional randfill operated by Waste Management under IVMED Fermit SWM 052426.

- Any equipment associated with the RGI that is no longer required for some other purpose following the closure will be removed from the location.
- Ecllowing removal of the tank and any liner material a five point composite sample will be taken of the excavation and tested per 19.15.17.13(F)(4) NMAC as identified in Table 1. Crab samples will be collected from any area that is wet discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Fami C.141.

Table 1 Closure Criteria for BGTs

1	Components	Testing Methods	Closure Limits (mg/Kg)	!
1	Benzene	EPA SW 846 Method 8021B or 8260B	() 2	ĺ
1	BILX	FPA SW-846 Method 8021B or 8260B	50	ţ
1	16.14	Efra SW 846 Method 418 1:1	100	ļ
1	Chlondes	[PA SW 846 Method 300 11]	250/0	

Method modified for solid waste

If that provide concentration of attendes greater transitionia, to their higher concentration with expensional concentration of attendes greater transitionia.

- If the Division and/or WEX determine there is a release. WEX will comply with 19-15-3-116 LIMAC and 19-15-1-19 NMAC.
- Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one-foot of top soil or background thickness whichever is greater and to existing grade. The suiface will be recontoired to match the native grade and prevent ponding.
- for those portions of the former pit are a no longer required for production activities. Whi will seed the disturbed areas the first growing scason after the pit is covered. Seeding will be accomplished via dilling on the contour whenever practical or by other Division approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover fun impacted) consisting of at least three native plant species including at least one grass but not including navious weeds, and maintained that cover through two successive growing scasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note if a surface owner agreement requires reseeding or other surface restantion that ac not meet re-vegetarium requirements of 15-15-17-13 FNMAC then WEA will submit the recposed alternative with written documentation that the surface covincials to the alternative for Division approval.
- For those portions of the former pit area required for production activities reseeding will be done at well abandonment, and following the procedure noted above

Closure Report

All closure activities will include proper accommentation and will be submitted to QCD within 60 days of the BCT closure on a Crosure Report using Division Form C. 144. The Report will include the following:

- Frost of diegote the control of the co
- · fencial forms & Conference
- · Sue Lacie an entre contrare
- · AVOIGHT HOUSE HE LIES

- · COMMINGROUS CONTROL FRANCE CORECT
- · Lachtron for his wife by one permit an meile
- · /pr he check the forest technical
- Enclode Commitment of Ferramotor

WELLS W/FEDERAL SURF MGT	API	FM1	SEC	TWN		PIT TYPE	
COX CANYON UNIT #001	3004511397	PLANCO MV	16N	32N	11W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
COX CANYON UNII #001A	3004522086	PLANCO MV	160	3211	11W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
COX CANYON UNIT #001B	3004530791	PLANCO MV	161	32N	1 1 VV	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	16F	3214	1 1 VV		DBL WALL STEEL FIRERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #003	3004511495	BLANCO MV	91	32N	1 1 V V		HDPE SECONDARY LINER
COX CANYON UNIT #003A	3004522088	BLANCO MV	9F)	32N	1 1 V V	BGI	DBI WALL STEEL
COX CANYON UNIT #003B	3004530871	BLANCO MV	9J	32N	1 1 W	BG1	DBI WALL STEEL
COX CANYON UNIT #004	3004511368	BLANCO MV	21A	32N	11W	BGT	DBI WALL STEFI
COX CANYON UNIT #004A	3004522093	BI ANCO MV	21F	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #004B	3004532186	BLANCO MV	211	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #005	3004511326	BLANCO MV	21K	32N	1 1 Vv	BGI	DBI WALL STEFI
COX CANYON UNIT #005A	3004522094	BLANCO MV BASIN DK /	21D	32N	1 1 VV	BGT	DBL WALL STEEL
COX CANYON UNIT #005B	3004532142	BLANCO MV	2114	32N	11W	BGT	DBI WALL STEEL
COY CANYON UNIT #005C	3004533493	BLANCO MV	21F	3211	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #006	3004511463	BLANCO MV	16A	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #006A	3004522095	BLANCO MV	161	32N	11W	BGT	OBL WALL STEEL
COX CANYON UNIT #006B	3004£32693	BLANCO MV	16B	32N	11W	BGT	DBL WALL STEFL
COX CANYON UNIT #006C	3004532733	BLANCO MV	16()	32N	11W	HG1 I	OBI WALL STEEL
COX CANYON UNIT #007	3004511455	PL ANCO MA	17G	32N	11W	t Gt , I	OBL WALL STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	32N	11W	BG1 (BI WALL STEFL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	32N	11W		DBL WALL STEEL TBERGLASS TANK WBANDED 20-mil
COX CAN) ON UNIT #008	3004511492	BLANCO MV	81	32N	11W		IDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	BLANCO MV	1711	32N	11W		DBL WALL STEEL IBERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #008B	3004532080	BLANCO MV	8P	32N	11W		IDPE SECONDARY LINER IBERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #008C COX CANYON UNIT #009A	3004531187	BLANCO MV	1 <i>7F'</i>	32N	11W	BGT F	IDPE SECONDARY LINER IBERGLASS TANK W/BANDED 20 mil
COM COX CANYON UNIT #009B	3004522092	BLANCO MV BASIN DK /	20D	32N	11W		IDPE SECONDARY LINER
СОМ	3004533926	BLANCO MV BASIN DK /	20B	32N	11W	BG1 L	DBL WALL STEEL
COX CANYON UNIT #009C	3003933851	BLANCO MV	20F	3211	11W		BL WALL STEEL IBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #013	3004521489	BLANCO PC	20A	32N	11W		IDPE SECONDARY LINER

WELLS W/FEDERAL							
SURF MGT	API	FMT	SEC	NWT	RNG	PIT TYPE	CONSTRUCTION MATERIAL
COX CANYON UNIT #023							FIBERGLASS TANK W/BANDED 20 mil
COM	3004522537	BLANCO PC	17C	32N	111/1	BGI	HDPF SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #025	3004522572	BLANCOPC	90	32N	1111/	BG1	HDPE SECONDARY LINER
COS CALIVARIANTA CON	10.41.0 -0.50	5 \ A 5 \ H \ L 5 \ L 7		07.11	* * * * * * * * * * * * * * * * * * * *	11413	FIBERGLASS TANK WBANDED 20 mil
COX CANYON UNIT #200	3004527878	BASINTIC	91	32N	11W	BG1	HOPE SECONDARY LINER
COX-CANYON-UNIT_#200A	2004520106	PLACINIC 1	- G()	- acai	1.1167		FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
CONTOUNDED THE SHOW	2004935 (SØ _	DASTALIC	9()	3211	1 1 VV	BGI	FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #203	3004527872	BASINETO	17A	32N	111/	BGT	HDPE SECONDARY LINER
SX CARTEST CART WEEK	3004321012	DAOMETIC	1175	SZIV	1100	1 6/0	THE CONTRACTOR
MADDOX #001	3004511487	BLANCO MV	10N	32N	1 1 VV	BG1	DBI WALL STEEL
	0004011401	DI MITOCO III	1 (7) 4	3211	1 1 7 7	001	L'DI WALL OTE EL
MADDOX #001A	3004523539	BLANCO MV	100	32N	11W	BGT	DBE WALL STEEL
NM 32 11 #001	3004511309	BLANCO MV	200	32N	11VV	BGT	DBL WALL STEEL
		BASIN DK /					
NM 32-11 #001B COM	3004532024	BLANCO MV	20J	32N	11W	BGI	DBL WALL STEEL
		BASIN DK /					
NM 32 11 #001C COM	3004532804	BLANCO MV	201	3211	11W	BG1	DBI WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
NM 32 11 #002 COM	3004511380	BLANCO MV	19A	32N	1 I W	BG1	HDPE SECONDARY LINER
NM 32 11 #002A COM	3004529017	BLANCO MV	190	3214	111/	BGT	DBL WALL STEEL
NHA 30 44 40000 COM	10 15 MU 20	D) AND (C) AND	440	2011		E 457	TATAL ARIAN A TATE FOR
NM 32 11 #0028 COM	3004532670	BLANCO MV	191	3211	111/	BG1	DBI WALL STEFI
 NM 32-11 #002C COM	3004533077	BLANCO MV	19G	32N	11VV	BG1	DBI WALL STEFI
111102 11 40020 0000	3004333077	DI ANCO NIV	13767	32 IV	HVV	ВСТ	DBL WALL STEET
ROSA UNIT #001 SWD	3003927055	SWD	231	31N	06W	BGI	DBL WALL STEEL
	5000027000	BASIN DK /	2 (7)	C 114	(1000	DGT	FIBERGLASS TANK w/bANDED 20 mil
ROSA UNIT #001E	3003925411	BLANCO MV	11P	31N	06₩	BGI	HDPE SECONDARY LINER
1		BLANCO MV /		.,			
ROSA UNIT #005A	3003925407	ROSA PC	26F	31N	06W	BG1	DBI WALL STEEL
		BASIN DK /					
ROSA UNIT #005B	3003926927	BLANCO MV	26B	3111	06W	BGI	DBI WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #005Y	3003926078	BI ANCO MV	26H	3111	06VV	BGT	HDPE SECONDARY LINER
		BLANCO MV /					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	OGW	BGT	HDPE SECONDARY LINER
Picock LIABT MOOV		BLANCO MV /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #006A	2002025 426	BLANCO MV /	OCE	1441	07.184	()()]	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
NOSA DINTI HUDOA	3003925430	ROSA PC	260	3111	06W	BG1	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008C	3003926944	BLANCO MV	26N	31N	06W	BGT	HDPE SECONDARY LINER
toor our roote	3003320344	DI ANGO WY	2018	DIIN	OOVV	DOT	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #009	3003907975	BLANCO MV	11K	31N	06W	BGT	HDPE SECONDARY LINER
	0000001010	BASIN DK /	, , , ,	3114	0014	DOT	THE COURSE WAY THE TOTAL PROPERTY OF THE PROPE
ROSA UNIT #009A	3003925584	BI ANCO MV	11C	31N	06W	BGT	DBI WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #009B	3003927042	BI ANCO MV	11 E	31N	06W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
OSA UNIT #010B	3003926556	BI ANCO MV	13N	31N	06VV	BG1	HDPE SECONDARY LINER
1							
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	06W	BGT	DBL WALL STEEL
							}
OSA UNIT #0102	3003926556	BLANCO MV	13N	31N	06W	BGT	DBL WALL STEEL

WELLS W/FEDERAL	** *** ** *						and the second second properties of the second seco
SURF MGT	API	FM1	SEC	TWN	RNG	PITTY	PE CONSTRUCTION MATERIAL
		BLANCO MV /					
ROSA UNIT #012A	3003925900	ROSA PC	15J	.×11N	OUV	EGI	
		BASIN DK /					FIRERGLASS TANK W/BANDED 20 mil
ROSA UNIT #012B	3003926555	BLANCO MV	15F	31N	(16VV	BG1	HDPE SECONDARY LINEP
ROSA UNIT #012C	3003929486	BLANCO MV	15A	31N	0644	رء ا	SINGLE WALL STEEL
						-	LIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #013	3003907936	BLANCO MV	31G	311/	05W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #013A	3003926298	BLANCO MV	31F	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #013B COM	10020200 14	BASIN DK /	016		()()()	12/21	DEL MARIE CALET
NOSA ORT HOTSE CORT	3003929834	BLANCO MV	31A	31N	05Vv	PG1	DBL WALL STEEL
ROSA UNIT #014	2002007060	DI ANICO MA	400	041	07.144	001	FIBERGLASS TANK w/BANDF() 20 mil
NOSA CIVIT HOTA	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPF SECONDARY LINER
RUSA UNIT #014A	2002006060	DLANK CLEAK	oot	51 4 K I	n. N.	E-O.1	HBERGLASS TANK W/BANDED 20 mil
THOUS ON THOUSAN	3003926280	BLANCO MV BASIN DK /	23F	31N	0674	BG1	HDPE SECONDARY LINER
ROSA UNIT #014C	2002020132	BLANCO MV	0.11.1	0.481	0.0141	542.7	-
NOSA ONIT #014C	3003930132	DI ANCO MV	2311	31N	06W	BGI	DBL WALL STEEL
ROSA UNIT #015	3003003040	DI ANICOLANI	0011	0.481	416.161	001	FIBERGLASS TANK w/BANDED 20 mil
ROSA ONIT WOTS	3003907946	BI ANCO MV	2911	31N	05W	BGT	
ROSA UNIT #016	204200204	DI ANGOLIA	4.481			50.	FIBERGLASS TANK w/BANDFD 20 mil
ROSA DIVIT #016	3003907963	BLANCO MV	14N	3111	0644	BGI	HDPE SECONDARY LINER
ROSA UNIT #016A	100.000 1.000	For a black bab.					LIBERGLASS TANK W/BANDED 20-mil
ROSA CINIT #016A	3003925496	BLANCO MV	14C	31N	OGVV	BGT	HOPE SECONDARY LINER
ROSA UNIT #016B	0.04.04.004.40						FIBERGLASS TANK W/BANDED 20 mil
ROSA CIVIT POTOR	3003926218	BLANCO MV	141/1	3110	0674	BGT	HOPE SECONDARY LINER
DOCA LINET HOLES							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #017A	3003926272	BLANCO MV	200	RIN	05W	BGT	HDPE SECONDARY LINER
DODA INUE WOATS		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #017B	3003926971	BI ANCO MV	20J	31N	05W	BGT	HDPE SECONDARY LINER
DOCA DAUG HOLD		BLANCO MV /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #018	3003907960	ROSA PC	22H	31N	06W	BGT	HDPE SECONDARY LINER
B004 1444 4644		BLANCO MV /					
ROSA UNIT #018A	3003925436	ROSA PC	55£,	31N	06VV	SGT	DBL WALL STEEL
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W	BG1	DBI WALL STEEL
	0000027002	DE ANCOMIV	220	311N	Otty	DOT	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06W	HG1	HDPE SECONDARY LINER
	Weden Soc	DI AIVOO MV	2411	3114	OOVV	001	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #019B	3003926560	BLANCO MV	241	31N	06W	BGI	HDPE SECONDARY LINER
	WW. COL 0000	D1711100 1111	2-71	(1)1	COOV	1701	THE SECOND WITH THE T
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBL WALL STEEL
						20,	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	31N	06W	BG1	HDPE SECONDARY LINER
						.,,	FIBERGLASS TANK W/BANDED 20 mill
ROSA UNIT #020A	3003925495	BLANCO MV	140	31N	06W	BGT	HDPE SECONDARY LINER
				0			
ROSA UNIT #020B	3003926220	BLANCO MV	14A	31N	06W	BGT	DBL WALL STEEL
	are a comparate of 1866 Bit 31		, .	~ / I · •	*****		FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W	BGT	HDPE SECONDARY LINER
	ON COULDER !		.40	V 114	(/() ¥ ¥	001	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #021A	3003926121	BLANCO MV	23C	31N	06W	BGT	HDPE SECONDARY LINER
=: · · · · · · · · · · · · · · · · · · ·	OVICUALUIZI	DE ANTOO INV	د بال	3114	OUVV	וטט	TIES E GEOGRAPHIC THERE
ROSA UNIT #021B	3003926554	BLANCO MV	23K	31N	06W	BG1	DBL WALL STEEL
	((////////////////////////////////////	DETAILOO MIV	C (11)	V 118	JUVV	וטטו	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #02!	3003907971	BLANCO MV	18A	31N	05VV	BG1	HDPE SECONDARY LINER
					0011		,,p. c ocoonprint chick

.

WELLS WIFEDERAL			-				
SURF MGT	API	FMT	SEC	TWN	RNG	PITTYP	
COCC LULIE AND A							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #027A	3003926390	BLANCO MV	18C	3111	0544	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #023	2002002030	EN ABIC () BAY	ants	2111	(16.17.)	001	HOPE SECONDARY LINER
ROSA ONT FUZS	3003907942	BLANCO MV	29M	311	05W	BGI	LIBERGLASS TANK W/BANDED 20 mil
 RGSA UNIT #023B	3003926553	BLANCO MV	29[31N	W-30	BG1	HDPE SECONDARY LINER
	CATOCATE CATACA	BASIN DK /	201.		OCT	1.431	LIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023C	3003927609	BLANCO MV	29(31N	05W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #024	3003907933	BLANCO MV	32M	31N	05W	BGT	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #024A	3003925568	BLANCO MV	32 £	31N	05Vv	SGI	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #024B	3003926630	BLANCO MV	32N	31N	05W	BG1	HDPE SECONDARY LINER
DOCA LIBERT 400A		BASIN DK /			05144	0.00	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #0240	3003926968	BLANCO MV BASIN DK /	32C	31N	05VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #026A	3003925580	BLANCO MV	32O	31N	05W	SGI	DBL WALL STEEL
	00000 20000	BITHIOG HIV	020	() 114	OOVY	001	THE WALL CIDES
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W	SG1	DBI WALL STEEL
							FIBERGLASS TANK WIBANDED 20-mil
ROSA UNIT #029	3004511136	BLANCO MV	32H	12N	0674	BGT	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20 mil
POSA UNIT #029B	3004530709	BLANCO MV	32B	75/1	0617	BGT	HDPE SECONDARY LINER
DOOL THIL MOONE		BASIN DK /					55 AMARIA (STREET
ROSA UNIT #029M	3004529584	BLANCO MV	321	3211	(IPA)	BG1	DBL WALL STEFL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #030 COM	3003925570	BASIN DK / BLANCO MV	12()	31N	06VV	BGT	HDPE SECONDARY LINER
	3003923370	DEANOO WV	120	SIN	OOVV	D() [FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #030A	3003926068	BLANCO MV	121/1	31N	06W	BGT	HDPE SECONDARY LINER
						., .	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #030B	3003926601	BLANCO MV	12N	3110	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #030C	3003929842	BLANCO MV	120	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #031							FIBERGLASS TANK w/BANDED 20 mil
RUSA UNIT #U31	3003926279	BLANCO MV	17C	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #031A	3003926346	BLANCO MV	171	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20 mill HDPE SEGONDARY LINER
NOON OITH WOOM	3000820040	BASIN DK /	171	SHV	(1,144	DG1	FIBERGLASS TANK wBANDED 20 mil
ROSA UNIT #031F	3003926579	BLANCO MV	17()	31N	05W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #031C	3003926578	BLANCO MV	17N	3111	05W	BGT	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #032	3003925389	ROSA PC	2111	31N	06W	BG1	DBL WALL STEEL
A 0 C 0 H THALL A 2 () C	0000005447	BLANCO MV /	15.45	544	414147	F) (1) 1	DOLLMAN CTET
ROSA UNIT #032A	3003925417	ROSA PC	21F	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #032B	3003926771	BASIN DK / BLANCO MV	21G	31N	06W	BGT	HDPE SECONDARY LINER
TOUR OTHER PROOFE	7003920771	BASIN DK /	216	2114	UOVV	PG1	[IBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #032C	3003927240	BLANCO MV	21F	31N	06//	BGT	HDPE SECONDARY LINER
	COUNTY IE TO		2	5,11		., .,	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034	3003907984	BLANCO MV	36B	3211	O6W	BG1	HDPE SECONDARY LINER
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W	BGI	DBL WALL STEEL
ROSA UNIT #034/	3003926119	BLANCO MV	361	32N	06W	SGI	DBI WALL STEEL
SASC A THUL MAG O	000000000	DI MICO TO	***	1.218.1	Z1014:	D.O.;	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034E	3003926629	BLANCO MV	36J	32N	06W	BGI	HDPE SECONDARY LINER

,

WELLS W/FEDERAL		,					
SURF MG1	API	<u>FMT</u>	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #0340	3003926969	ELANCO MV	36H	1211	()(·W	£4G1	HUPE SECONDARY LINER
ROSA UNIT #035X	3004510996	F1 ANCO MV	5K	3114	()(5\27	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #036	3003907977	ELVIVO WA	1111	1111	(iCVv	FG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #036C	3003930182	BLANCO MV	11(7	3111	(i6W	HGT	HDPF SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #041	3003907981	BLANCO MV BASIN DK /	5K	31N	05W	HG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #041B	3003927014	BLANCO MV	99	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #044	3003925873	BI ANCO MV	35K	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	()(·W	SGI	SINGLE WALL STEFL
ROSA UNIT #()44A	3003926161	BLANCO MV	35E	32N	OGW	SGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06W	BGT	HDPF SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #045	3003923013	BLANCO MV BASIN DK /	Me	31N	05W	BG1	HDPE SECONDARY LINER LIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #046A	3003926986	BLANCO MV	80	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDFD 20 mil
ROSA UNIT #053	3003920293	BASIN DK	8B	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #055	3003920923	BASIN DK	341	31N	()5VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #059 DK	3003923270	BASIN DK	25N	31N	()6W	BGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06Vv	5GT	HDPE SECONDARY LINER LIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	06Vv	BG1	HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05Vv	BGT	DBI WALL STEEL
ROSA UNIT #064	3003921703	BASIN DK BASIN DK /	29A	31N	05W	561	OBI WALL STEEL
ROSA UNIT #064M	3003925563	BLANCO MV	29F	31N	05W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	05W		HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #066	3003921758	BASIN DK BASIN DK /	13L	31N	06Vv		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #066M	3003925747	BI ANCO MV	13F	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDE() 2() mil
ROSA UNIT #072	3003925509	BLANCO MV	61	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #072A	3003925795	BI ANCO MV	6K	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #075	3004529895	BLANCO MV	10l	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #075A	3004529854	BLANCO MV DK/UNDES	4()	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #07	3003922538	GL/BLANCO	33L	31N	05W		HDPE SECONDARY LINER

•

.

WELLS W/FEDERAL							
SURF MGT	API	FM1 BASIN DK /	SEC	TWN	RNG	PIT TYPI	E CONSTRUCTION MATERIAL
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK /	22K	31N	06W	BGT	DBI WALL STELL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV	22K	31N	06W	SG1	DBI WALL STEFT
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	22F	3114	06W	BG1	DBI WALL STEEL
ROSA UNIT #079B	3003926920	BLANCO MV	22C	3117	06W	BG1	DBI WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3111	05W	BGT	DBL WALL STEFT FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #080	3003922537	BLANCO MV	8K	31N	05Vv	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #080A	3003926413	BLANCO MV	8f	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BGT	HDPL SECONDARY LINER LIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	05VV	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085A	3003926314	BLANCO MV	20C	31N	05W	B(-)	HOPE SECONDARY LINER
ROSA UNIT #085P	3003930130	BLANCO MV	20D	4116	05W	BGI	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GL BLANCO MV /	12W	31N	()4W	SGT	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	ROSA PC	86	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #069	3003922782	BLANCO MV	34A	32N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w BANDED 20 mil
ROSA UNIT #089A	3003925512	BI ANCO MV	34()	32N	06W	HGT	HDPE SECONDARY LINER
ROSA UNIT #089B	3003926851	BLANCO MV	341	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	346	32N	0674	SG1	SINGLE WALL STELL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #090 COM	3004525370	BLANCO MV	ა3G	32N	06//	BGT	HDPE SECONDARY LINER
ROSA UNIT #090A COM	3004529259	BI ANCO MV	33G	3514	0617	BG1	DBL WALL STEEL FIBERGLASS TANK wBANDED 20 mil
ROSA UNIT #091	3003922780	BI ANCO MV	3511	32N	06W	BGT	HDPE SECONDARY LINER
KOSA UNIT #(191A	3003925790	BLANCO MV	35O	32N	06W	SG1	DBI WALL STEFL
ROSA UNIT #091B	3003926684	BI ANCO MV	35P	32N	06W	BGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #(1910	3003926991	BI ANCO MV	35G	32N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
Reo# TINU AZOS	3003923265	BASIN DK / GL BASIN DK /	231	31N	06W	BG1	HDPE SECONDARY LINER
OSA UNIT #100B	3003929547	BI ANCO MV	21()	31N	06W	BG1	LIBE WALL STEEL
:OSA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	06W	BG1	DRI MAII SIEEI
OSA UNIT #100F	3003925135	ROSA PC	211	31N	()6W	SG1	SINGLE WALL STEEL
OSA UNIT #1011/1	3003925577	BLANCO MV	24F	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
OSA UNIT #108	3003923506	BASIN DK / GI	7G	3111	05W	BG1	HDPE SECONDARY LINER

٠

•

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	IWN	RNG	PIT TYPI	CONSTRUCTION MATERIAL
ROSA UNIT #119	3003925143	BASIN DK	18N	31N	0: \%	BG1	DBL WALL STEEL FIBERGLASS TANK w.BANDED 20 m
ROSA UNIT #125	3003925144	BLANCO MV	13B	3110	Оө₩	BGT	HIDPE SECONDARY LINER
ROSA UNIT #1250	3003929843	BLANCO MV BASIN DK /	13G	31N	(161/1	BGT	DBL WALL STEEL FIBERGLASS TANK W&ANDED 20 m
ROSA UNIT #125F	3003925526	BLANCO MV	13.7	31N	06W	BGT	HDFE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34E	32N	VV80	b G1	DBL WALL STEFT
ROSA UNIT #129A	3003926297	BLANCO MV	34K	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT #137	3003925410	BLANCO MV BLANCO MV /	31K	31N	05W	BG1	HOPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSA PC	311	31N	(15VV	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 m
ROSA UNIT #137B	3003927002	BLANCO MV BLANCO MV /	31F	31N	05W	BG1	HDF'E SECONDARY LINER FIBERGLASS TANK WBANDED 20 m
ROSA UNIT #138	3004529147	ROSA PC BLANCO MV /	171	31N	06W	6G1	HUPE SECONDARY LINER
ROSA UNII #136A	3004529134	ROSA PC	1711	3111	06W	BGT	DBI WALL STEEL
ROSA UNIT #138B	3004532168	BLANCO MV	17#1	3111	06W	BG1	DBI WALL STEFF
ROSA UNIT #139A	3004529600	BLANCO MV	17M	31N	0t-W	BGT	DPL WALL STEEL
ROSA UNIT #14()	3003925435	ROSA PC	22K	31N	06W	BG1	DBL WALL STEFL
ROSA UNIT #144	3003925421	ROSA FC	26A	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16F	3111	06W	861	DBI WALL STEEL FIBERGLASS TANK A/BANDED 20 no
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W	PGT	HDPE SECONDARY LINER
ROSA UNIT #146C	3003930187	BLANCO MV	28B	31N	05W	BGT	DBI WALL STEFI
ROSA UNIT #148	3003925493	BASIN DK	20	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #148A	3003925776	BLANCO MV	214	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mi
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	06 V V		HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	12F	3111	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mi
ROSA UNIT #149B	3003926599	BLANCO MV	12 F	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mi
ROSA UNIT #150	3004529229	BI ANCO MV	32F	32N	06W		HDPE SECONDARY LINFR
ROSA UNIT #150A	3004529592	BLANCO MV	32M	32N	06VV	BG1	DBL WALL STEFL
ROSA UNIT #150B	3004530874	BASIN DK / BLANCO MV	32D	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #1500	3004532157	BI ANCO MV	32K	32N	06W	BGT	DBL WALL STEEL
IOSA UNIT #15	3004529267	BLANCO MV	33C	32N	06W	BG1	DBL WALL STEEL

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	IWN	RNG	PIT TYPE	E CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	331	32N	V290	BGI	DBI WALL STEEL
ROSA UNIT #1510	3004532196	BLANCO MV	3314	32N	06\/v	FGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #152	3003925494	BLANCO MV	36E	32N	06VV	EGI	HOPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	3211	06Vv	BGT	DBL WALL STEEL
ROSA UNIT #152B	3003926631	BLANCO MV	360	32N	06W	861	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNII #152C	3003927635	BLANCO MV	361	32N	W80	EGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #153	3003925524	BLANCO MV	17()	31N	05V/	RG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDLD 20 mil
ROSA UNIT #153A	3003926329	BLANCO MV BASIN DK /	17/	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #153B	3003927603	BLANCO MV	171	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	7N	31N	05Vv	вет	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #154A	3003926274	BLANCO MV	7P	3110	0577	BGI	HDPE SECONDARY LINER HBERGLASS TANK WBANDLD 20 mil
ROSA UNIT #156	3004529661	BLANCO MV	9A	3111	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #156A	3004529640	BLANCO MV BASIN DK	91	31N	OoW	BG1	HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BI ANCO MV	19O	31N	05W	BG1	DBL WALL STEFT FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3114	05W	BG1	HDPE SECONDARY LINER LIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #150	3003930111	BLANCO MV BLANCO MV	29G	31N	O5VV	BGT	HDFE SECONDARY LINER
ROSA UNIT #160	3003925890	ROSA PC	250	31N	0644	BGT	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV BASIN DK /	25N	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #160B	3003926962	BI ANCO MV	251	31N	06VV		HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	0674	=	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #162	3003926069	BI ANCO MV	30K	311/	05W		HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BI ANCO MV	30P	31N	05W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #163	3003926345	BI ANCO MV	74G	31N	06W	BG1	HDPE SECONDARY LINER HBERGLASS TANK WBANDED 20 mil
ROSA UNIT #163A	3003926336	BLANC() MV	240	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	3111	06W	SGT	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV	24J	31N	06W		SINGLE WALL STEEL
ROSA UNIT #164	3003926151	BASIN DK / BLANCO MV	1J	31N	06W	BG1	FIBERGLASS TANK WIBANDE() 20-mil HDPE SECONDARY LINER
ROSA UNIT #164A	3003926080	BLANCO MV	1J	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #164E	3003927242	BASIN DK / BLANCO MV	1J	31N	06W		FIBERGLASS TANK W/BANDFD 20 mil HDPE SECONDARY LINER

• •

WELLS W/FEDERAL	4.5.1					*****	CONCEDICATION MATERIAL
SURF MG1	API	FM1 BLANCO MV /	SEC	<u>IWN</u>	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNII #165	3003926070	ROSAPC	254	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 not
ROSA UNIT #165A	3003926150	BLANGO MV BASIN DK /	25B	31N	OeW	BG1	HOFE SECONDARY LINER
ROSA UNIT #165B	3003926557	BLANCO MV BASIN DK /	251	31N	OGVV	BGT	OBI WALL STEEL
ROSA UNIT #165C	3003926961	BLANCO MV	25G	31N	06W	BG1	DBI WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #166A	3003926282	BLANCO MV	30F	31N	05W	BG1	HUFF SECONDARY LINER
ROSA UNIT #167A	3004529886	BLANCO MV	A8	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #169	3003926130	BLANCO MV	3J	31N	06W	BG1	DBI WALL STEFL
ROSA UNIT #169A	3003926149	BLANCO MV	31	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #169C	3003927717	BLANCO MV	2M	3111	06Vv	BG1	FIBERGLASS TANK W/BANDED 20-mil HDFE SECONDARY LINER
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	06W	BG1	DBI WALI STEFF
ROSA UNII #171	3003926286	BLANCO MV	/G	3111	05W	861	DBI WALL STEEL
ROSA UNIT #171A	3003926389	BLANCO MV	7G	31N	05W	BGT	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #171B	3003927013	BLANCO MV	6 Đ	31N	05W	BGT	FIBERGLASS TANK WBANDED 20 mil HDFE SECONDARY LINER
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	06W	5G1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #180B	3004533134	BLANCO MV	91	3111	06W	BGT	DBI WALL STEFF
ROSA UNIT #1800	3004533191	BLANCO MV	9E	31N	W80	BGI	DBL WALL STEFL
ROSA UNIT #181	3003926463	BLANCO MV	11K	31N	06VV	BG1	DBI WALL STEEL
ROSA UNIT #181A	3003926312	BLANCO MV	15A	31N	06W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #181((shared w/169C)	3003927714	BLANCO MV	2M	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPF SECONDARY LINER
ROSA UNIT #182	3003926283	BI ANCO MV	18N	31N	05W	BG1	HBERGLASS TANK WBANDED 20-mil HDEE SECONDARY LINER
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	BGT	DBI WALL STEFI
ROSA UNIT #1820	3003930180	BI ANCO MV	18F¹	31N	05W	SG1	SINGLE WALL STEFL
ROSA UNIT #183	3003926387	BI ANCO MV	19G	31N	05W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #183A	3003926386	BI ANCO MV	19F	31N	05W		FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #183B	3003930087	BI ANCO MV	19B	31N	05W	BGI	UBI WALL STEFL
ROSA UNIT #185B	3004532734	BASIN DK / BLANCO MV	16F	31N	06W	BG1	DBL WALL STEFL
ROSA UNIT #185C	3004534484	BLANCO MV	16F	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #185	3003930186	BLANCO MV	21G	31N	υ5 ₩	BG1	DBL WALL STEEL

•

WELLS W/FEDERAL SURF MG1	API	FMT	SEC	IWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #231	3003924441	BASINTIC	31N	3110	05Vv	561	SINGLE WALL STILL
ROSA UNIT #335A	3003930222	BASINFIC	05J	3111	0544	SG1	SINGLE WALL STEEL

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Report

Well:

(Cox Canyon #200A)

API No:

30-04532126

Location: O-S09-T32N-R11W, NMPM



In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be initiated within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current landowner of record. The landowner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the landowner of record will be notified as soon as practical.

Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)

Aztec District office was notified of Williams E&P intent to close on (10/28/2010). Email attached.

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

Williams closed the BGT used by the Cox Canyon #200A separator and piped all liquids to the Produced Water Storage Tank.

8/30/2011

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled</u> to the Rosa Unit disposal wells listed.

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location. The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

rable	1:	Closure	CIII	eria	tor Ro	اح
Testing	M	ethods	ا آستو		T.	CI

Components /	Testing Methods 🍰 💢 👙	Closure Limits	Sample
		(mg/Kg)	Results (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2	ND
BTEX	EPA SW-846 Method 8021B or 8260B	50	ND
TPH	EPA SW-846 Method 418.1(1)	100	22.3
Chlorides	EPA SW-846 Method 300.1(1)	250(2)	5

⁽¹⁾ Method modified for solid waste.

9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pıt area backfilled with clean earthen material following sample results. No</u> contaminated soil taken off site. Backfill compacted to avoid settling and pit area remains in use for production operations.

 $^{^{(2)}}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13., I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

<u>Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.</u>

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above. See above notes.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available inspection reports

- Confirmation Sampling Analytical
 Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation