District I ,

1625 N French Dr , Hobbs, NM 88240

District II 1301 W Grand Ave , Artesia, NM 88210

District III 1000 Rio Biazos Rd , Aztec, NM 87410

1220 S St Francis Dr , Santa Fe, NM 87505

Type of action:

í -

District IV

State of New Mexico Energy Minerals and Natural Resources

Department
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Modification to an existing permit

below-grade tank, or proposed alternative method

Form C-144
July 21, 2008

For temporary pits, closed-loop sytems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method X Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method

Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system,

Operator. Burlington Resources Oil & Gas Company, LP	OGRID# 14538
Address P.O. Box 4289, Farmington, NM 87499	
Facility or well name SAN JUAN 28-6 UNIT 126N	
API Number. 30-039-30711	OCD Permit Number
J/L or Qtr/Qtr G(SW/NE) Section 16 Township: 28N	Range: 6W County Rio Arriba
Center of Proposed Design Latitude. 36.66425 °N	Longitude: 107.4689 °W NAD. 1927 1983
Surface Owner X Federal State Private	Tribal Trust or Indian Allotment
)	
X Prt: Subsection F or G of 19 15 17 11 NMAC	
Temporary X Drilling Workover	
Permanent Emergency Cavitation P&A	
X Lined Unlined Liner type Thickness 20 m	nl X LLDPE HDPE PVC Other
X String-Reinforced	
Liner Seams X Welded X Factory Other	Volume 7700 bbl Dimensions L 120' x W 55' x D 12'
Closed-loop System: Subsection H of 19 15 17 11 NMAC	
	r or Drilling (Applies to activities which require prior approval of a permit or
notice of	
Drying Pad Above Ground Steel Tanks Haul-off Bins	Other
Lined Unlined Liner type Thicknessmi	ILLDPEHDPEPVDOther
Liner Seams Welded Factory Other	- / ECENT
4	(1 COM 2007)
Below-grade tank: Subsection I of 19 15 17 11 NMAC	CO CONS DIV.
Volumebbl Type of fluid	\[\bar{c}_{\bar{c}}\]
Tank Construction material	
	iner, 6-inch lift and automatic overflow shut-off
Visible sidewalls and liner Visible sidewalls only	
Liner Type Thickness mil HDPE P	VC Other

32

Page 1 of 5

6.		
Fencing: Subsection D of 19 15 17 11 NMAC (Applies to permanent pit, temporary pits, and below-grade tanks)		
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institution or church)		
Four foot height, four strands of barbed wire evenly spaced between one and four feet		
Alternate Please specify		
7		
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks)		
Screen Netting Other		
Monthly inspections (If netting or screening is not physically feasible)		
8		
Signs: Subsection C of 19 15 17 11 NMAC		
12" X 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers		
X Signed in compliance with 19 15.3 103 NMAC		
9		
Administrative Approvals and Exceptions:		
Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance		
Please check a box if one or more of the following is requested, if not leave blank:		
Administrative approval(s) Requests must be submitted to the appropriate division district of the Santa Fe Environmental Bureau office for consideration (Fencing/BGT Liner)	eration of appi	roval
Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval		
Siting Criteria (regarding permitting) 19.15.17.10 NMAC		
Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptable		
source material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the		
appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau Office for consideration of approval. Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria		
does not apply to drying pads or above grade-tanks associated with a closed-loop system.		
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank.	□Ves	Пио
- NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells		
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other watercourse, lakebed, sinkhole, or playa lake	Yes	□No
(measured from the ordinary high-water mark). - Topographic map, Visual inspection (certification) of the proposed site		1
- Topographic map, Visual inspection (contineation) of the proposed site		
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes	No
(Applies to temporary, emergency, or cavitation pits and below-grade tanks)	NA	
- Visual inspection (certification) of the proposed site, Aerial photo; Satellite image		
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes	No
(Applied to permanent pits)	□NA	_
- Visual inspection (certification) of the proposed site, Aerial photo; Satellite image		
Within 500 horizonal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.	Yes	□No
- NM Office of the State Engineer - IWATERS database search; Visual inspection (certification) of the proposed site.		
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	□ Vos	Пма
adopted pursuant to NMSA 1978, Section 3-27-3, as amended	Yes	∐No
- Written confirmation or verification from the municipality, Written approval obtained from the municipality Within 500 feet of a wetland.	Yes	□No
- US Fish and Wildlife Wetland Identification map, Topographic map; Visual inspection (certification) of the proposed site	L	
Within the area overlying a subsurface mine.	Yes	□No
- Written confirmation or verification or map from the NM EMNRD - Mining and Mineral Division		
Within an unstable area.	Yes	No
- Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological		-
Society; Topographic map	V	
Within a 100-year floodplain - FEMA map	Yes	∐No

Form C-144 Oil Conservation Division Page 2 of 5

Temporary Pits, Emergency Pits and Below-grade Tanks Permit Application Attachment Checklist Subsection B of 19 15 17 9 NMAC
Instructions Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15 17 9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15 17 9
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC
Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of
19 15 17 9 NMAC and 19 15 17 13 NMAC
Previously Approved Design (attach copy of design) API or Permit
12
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC
Instructions Each of the following items must be attached to the application Please indicate, by a check mark in the box, that the documents are attached Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15 17 9
Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19 15 17 10 NMAC
Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17 9
NMAC and 19.15 17 13 NMAC
Previously Approved Design (attach copy of design) API
Previously Approved Operating and Maintenance Plan API
13
Permanent Pits Permit Application Checklist: Subsection B of 19 15 17 9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report - based upon the requirements of Paragraph (I) of Subsection B of 19 15 17.9 NMAC
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC
Climatological Factors Assessment
☐ Certified Engineering Design Plans - based upon the appropriate requirements of 19 15 17 11 NMAC ☐ Dike Protection and Structural Integrity Design—based upon the appropriate requirements of 19 15 17 11 NMAC
Leak Detection Design - based upon the appropriate requirements of 19 15 17 11 NMAC
Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15 17 11 NMAC
Quality Control/Quality Assurance Construction and Installation Plan
Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC
Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19 15 17 11 NMAC
Nuisance or Hazardous Odors, including H2S, Prevention Plan
Emergency Response Plan
Oil Field Waste Stream Characterization
Monstoring and Inspection Plan Erosion Control Plan
Closure Plan - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15 17 13 NMAC
14
Proposed Closure: 19 15 17 13 NMAC
Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative
Proposed Closure Method Waste Excavation and Removal
Waste Removal (Closed-loop systems only)
On-site Closure Method (only for temporary pits and closed-loop systems)
In-place Burial On-site Trench
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
15
Waste Excavation and Removal Closure Plan Checklist (19 15 17 13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.
Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC
Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15.17 13 NMAC
Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)
Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15 17 13 NMAC
Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17.13 NMAC
Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC

Form C-144 Oil Conservation Division Page 3 of 5

Internations: Please identify the faculty or faculties for the disposal of luquids, drilling fluids and drill extings: Vise dischanned if more than two facilities are sequented Disposal Faculity Name		
Disposal Facility Name Disposal Facility Permit #		
Disposal Facility Name Disposal Facility Permit #		
Will any of the proposed closed-loop system operations and associated activities occur on or in areas that will nbe used for future service and Yes (If yes, please provide the information. No No No No No No No N		
Soil Backfill and Cover Design Specification - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Stite Reclamation Plan - based upon the subsection G of 19 15 17 10 NMAC Stite Requirements of Subsection G of 19 15 17 10 NMAC Stite Requirements of Subsection G of 19 15 17 10 NMAC Stite Requirements of 19 15		
Siting Criteria (Regarding on-site closure methods only; 19 15 17 10 NMAC Paramenors Each string criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable source material are provided below. Requests regarding changes to criterian string criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable source material are provided below. Requests regarding changes to criterian string criteria requires a demonstrative approval from the appropriate distinct office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau effects for consideration of approval. Justifications and/or demonstrations of equivalency are required. Please refer to 19 15 17 10 NMAC for guidance. Ground water is less than 50 feet below the bottom of the burned waste - NM Office of the State Engineer - iWATERS databases search, USGS. Data obtained from nearby wells. Ground water is between 50 and 100 feet below the bottom of the burned waste - NM Office of the State Engineer - iWATERS databases earch, USGS, Data obtained from nearby wells. Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map, Visual inspection (certification) of the proposed site. Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site. Within 500 horizontal feet of a private, domestic fresh water well or spring, in existence at the time of the initial application. - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site. Within 500 horizontal feet of any other fresh water well or spring, in existence at the time of the initial application. - NM Office of the State Engi		
- NM Office of the State Engineer - iWATERS database search, USGS Data obtained from nearby wells Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, satellite image Within 500 horizontal feet of a private, domestic fresh water well or spring, in existence at the time of the initial application - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within nocoporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMAS 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain		
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa take (measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, satellite image Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the imminipality Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain		
NM Office of the State Engineer - iWATERS database search, USGS. Data obtained from nearby wells N/A N/A N/A N/A N/		
NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells N/A N/A N/		
NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) Topographic map, Visual inspection (certification) of the proposed site Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application Visual inspection (certification) of the proposed site, Aerial photo, satellite image Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within neorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted purpusuant to NMSA 1978, Section 3-27-3, as amended Within 500 feet of a wetland US Fish and Wildlife Wetland Identification from the municipality, Written approval obtained from the imunicipality Within the area overlying a subsurface mine Within the area overlying a subsurface mine Within an unstable area Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain		
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) - Topographic map. Visual inspection (certification) of the proposed site Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, satellite image Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within neorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain		
(measured from the ordinary high-water mark) - Topographic map, Visual inspection (certification) of the proposed site Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, satellite image Yes		
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, satellite image Yes		
Visual inspection (certification) of the proposed site, Aerial photo, satellite image Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain Within a 100-year floodplain		
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application - NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain Within a 100-year floodplain		
purposes, or within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended Written confirmation or verification from the municipality, Written approval obtained from the municipality Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain Within a 100-year floodplain		
pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain Yes		
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine - Written confiramtion or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain		
- US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site Within the area overlying a subsurface mine - Written confiramtion or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain Yes No		
Within the area overlying a subsurface mine - Written confiramtion or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain		
- Written confiramtion or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area - Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain Yes No		
- Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society, Topographic map Within a 100-year floodplain Yes No		
Topographic map Within a 100-year floodplain Yes No		
18 On-Site Closure Plan Checklist: (19 15 17 13 NMAC) Instructions: Each of the following items must bee attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.		
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC		
Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC		
Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of 19.15 17 13 NMAC		
1 Construction/Design Plan of Temporary Pit (for in place burial of a drying had) - based upon the appropriate requirements of 19 15 17 11 NMAC		
Construction/Design Plan of Temporary Pit (for in place burial of a drying pad) - based upon the appropriate requirements of 19 15 17 11 NMAC Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC		
Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC		
Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC		
Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC Waste Material Sampling Plan - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC		
Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC		

Operator Application Certification:
I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief
Name (Print) Title
Signature Date e-mail address Telephone
e-mail address Telephone
OCD Approval: Permit Application (including classic plan) Closure Diamonly) OCD Conditions (see attachment) OCD Representative Signature: Approval Date: OCD Bermit Number:
21
Closure Report (required within 60 days of closure completion): Instructions Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed. Closure Completion Date: July 1, 2011
20 Closure Completion Date. Completion
22 Closure Method: Waste Excavation and Removal X On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain
23
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please identify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities
were utilized.
Disposal Facility Name Disposal Facility Permit Number
Disposal Facility Name Disposal Facility Permit Number
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes (If yes, please demonstrate compliant to the items below) No
Required for impacted areas which will not be used for future service and operations
Site Reclamation (Photo Documentation)
Soil Backfilling and Cover Installation
Re-vegetation Application Rates and Seeding Technique
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. X Proof of Closure Notice (surface owner and division) X Proof of Deed Notice (required for on-site closure) X Plot Plan (for on-site closures and temporary pits) X Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) X Disposal Facility Name and Permit Number X Soil Backfilling and Cover Installation X Re-vegetation Application Rates and Seeding Technique X Site Reclamation (Photo Documentation) On-site Closure Location Latitude 36.6642 °N Longitude 107.46861 °W NAD 1927 X 1983
25
Operator Closure Certification: I hereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.
Name (Print) Jamie & Qodwin Title Regulatory, Tech
Signature: 000/100 Date 11/4/1/
e-mail address / jamie goodwin@conocophillips.com Telephone 505-326-9784

Burlington Resources Oil Gas Company, LP San Juan Basin Closure Report

Lease Name: SAN JUAN 28-6 UNIT 126N

API No.: 30-039-30711



In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the temporary pit referenced above. All proper documentation regarding closure activities is being included with the C-144. The temporary pit for this location was constructed and location drilled before June 16, 2008 (effective date for Rule 19.15.17). While closure of the temporary pit did fall within the rule some dates for submittals are after the rig release date.

- Details on Capping and Covering, where applicable (See report)
- Plot Plan (Pit Diagram) (Included as an attachment)
- Inspection Reports (Included as an attachment)
- Sampling Results (Included as an attachment)
- C-105 (Included as an attachment)
- Copy of Deed Notice will be filed with County Clerk (Not required on Federal, State, or Tribal land as stated by FAQ dated October 30, 2008)

General Plan:

 All free standing liquids will be removed at the start of the pit closure process from the pit and disposed of in a division—approved facility or recycle, reuse or reclaim the liquids in a manner that the appropriate division district office approves.

All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B).

2. The preferred method of closure for all temporary pits will be on-site burial, assuming that all the criteria listed in sub-section (B) of 19.15.17.13 are met.

The pit was closed using onsite burial.

3. The surface owner shall be notified of BR's closing of the temporary pit as per the approved closure plan using certified mail, return receipt requested.

The closure process notification to the landowner was sent via email. (See Attached)(Well located on Federal Land, certified mail is not required for Federal Land per BLM/OCD MOU.)

4. Within 6 months of the Rig Off status occurring BR will ensure that temporary pits are closed, re-contoured, and reseeded.

The closure plan requirements were met due to rig move off date as noted on C-105.

- 5. Notice of Closure will be given to the Aztec Division office between 72 hours and one week of closure via email, or verbally. The notification of closure will include the following:
 - i. Operator's name
 - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

Notification is attached.

6. Liner of temporary pit shall be removed above "mud level" after stabilization. Removal of liner will consist of manually or mechanically cutting liner at mud level and removing all remaining liner. Care will be taken to remove "All" of the liner i.e., edges of liner entrenched or buried. All excessive liner will be disposed of at a licensed disposal facility.

Liner of temporary pit was removed above "mud level" after stabilization. Removal of the liner consisted of manually cutting liner at mud level and removing all remaining liner. Care was taken to remove "ALL" of the liner i.e., edges of liner entrenched or buried. All excessive liner was disposed of at a licensed disposal facility, (San Juan County Landfill).

7. Pit contents shall be mixed with non-waste containing, earthen material in order to achieve the solidification process. The solidification process will be accomplished using a combination of natural drying and mechanically mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed a safe and stable. The mixing ratio shall not exceed 3 parts clean soil to 1 part pit contents.

Burlington mixed the Pit contents with non-waste containing, earthen material in order to achieve the solidification process. The solidification process was accomplished by using a combination of natural drying and mechanically mixing. Pit contents were mixed with non-waste, earthen material to a consistency that is deemed as safe and stable. The mixing ratio consisted of approximately 3 parts clean soil to 1 part pit contents.

8. A five point composite sample will be taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.13(B)(1)(b). In the event that the criteria are not met, all contents will be handled per Subparagraph (a) of Paragraph (1) of Subsection B of 19.15.17.13 i.e., Dig and haul.

A five point composite sample was taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached).

Components	Tests Method	Limit (mg/Kg)	Results
Benzene	EPA SW-846 8021B or 8260B	0.2	ND ug/kg
BTEX	EPA SW-846 8021B or 8260B	50	800 ug/kG
TPH	EPA SW-846 418.1	2500	181mg/kg
GRO/DRO	EPA SW-846 8015M	500	29.7 mg/Kg
Chlorides	EPA 300.1	1000/500	420 mg/L

9. Upon completion of solidification and testing standards being passed, the pit area will be backfilled with compacted, non-waste containing, earthen material. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater. If standard testing fails BR will dig and haul all contents pursuant to 19.15.17.13.i.a. After doing such, confirmation sampling will be conducted to ensure a release has not occurred

The pit material passed solidification and testing standards. The pit area was then backfilled with compacted, non-waste containing, earthen material. More than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

10. During the stabilization process if the liner is ripped by equipment the Aztec OCD office will be notified within 48 hours and the liner will be repaired if possible. If the liner can not be repaired then all contents will be excavated and removed.

The integrity of the liner was not damaged in the pit closure process.

11. Dig and Haul Material will be transported to the Envirotech Land Farm located 16 miles south of Bloomfield on Angel Peak Road, CR 7175. Permit # NM010011

Dig and Haul was not required.

12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final recontour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The pit area was re-contoured to match fit, shape, line, form and texture of the surrounding area. Reshaping included drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final recontour has a uniform appearance with smooth surface, fitting the natural landscape.

13. Notification will be sent to OCD when the reclaimed area is seeded.

Provision 13 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

14. BR shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM or Forest Service stipulated seed mixes will used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs.

Provision 14 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

15. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial upon the abandonment of all the wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the operator's information at the time of all wells on the pad are abandoned. The operator's information will include the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

Provision 15 was accomplished by installing a steel marker in the temporary pit, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial. The marker is flush with the ground to allow access of the active well pad and for safety concerns. The top of the marker contains a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate contains the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the following operator's information at the time of all wells on the pad are abandoned. The riser will be labeled: BR, BLM, SAN JUAN 28-6 UNIT 126N, UL-G, Sec. 16, T 28N, R 6W, API # 30-039-30711

Sessions, Tamra D

From:

Sessions, Tamra D

Sent:

Wednesday, March 18, 2009 10:48 AM

To: Subject: 'mark_kelly@nm.blm.gov' Surface Owner Notification

The following temporary pits will be closed on-site. The new OCD Pit Rule 17 requires the surface owner be notified.

San Juan 31-6 Unit 27M San Juan 32-7 Unit 18M San Juan 32-7 Unit 71A

The following locations will have a temporary pit that will be closed on-site.

San Juan 28-6 Unit 109N

San Juan 28-6 Unit 126N

San Juan 28-6 Unit 144N

San Juan 29-6 Unit 4M

San Juan 29-7 Unit 83B

San Juan 29-7 Unit 83M

San Juan 30-5 Unit 97M

San Juan 30-5 Unit 100N

Thank You,

Tamra Sessions
Staff Regulatory Technician
CONOCOPHILLIPS COMPANY / SJBU
505-326-9834
Tamra.D.Sessions@conocophillips.com

District I 1625 N French Dr., Hobbs, NM 88240

State of New Mexico Energy, Minerals & Natural Resources Department

District II 1301 W Grand Avenue, Artesia, NM BB210

1000 Rio Brazos Rd. Aztec, NM 87410

District IV 1220 S St Francis Dr., Santa Fe. NM 87505

OIL CONSERVATION DIVISION

1220 South St. Francis Dr Santa Fe. NM 87505

Revised October 12, 2005 Instructions on back Submit to Appropriate District Office

State Lease - 4 Copies Fee Lease - 3 Copies

Form C-102


AMENDED REPORT


WELL LOCATION AND ACREAGE DEDICATION PLAT

'API Number	² Pool Code 72319 / 71599	³Pool Name BLANCO MESAVERDE / BAS	SIN DAKOTA
*Property Code	•	Property Name SAN JUAN 28-6 UNIT	
'OGRID № 14538	• •	ator Name S OIL & GAS COMPANY LP	*Elevation 6710'

¹⁰ Surface Location Feet from the North/South line UL or lot no Section Township Range Lot Idn Feet from the East/West line RTO 16 28N 6W 1555 NORTH G 1575 EAST ARRIBA 11 Bottom Hole Location If Different From Surface UL or lot no Sect ion Township Range Lot Idn Feet from the North/South line Feet from the East/West line RIO 6W NORTH 28N 1500 16 2260 WEST ARRIBA 13 Joint or Infill 12 Dedicated Acres ¹⁴ Consolidation Code ¹⁵ Order No 320.0 Acres - (W/2)

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

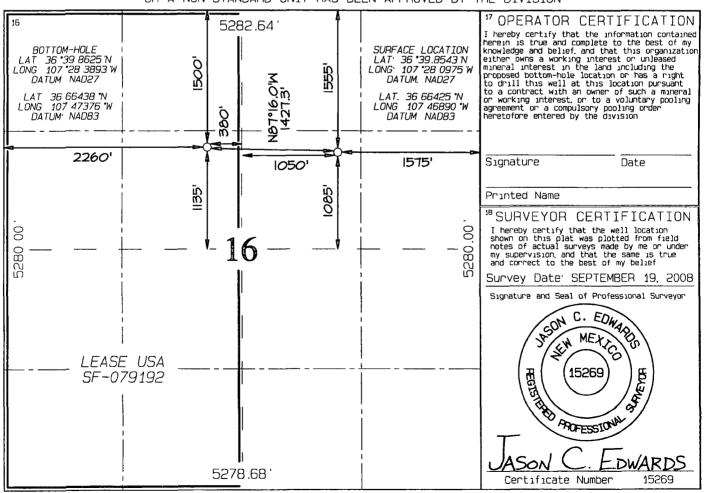

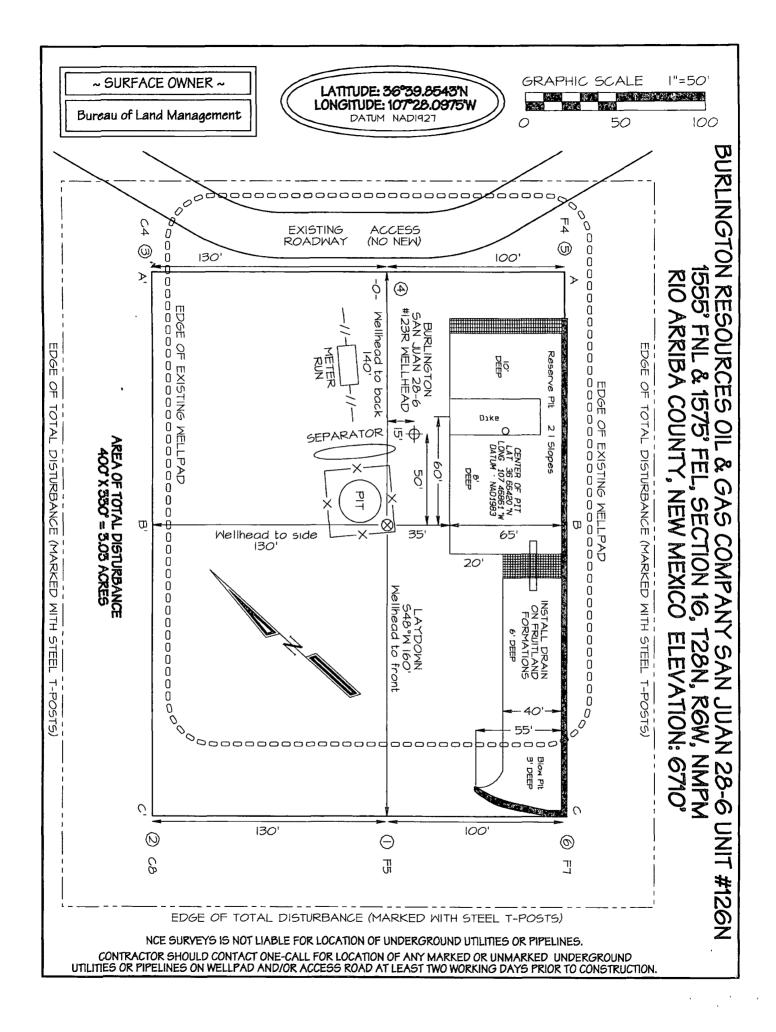



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Burlington	Project #:	92115-1271
Sample ID:	Reserve Pit	Date Reported:	05-19-11
Laboratory Number:	58231	Sampled:	05-17-11
Chain of Custody No:	11692	Date Received:	05-17-11
Sample Matrix:	Soil	Date Extracted:	05-18-11
Preservative:	Cool	Date Analyzed:	05-18-11
Condition:	Intact	Analysis Requested:	8015 TPH
		Dilution:	X2

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	23.3	0.4
Diesel Range (C10 - C28)	6.4	0.2
Total Petroleum Hydrocarbons	29.7	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste, SW-846, USEPA, December 1996.

Comments:

San Juan 28-6 Unit 126N



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	Burlington	Project #:	92115-1271
Sample ID:	Back Ground	Date Reported:	05-19-11
Laboratory Number:	58232	Sampled:	05-17 - 11
Chain of Custody No:	11692	Date Received:	05-17 - 11
Sample Matrix:	Soil	Date Extracted:	05-18-11
Preservative:	Cool	Date Analyzed:	05-18-11
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste, SW-846, USEPA, December 1996.

Comments:

San Juan 28-6 Unit 126N

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

Client:	QA/QC	Project #:	N/A
Sample ID:	05-18-11 QA/QC	Date Reported:	05-19-11
Laboratory Number:	58219	Date Sampled:	N/A
Sample Matrix:	Methylene Chloride	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	05-18-11
Condition:	N/A	Analysis Requested:	TPH

	I-Cal Date	I-Cal RF:	C-Cal RF:	% Difference	Accept. Range
Gasoline Range C5 - C10	05/18/11	9.996E+02	1.000E+03	0.04%	0 - 15%
Diesel Range C10 - C28	05/18/11	1.007E+03	1.007E+03	0.04%	0 - 15%

Blank Conc. (mg/L - mg/Kg)	Concentration	Detection Limit
Gasoline Range C5 - C10	2.3	0.2
Diesel Range C10 - C28	1.2	0.1

Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Range
Gasoline Range C5 - C10	11.6	10.9	5.87%	0 - 30%
Diesel Range C10 - C28	32.0	31.5	1.66%	0 - 30%

Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept. Range
Gasoline Range C5 - C10	11.6	250	258	98.5%	75 - 125%
Diesel Range C10 - C28	32.0	250	287	102%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 58219-58220, 58226-58227. 58229-58238, 58242



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Burlington	Project #:	92115-1271
Sample ID:	Reserve Pit	Date Reported:	05-20-11
Laboratory Number:	58231	Date Sampled:	05-17-11
Chain of Custody:	11692	Date Received:	05-17-11
Sample Matrix:	Soil	Date Analyzed:	05-18-11
Preservative:	Cool	Date Extracted:	05-18-11
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

		.0	
Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	-
Daw	ND	2.0	
Benzene	ND	0.9	
Toluene	258	1.0	
Ethylbenzene	46.7	1.0	
p,m-Xylene	460	1.2	
o-Xylene	38.7	0.9	
Total BTEX	800		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	104 %
	1,4-difluorobenzene	104 %
	Bromochlorobenzene	111 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

San Juan 28-6 Unit 126N



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Burlington	Project #:	92115-1271
Sample ID:	Back Ground	Date Reported:	05-20-11
Laboratory Number:	58232	Date Sampled:	05-17-11
Chain of Custody:	11692	Date Received:	05-17-11
Sample Matrix:	Soil	Date Analyzed:	05-18-11
Preservative:	Cool	Date Extracted:	05-18-11
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

	Dilution:	10	
Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
·			
Benzene	ND	0.9	
Toluene	ND	1.0	
Ethylbenzene	ND	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	ND	0.9	
Total BTEX	, ND		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	106 %
	1,4-difluorobenzene	107 %
	Bromochlorobenzene	99.0 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

San Juan 28-6 Unit 126N

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A		Project#:		N/A
Sample ID:	0518BBLK QA/QC	;	Date Reported:		05-20-11
Laboratory Number:	58229		Date Sampled:		N/A
Sample Matrix:	Soil		Date Received:		N/A
Preservative:	N/A		Date Analyzed:		05-18-11
Condition:	N/A		Analysis:		BTEX
			Dilution:		10
Calibration and	I-Cal RF:	C-Cal RF:	%Diff.	Blank	Detect.
Detection Limits (ug/L)	and the second s	Accept. Rand	je 0 - 15%	Conc	Limit
Benzene	3.6460E+006	3.6533E+006	0.2%	ND	0.1
Toluene	1.0734E+006	1.0755E+006	0.2%	ND	0.1
Ethylbenzene	7.9665E+005	7.9824E+005	0.2%	ND	0.1
p,m-Xylene	1.6785E+006	1.6819E+006	0.2%	ND	0.1
o-Xylene	6.3805E+005	6.3933E+005	0.2%	ND	0.1

Duplicate Conc. (ug/Kg)	Sample D	uplicate	%Diff.	Accept Range	Detect. Limit
Benzene	36.1	38.4	6.4%	0 - 30%	0.9
Toluene	765	828	8.2%	0 - 30%	1.0
Ethylbenzene	265	255	4.0%	0 - 30%	1.0
p,m-Xylene	3,110	3,140	0.9%	0 - 30%	1.2
o-Xylene	503	562	11.8%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Sample	Amount Spiked	Spiked Sample	% Recovery	Accept Range
Benzene	36.1	500	578	108%	39 - 150
Toluene	765	500	1,280	101%	46 - 148
Ethylbenzene	265	500	768	100%	32 - 160
p,m-Xylene	3,110	1000	3,660	89 [.] 1%	46 - 148
o-Xylene	503	500	1,030	103%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 58229-58238



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Burlington	Project #:	92115-1271
Sample ID:	Reserve Pit	Date Reported:	05/18/11
Laboratory Number:	58231	Date Sampled:	05/17/11
Chain of Custody No:	11692	Date Received:	05/17/11
Sample Matrix:	Soil	Date Extracted:	05/18/11
Preservative:	Cool	Date Analyzed:	05/18/11
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

181

7.7

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

San Juan 28-6 Unit 126N

5796 US Highway 44-Farmington, NM 87401



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Burlington	Project #:	92115-1271
Sample ID:	Back Ground	Date Reported:	05/18/11
Laboratory Number:	58232	Date Sampled:	05/17/11
Chain of Custody No:	11692	Date Received:	05/17/11
Sample Matrix:	Soil	Date Extracted:	05/18/11
Preservative:	Cool	Date Analyzed:	05/18/11
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

20.6

7.7

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

San Juan 28-6 Unit 126N Comments:



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS QUALITY ASSURANCE REPORT

Client: QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

05/18/11

Laboratory Number:

05-18-TPH.QA/QC 58229

Date Sampled: Date Analyzed: N/A 05/18/11

Sample Matrix:

Freon-113 N/A

Date Extracted:

05/18/11

Preservative: Condition:

N/A

Analysis Needed:

TPH

Calibration

I-Cal Date 05/09/11

C-Cal Date 05/18/11

I-Cal RF:

1,610

C-Cal RF: 1,670

3.7%

% Difference Accept. Range: +/- 10%

Blank Conc. (mg/Kg)

Concentration

Detection Limit

TPH

TPH

ND

7.7

Duplicate Conc. (mg/Kg) **TPH**

Sample 2,970

Duplicate 2,710

8.8%

84.3%

% Difference Accept. Range +/- 30%

Spike Conc. (mg/Kg

Sample 2,970

2,000

4,190

Spike Added Spike Result % Recovery Accept Range

80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 58219-58220, 58222, 58229-58238



Chloride

Client:

Burlington

Project #:

92115-1271

Sample ID:

Reserve Pit

Date Reported:

05/19/11

Lab ID#:

58231

Date Sampled:

05/17/11

Sample Matrix:

Soil

Date Received:

05/17/11

Preservative:

Cool

Date Analyzed:

05/19/11

Condition:

Intact

Chain of Custody:

11692

Parameter

Concentration (mg/Kg)

Total Chloride

420

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

San Juan 28-6 Unit 126N

5796 US Highway 64, Farmington, NM 87401

Review



Chloride

Client: Burlington Project #: 92115-1271 Sample ID: **Back Ground** Date Reported: 05/19/11 Lab ID#: 58232 Date Sampled: 05/17/11 Sample Matrix: Soil Date Received: 05/17/11 Preservative: Cool Date Analyzed: 05/19/11 Condition: Chain of Custody: Intact 11692

Parameter Concentration (mg/Kg)

Total Chloride

40

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

San Juan 28-6 Unit 126N

5796 US Highway 64, Farmington, NM 87401

()

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com

Submit To Approp Two Copies	wo Copies State of New											Form C-105							
District I 1625 N French Dr., Hobbs, NM 88240 Energy, Minerals an							d Na	tural Re	es	ources	-	July 17, 2008 1. WELL API NO.							
District II 1301 W Grand Avenue, Artesia, NM 88210 Oil Conservation											İ	1. WELL API NO. 30-039-30711							
District III 1000 Rio Brazos Rd , Aztec, NM 87410 1220 South St. F									2 Type of Lease										
District IV									31ATE DIEE ATED/INDIAN							IAN			
1220 S St Francis Dr. Santa Fe, NM 87505 Santa Fe, NM									SF - 079192										
	WELL COMPLETION OR RECOMPLETION REPORT.									LOG							12.65		
4 Reason for fil	ıng											5 Lease Name SAN JUAN				ent Name			
☐ COMPLET	ION REPO	RT (Fill in b	oxes#	l throug	h #31	for State and Fe	e wells	s only)				6 Well Number		-0 0111	-				
C-144 CLO #33, attach this a	ind the plat to	ACHMENT the C-144	(Fill	ın boxes report ıı	#1 thr	ough #9, #15 Da	ate R18	g Released 13 K NMA	aı	nd #32 and/o	or	126N							
7 Type of Com ✓ NEW	pletion WELL \big	WORKOVE	R 🗀	DEEPEN	NING	□PLUGBACI	к 🗆	DIFFERE	N	T RESERVO	OIR	OTHER							
8 Name of Oper		01. 0	<u> </u>		D							9 OGRID 14538							
Burlington F		Oll Gas	Comj	pany, 1	<u>ır</u>						\dashv	11 Pool name	or V	Vildcat			<u> </u>		
PO Box 4298, Fa		M 87499												·					
12.Location	Unit Ltr	Section		Townsh	ip	Range	Lot		I	Feet from th	ie	N/S Line	Fee	t from th	e	E/W Line	County		
Surface:	ļ	ļ					<u> </u>		Ļ						\downarrow				
BH:			1	1.6.5			<u> </u>		Ļ		_				╧				
13 Date Spudde	d 14 Date	TD Reach	ied	2/20/2		Released		16	Ι	Date Comple	eted	(Ready to Produ	uce)			Elevations (DI GR, etc.)	F and RKB,		
18 Total Measu	red Depth of	Well		19 Pl	ug Bac	k Measured Dep	pth	20		Was Direction	ona	l Survey Made?				Electric and O	ther Logs Ru		
22 Producing In	terval(s), of	this complet	ion - T	op, Botto	m, Na	ame								<u> </u>			···		
					746	INC DEC	OD	D (D :		4 -11 -4	•		11\						
23 CASING S	IZE	WEIGHT	LB/F		_AS	ING REC	UK			ert all str LE SIZE	ıng	gs set in we			Τ	AMOUNT	PHLLED		
Cristings	.22	WEIGHT.	<u> </u>			DEI TITSET				<u>L SIEL</u>		CEMENTAL	3 10	LCORD	╁	AMOUNT	TOLLLO		
															├_				
				<u> </u>											 	-			
24					LIN	ER RECORD					25	T	UB	ING RE	\overline{co}	RD			
SIZE	TOP		BOT	ТОМ		SACKS CEM	IENT	SCREE	N		SIZ	ZE DEPTH S			SET PACKER SET				
								 					+						
26 Perforation	n record (inte	rval, size, a	nd num	nber)		,I		27 AC	II	D, SHOT, I	FR.	ACTURE, CEI	ME	NT, SQ	JEI	EZE, ETC			
								DEPTH	11	NTERVAL		AMOUNT A	ND	KIND M	ATI	ERIAL USED			
												 							
												-							
28							PR	ODUC'	T	ION									
Date First Produ	ction	Pı	oducti	on Metho	od (Fle	owing, gas lift, p	numpin	ıg - Sıze an	nd	type pump)		Well Status	(Pro	od or Shi	it-in	i)			
Date of Test	Hours T	ested	Chol	ke Sıze		Prod'n For Test Period		Oil - Bb	ì		Gas	s - MCF	 	Vater - Bl	οl	Gas - 0	Oıl Ratıo		
Flow Tubing Press	Casing I	Pressure	1 '	culated 24 ir Rate	1-	Oıl - Bbl		Gas		MCF	,]	Water - Bbl		Oıl G	ravı	ity - API - (Co	rr)		
29 Disposition] of Gas <i>(Sold,</i>	used for fue	l, vente	ed, etc)		<u> </u>					_l_	T	30	Test Wit	ness	sed By			
31 List Attachm	nents																		
32 If a temporar	ry pit was use	ed at the we	l, attac	h a plat v	with th	e location of the	temp	orary pit							_				
33 If an on-site	burial was us	sed at the wo	ell, repo	ort the ex	act lo	cation of the on-	site bu	ırial											
		Latitude	36.66	420°N	Lon	gitude 107.468	61°W	NAD 🔲	19	27 🛮 1983									
I hereby cert	``	11/	1) .	Pri	nted											ef.		
- //:	<i>S</i> mc	e Go				ne Jamie Go	oodw	ın Tit	le	e: Regula	tor	y Tech.	Da	te: 11/4	′20	11			
E-mail Addre	ess jamie.	l.goodwir	@coi	nocoph	ıllıps	.com													

ConocoPhillips

Pit Closure Form: Date: ブ/1/20//	
Well Name: <u>SJ 28-6 /26N</u>	-
Footages:	Unit Letter:
Section:, TN, RW, County:	A. State: NY
Contractor Closing Pit:	
Construction Inspector: Norman Faver Inspector Signature: Towns Jaw	Date: 7/1/201/
Revised 11/4/10	
Office Use Only: Subtask DSM Folder	

Goodwin, Jamie L

From: Sent:

Payne, Wendy F

Monday, June 27, 2011 2:14 PM

To:

(Brandon.Powell@state.nm.us), GRP.SJBU Regulatory; Eli (Cimarron)

(eliv@qwestoffice.net); James (Cimarron) (jwood@cimarronsvc.com); Mark Kelly; Randy

McKee; Robert Switzer; Sherrie Landon; Bassing, Kendal R.; Berenz

(mxberenz@yahoo.com); Chavez Darrell (dchavez0330@yahoo com), Elmer Perry; Faver

Norman, Fred Martinez; Jared Chavez; Lowe, Terry; McDonald Johnny

(jr_mcdonald@msn.com); Payne, Wendy F; Smith, Mike W; Spearman, Bobby E; Steve McGlasson; Tally, Ethel, Becker, Joey W, Bowker, Terry D; Frost, Ryan M; Goosey, Paul P; Gordon Chenault; Green, Cary J; GRP:SJBU Production Leads; Hockett, Christy R; Johnson, Kirk L, Bassing, Kendal R.; Kennedy, Jim R; Lopez, Richard A, Nelson, Garry D; O'Nan, Mike J., Peace, James T; Pierce, Richard M; Poulson, Mark E, Schaaphok, Bill; Smith, Randall O; Souther, Tappan G, Spearman, Bobby E; Stamets, Steve A; Thacker, LARRY; Thibodeaux,

Gordon A; Work, Jim A; Corey Alfandre; 'isaiah@crossfire-llc.com'; Jerid Cabot

(¡erid@crossfire-llc.com); Blair, Maxwell O; Blakley, Mac; Farrell, Juanita R; Gıllette, Steven L (PAC); Hines, Derek J; Maxwell, Mary Alice; McWilliams, Peggy L; Saiz, Kooper (Finney Land

Co.); Seabolt, Elmo F; Thayer, Ashley A; Thompson, Trey E (Finney Land Co.)

Cc:

'JDRITT@aol.com'

Subject:

Reclamation Notice: San Juan 28-6 Unit 126N (Area 24 * Run 458)

Importance:

High

Attachments:

San Juan 28-6 Unit 126N.pdf

JD Ritter Construction will move a tractor to the San Juan 28-6 Unit 126N on Thursday, June 30, 2011 to start the reclamation process. Please contact Norm Faver (320-0670) if you have questions or need further assistance



San Juan 28-6 Unit 126N.pdf (1...

Burlington Resources Well - Network # 10247355 - Activity Code D250 (reclamation) & D260 (pit closure) - (PO:Kaitlw) Rio Arriba County, NM

San Juan 28-6 Unit 126N - BLM surface/BLM minerals

Onsited Roger Herrera 12-3-08

Twinned: San Juan 28-6 Unit 123R (existing)

1555' FNL, 1575' FEL Sec.16, T28N, R6W

Unit Letter " G "

Unit # NMNM-78412C & NMNM-78417A & NMNM-78417B

Lease # SF-079192

BH. SENW, Sec 16, T28N, R6W Latitude:36° 39' 51" N (NAD 83) Longitude: 107° 28' 08" W (NAD 83)

Elevation, 6710'

Total Acres Disturbed: 3 03 acres

Access Road n/a API # 30-039-30711 Within City Limits: NO Pit Lined: YES

NOTE: Arch Monitoring IS required on this location. (WCRM 326-7420)


Wendy Payne ConocoPhillips-SJBU 505-326-9533

Wendy.F.Payne@conocophillips.com

ConocoPhillips

Reclamation Form:
Date: 10/25/2011
Well Name: <u>55 28-6 126ル</u>
Footages: 1555 FNL, 1575 FEL Unit Letter: G
Section: 16, T-28-N, R-6 -W, County: R.A. State: NM
Reclamation Contractor: Riffer
Reclamation Date: 7/11/2011
Road Completion Date: 7/26/2011
Seeding Date: 9/29/2011
O.S. P. P.
**PIT MARKER STATUS (When Required): Picture of Marker set needed
MARKER PLACED: 7/14/2011 (DATE)
LATATUDE:
LONGITUDE:
Pit Manifold removed(DATE)
onstruction Inspector: Norman Faver Date: 10/25/2011
nspector Signature: 11 man fave
fice Use Only: ubtask SM older ctures evised 11/4/10



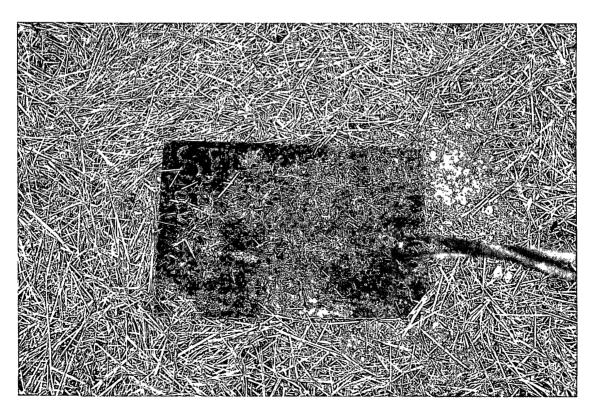





_	WELL NAME: San Juan 28-6 Unit 126N	OPEN P	IT INSPE	CTION I	ConocoPhillips					
	INSPECTOR	E. Perry	E. Perry	E. Perry	E. Perry	E. Perry	E. Perry	E. Perry	E. Perry	E. Perry
	DATE	02/04/11	02/11/15	02/15/11	02/23/11	02/28/11	03/04/11	03/11/11	03/21/11	03/28/11
	*Please request for pit extention after 26 weeks	Week 1	Week 2	Week 3 Indied	Week 4	Week 5	Week 6	Week 7	Week 8	Week 9 Drilled
	PIT STATUS	Clean-Up	Completed Clean-Up	Clean-Up	Completed Clean-Up	Completed Clean-Up	Completed Clean-Up	Completed Clean-Up	Completed Clean-Up	Completed Clean-Up
NOIT	Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.)	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No
LOCATION	Is the temporary well sign on location and visible from access road?	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
	Is the access road in good driving condition? (deep ruts, bladed)	✓ Yes □ No	✓ Yes □ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	✓ Yes ☐ No	✓ Yes 🗌 No	✓ Yes ☐ No
	Are the culverts free from debris or any object preventing flow?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No
炽	Is the top of the location bladed and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
COMPLIANCE	Is the fence stock-proof? (fences tight, barbed wire, fence clips in place?	☑ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
OMP	Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.)	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes 🗀 No	☑ Yes ☐ No	☑ Yes ☐ No
TAL (Is the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.)	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No
ENVIRONMENTAL	Does the pit contain two feet of free board? (check the water levels)	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☑ Yes 🗌 No
VIRC	Is there any standing water on the blow pit?	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No
	Are the pits free of trash and oil?	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No	✓ Yes 🗌 No
	Are there diversion ditches around the pits for natural drainage?	☐ Yes ☑ No	☐ Yes ☑ No	✓ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☑ Yes ☐ No
	Is the Manifold free of leaks? Are the hoses in good condition?	✓ Yes 🗌 No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No
ပ္ပ	Was the OCD contacted?	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No
	PICTURE TAKEN	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	Yes 🗸 No
	COMMENTS	No Diversion Ditch	No Diversion Ditch	Fence down for Rig No Diversion Ditch		Rd Rough Fence Loose Need Culverts No Diversion Ditch	Rough Need Culverts No	Rd and Loc Rough Need Culverts at Main Rd No Diversion Ditch	Rd and Loc Rough Need Culverts at Main Rd No Diversion Ditch	Need more Culverts in Main Road

	WELL NAME:			-		3.7.				A
	San Juan 28-6 Unit 126N	,		•			, " ,			
	INSPECTOR			Fred	E. Perry	E. Perry	E. Perry	E. Perry	E. Perry	E. Perry
	*Please request for pit extention after 26 weeks	04/01/11 Week 10	Week 11	04/13/11 Week 12	04/20/11 Week 13	04/27/11 Week 14	05/03/11 Week 15	05/09/11 Week 16	05/16/11 Week 17	05/23/11 Week 18
	PIT STATUS	☑ Drilled ☐ Completed ☐ Clean-Up	Drilled Completed Clean-Up	Drilled Completed Clean-Up	Drilled Completed Clean-Up	☑ Drilled ☐ Completed ☐ Clean-Up	✓ Drilled ✓ Completed ☐ Clean-Up	✓ Drilled ✓ Completed ☐ Clean-Up	✓ Drilled ✓ Completed ☐ Clean-Up	✓ Drilled ✓ Completed ☐ Clean-Up
LOCATION	Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.)	☑ Yes ☐ No	Yes No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
10CA	Is the temporary well sign on location and visible from access road?	☑ Yes ☐ No	Yes No	☑ Yes ☐ No	✓ Yes 🗌 No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
	is the access road in good driving condition? (deep ruts, bladed)	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☑ Yes 🗌 No	✓ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No
	Are the culverts free from debris or any object preventing flow?	☐ Yes ☑ No	☐ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	Yes 🗸 No	☐ Yes ☑ No	☑ Yes ☐ No	☑ Yes ☐ No
	Is the top of the location bladed and in good operating condition?	✓ Yes ☐ No	Yes No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	Yes V No	☐ Yes ☑ No	☑ Yes ☐ No
COMPLIANCE	Is the fence stock-proof? (fences tight, barbed wire, fence clips in place?	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	Yes V No	☐ Yes ☑ No	☐ Yes ☑ No
SOMP	Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.)	✓ Yes 🗌 No	☐ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
_	ls the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.)	✓ Yes 🗌 No	☐ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
NWE	Does the pit contain two feet of free board? (check the water levels)	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No
ENVIRONMENTAL	Is there any standing water on the blow pit?	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No
<u> </u>	Are the pits free of trash and oil?	✓ Yes 🗌 No	☐ Yes ☐ No	☐ Yes ☑ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
	Are there diversion ditches around the pits for natural drainage?	✓ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
	Is the Manifold free of leaks? Are the hoses in good condition?	✓ Yes 🗌 No	☐ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No
၁၀	Was the OCD contacted?	☐ Yes ☑ No	Yes No	Yes V No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No
	PICTURE TAKEN	☐ Yes ☑ No	Yes No	☐ Yes ☑ No	☐ Yes ☑ No	Yes 🗸 No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No
	COMMENTS	Need more Culverts in Main Road		Oil in Pit Loc Rough No Culverts	No Culverts Loc Rough Fence Loose	Rd and Loc Rough Fence Loose No Culverts	Rd and Loc Rough Fence Loose Need Culverts Rig on Loc	Loc Rutted Bad Need Culverts Rig left Fence in bad shape	Loc Rutted Fence Loose Need Culverts	Fence Loose Need Culverts in Main Road

	WELL NAME:	`	4 4				•			
	San Juan 28-6 Unit 126N		2					,	5	
	INSPECTOR		E. Perry	E. Perry	E. Perry	E. Perry	E. Perry	CLOSED		
	DATE	,,	06/03/11	06/13/11	06/17/11	06/24/11	07/01/11	Week 25	*Week 26*	Week 27
	*Please request for pit extention after 26 weeks	Week 19 ☑ Drilled	Week 20	Week 21 Drilled	Week 22 ✓ Drilled	Week 23	Week 24	Dniled	Drilled	Drilled
ŀ	PIT STATUS	✓ Completed	✓ Completed	✓ Completed	✓ Drilled ✓ Completed	✓ Drilled ✓ Completed	Completed	Completed	Completed	Completed
	FII SIMIUS	Clean-Up	Clean-Up	Clean-Up	Clean-Up	Clean-Up	Clean-Up	☐ Clean-Up	Clean-Up	Clean-Up
_	িন্দ্ৰ কৰি চুন নামূল স্কুলাইল জিননক নামূলক না স্থাপ্ত ক্রুলাইলিন্দ্র ইউ প্রস	44. 2 · · · · · · · · · · · · · · · · · ·	****	7 · 4 · · · · · · · · · ·					(50)	
ATION	Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.)	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No	☐ Yes ☐ No	Yes No	Yes No	Yes No
01	Is the temporary well sign on location and visible from access road?	✓ Yes 🗌 No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	Yes No	Yes No	Yes No	☐ Yes ☐ No
	is the access road in good driving condition? (deep ruts, bladed)	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No	☐ Yes ☐ No
	Are the culverts free from debris or any object preventing flow?	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes □ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
U.	Is the top of the location bladed and in good operating condition?	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	✓ Yes ☐ No	☐ Yes ☐ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No
MPLIANC	Is the fence stock-proof? (fences tight, barbed wire, fence clips in place?	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☑ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
COMP	is the pit liner in good operating condition? (no tears, up-rooting corners, etc.)	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes 🗌 No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	is the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.)	✓ Yes 🗌 No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
NWE	Does the pit contain two feet of free board? (check the water levels)	✓ Yes 🗌 No	☑ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
ENVIRONMENTAL	Is there any standing water on the blow pit?	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Are the pits free of trash and oil?	✓ Yes 🗌 No	☑ Yes ☐ No	✓ Yes 🗌 No	☑ Yes ☐ No	✓ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Are there diversion ditches around the pits for natural drainage?	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Is the Manifold free of leaks? Are the hoses in good condition?	☑ Yes ☐ No	☑ Yes ☐ No	✓ Yes ☐ No	☑ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
ე ე	Was the OCD contacted?	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☑ No	☐ Yes ☐ No	Yes No	Yes No	Yes No
	PICTURE TAKEN	☐ Yes ☑ No	☐ Yes ☑ No	Yes 🗹 No	Yes 🗸 No	☐ Yes ☑ No	Yes No	Yes No	☐ Yes ☐ No	Yes No
	COMMENTS	Need Culvewrts in Main Road	Sign on Facility Need Culverts	Sign on Facility Rd Rough Need more Culverts	Sign on Facil,ity Road Rough Need more Culverts in Main Road	Sign on Facility Rd Fough Need more culverts	PIT CLOSED	CLOSED		